AUTHENTICATED
U.S. GOVERNMENT
INFORMATION
GPO

THE NATIONAL ARCHIVES OF THE UNITED STATES
LITTERA SCRIPTA MANET
1934

# FEDERAL REGISTER

VOLUME 18 NUMBER 228

Washington, Saturday, November 21, 1953

## TITLE 6—AGRICULTURAL CREDIT

### Chapter IV—Production and Marketing Administration and Commodity Credit Corporation, Department of Agriculture

### Subchapter C—Loans, Purchases, and Other Operations

[1953 C. C. C. Grain Price Support Bulletin 1, Supp. 1, Amdt. 4, Grain Sorghums]

### PART 601—GRAIN AND RELATED COMMODITIES

### SUBPART—1953-CROP GRAIN SORGHUMS LOAN AND PURCHASE AGREEMENT PROGRAM

SUPPORT RATES

The regulations issued by the Commodity Credit Corporation and the Production and Marketing Administration published in 18 F. R. 1969, 4787, 4990 and 5725, and containing the specific requirements for the 1953-Crop Grain Sorghums Price Support Program are hereby amended as follows:

Section 601.133 (c) (1) is amended by increasing the basic county support rate for Lea County, New Mexico from $2.32 to $2.33 per 100 pounds.

(Sec. 4, 62 Stat. 1070 as amended, 15 U. S. C. Sup. 714b. Interprets or applies sec. 5, 62 Stat. 1072; secs. 301, 401, 63 Stat. 1053; 15 U. S. C. Sup. 714; 7 U. S. C. Sup. 1447, 1521.)

Issued this 17th day of November 1953.

[SEAL] HOWARD H. GORDON,
*President,*
*Commodity Credit Corporation.*

[F. R. Doc. 53-9821; Filed, Nov. 20, 1953; 8:50 a. m.]

---

[1952 C. C. C. Grain Price Support Bulletin 1, Amdt. 1 to Supp. 3, Corn]

### PART 601—GRAINS AND RELATED COMMODITIES

### SUBPART—1952-CROP CORN RESEAL LOAN PROGRAM

STORAGE AND TRACK-LOADING PAYMENTS

Supplement 3, Corn, 18 F. R. 3058, to the 1952 CCC Grain Price Support Bulletin 1 (17 F. R. 3521 and 18 F. R. 3303), is hereby amended as follows:

Section 601.1630 is amended by changing paragraph (b) *Track-loading payments* to paragraph (c) *Track-loading payments* and adding a new paragraph (b) to provide for storage payments on resealed corn which is redeemed by the producer. The new paragraph (b) reads as follows:

§ 601.1630 *Storage and track-loading payments*— * * *

(b) *Storage payment on redeemed corn.* (1) A producer who redeems corn on or after July 31, 1954, will receive a storage payment for the quantity of corn redeemed computed at the rate of 13 cents per bushel.

(2) A producer who redeems corn prior to July 31, 1954, will receive a prorated storage payment computed at the rate of $\frac{1}{25}$ of a cent per bushel per day beginning on October 1, 1953, and ending on the date of redemption, but not to exceed 13 cents per bushel on the quantity redeemed: *Provided,* That no such prorated payment will be made in any case where redemption follows demand by the President, CCC for repayment of the loan, if such demand is due to the fact that the corn was damaged, abandoned or otherwise impaired due to negligence on the part of the producer.

(3) Notwithstanding anything to the contrary in the foregoing provisions of this paragraph no storage payment will be made where the producer has made any false representations in the loan documents or in obtaining the loan, or where there has been conversion on the part of the producer.

(Sec. 4, 62 Stat. 1070, as amended; 15 U. S. C. Sup. 714b. Interpret or apply sec. 5, 62 Stat. 1072, secs. 101, 401, 63 Stat. 1051; 15 U. S. C. Sup. 714c, 7 U. S. C. Sup. 1421, 1441)

Issued this 17th day of November 1953.

[SEAL] HOWARD H. GORDON,
*President,*
*Commodity Credit Corporation.*

[F. R. Doc. 53-9819; Filed, Nov. 20, 1953; 8:49 a. m.]

## CONTENTS

**Agriculture Department** Page
*See* Commodity Credit Corporation; Production and Marketing Administration; Rural Electrification Administration.
**Atomic Energy Commission**
*See* Patent Compensation Board.
**Civil Aeronautics Administration**
Rules and regulations:
  Alterations; designation of:
    Civil airways ............ 7476
    Control areas, zones, and reporting points ............ 7476
  Maintenance, repair, and alteration of airframes, powerplants, propellers, and appliances; CAA rules, interpretations and policies ............ 7386
**Commerce Department**
*See* Civil Aeronautics Administration.
**Commodity Credit Corporation**
Notices:
  Sales of certain commodities at fixed prices; November 1953 domestic and export price lists ............ 7482
Rules and regulations:
  1952 crop reseal loan program; storage and track-loading payments:
    Corn ............ 7377
    Wheat; support rates ............ 7378
    Oats ............ 7379
  1953 crop loan and purchase agreement program; grain sorghums; support rates ............ 7377
**Federal Power Commission**
Notices:
  Hearings, etc.:
    Arizona Public Service Co ............ 7485
    County of Placer, California ............ 7485
    Kansas Gas and Electric Co ............ 7485
    United Gas Pipe Line Co ............ 7485
**Food and Drug Administration**
Rules and regulations:
  Antibiotic and antibiotic-containing drugs: miscellaneous amendments:
    Certification of batches ............ 7382
    Tests and methods of assay ............ 7382

# FEDERAL REGISTER

Published daily, except Sundays, Mondays, and days following official Federal holidays, by the Federal Register Division, National Archives and Records Service, General Services Administration, pursuant to the authority contained in the Federal Register Act, approved July 26, 1935 (49 Stat. 500, as amended; 44 U. S. C., ch. 8B), under regulations prescribed by the Administrative Committee of the Federal Register, approved by the President. Distribution is made only by the Superintendent of Documents, Government Printing Office, Washington 25, D. C.

The regulatory material appearing herein is keyed to the Code of Federal Regulations, which is published, under 50 titles, pursuant to section 11 of the Federal Register Act, as amended August 5, 1953.

The FEDERAL REGISTER will be furnished by mail to subscribers, free of postage, for $1.50 per month or $15.00 per year, payable in advance. The charge for individual copies (minimum 15¢) varies in proportion to the size of the issue. Remit check or money order, made payable to the Superintendent of Documents, directly to the Government Printing Office, Washington 25, D. C.

There are no restrictions on the republication of material appearing in the FEDERAL REGISTER.

## CFR SUPPLEMENTS

**(For use during 1953)**

**The following Supplement is now available:**

**General Index ($1.00)**

**Previously announced: Title 3 ($1.75); Titles 4–5 ($0.55); Title 6 ($1.50); Title 7: Parts 1–209 ($1.75), Parts 210–899 ($2.25), Part 900–end (Revised Book) ($6.00); Title 8 (Revised Book) ($1.75); Title 9 ($0.40); Titles 10–13 ($0.40); Title 14: Parts 1–399 (Revised Book) ($6.00), Part 400–end (Revised Book) ($3.75); Title 15 ($0.75); Title 16 ($0.65); Title 17 ($0.35); Title 18 ($0.35); Title 19 ($0.45); Title 20 ($0.60); Title 21 ($1.25); Titles 22–23 ($0.65); Title 24 ($0.65); Title 25 ($0.40); Title 26: Parts 80–169 ($0.40), Parts 170–182 ($0.65), Parts 183–299 ($1.75); Title 26: Part 300–end, Title 27 ($0.60); Titles 28–29 ($1.00); Titles 30–31 ($0.65); Title 32: Parts 1–699 ($0.75), Part 700–end ($0.75); Title 33 ($0.70); Titles 35–37 ($0.55); Title 38 ($1.50); Title 39 ($1.00); Titles 40–42 ($0.45); Title 43 ($1.50); Titles 44–45 ($0.60); Title 46: Parts 1–145 (Revised Book) ($5.00), Part 146–end ($2.00); Titles 47–48 ($2.00); Title 49: Parts 1–70 ($0.50), Parts 71–90 ($0.45), Parts 91–164 ($0.40), Part 165–end ($0.55); Title 50 ($0.45)**

**Order from**

**Superintendent of Documents, Government Printing Office, Washington 25, D. C.**

## CONTENTS—Continued

Page

**Health, Education, and Welfare Department**
*See* Food and Drug Administration.

**Interior Department**
*See also* Reclamation Bureau.
Notices:
  Adoption of Federal Indian liquor laws on Reservation:
    Cheyenne River Sioux Tribe of South Dakota 7478
    Fort Belknap Indian Community, Montana 7478

**Interstate Commerce Commission**
Notices:
  Applications for relief:
    Cotton from South Atlantic ports to Alabama, Georgia, North Carolina and South Carolina 7488
    Grain from certain States to:
      Louisiana and Arkansas 7488
      Texas 7488
    Iron and steel billets, blooms or slabs from Chicago, Ill., group and Sterling (Rock Falls), Ill., to Baton Rouge, La 7488

**Labor Department**
*See* Wage and Hour Division.

**Patent Compensation Board**
Notices:
  Applications filed with Board:
    Pacyna, Arnold 7482
    Rapp, Sherman Douglas 7482

**Production and Marketing Administration**
Notices:
  Peanuts; redelegation of authority by New Mexico State PMA Committee 7483
Rules and regulations:
  Filberts grown in Oregon and Washington, handling of; changes in salable, surplus, and withholding percentages 7382
  Limitation of shipments:
    Lemons grown in California and Arizona 7381
    Orange, grapefruit, and tangerines grown in Florida (2 documents) 7380, 7381
  Navel oranges grown in Arizona and designated part of California; limitation of handling 7379

**Reclamation Bureau**
Notices:
  Bear River Project, Utah; order of revocation 7478

**Rural Electrification Administration**
Notices:
  Allocation of funds for loans 7484
  Loan announcements (9 documents) 7484

**Securities and Exchange Commission**
Notices:
  Hearings, etc.:
    Attleboro Steam and Electric Co. et al 7485
    Delaware Power & Light Co 7485
    Narragansett Electric Co 7486

## CONTENTS—Continued

Page

**Securities and Exchange Commission—Continued**
Notices—Continued
  Hearings, etc.—Continued
    Narragansett Electric Co. and New England Electric System 7486
    North Continent Utilities Corp 7487

**Treasury Department**
Notices:
  Commissioner of Narcotics; delegation of authority with respect to final approval of compromises 7477
  Importation of certain merchandise directly from Hong Kong, Japan, Taiwan, the Republic of Korea; and the Federal Republic of Germany; available certifications by specified foreign governments 7477
Rules and regulations:
  Foreign assets control regulations; miscellaneous amendments 7384

**Wage and Hour Division**
Notices:
  Learner employment certificates; issuance to various industries 7480

## CODIFICATION GUIDE

A numerical list of the parts of the Code of Federal Regulations affected by documents published in this issue. Proposed rules, as opposed to final actions, are identified as such.

Page

**Title 6**
Chapter IV:
  Part 601 (4 documents) 7377–7379

**Title 7**
Chapter IX:
  Part 914 7379
  Part 933 (2 documents) 7380, 7381
  Part 953 7381
  Part 997 7382

**Title 14**
Chapter I:
  Part 18 7386
Chapter II:
  Part 600 7476
  Part 601 7476

**Title 21**
Chapter I:
  Part 141 7382
  Part 146 7382

**Title 31**
Chapter V:
  Part 500 7384

---

[1952 C. C. C. Grain Price Support Bulletin 1, Amdt. 1 to Supp. 3, Wheat]

### PART 601—GRAINS AND RELATED COMMODITIES

### SUBPART—1952-CROP WHEAT RESEAL LOAN PROGRAM

### STORAGE AND TRACK-LOADING PAYMENTS; SUPPORT RATES

Supplement 3, Wheat, 18 F. R. 3817, to the 1952 CCC Grain Price Support Bulletin 1 (17 F. R. 3521 and 18 F. R. 3303), is hereby amended as follows:

1. Section 601.1730 is amended by adding a new subparagraph (3) to paragraph (a) to provide for storage payments on resealed wheat which is redeemed by the producer, such added subparagraph reading as follows:

§ 601.1730 *Storage and track-loading payments*—(a) *Storage payment.* * * *

(3) (i) A producer who redeems wheat on or after April 30, 1954, will receive a storage payment for the quantity of wheat redeemed computed at the following rate per bushel: Area II, 14 cents per bushel; Area III, 15 cents per bushel.

(ii) A producer who redeems wheat prior to April 30, 1954, will receive a prorated storage payment computed at the rate of $\frac{1}{25}$ of a cent per bushel per day in both areas II and III beginning on July 1, 1953, and ending on the date of redemption, but not to exceed 13 cents per bushel on the quantity redeemed; provided that no such prorated payment will be made in any case where redemption follows demand by the President, CCC for repayment of the loan, if such demand is due to the fact that the wheat was damaged, abandoned or otherwise impaired due to negligence on the part of the producer.

(iii) Notwithstanding anything to the contrary in the foregoing provisions of this subparagraph, no storage payment will be made where the producer has made any false representations in the loan documents or in obtaining the loan, or where there has been conversion on the part of the producer.

2. Paragraph (a) (2) of § 601.1730 is corrected by inserting "per day" in the second sentence so that such subparagraph reads as follows:

(2) If the wheat is delivered to CCC prior to April 30, 1954, upon request by the producer and with the approval of CCC, or in the case of loss assumed by CCC under the loan program, the amount of the storage payment will be prorated depending upon the length of time the wheat was in store, provided delivery was not made as a result of a demand for repayment due to any fraudulent representation on the part of the producer, or the fact that the wheat was damaged, abandoned, or otherwise impaired due to negligence on the part of the producer. The prorated storage payment will be computed at the rate of 1/25 of a cent per bushel per day in both Area II and Area III beginning on July 1, 1953, and ending on the date delivery is accomplished or ending on the final date of delivery as specified in the delivery instructions issued to the producer by the county committee, whichever is earlier, but not to exceed 13 cents per bushel on the quantity delivered under the reseal program. In the case of losses assumed by CCC, the period for computing the storage payment shall end on the date of the loss.

3. Section 601.1732 is amended to correct the reference, "Supplement 1, and any amendments thereto" to "Supplement 2 and any amendments thereto", so that the amended section reads as follows:

§ 601.1732 *Support rates.* The support rate for an extended farm-storage loan shall remain the same as for the original loan. The support rate for wheat covered by a purchase agreement placed under a farm-storage loan shall be the same as the support rate established for the wheat in § 601.1711 of 1952 CCC Grain Price Support Bulletin 1, Supplement 2, Wheat and any amendments thereto.

(Sec. 4, 62 Stat. 1070, as amended; 15 U. S. C. Sup., 714b. Interpret or apply sec. 5, 62 Stat. 1072, secs. 101, 401, 63 Stat. 1051, 1054; 15 U. S. C. Sup. 714c, 7 U. S. C. Sup. 1441, 1421)

Issued this 17th day of November 1953.

[SEAL] HOWARD H. GORDON,
*President,*
*Commodity Credit Corporation.*

[F. R. Doc. 53-9822; Filed, Nov. 20, 1953; 8:50 a. m.]

---

[1952 C. C. C. Grain Price Support Bulletin 1, Amdt. 2 to Supp. 2, Oats]

### PART 601—GRAINS AND RELATED COMMODITIES

### SUBPART—1952-CROP OATS RESEAL LOAN PROGRAM

#### STORAGE AND TRACK-LOADING PAYMENTS

Supplement 2, Oats, 18 F. R. 2911, and 3705, to the 1952 CCC Grain Price Support Bulletin 1, (17 F. R. 3521 and 18 F. R. 3303), is hereby amended as follows:

Section 601.1830 is amended by adding a new subparagraph (3) to paragraph (a) to provide for storage payments on resealed oats which are redeemed by the producer, such added subparagraph reading as follows:

§ 601.1830 *Storage and track-loading payments*—(a) *Storage payments.* * * *

(3) (i) A producer who redeems oats on or after April 30, 1954, will receive a storage payment for the quantity of oats redeemed computed at the rate of 10 cents per bushel.

(ii) A producer who redeems oats prior to April 30, 1954, will receive a prorated storage payment computed at the rate of $\frac{1}{30}$ of a cent per bushel per day beginning on July 1, 1953, and ending on the date of redemption, but not to exceed 10 cents per bushel on the quantity redeemed; provided that no such prorated payment will be made in any case where redemption follows demand by the President, CCC for repayment of the loan, if such demand is due to the fact that the oats were damaged, abandoned or otherwise impaired due to negligence on the part of the producer.

(iii) Notwithstanding anything to the contrary in the foregoing provisions of this subparagraph, no storage payment will be made where the producer has made any false representations in the loan documents or in obtaining the loan, or where there has been conversion on the part of the producer.

(Sec. 4, 62 Stat. 1070, as amended; 15 U. S. C. Sup. 714b. Interprets or applies sec. 5, 62 Stat. 1072, secs. 301, 401, 63 Stat. 1053, 15 U. S. C. Sup. 714c, 7 U. S. C. Sup. 1447, 1421)

Issued this 17th day of November 1953.

[SEAL] HOWARD H. GORDON,
*President,*
*Commodity Credit Corporation.*

[F. R. Doc. 53-9820; Filed, Nov. 20, 1953; 8:49 a. m.]

---

## TITLE 7—AGRICULTURE

## Chapter IX—Production and Marketing Administration (Marketing Agreements and Orders), Department of Agriculture

[Navel Orange Reg. 5]

### PART 914—NAVEL ORANGES GROWN IN ARIZONA AND DESIGNATED PART OF CALIFORNIA

#### LIMITATION OF HANDLING

§ 914.305 *Navel Orange Regulation 5*—(a) *Findings.* (1) Pursuant to the marketing agreement and Order No. 14 (18 F. R. 5638), regulating the handling of navel oranges grown in Arizona and designated part of California, effective September 22, 1953, under the applicable provisions of the Agricultural Marketing Agreement Act of 1937, as amended (7 U. S. C. 601 et seq.), and upon the basis of the recommendation and information submitted by the Navel Orange Administrative Committee, established under the said marketing agreement and order, and upon other available information, it is hereby found that the limitation of handling of such navel oranges, as hereinafter provided, will tend to effectuate the declared policy of the act.

(2) It is hereby further found that it is impracticable and contrary to the public interest to give preliminary notice, engage in public rule-making procedure, and postpone the effective date of this section until 30 days after publication thereof in the FEDERAL REGISTER (60 Stat. 237; 5 U. S. C. 1001 et seq.) because the time intervening between the date when information upon which this section is based became available and the time when this section must become effective in order to effectuate the declared policy of the act is insufficient, and a reasonable time is permitted, under the circumstances, for preparation for such effective time; and good cause exists for making the provisions of this section effective as hereinafter set forth. The Navel Orange Administrative Committee held an open meeting on November 19, 1953, after giving due notice thereof, to consider supply and market conditions for navel oranges and the need for regulation; interested persons were afforded an opportunity to submit information and views at this meeting; the recommendation and supporting information for regulation during the period specified herein was promptly submitted to the Department after such meeting was held; the provisions of this section, including its effective time, are identical with the aforesaid recommendation of the committee, and information concerning such provisions and effective time has been disseminated among handlers of such navel oranges; it is neces-

sary, in order to effectuate the declared policy of the act, to make this section effective during the period herein specified; and compliance with this section will not require any special preparation on the part of persons subject thereto which cannot be completed on or before the effective date hereof.

(b) *Order.* (1) The quantity of navel oranges grown in Arizona and designated part of California which may be handled during the period beginning at 12:01 a. m., P. s. t., November 22, 1953, and ending at 12:01 a. m., P. s. t., November 29, 1953, is hereby fixed as follows:

(i) District 1: 815.01 carloads;
(ii) District 2: Unlimited movement;
(iii) District 3: 125 carloads;
(iv) District 4: 65 carloads.

(2) The prorate base of each handler who has made application therefor, as provided in the said marketing agreement and order, is hereby fixed in accordance with the prorate base schedule which is attached hereto and made a part hereof by this reference.

(3) As used in this section "handled," "handler," "carloads," "prorate base," "District 1," "District 2," "District 3," and "District 4" shall have the same meaning as when used in said marketing agreement and order.

(Sec. 5, 49 Stat. 753, as amended; 7 U. S. C. and Sup. 608c)

Done at Washington, D. C., this 20th day of November 1953.

[SEAL] S. R. SMITH,
*Director,*
*Fruit and Vegetable Branch.*

PRORATE BASE SCHEDULE

[12:01 a. m., P. s. t., Nov. 22, to 12:01 a. m. (P. s. t.) Nov. 29, 1953]

NAVEL ORANGES

PRORATE DISTRICT NO. 1

| *Handler* | *Prorate base (percent)* |
|---|---|
| Total | 100.0000 |
| A. F. G. Lindsay | 1.8660 |
| A. F. G. Porterville | 2.7505 |
| Ivanhoe Cooperative Association | .7323 |
| Anderson Packing Co | 1.3904 |
| Euclid Avenue Orange Association | 1.2451 |
| Lindsay Mutual Groves | 1.7777 |
| Martin Ranch | 1.4745 |
| Orange Cove Orange Growers | 2.5055 |
| Woodlake Packing House | 2.1556 |
| Doffle Myer & Son, W. Todd | .4880 |
| Earlibest Orange Association | 2.0715 |
| Elderwood Citrus Association | .7284 |
| Exeter Citrus Association | 3.3481 |
| Exeter Orange Growers Association | 1.3274 |
| Exeter Orchards Association | 1.5036 |
| Hillside Packing Association | 1.3020 |
| Ivanhoe Mutual Orange Association | 1.1277 |
| Klink Citrus Association | 3.9335 |
| Lemon Cove Citrus Association | .8974 |
| Lindsay Citrus Growers Association | 2.5242 |
| Lindsay Cooperative Association | 1.6545 |
| Lindsay Fruit Association | 2.4965 |
| Lindsay Orange Growers Association | .8134 |
| Naranjo Packing House Co | 1.3031 |
| Orange Cove Citrus Association | 3.3607 |
| Orange Packing Co | .9987 |
| Orosi Foothill Citrus Association | 1.3508 |
| Palome Citrus Fruit Association | .8073 |
| Rocky Hill Citrus Association | 1,4844 |
| Sanger Citrus Association | 2.8995 |
| Sequoia Citrus Association | 0.8998 |
| Stark Packing House | 2.7232 |
| Visalia Citrus Association | 2.1141 |
| Waddell & Son | 2.6306 |
| Baird-Neece Corp | 2.2756 |
| Beattie Association, D. A | .4187 |
| Grand View Heights Citrus Association | 3.2306 |
| Magnolia Citrus | 2.6476 |
| Porterville Citrus Association, The | 1.7857 |
| Randolph Marketing Co | 2.5281 |
| Richgrove-Jasmine Citrus Association | 1.1739 |
| Strathmore Cooperative Citrus Association | 1.2349 |
| Strathmore District Orange Association | 1.7822 |
| Strathmore Fruit Association | .0000 |
| Strathmore Packing House Co | 2.2754 |
| Sunflower Citrus Growers | 2.6000 |
| Sunland Packing House Co | 2.6575 |
| Terra Bella Citrus Association | 1.3961 |
| Tule River Citrus Association | .9059 |
| Baker Ranch Packing House | .1948 |
| Batkins Jr., Fred A | .0550 |
| California Citrus Groves, Inc., Ltd | 2.5786 |
| Darby, Fred J | .0282 |
| Dubendorf, John | .1234 |
| Evans Bros. Packing Co | .2466 |
| Far West Produce Distributors | .0590 |
| Foothill Packing Co | .2003 |
| Gluskin, Ludwig E | .0119 |
| Harding & Laggett | 1.6799 |
| Independent Growers, Inc | 1.1231 |
| Lo Bue Bros | .7775 |
| Maas, W. A | .1001 |
| Marks, W. & M | .4670 |
| Morin, Carl W | .0271 |
| Orange Belt Fruit Distributors, Inc | .2869 |
| Paramount Citrus Association | 2.0138 |
| Reimers, Don H | .5586 |
| Riverside Fruit Co | .1797 |
| Sequoia Cider Mill | .0162 |
| Tashjiam, John | .2165 |
| Zaninovich Bros., Inc | 1.4576 |

PRORATE DISTRICT NO. 3

| | |
|---|---|
| Total | 100.0000 |
| Consolidated Citrus Growers | 11.5641 |
| McKellips Citrus Co., Inc | 15.7798 |
| Phoenix Citrus Packing Co | 1.0303 |
| Pioneer Fruit Co | 4.0484 |
| Arizona Citrus Growers | 14.2931 |
| Chandler Heights Citrus Growers | 2.1450 |
| Desert Citrus Growers | 6.8723 |
| Nesa Citrus Growers | 22.2521 |
| Tal'-Wi-Wi Ranches | 2.9153 |
| Tempeco Groves | 6.9153 |
| Yuma Mesa Fruit Growers Association | .9828 |
| Allen & Allen Citrus Packing Co | 2.1139 |
| Commercial Citrus Co | .9072 |
| Ishikawa, Paul | .0490 |
| Lepple, Cecile | .2090 |
| Leppla, Henry | .3142 |
| Leppla, H. Lorain | 3.3547 |
| Macchiaroli Fruit Co., James | 2.8521 |
| Potato House | .2149 |
| Sunny Valley Citrus Packing Co | 1.0718 |
| Valley Citrus Packing Co | .3380 |

PRORATE DISTRICT NO. 4

| | |
|---|---|
| Total | 100.0000 |
| Placentia Cooperative Orange Association | 29.2238 |
| Richgrove-Jasmine Citrus Association | 17.6611 |
| B & L Citrus Distributors | 4.6489 |
| Edison Citrus Co | 43.7801 |
| Kim, Charles | 2.3513 |
| Toy, Chin | 2.3348 |

[F. R. Doc. 53-9893; Filed, Nov. 20, 1953; 11:22 a. m.]

---

[Orange Reg. 244]

## PART 933—ORANGES, GRAPEFRUIT, AND TANGERINES GROWN IN FLORIDA

### LIMITATION OF SHIPMENTS

§ 933.647 *Orange Regulation 244*—(a) *Findings.* (1) Pursuant to the marketing agreement, as amended, and Order No. 33, as amended (7 CFR Part 933), regulating the handling of oranges, grapefruit, and tangerines grown in the State of Florida, effective under the applicable provisions of the Agricultural Marketing Agreement Act of 1937, as amended, and upon the basis of the recommendations of the committees established under the aforesaid amended marketing agreement and order, and upon other available information, it is hereby found that the limitation of shipments of Temple oranges, as hereinafter provided, will tend to effectuate the declared policy of the act.

(2) It is hereby further found that it is impracticable and contrary to the public interest to give preliminary notice, engage in public rulemaking procedure, and postpone the effective date of this section until 30 days after publication thereof in the FEDERAL REGISTER (60 Stat. 237; 5 U. S. C. 1001 et seq.) because the time intervening between the date when information upon which this section is based became available and the time when this section must become effective in order to effectuate the declared policy of the act is insufficient; a reasonable time is permitted, under the circumstances, for preparation for such effective time; and good cause exists for making the provisions this section effective not later than November 23, 1953. Shipments of Temple oranges, grown in the State of Florida, are presently subject to regulation by grades, pursuant to the amended marketing agreement and order, and will so continue until November 23, 1953; the recommendation and supporting information for continued regulation subsequent to November 22 was promptly submitted to the Department after an open meeting of the Growers Administrative Committee on November 17; such meeting was held to consider recommendations for regulation, after giving due notice of such meeting, and interested persons were afforded an opportunity to submit their views at this meeting; the provisions of this section, including the effective time hereof, are identical with the aforesaid recommendation of the committee, and information concerning such provisions and effective time has been disseminated among handlers of such Temple oranges; it is necessary, in order to effectuate the declared policy of the act, to make this section effective during the period hereinafter set forth so as to provide for the continued regulation of the handling of Temple oranges; and compliance with this section will not require any special preparation on the part of the persons subject thereto which cannot be completed by the effective time hereof.

(b) *Order.* (1) During the period beginning at 12:01 a. m., e. s. t., November 23, 1953, and ending at 12:01 a. m.,

e. s. t., November 30, 1953, no handler shall ship:

(i) Any Temple oranges grown in the State of Florida, which do not grade at least U. S. Fancy.

(2) During the period beginning at 12:01 a. m., e. s. t., November 30, 1953, and ending at 12:01 e. s. t., July 31, 1954, no handler shall ship:

(i) Any Temple oranges grown in the State of Florida, which do not grade at least U. S. No. 2.

(3) As used in this section, the terms "handler," "ship," and "Growers Administrative Committee" shall each have the same meaning as when used in said amended marketing agreement and order; and the terms "U. S. Fancy," and "U. S. No. 2" shall have the same meaning as when used in the revised United States Standards for Florida Oranges (§ 51.302 of this title).

(Sec. 5, 49 Stat. 753, as amended; 7 U. S. C. and Sup. 608c)

Done at Washington, D. C., this 18th day of November 1953.

[SEAL] S. R. SMITH,
*Director, Fruit and Vegetable Branch, Production and Marketing Administration.*

[F. R. Doc. 53-9846; Filed, Nov. 20, 1953; 8:55 a. m.]

---

[Tangerine Reg. 140]

### PART 933—ORANGES, GRAPEFRUIT, AND TANGERINES GROWN IN FLORIDA

#### LIMITATION OF SHIPMENTS

§ 933.648 *Tangerine Regulation 140*—(a) *Findings.* (1) Pursuant to the marketing agreement, as amended, and Order No. 33, as amended (7 CFR Part 933), regulating the handling of oranges, grapefruit, and tangerines grown in the State of Florida, effective under the applicable provisions of the Agricultural Marketing Agreement Act of 1937, as amended, and upon the basis of the recommendations of the committees established under the aforesaid amended marketing agreement and order, and upon other available information, it is hereby found that the limitation of shipments of tangerines, as hereinafter provided, will tend to effectuate the declared policy of the act.

(2) It is hereby further found that it is impracticable and contrary to the public interest to give preliminary notice, engage in public rule-making procedure, and postpone the effective date of this section until 30 days after publication thereof in the FEDERAL REGISTER (60 Stat. 237; 5 U. S. C. 1001 et seq.) because the time intervening between the date when information upon which this section is based became available and the time when this section must become effective in order to effectuate the declared policy of the act is insufficient; a reasonable time is permitted, under the circumstances, for preparation for such effective time; and good cause exists for making the provisions of this section effective not later than November 23, 1953. Shipments of tangerines, grown in the State of Florida, are presently subject to regulation by grades and sizes, pursuant to the amended marketing agreement and order, and will so continue until November 23, 1953; the recommendation and supporting information for continued regulation subsequent to November 22 was promptly submitted to the Department after an open meeting of the Growers Administrative Committee on November 17; such meeting was held to consider recommendations for regulation, after giving due notice of such meeting, and interested persons were afforded an opportunity to submit their views at this meeting; the provisions of this section including the effective time hereof, are identical with the aforesaid recommendation of the committee, and information concerning such provisions and effective time has been disseminated among handlers of such tangerines; it is necessary, in order to effectuate the declared policy of the act, to make this section effective during the period hereinafter set forth so as to provide for the continued regulation of the handling of tangerines; and compliance with this section will not require any special preparation on the part of persons subject thereto which cannot be completed on or before the effective date hereof.

(b) *Order.* (1) During the period beginning at 12:01 a. m., e. s. t., November 23, 1953, and ending at 12:01 a. m., e. s. t., November 30, 1953, no handler shall ship:

(i) Any tangerines, grown in the State of Florida, that do not grade at least U. S. No. 1; or

(ii) Any tangerines, grown in the State of Florida, which are of a size smaller than the size that will pack 176 tangerines, packed in accordance with the requirements of a standard pack, in a half-standard box (inside dimensions 9½ x 9½ x 19⅛ inches; capacity 1,726 cubic inches).

(2) As used in this section, "handler," "ship," and "Growers Administrative Committee" shall have the same meaning as when used in said amended marketing agreement and order; and "U. S. No. 1" and "standard pack" shall have the same meaning as when used in the United States Standards for Tangerines (§ 51.416 of this title).

(Sec. 5, 49 Stat. 753, as amended; 7 U. S. C. and Sup. 608c)

Done at Washington, D. C., this 18th day of November 1953.

[SEAL] S. R. SMITH,
*Director, Fruit and Vegetable Branch, Production and Marketing Administration.*

[F. R. Doc. 53-9847; Filed, Nov. 20, 1953; 8:55 a. m.]

---

[Lemon Reg. 512]

### PART 953—LEMONS GROWN IN CALIFORNIA AND ARIZONA

#### LIMITATION OF SHIPMENTS

§ 953.619 *Lemon Regulation 512*—(a) *Findings.* (1) Pursuant to the marketing agreement, as amended, and Order No. 53, as amended (7 CFR Part 953), regulating the handling of lemons grown in the State of California or in the State of Arizona, effective under the applicable provisions of the Agricultural Marketing Agreement Act of 1937, as amended (7 U. S. C. 601 et seq.), and upon the basis of the recommendation and information submitted by the Lemon Administrative Committee, established under the said amended marketing agreement and order, and upon other available information, it is hereby found that the limitation of the quantity of such lemons which may be handled, as hereinafter provided, will tend to effectuate the declared policy of the act.

(2) It is hereby further found that it is impracticable and contrary to the public interest to give preliminary notice, engage in public rule-making procedure, and postpone the effective date of this section until 30 days after publication thereof in the FEDERAL REGISTER (60 Stat. 237; 5 U. S. C. 1001 et seq.) because the time intervening between the date when information upon which this section is based became available and the time when this section must become effective in order to effectuate the declared policy of the act is insufficient, and a reasonable time is permitted, under the circumstances, for preparation for such effective time; and good cause exists for making the provisions of this section effective as hereinafter set forth. Shipments of lemons, grown in the State of California or in the State of Arizona, are currently subject to regulation pursuant to said amended marketing agreement and order; the recommendation and supporting information for regulation during the period specified in this section was promptly submitted to the Department after an open meeting of the Lemon Administrative Committee on November 18, 1953; such meeting was held, after giving due notice thereof to consider recommendations for regulation, and interested persons were afforded an opportunity to submit their views at this meeting; the provisions of this section, including its effective time, are identical with the aforesaid recommendation of the committee, and information concerning such provisions and effective time has been disseminated among handlers of such lemons; it is necessary, in order to effectuate the declared policy of the act, to make this section effective during the period hereinafter specified; and compliance with this section will not require any special preparation on the part of persons subject thereto which cannot be completed by the effective time thereof.

(b) *Order.* (1) The quantity of lemons grown in the State of California or in the State of Arizona which may be handled during the period beginning at 12:01 a. m., P. s. t., November 22, 1953, and ending at 12:01 a. m., P. s. t., November 29, 1953, is hereby fixed as follows:

(i) District 1: 18 carloads;

(ii) District 2: 220 carloads;

(iii) District 3: 12 carloads.

(2) The prorate base of each handler who has made application therefor, as provided in the said amended marketing agreement and order, is hereby fixed in accordance with the prorate base

schedule which is attached to Lemon Regulation 511 (18 F. R. 7229) and made a part hereof by this reference.

(3) As used in this section, "handled," "handler," "carloads," "prorate base," "District 1," "District 2," and "District 3," shall have the same meaning as when used in the said amended marketing agreement and order.

(Sec. 5, 49 Stat. 753, as amended; 7 U. S. C. and Sup. 608c)

Done at Washington, D. C., this 19th day of November 1953.

[SEAL] S. R. SMITH,
*Director,*
*Fruit and Vegetable Branch.*

[F. R. Doc. 53-9874; Filed, Nov. 20, 1953; 8:57 a. m.]

---

## PART 997—FILBERTS GROWN IN OREGON AND WASHINGTON

### CHANGES IN SALABLE, SURPLUS, AND WITHHOLDING PERCENTAGES

Upon the basis of the recommendation of the Filbert Control Board, the administrative agency for operations under the marketing agreement and order (7 CFR, 1952 Rev., Part 997) regulating the handling of filberts grown in Oregon and Washington, effective pursuant to the provisions of the Agricultural Marketing Agreement Act of 1937, as amended (7 U. S. C. 601 et seq.), and other available information, it is hereby found and determined that the existing regulation (18 F. R. 5727) fixing the salable, surplus, and withholding percentages for filberts at 95 percent, 5 percent, and 5 percent, respectively, should be amended to provide for salable, surplus, and withholding percentages for the fiscal year beginning August 1, 1953, at 100 percent, 0 percent, and 0 percent, respectively. Therefore, it is hereby ordered that § 997.203 be, and it is hereby amended, to read as follows:

§ 997.203 *Salable, surplus, and withholding percentages for merchantable inshell filberts.* For the fiscal year beginning August 1, 1953, the salable percentage of merchantable inshell filberts shall be 100 percent, the surplus percentage shall be 0 percent and the withholding percentage shall be 0 percent.

It is hereby found and determined that it is impracticable, unnecessary, and contrary to the public interest to give preliminary notice, engage in public rule making procedure, and to postpone the effective date of this document later than the date of its publication in the FEDERAL REGISTER. The existing regulation for the 1953-54 fiscal year was fixed on the basis of an estimate of merchantable filbert production which is substantially greater than the presently indicated merchantable production based on the latest crop information. As a result of this situation, it now appears that the entire production of merchantable filberts for the 1953-54 fiscal year will be below the quantity required to meet the estimated trade demand. This trade demand is of such character as to require that all of said merchantable filberts be made available to meet demand as promptly as is practicable. Further, the effect of this action will be to benefit the persons affected thereby in that it will serve to relieve them of existing restrictions. No preparation for this regulation will be necessary which cannot be completed prior to its effective date. Therefore, good cause exists for not giving preliminary notice, engaging in rule making procedure, and postponing the effective date of this document later than the date of its publication in the FEDERAL REGISTER. (See section 4c of the Administrative Procedure Act; 5 U. S. C. 1001 et seq.)

(Sec. 5, 48 Stat. 31, as amended; 7 U. S. C. and Sup. 608c)

Issued at Washington, D. C., this 18th day of November 1953, to become effective upon publication of this document in the FEDERAL REGISTER.

[SEAL] S. R. SMITH,
*Director,*
*Fruit and Vegetable Branch.*

[F. R. Doc. 53-9848; Filed, Nov. 20, 1953; 8:55 a. m.]

---

# TITLE 21—FOOD AND DRUGS

## Chapter I—Food and Drug Administration, Department of Health, Education, and Welfare

## PART 141—TESTS AND METHODS OF ASSAY FOR ANTIBIOTIC AND ANTIBIOTIC-CONTAINING DRUGS

## PART 146—CERTIFICATION OF BATCHES OF ANTIBIOTIC AND ANTIBIOTIC-CONTAINING DRUGS

### MISCELLANEOUS AMENDMENTS

By virtue of the authority vested in the Secretary by the provisions of the Federal Food, Drug, and Cosmetic Act (sec. 507, 59 Stat. 463, as amended by 61 Stat. 11, 63 Stat. 409, 67 Stat. 389; sec. 701, 52 Stat. 1055; 21 U. S. C. 357, 371; 67 Stat. 18), the regulations for tests and methods of assay for antibiotic and antibiotic-containing drugs (21 CFR, 1952 Supp., Part 141) and certification of batches of antibiotic and antibiotic-containing drugs (21 CFR, 1952 Supp., Part 146) are amended as indicated below:

1. Part 141 is amended by adding the following new sections:

§ 141.418 *Zinc bacitracin (bacitracin zinc salt)*—(a) *Potency.* Proceed as directed in § 141.401 (a) (1), except prepare the sample as follows: Suspend an accurately weighed sample of approximately 100 milligrams in 5 milliliters of distilled water. Add 0.5 milliliter of 3 *N* HCl, stir until the sample is dissolved, and transfer to a 100-milliliter volumetric flash and make to volume with distilled water. Dilute an aliquot of this solution to 1.0 unit per milliliter (estimated) with 1-percent phosphate buffer.

(b) *Toxicity.* Administer orally, by means of a cannula or other suitable device, to each of 5 mice within the weight range of 18-25 grams, 0.5 milliliter of a water suspension of the drug containing 4,000 units per milliliter. If no animal dies within 48 hours, the sample is nontoxic. If one or more animals die within 48 hours, repeat the test with 5 unused mice weighing 20 grams (±0.5 gram each); if all animals survive the repeat test, the sample is nontoxic.

(c) *Moisture.* Proceed as directed in § 141.5 (a).

(d) *pH.* Prepare a saturated solution, using approximately 100 milligrams of the sample per milliliter, and proceed as directed in § 141.5 (b).

(e) *Zinc content*—(1) *Reagents*—(i) *8-hydroxyquinoline.* Dissolve 5.0 grams of 8-hydroxyquinoline in 12 milliliters of acetic acid. Dilute to 100 milliliters with distilled water and filter if not clear. Do not use this solution if it is 2 weeks old.

(ii) *Ammonium acetate solution (approximately 2 N).* Dissolve 150-160 grams of ammonium acetate in 1 liter of distilled water and filter if not clear.

(iii) *10-percent acetic acid.* Add 1 part of acetic acid to 9 parts of water.

(2) *Procedure.* Accurately weigh approximately 500 milligrams of the sample in a 400-milliliter beaker. Dissolve the sample in 5 milliliters of 10-percent acetic acid and dilute to about 100 milliliters with distilled water. Heat the solution to 70° C.-90° C. and then add 10 milliliters of the 8-hydroxyquinoline reagent. Slowly add the ammonium acetate solution until a pH of 4.9-5.1 is reached (usually about 20 milliliters is required). Heat just below the boiling point for 2-5 minutes and then allow to cool for 30-60 minutes. Filter through a tared Gooch crucible, wash the precipitate thoroughly with distilled water, and dry to constant weight at 130° C.-140° C. Calculate the percentage of zinc content as follows:

$$\text{Percent zinc} = \frac{\text{weight of precipitate} \times 18.49}{\text{weight of sample in milligrams}}$$

§ 141.419 *Bacitracin-neomycin-polymyxin troches, zinc bacitracin-neomycin-polymyxin troches*—(a) *Potency*—(1) *Content of bacitracin or zinc bacitracin.* Proceed as directed in § 141.403 (a), except if it is zinc bacitracin add 0.1 milliliter of 3 *N* HCl per 1,000 units when preparing the initial stock solution. The content of bacitracin or zinc bacitracin is satisfactory if the drug contains not less than 85 percent of the number of units per troche that it is represented to contain.

(2) *Neomycin content.* Proceed as directed in § 141.410 (a) (1) (ii). The content of neomycin is satisfactory if the drug contains not less than 85 percent of the number of milligrams of activity that it is represented to contain.

(3) *Polymyxin content.* Proceed as directed in § 141.112 (a) (1) (ii), except calculate from the quantity of neomycin found (using the method prescribed in subparagraph (2) of this paragraph) the quantity of neomycin that would be present when the sample is diluted to contain 100 units of polymyxin (labeled potency) per milliliter. Prepare the polymyxin standard curve by adding this calculated quantity of neomycin to each concentration of polymyxin used for the curve. Use this standard curve to calculate the polymyxin content of the sample. Its content of polymyxin is satsifactory if it contains not less than 85 percent of the number of units per troche that it is represented to contain.

(b) *Moisture.* Proceed as directed in § 141.5 (a).

2. In § 146.403 *Bacitracin tablets* * * *, subparagraph (1) (iii) of paragraph (c) *Labeling* is amended by changing the semicolon at the end thereof to a comma and adding the following clause: "except that the blank may be filled in with the date which is 18 months after the month during which the batch was certified if the person who requests certification has submitted to the Commissioner results of tests and assays showing that after having been stored for such period of time such drug as prepared by him complies with the standards prescribed by paragraph (a) of this section;"

3. Part 146 is amended by adding the following new sections:

§ 146.418 *Zinc bacitracin (bacitracin zinc salt)*—(a) *Standards of identity, strength, quality, and purity.* Zinc bacitracin is the zinc salt of a kind of bacitracin or a mixture of two or more such salts. It is so purified and dried that:

(1) Its potency is not less than 40 units per milligram.

(2) It is nontoxic.

(3) Its moisture content is not more than 5 percent.

(4) Its pH is not less than 6.0 and not more than 7.5.

(5) Its zinc content is not more than 10 percent by weight on a moisture-free basis.

(b) *Packaging.* In all cases the immediate containers shall be tight containers as defined by the U. S. P. The composition of the immediate containers shall be such as will not cause any change in the strength, quality, or purity of the contents beyond any limit therefor in applicable standards, except that minor changes so caused that are normal and unavoidable in good packaging, storage, and distribution practice shall be disregarded.

(c) *Labeling.* Each package of zinc bacitracin shall bear on its outside wrapper or container and the immediate container:

(1) The batch mark.

(2) The number of units of bacitracin activity per milligram of zinc bacitracin and the number of grams of the drug in the immediate container.

(3) The statement "Expiration date ------," the blank being filled in with the date which is 24 months after the month during which the batch was certified.

(4) The statement "For use only in the manufacture of nonparenteral drugs."

(5) The statement "Caution: Federal law prohibits dispensing without prescription."

(d) *Request for certification; samples.* (1) In addition to complying with the requirements of § 146.2, a person who requests certification of a batch shall submit with his request a statement showing the batch mark, the number of packages of each size in the batch, the number of units of bacitracin activity per milligram of zinc bacitracin, the zinc content, and the total number of grams of zinc bacitracin in each package. Such request shall be accompanied or followed by the results of tests and assays made by him on the batch for potency, toxicity, moisture, pH, and zinc content.

(2) Such person shall also submit with his request an accurately representative sample of the batch, consisting of 5 packages each containing approximately 1.0 gram taken from a different part of such batch, and each shall be packaged in accordance with the requirements of paragraph (b) of this section.

(e) *Fees.* The fee for the services rendered with respect to each batch under the regulations in this part shall be:

(1) $4.00 for each immediate container in the sample submitted in accordance wih paragraph (d) (2) of this section.

(2) If the Commissioner considers that investigations other than the examination of such immediate containers are necessary to determine whether or not such batch complies with the requirements of § 146.3 for the issuance of a certificate, the cost of such investigations.

The fee prescribed by subparagraph (1) of this paragraph shall accompany the request for certification unless such fee is covered by an advance deposit maintained in accordance with § 146.8 (d).

§ 146.419 *Bacitracin-neomycin-polymyxin troches, zinc bacitracin-neomycin-polymyxin troches*—(a) *Standards of identity, strength, quality, and purity.* Bacitracin-neomycin-polymyxin troches and zinc bacitracin-neomycin-polymyxin troches are troches composed of bacitracin or zinc bacitracin, neomycin, and polymyxin B with one or more suitable and harmless diluents, binders, lubricants, colorings, and flavorings. The potency of each troche is not less than 200 units of bacitracin or zinc bacitracin, 5.0 milligram of neomycin, and 2,000 units of polymyxin B. Its moisture content is not more than 5 percent. The bacitracin used conforms to the standards prescribed therefor by § 146.401 (a) except § 146.401 (a) (1), (2), and (4), but its potency is not less than 30 units per milligram. The zinc bacitracin used conforms to the standards prescribed therefor by § 146.418 (a). The neomycin used conforms to the standards prescribed therefor by § 146.410 (a) (2). The polymyxin B used conforms to the standards prescribed therefor by § 146.107 (a). Each other substance used, if its name is recognized in the U. S. P. or N. F., conforms to the standards prescribed therefor by such official compendium.

(b) *Packaging.* It shall be packaged in accordance with the requirements prescribed by § 146.403 (b).

(c) *Labeling.* Each package shall bear on its label or labeling, as hereinafter indicated, the following:

(1) On the outside wrapper or container and the immediate container:

(i) The batch mark.

(ii) The number of units of bacitracin or zinc bacitracin, the number of milligrams of neomycin, and the number of units of polymyxin B in each troche of the batch.

(iii) The statement "Expiration date ------------," the blank being filled in with the date which is 12 months after the month during which the batch was certified.

(2) On the outside wrapper or container:

(i) The statement "Caution: Federal law prohibits dispensing without prescription."

(ii) If it is packaged for dispensing, a reference specifically identifying a readily available medical publication containing information (including contraindications and possible sensitization) adequate for the use of such drug by practitioners licensed by law to administer it; or a reference to a brochure or other printed matter containing such information, and a statement that such brochure or other printed matter will be sent on request: *Provided, however,* That this reference may be omitted if the information is contained in a circular or other labeling within or attached to the package.

(d) *Request for certification; samples.* (1) In addition to complying with the requirements of § 146.2, a person who requests certification of a batch shall submit with his request a statement showing the batch mark, the number of packages of each size in such batch, the batch mark and (unless they were previously submitted) the dates on which the latest assays of the bacitracin or zinc bacitracin, neomycin, and polymyxin B used in making such batch were completed, the potency of each troche, the quantity of each ingredient used in making the batch, the date on which the latest assay of the drug comprising such batch was completed, and a statement that each ingredient used in making the batch conforms to the requirements prescribed therefor by this section.

(2) Except as otherwise provided in subparagraph (4) of this paragraph, such person shall submit in connection with his request results of the tests and assays listed after each of the following, made by him on an accurately representative sample of:

(i) The batch; average potency of bacitracin or zinc bacitracin, neomycin, and polymyxin per troche, and average moisture.

(ii) The bacitracin used in making the batch; potency, toxicity, moisture, and pH.

(iii) The zinc bacitracin used in making the batch; potency, toxicity, moisture, pH, and zinc content.

(iv) The neomycin used in making the batch; potency, toxicity, moisture, and pH.

(v) The polymyxin used in making the batch; potency and toxicity.

(3) Except as otherwise provided by subparagraph (4) of this paragraph, such person shall submit in connection with his request, in the quantities hereinafter indicated, accurately representative samples of the following:

(i) The batch; 1 troche for each 5,000 troches in the batch, but in no case less than 40 troches or more than 100 troches, collected by taking single troches at such intervals throughout the entire time of tableting that the quantities tableted during the intervals are approximately equal.

(ii) The bacitracin used in making the batch; 6 packages, each containing approximately equal portions of not less than 0.5 gram, packaged in accordance with the requirements of § 146.401 (b).

(iii) The zinc bacitracin used in making the batch; 5 packages, each containing approximately equal portions of not less than 1.0 gram, packaged in accordance with the requirements of § 146.418 (b).

(iv) The neomycin used in making the batch; 5 packages, each containing approximately equal portions of not less than 0.5 gram.

(v) The polymyxin used in making the batch; 5 packages, each containing approximately equal portions of not less than 0.5 gram.

(vi) In case of an initial request for certification, each other ingredient used in making the batch; 1 package of each, containing approximately 5 grams.

(4) No result referred to in subparagraph (2) (ii), (iii), (iv), and (v) of this paragraph, and no samples referred to in subparagraph (3) (ii), (iii), (iv), and (v) of this paragraph, is required if such result or sample has been previously submitted.

(e) *Fees.* The fee for the services rendered with respect to each batch under the regulations in this part shall be:

(1) $1.00 for each troche in the sample submitted in accordance with paragraph (d) (3) (i) of this section; $4.00 for each package in the samples submitted in accordance with paragraph (d) (3) (ii), (iii), (iv), (v), and (vi) of this section.

(2) If the Commissioner considers that investigations, other than examination of such troches and packages are necessary to determine whether or not such batch complies with the requirements of § 146.3 for the issuance of a certificate, the cost of such investigations.

The fee prescribed by subparagraph (1) of this paragraph shall accompany the request for certification unless such fee is covered by an advance deposit maintained in accordance with § 146.8 (d).

(Sec. 701, 52 Stat. 1055; 21 U. S. C. 371)

Notice and public procedure are not necessary prerequisites to the promulgation of this order, and I so find, since it was drawn in collaboration with interested members of the affected industry and since it would be against public interest to delay providing for the amendments set forth above.

This order shall become effective upon publication in the FEDERAL REGISTER, since both the public and the affected industry will benefit by the earliest effective date, and I so find.

Dated: November 17, 1953.

[SEAL] OVETA CULP HOBBY,
*Secretary.*

[F. R. Doc. 53-9843; Filed, Nov. 20, 1953; 8:54 a. m.]

---

# TITLE 31—MONEY AND FINANCE: TREASURY

## Chapter V—Foreign Assets Control, Department of the Treasury

### PART 500—FOREIGN ASSETS CONTROL REGULATIONS

#### AMENDMENT OF REGULATIONS RELATING TO IMPORTATIONS

The Foreign Assets Control Regulations, 31 CFR 500.101-500.808, are hereby amended by the amendment of § 500.204 (a) (2) and (a) (3) and by the amendment of § 500.536 (c) and the addition of subdivision (v) to § 500.536 (d) (1).

The principal effect of the amendment of § 500.204 is to make certain changes in the lists of commodities dealings in which are prohibited except under license. Attention is specifically directed to § 500.204 (a) (2) as it relates to aniseed, aniseed oil, eggs and egg products, fur skins, gallnuts, jade, menthol, and silk (tussah). Attention is specifically directed to § 500.204 (a) (3) as it relates to camphor, camphor oil, cane webbing, and hardwood manufactures.

The amendment of § 500.536 makes the provisions of the general license contained in that section applicable to goods of Chinese type thereafter imported, the German origin of which is properly certified by the Government of the Federal Republic of Germany. Goods so certified may be purchased, financed, and imported without any specific Foreign Assets Control license.

§ 500.204 *Importation of and dealings in certain merchandise.* (a) Except as specifically authorized by the Secretary of the Treasury (or any person, agency, or instrumentality designated by him) by means of regulations, or rulings, instructions, licenses, or otherwise, no person subject to the jurisdiction of the United States may purchase, transport, import, or otherwise deal in or engage in any transaction with respect to any merchandise outside the United States if such merchandise is:

* * * * *

(2) Merchandise specified in this subparagraph, however processed, unless such merchandise is imported directly from a country named as excepted for that type of merchandise:

| *Type of merchandise* | *Exceptions* |
|---|---|
| (1) All merchandise, not elsewhere specified in this paragraph, if prior to Dec. 17, 1950, imports thereof into the United States were chiefly of Chinese origin within the meaning of this chapter, and | None. |

| *Type of merchandise* | *Exceptions* |
|---|---|
| (ii) All of the following specified types of merchandise: | |
| Aniseed | Mexico, Spain, Turkey. |
| Aniseed oil | None. |
| Antiques, Chinese type (other than Chinese porcelain which qualifies within the provisions of par. 1811 of the Tariff Act of 1930 and which is decorated with the armorial bearings, crests, monograms, cyphers, or badges of European or American families or societies or bearing motifs based thereon, or with European or American political, memorial, or Masonic scenes or devices or with European or American figures, ships, or other scenes, or with motifs or inscriptions in English, Latin, or any other European language). | None. |
| Bamboo, split | None. |
| Beverages, Chinese type | None. |
| Braids, straw | Italy, Japan. |
| Bristles, hog, Asiatic (other than Indian), including such bristles in knots or other processed condition. | None. |
| Bristles, hog, dyed, including such bristles in knots or other processed condition. | None. |
| Carpet wool, Tibetan type (including Nepalese type) | None. |
| Cashmere | Iran. |
| Cassia | Associated states of Cambodia, Laos and Vietnam (formerly known as Indo-China) Indonesia. |
| Cassia oil | None. |
| Drugs, Chinese type | None. |
| Eggs, poultry: | |
| Whole in the shell, other than chicken | None. |
| Whole, dried | None. |
| Albumen, dried | None. |
| Yolks, dried | None. |
| Firecrackers | None. |
| Floor coverings, grass and straw, including seagrass mats and squares. | Japan. |
| Foodstuffs, Chinese type | None. |
| Fur skins: | |
| Goat and kid | Argentina, Ethiopia (including Eritrea), Iran, Iraq. |
| Kolinsky | Republic of Korea. |
| Weasel | Canada. |
| Gallnuts, including tannic acid, other than Aleppo | None. |
| Ginger root, candied or otherwise prepared or preserved | None. |
| Hair, human: | |
| Raw, Asiatic | None. |
| Nets and netting | None. |
| Hats, unfinished: | |
| Manila Hemp (Abaca) | None. |
| Palm leaf | Mexico, Philippines. |
| Straw (Unfinished hats of the following types are not included: Lindu, Lintao, Macorra, Panama, Pandan, Raffia, Toquilla, and Yeddo.) | Brazil, Dominican Republic, Italy, Japan, Philippines. |
| Jade, stones, cut but not set and suitable for use in jewelry | None. |
| Medicines, prepared, Chinese type | None. |
| Menthol, natural and synthetic | Brazil. |
| Musk | None. |
| Silk, tussah | None. |
| Sophora Japonica, including Rutin | None. |
| Tea, Chinese type | Formosa. |
| Tung oil | Argentina, Brazil, Paraguay. |
| Walnuts | France, Iran, Italy, Turkey. |

(3) Merchandise specified in this subparagraph, howsoever processed, if such merchandise is or has been located in or transported from or through Hong Kong, Macao, or any country not in the authorized trade territory.

*Type of merchandise*

Agar Agar.
Antimony.
Bamboo:
  Bags, baskets and other manufactures excluding furniture.
  Poles and sticks.
Bismuth.
Camphor, natural and synthetic.
Camphor oil, natural and synthetic.
Cane webbing.
Carpet wool.
Carpets.
Chinaware.
Citronella oil.
Cotton manufactures:
  Embroideries and laces.
  Embroidered and lace articles.
  Handkerchiefs.
  Wearing apparel.
Cotton waste.
Earthenware.
Feathers and down, Asiatic.
Hair, animal.
Hardwood manufactures, including furniture other than bentwood furniture.
Hats, paper.
Hides, buffalo, including India water buffalo.
Ivory manufactures.
Linen manufactures:
  Handkerchiefs.
  Embroideries and laces.
  Embroidered and lace articles.
  Other articles excluding wearing apparel.
Molybdenum.
Quicksilver.
Ramie.
Rugs.
Seagrass and straw manufactures, excluding floor covering.
Sesame, oil and seed.
Shoes, leather-soled with non-leather uppers.
Silk:
  Raw and manufactures.
  Waste.
Skins, deer and goat.
Stones, semiprecious and manufactures thereof excluding jewelry.
Tapestries (including needlework tapestries).
Tapioca (including tapioca flour).
Tin:
  Alloys.
  Bars, blocks and pigs.
  Ore.
Tungsten ores and concentrates.

§ 500.536 *Certain transactions with respect to merchandise affected by § 500.204.* * * *

(c) The purchase outside the United States for importation into the United States of merchandise specified in § 500.204 (other than merchandise to which § 500.204 (a) (1) is applicable) and the importation of such merchandise into the United States (including transactions listed in paragraph (a) of this section) are authorized if the merchandise is shipped to the United States directly or on a through bill of lading from the Federal Republic of Germany, Hong Kong, Japan, Taiwan (Formosa) or the Republic of Korea, provided that there is presented to the collector of customs in connection with such importation the original of an appropriate certificate of origin as defined in paragraph (d) of this section.

(d) A certificate of origin is appropriate for the purposes of this section only if

(1) It is a certificate of origin which

* * * * *

(v) In the case of merchandise shipped from the Federal Republic of Germany, is issued by the Federal Ministry of Economics of the Federal Republic of Germany (or its Federal Agency for Commodity Trade) and relates to merchandise exported from Germany after November 20, 1953.

(Sec. 5, 40 Stat. 415, as amended; 50 U. S. C. App. 5; E. O. 9193, July 6, 1942, 7 F. R. 5205; 3 CFR, 1943 Cum. Supp. E. O. 9989, Aug. 20, 1948, 13 F. R. 4891; 3 CFR, 1948 Supp.)

[SEAL] A. N. OVERBY,
*Acting Secretary of the Treasury.*

[F. R. Doc. 53-9868; Filed, Nov. 20, 1953; 8:56 a. m.]

# TITLE 14—CIVIL AVIATION

## Chapter I—Civil Aeronautics Board

### Subchapter A—Civil Air Regulations

[Supp. 1]

### PART 18—MAINTENANCE, REPAIR, AND ALTERATION OF AIRFRAMES, POWERPLANTS, PROPELLERS, AND APPLIANCES

### CAA RULES, INTERPRETATIONS, AND POLICIES

The rules, interpretations, and policies of the Administrator contained in this supplement, implement the provisions of Part 18 published on April 5, 1952, in 17 F. R. 2975, and made effective by the Civil Aeronautics Board on June 15, 1952. The rules are made effective without delay in the interest of aviation safety. Compliance with the notice, procedures, and effective date provisions of section 4 of the Administrative Procedure Act is impracticable and contrary to the public interest, and therefore is not required.

All rules of the Civil Aeronautics Board published in Part 18 are repeated here for the guidance of the public. The following rules, interpretations, and policies, which supersede all rules, interpretations, and policies previously promulgated by the Administrator of Civil Aeronautics under Part 18, are hereby adopted:

APPLICABILITY AND DEFINITIONS

Sec.
18.0 Applicability of this part.
18.1 Definitions.
18.1–1 Major alterations (CAA interpretations which apply to § 18.1 (a) (15)).
18.1–2 Procedures for handling typical major alterations (CAA policies which apply to § 18.1 (a) (15)).
18.1–3 Major repairs (CAA interpretations which apply to § 18.1 (a) (16)).
18.1–4 Minor alterations (CAA interpretations which apply to § 18.1 (a) (18)).
18.1–5 Minor repair (CAA interpretations which apply to § 18.1 (a) (19)).
18.1–6 Preventive maintenance (CAA interpretations which apply to § 18.1 (a) (22)).

GENERAL

18.10 Persons authorized to perform maintenance, preventive maintenance, repairs, and alterations.
18.10–1 Persons authorized to perform maintenance, repairs, and alterations (CAA interpretations which apply to § 18.10 (a)).
18.11 Persons authorized to approve maintenance, repairs, and alterations.
18.11–1 Return to service (CAA interpretations which apply to § 18.11).
18.11–2 Contacting CAA representative prior to alteration (CAA policies which apply to § 18.11).
18.12 Flight tests.
18.12–1 Flight tests (CAA interpretations which apply to § 18.12).
18.12–2 Flight test after component replacement (CAA policies which apply to § 18.12).
18.13 Aircraft operating limitations.
18.13–1 Aircraft operating limitations (CAA policies which apply to § 18.13).

MAINTENANCE, REPAIR, AND ALTERATION RECORDS

18.20 Required records and entries.
Sec.
18.20–1 Flight time in aircraft record (CAA interpretations which apply to § 18.20).
18.21 Content of repair and alteration records.
18.21–1 Scope of repair and alteration records (CAA interpretations which apply to § 18.21 (a)).
18.22 Form and disposition of major repair or major alteration records.
18.22–1 Procedure for certificated mechanics (CAA rules which apply to § 18.22).
18.22–2 Procedure for certificated repair stations and manufacturers (CAA rules which apply to § 18.22).
18.23 Provisions for air carrier records.

PERFORMANCE RULES

18.30 Standard of performance; general.
18.30–1 Standard of performance (CAA interpretations which apply to § 18.30).
18.30–2 Wood aircraft structures (CAA policies which apply to § 18.30).
18.30–3 Fabric covering (CAA policies which apply to § 18.30).
18.30–4 Metal aircraft structures (CAA policies which apply to § 18.30).
18.30–5 Control cables and terminals (CAA policies which apply to § 18.30).
18.30–6 Bolts, screws, and miscellaneous fasteners (CAA policies which apply to § 18.30).
18.30–7 Corrosion protection, cleaners, and paint removers (CAA policies which apply to § 18.30).
18.30–8 Identification and inspection of material (CAA policies which apply to § 18.30).
18.30–9 Aircraft equipment (CAA policies which apply to § 18.30).
18.30–10 Windshields and enclosures (CAA policies which apply to § 18.30).
18.30–11 Hydraulic systems (CAA policies which apply to § 18.30).
18.30–12 Electrical systems (CAA policies which apply to § 18.30).
18.30–13 Instruments (CAA policies which apply to § 18.30).
18.30–14 Engine and fuel systems (CAA policies which apply to § 18.30).
18.30–15 Propellers (CAA policies which apply to § 18.30).
18.30–16 Weight and balance control (CAA policies which apply to § 18.30).
18.30–17 Procedures and guiding comments covering typical major alterations and modifications (CAA policies which apply to § 18.30).

AUTHORITY: §§ 18.0 to 18.30–17 issued under sec. 205, 52 Stat. 984, as amended; 49 U. S. C. 425. Interpret or apply secs. 601, 605, 52 Stat. 1007, 1010, as amended; 49 U. S. C. 551, 555.

### APPLICABILITY AND DEFINITIONS

§ 18.0 *Applicability of this part.* This part establishes rules for the performance of maintenance, repair, and alteration of aircraft for which airworthiness certificates have been issued by the Administrator, or any component thereof.[1]

18.1 *Definitions.* (a) As used in this part terms are defined as follows:

(1) *Aircraft.* An aircraft shall mean any contrivance now known or hereafter invented, used, or designed for navigation of or flight in the air, including airframe, powerplant, propeller, and appliances.

(2) *Aircraft engine.* An aircraft engine shall mean an engine used, or intended to be used, for propulsion of aircraft, and includes all parts, appurtenances, and accessories thereof other than propellers.

(3) *Airframe.* Airframe shall mean any and all kinds of fuselages, booms, nacelles, cowlings, fairings, empennages, airfoil surfaces, and landing gear, and all parts, accessories, or controls, of whatever description, appertaining thereto, but not including powerplants and propellers.

(4) *Alteration.* An alteration shall mean any appreciable change in the design of an airframe, powerplant, propeller, or appliance.

(5) *Appliances.* Appliances shall mean instruments, equipment, apparatus, parts, appurtenances, or accessories of whatever description, which are used, or are capable of being or intended to be used, in the navigation, operation, or control of aircraft in flight (including communication equipment, electronic devices, and any other mechanism or mechanisms installed in or attached to aircraft during flight, but excluding parachutes), and which are not a part or parts of airframes, powerplants, or propellers.

(6) *Appropriately certificated air carrier.* An appropriately certificated air carrier shall mean an air carrier holding an air carrier operating certificate, and which is required, either by its operating certificate or by operations specifications approved by the Administrator, to provide for a continuous airworthiness maintenance and inspection program to be performed by the carrier in accordance with its maintenance manual.

(7) *Approved.* Approved, when used either alone or as modifying such words as aircraft, airframe, powerplant, propeller, appliance, method, or technique, shall mean approved by the Administrator of Civil Aeronautics in accordance with the applicable requirements of this subchapter.

(8) *Authorized representative of the Administrator.* An authorized representative of the Administrator shall mean any employee of the Civil Aeronautics Administration or any private person, authorized by the Administrator to perform particular duties of the Administrator under the provisions of this part.

(9) *Certificated mechanic.* A certificated mechanic shall mean an individual holding a valid mechanic certificate with appropriate ratings issued by the Administrator.

(10) *Certificated repair station.* A certificated repair station shall mean a facility for the maintenance, repair, and alteration of airframes, powerplants, propellers, or appliances, holding a valid repair station certificate with appropriate ratings issued by the Administrator.

(11) *Certificated repairman.* A certificated repairman shall mean an individual holding a valid repairman certificate issued in accordance with Subpart B of Part 24 of this subchapter.

(12) *Component.* A component shall mean a constituent part of an aircraft.

(13) *Instrument.* An instrument shall mean a device utilizing internal mechanism to indicate visually or aurally the attitude, altitude, performance, or operation of an aircraft or any component thereof, and shall include electronic instrumentation and devices for the automatic control of navigation of the aircraft in flight.

(14) *Maintenance.* Maintenance, which includes preventive maintenance, shall mean the inspection, overhaul, repair, upkeep, and preservation of airframes, powerplants, propellers, and appliances, including the replacement of parts.

(15) *Major alteration.* A major alteration of an aircraft or any component thereof shall mean:

(i) An alteration which might cause an appreciable change in its weight, balance, structural strength, performance, powerplant operation, flight characteristics, or other qualities affecting airworthiness, or

---

[1] The Administrator publishes Civil Aeronautics Manual 18 which lists operations considered to be maintenance, preventive maintenance, minor and major repairs, and alterations, and sets forth acceptable procedures, methods, and practices under the provisions of this part. This manual may be obtained from the Superintendent of Documents, Government Printing Office, Washington 25, D. C.

(ii) An alteration which is not accomplished in accordance with accepted practices or cannot be performed by means of elementary operations.

(16) *Major repair.* A major repair to an aircraft or any component thereof shall mean:

(i) A repair which, if improperly accomplished, would adversely affect the structural strength, performance, flight characteristics, powerplant operation, or other qualities affecting airworthiness, or

(ii) A repair which is not accomplished in acordance with accepted practices or cannot be performed by means of elementary operations.

(17) *Manufacturer.* A manufacturer shall mean any person who:

(i) Holds a type or production certificate for and manufactures an aircraft, aircraft engine, propeller, or appliance, or

(ii) Manufactures an approved appliance in accordance with a specification issued by the Administrator.

(18) *Minor alteration.* A minor alteration of an aircraft or any component thereof shall mean an alteration other than a major alteration.

(19) *Minor repair.* A minor repair shall mean any repair other than a major repair.

(20) *Person.* Person shall mean any individual, firm, copartnership, corporation, company, association, joint-stock association, or body politic; and includes any trustee, receiver, assignee, or other similar representative thereof.

(21) *Powerplant.* Powerplant shall mean an aircraft engine and its component parts, and other parts necessary to properly install such engine in an aircraft, but not the propeller (if used).

(22) *Preventive maintenance.* Preventive maintenance shall mean simple or minor preservation operations and the replacement of small standard parts not involving complex assembly operations.[2]

(23) *Propeller.* Propeller shall mean a device for propelling an aircraft through the air, having blades mounted on a power-driven shaft, which when rotated produces by its action on the air a thrust approximately parallel to the longitudinal axis of the aircraft, and shall also include control components normally supplied by the manufacturer of the propeller. It shall also include a system of rotating airfoils which serve either to counteract the effect of the main rotor torque of a rotorcraft or to maneuver a rotorcraft about 1 or more of its 3 principal axes.

(24) *Repair.* Repair shall mean the restoration of an airframe, powerplant, propeller, or appliance to a condition for safe operation after damage or deterioration.

(25) *Type.* Type shall mean all aircraft of the same basic design, including all modifications thereto.

§ 18.1–1 *Major alterations (CAA interpretations which apply to § 18.1 (a) (15)).* Changes of the following types to an airframe, powerplant, propeller, or appliance, when not listed in the specifications issued by the Civil Aeronautics Administration, are considered aircraft major alterations.

(a) *Airframe major alterations.* (1) Major changes to the basic design or external configuration of any structural component such as:

Wings.
Tail surfaces.
Fuselage.
Engine mounts.
Control system.
Landing gear.
Hull or floats.
Elements of components (spars, ribs, fittings, shock absorbers, bracing, cowlings, fairings, balance weights, etc.) of an airframe.
Hydraulic and electrical actuating system of components.
Rotor blades.

(2) Changes in equipment where the cumulative weight change of all such alterations since the aircraft was reweighed or the weight and balance data recomputed exceed two percent of the certificated empty weight of aircraft under 12,500 pounds gross weight or ½ of one percent of the certificated maximum landing weight on aircraft over 12,500 pounds gross weight and/or the empty weight center of gravity location exceeds ½ of one percent of M. A. C.

(3) Changes to the basic design of the fuel, oil, cooling, heating, cabin pressurization, electrical, hydraulic, deicing, and exhaust systems.

(4) Modifications to the wing or to fixed or movable control surfaces which affect flutter and vibration characteristics.

(5) Installation or modification of any system affecting the structural airworthiness, flight behavior, or control of the aircraft.

(b) *Powerplant major alterations.* Changes such as the following are considered major powerplant alterations:

(1) Installation of a type of engine different from that approved for the aircraft.

(2) Conversion of an aircraft engine from one approved model to another, involving any changes in compression ratio, propeller reduction gear, impeller gear ratios or the substitution of major engine parts which requires extensive rework and testing of the engine. (See § 18.30–14 (a) (9) for details of identification of converted engines.)

(3) Modification of the engine by replacing aircraft engine structural parts with other than those supplied by the original manufacturer or otherwise specifically approved by the Civil Aeronautics Administration.[1]

(4) Installation of an accessory which has not been approved for the engine.

(5) Removal of accessories that are listed as required equipment on the aircraft or engine specification.

(6) Changes to the basic design of the engine mount.

(7) Installation of structural parts such as engine mount attachment bolts or engine attachment bolts, other than the type of parts approved for the installation.

(8) Conversions of any sort for the purpose of using fuel of rating or grade other than that called for in the engine specification.

(c) *Propeller major alterations.* Changes such as the following, when not authorized in the propeller specifications issued by the Civil Aeronautics Administration,[2] are considered major propeller alterations:

(1) Changes in blade design.

(2) Changes in hub design.

(3) Changes in governor or control design.

(4) Installation of a propeller governor or feathering system.

(5) Installation of propeller de-icing system.

(6) Installation of parts not approved for the propeller.

(7) Any changes in the design of a balance propeller or its controls.

(d) *Appliance major alterations.* Changes to the basic design not made in accordance with "Administrator of Civil Aeronautics" approved recommendations of the appliance manufacturer or in accordance with a CAA Airworthiness Directive are considered to be major appliance alterations.

§ 18.1–2 *Procedures for handling certain typical major alterations or modifications (CAA policies which apply to § 18.1 (a) (15)).* Procedures for handling certain typical alterations or modifications are discussed in detail in § 18.30–17.

§ 18.1–3 *Major repairs (CAA interpretations which apply to § 18.1 (a) (16)).* Repairs of the following types to an airframe, powerplant, propeller, or appliance are considered to be major repairs:

(a) *Airframe major repairs.* (1) All repairs involving the strengthening, reinforcing, splicing and manufacturing of primary structural members or their replacement, when replacement is by fabrication such as riveting or welding, are considered airframe major repairs. The following are examples of such members:

Box beams.
Monocoque or semimonocoque wings or control surfaces.
Wing stringers or chord members.
Repairs involving the substitution of materials.
Spars.
Spar flanges.
Members of truss-type beams.
Thin sheet webs of beams.
Keel and chine members of boat hulls or floats.
Corrugated sheet compression members which act as flange material of wings or tail surfaces.
Wing main ribs and compression members.
Wing or tail surface brace struts.
Engine mounts.
Fuselage longerons.
Members of the side truss, horizontal truss, or bulkheads.
Main seat support braces and brackets.
Landing gear brace struts.
Axles.
Wheels.
Skis, and ski pedestals.
Parts of the control system such as control columns, pedals, shafts, brackets, or horns.

(2) The repair of damaged areas in metal or plywood stressed covering exceeding six inches in any direction; the repair of portions of skin sheets by making additional seams; splicing of skin sheets.

(3) Repair of three or more adjacent wing or control surface ribs or leading

---

[2] The Administrator will publish, as part of Civil Aeronautics Manual 18, the various operations constituting preventive maintenance of the several types of aircraft.

[1] Changes as above require extensive proof tests as specified in Part 13 of the Civil Air Regulations.

[2] Changes such as outlined above usually involve proof testing of the propeller or governor in accordance with Part 14 of the Civil Air Regulations.

edge of wings and control surfaces, between such adjacent ribs.

(4) Repair of fabric covering involving a greater area than required to repair two adjacent ribs; replacement of fabric on fabric covered components such as wings, fuselages, stabilizers, and control surfaces.

(5) Rebuilding, including rebottoming, of removable or integral fuel tanks, and oil tanks.

(b) *Powerplant major repairs.* Repairs such as the following are considered powerplant major repairs:

(1) Any maintenance operation requiring (i) the separation or disassembly of a crankcase or crankshaft of an engine equipped with an integral supercharger and/or propeller reduction gearing; (ii) disassembly of a nonfloat type carburetor or fuel injection unit used with such engines; or, (iii) top overhaul of such engines.

(2) Special repairs to structural engine parts by welding, plating, metalizing or other methods. (See § 18.30-14 (a) (10) through (12) for details.)

(c) *Propeller major repairs.* Repairs of the following types are considered to be major propeller repairs:

(1) Any repairs to or straightening of steel blades.

(2) Repairing or machining of steel hubs.

(3) Shortening of blades.

(4) Retipping of wood propellers.

(5) Replacement of outer laminations on fixed pitch wood propellers.

(6) Repairing elongated bolt holes in the hub of fixed pitch wood propellers.

(7) Inlay work on wood blades.

(8) All repairs to composition blades.

(9) Replacement of tip fabric.

(10) Replacement of plastic covering.

(11) Repair of propeller governors.

(12) Repair of balance propellers of rotocraft.

(13) Overhaul of controllable pitch propellers (see § 18.30-15 (c) (1)).

(14) Repairs to deep dents, cuts, scars, nicks, etc., and straightening of aluminum blades, such as described in § 18.30-15 (b) (3) (iii).

(15) The repair or replacement of internal elements of blades.

(d) *Appliance major repairs.* Repairs to appliances which are complex repair operations requiring the use of skilled techniques and/or special tools and test equipment not available to a mechanic working outside of an appliance shop are considered to be a major repair. Major repairs to appliances include, but are not limited to the following:

(1) *Instruments.* All repairs to instruments.

(2) *Electronics equipment.* Adjusting and calibration of VOR, ILS or DME equipment.

(3) *Electrical equipment.* Rewinding of any electrical accessory field coil.

(4) *Hydraulic accessories.* Complete disassembly of complex hydraulic power valves.

(5) *Mechanical accessories.* (i) Pressure type carburetor overhaul. (ii) Overhaul of pressure type fuel, oil or hydraulic pumps.

§ 18.1-4 *Minor alterations (CAA interpretations which apply to § 18.1 (a) (18)).* Changes such as the following to an airframe, powerplant, propeller, or appliance are considered minor aircraft alterations:

(a) *Airframe minor alterations.* Changes such as listed below are considered to be airframe minor alterations:

(1) *Optional equipment on aircraft specification.* The installation or removal of specific items of optional equipment listed in the aircraft specification[3] when such installation is made in accordance with the manufacturer's instructions.

(2) *Equipment of equal or less weight.* The installation or removal of equipment of equal or less weight and in the same location as that listed as optional equipment in the aircraft specification.

(3) *Changes to improve service life.* Changes of a minor nature may be made to structural and nonstructural elements for the purpose of improving the service life or reducing maintenance costs, provided the cumulative weight changes of all such alterations since the aircraft was reweighed or the weight and balance data recomputed do not exceed two percent of the certificated weight empty on aircraft under 12,500 pounds gross weight, or one-half of 1 percent of the certificated maximum landing weight on aircraft over 12,500 pounds gross weight and provided the empty weight center of gravity location does not exceed one-half of 1 percent of MAC.

(b) *Powerplant minor alterations.* Any powerplant alteration other than listed as a major alteration under § 18.1-1 (b) is considered to be a minor powerplant alteration. The following are examples of powerplant minor alterations:

(1) Alterations to supporting brackets or braces of units of the powerplant which do not adversely affect the structural integrity of such parts.

(2) Changes to the cowling which do not affect engine cooling, such as revisions to mounting bracket attachments.

(3) The alteration or conversion of an aircraft engine by simple substitution of parts of different design or addition of CAA approved parts in accordance with approved practices and in conformity to the engine manufacturer's or CAA instructions.

(c) *Propeller minor alterations.* Any propeller alteration other than defined as a major alteration under § 18.1-1 (c) is considered to be a minor propeller alteration. The following are examples of minor propeller alterations:

(1) Initial installation of a propeller spinner.

(2) Changes to the basic design of, or the relocating of brackets or braces of the propeller controls.

(3) Changes to the basic design of propeller control rods or cables.

(d) *Appliance minor alterations.* Changes to the basic design made in accordance with the "Administrator of Civil Aeronautics" approved recommendations of the appliance manufacturer, or in accordance with a CAA Airworthiness Directive are considered to be minor appliance alterations.

§ 18.1-5 *Minor repairs (CAA interpretation which apply to § 18.1 (a) (19)).* Repairs of the following types to an airframe, powerplant, propeller, or appliance are considered to be minor repairs:

(a) *Airframe minor repairs*—(1) *Nonstructural members.* Repairs to nonstructural members which may affect the airworthiness of an aircraft, such as:

Cowlings.
Wing and control surface fairings.
Electrical installations.
Windshields.

(2) *Tanks.* Patching and repairing of leaks in nonintegral fuel, oil, hydraulic, and de-icer fluid tanks.

(3) *Ribs, leading and trailing edges, tip strips.* The repair of: Not more than two adjacent wing or control surface ribs of a conventional type (wood or metal); the leading edge of wing and control surfaces between two adjacent wing or control surface ribs; the trailing edge of wings, control surfaces, and flaps; the wing and control surface tip strips.

(4) *Fabric covering.* Patching of fabric involving replacement of fabric covering of surfaces when such replacement is of an area not greater than that required to repair two adjacent ribs.

(5) *Metal or plywood stressed covering.* The patching of holes in metal or plywood stressed covering not to exceed 6 inches in any direction when ribs, stringers, bulkheads, and reinforcements are not directly affected.

(6) *Replacement of components.* Replacement of components or complete units such as listed below with parts supplied by the original manufacturer or manufactured in accordance with approved drawings:

Wings.[4]
Replaceable wing tips.[4]
Control surfaces[4] (fixed and movable) and control cables.
Wing or control surface bracing (struts or wires).
Floats.
Landing gears.
Tail wheel assemblies.
Engine mounts (prefabricated and bolted on, not to be welded on).
Fuel and oil system accessories.
Hydraulic system accessories.
Fuel and oil tanks.
Powerplant controls.
Propeller controls.
Appliances such as: instruments, hydraulic or electrical actuating units of components, cabin heaters, radio units, auto-pilots.

(b) *Powerplant minor repairs.* Any powerplant repair other than listed under § 18.1-3 as a major repair, or under § 18.1-6 as preventive maintenance, is considered to be a minor repair. The following are examples of powerplant minor repairs:

(1) *Engine top overhauls.* Engines which have neither an integral supercharger nor integral propeller reduction gearing, consisting of the following:

(i) Removal of cylinders.

(ii) Grinding valves and removing carbon.

(iii) Fitting new rings.

---

[3] Copies of aircraft specifications may be obtained from CAA, Office of Aviation Information, Washington 25, D. C.

[4] See § 18.12-2 regarding flight test after component replacement.

(iv) Adjustments of valve gear or replacement of parts in valve mechanism outside of the crank case.

(2) *Engine complete overhauls.* Complete overhauls of engines which have neither an integral supercharger nor integral propeller reduction gearing.

(3) *Replacement of components.* The replacement of components not a part of the basic structure of the engine, such as carburetors, magnetos, ignition harnesses, on engines of any horsepower.

(4) *Replacement of accessories.* The replacement of components such as generators, starters, fuel pumps, vacuum pumps, hydraulic pumps, and oil coolers on engines of any horsepower.

(c) *Propeller minor repairs.* Repairs such as the following to propellers are considered to be propeller minor repairs:

(1) Repairing dents, cuts, scars, scratches, nicks, leading edge pitting of aluminum blades, provided removal or treatment does not materially affect the strength, weight, balance, or performance of the propeller. (See § 18.30–15 (b) (3) (iii).)

(2) Repairing dents, cuts, scars, scratches, nicks, and small cracks parallel to the grain of wood blades. (See § 18.30–15 (b) (2) (i).)

(3) Removal and installation of propellers.

(4) Assembly and dissassembly of ground adjustable propellers.

(5) Balancing of fixed pitch and ground adjustable propellers.

(6) Refinishing of wood propellers.

(d) *Appliance minor repairs.* Any repair to an appliance which would not be defined as a major appliance repair under § 18.1–1 (d) or preventive maintenance under § 18.1–6 is considered to be a minor appliance repair.

§ 18.1–6 *Preventive maintenance (CAA interpretations which apply to § 18.1 (a) (22).* The following are considered to be typical preventive maintenance operations:

Removal, installation, and repair of landing gear tires.

Replacing of elastic shock absorber cords on landing gear.

Servicing landing gear shock struts by adding oil and/or air.

Servicing landing gear wheel bearings, such as cleaning and greasing.

Replacing defective safety wiring or cotter keys.

Any lubrication not requiring disassembly other than removal of nonstructural cover plates, cowlings, fairings, etc.

Making simple fabric patches not requiring rib stitching or the removal of structural parts or control surfaces.

Replenishing hydraulic fluid in hydraulic reservoir.

Refinishing decorative coating of fuselage, wings, and tail group surfaces (excluding balanced control surfaces), fairings, cowling, landing gear, cabin or cockpit interior not requiring removal or disassembly of any primary structure or operation system such as hydraulic or fuel system.

Applying preservative or protective material to components where no disassembly of primary structure or operation systems is involved, such as seaplane preservation (paralkatone to control cables, etc.), anticorrosive paint to structures or components where such coating is not prohibited or is not contrary to good practices.

Cabin or cockpit interior work (repairing upholstery and decorative furnishings) which does not require disassembly of any primary structure or operation system or interfere with an operating system or affect primary structure of the aircraft.

Small simple repairs to fairings, nonstructural cover plates, cowlings, such as drilling stop holes (section 18.30), small patches and reinforcements not making any change to contour where such change would interfere with proper air flow.

Replacing of side windows where such work does not interfere with structure or any operating system such as controls, electrical equipment, etc.

Replacing of safety belts.

Replacing of seats or seat parts wth replacement parts approved for the aircraft, not involving disassembly of any primary structure or operating system.

Trouble shooting and repairing broken circuits in landing light wiring circuits.

Replacing of bulbs, reflectors, and lenses of position and landing lights.

Replacing of wheels and skis where no weight and balance computation is involved.

Replacing of any cowling not requiring removal of the propeller or any disconnecting of flight controls.

Replacing or cleaning and setting of spark plug gap clearance.

Replacing of any hose connection except hydraulic connections.

Replacing prefabricated fuel lines.

Cleaning fuel and oil strainers.

Replacing of batteries and checking fluid level and specific gravity.

### GENERAL

§ 18.10 *Persons authorized to perform maintenance, preventive maintenance, repairs, and alterations.*[3] No person shall perform maintenance, preventive maintenance, repairs, or alterations on civil aircraft of United States registry except as provided as follows:

(a) A certificated mechanic or a person who works under the direct supervision of such mechanic may perform maintenance, repairs, and alterations on aircraft or aircraft components including related appliances, appropriate to his rating, but excluding major repairs and alterations to propellers and all repairs and alterations to instruments.

(b) An appropriately rated repair station may perform maintenance, repairs, and alterations on aircraft or aircraft components, including propellers and appliances, as provided in Part 52 of this subchapter.

(c) A certificated pilot may perform, on aircraft owned or operated by him, except aircraft used in air carrier service, such preventive maintenance as may be authorized by the Administrator.

(d) A manufacturer shall be subject to the requirements of paragraphs (a) and (b) of this section, except that he may rebuild or alter:

(1) Any product manufactured by him under a type or production certificate, or

(2) Any product manufactured by him and approved under the terms of a Technical Standard Order or Product and Process Specification issued by the Administrator.

(e) An appropriately certificated air carrier may perform maintenance, repairs, and alterations on aircraft or aircraft components, including propellers and appliances, as provided for in its continuous airworthiness maintenance and inspection program and its maintenance manual.

§ 18.10–1 *Persons authorized to perform maintenance, repairs, and alterations (CAA interpretations which apply to § 18.10 (a)).* Direct supervision means that the supervising mechanic personally maintains such observation of the work being performed as is necessary to insure that the work is being performed properly, and the supervising mechanic is readily available in person for consultation with the person performing the work.

§ 18.11 *Persons authorized to approve maintenance, repairs, and alterations*—(a) *Maintenance, minor repairs, and minor alterations.* No airframe, powerplant, propeller, or appliance which has undergone maintenance, minor repair, or minor alteration may be approved and returned to service except by one of the following:

(1) An appropriately rated certificated mechanic, or

(2) An appropriately rated certificated repair station, or

(3) An appropriately certificated air carrier, or

(4) A manufacturer, if the product has been rebuilt or altered by the manufacturer under the provisions of § 18.10 (d).

(b) *Major repairs and major alterations.* No airframe, powerplant, propeller, or appliance, which has undergone any major repair or major alteration shall be returned to service until such repair or alteration has been examined, inspected, and approved as airworthy by one of the following:

(1) An authorized representative of the Administrator, or

(2) An appropriately rated certificated repair station, if the work has been performed by such repair station in accordance with a manual, specification, or other technical data aproved by the Administrator,[4] or

(3) A manufacturer, if the product has been rebuilt or altered by the manufacturer under the provisions of § 18.10 (d) and in accordance with a manual, specification, or other technical data approved by the Administrator,[4] or

(4) An appropriately certificated air carrier, if the work has been performed by such air carrier in accordance with a manual, specification, or other technical data approved by the Administrator.[4]

§ 18.11–1 *Return to service (CAA interpretations which apply to § 18.11).* An airframe, powerplant, propeller, or appliance which has undergone maintenance, repair or alteration is considered returned to service when it has been determined airworthy by a person authorized to approve maintenance, repairs or alterations under § 18.11, and:

---

[3] The Communications Act of 1934, as amended, and the rules and regulations of the Federal Communications Commission require that all transmitter adjustments or tests during or coincident with the installation, servicing, or maintenance of a radio station licensed by the Federal Communications Commission which may affect the proper operations of such station shall be made by or under the immediate supervision and responsibility of a person holding a first- or second-class radio operator license issued by the Federal Communications Commission, either radiotelephone or radiotelegraph as may be appropriate for the class of station concerned, who shall be responsible for the proper functioning of the station equipment.

[4] Major repairs and major alterations whose design has not previously been approved by the Administrator may require the submittal of technical data and/or flight tests in order to establish compliance with the applicable airworthiness provisions. Examples of such major alterations for which it would be desirable to contact a representative of the Administrator prior to accomplishment of the alteration are given in Civil Aeronautics Manual 18.

(a) Appropriate aircraft record entries have been made and approved by a person authorized under § 18.11 (a).

(b) The repair and alteration form authorized or furnished by the Administrator has been properly executed and approved by a person authorized under § 18.11 (b).

§ 18.11–2 *Contacting CAA representative prior to alteration (CAA policies which apply to § 18.11).* Before the following major alterations are undertaken, they should be discussed with a representative of the Administrator who is authorized to approve them.

(a) Major changes to the basic design of the wings or control surfaces.

(b) Changes which may affect the aerodynamic characteristics, flight behavior, or control of the aircraft.

(c) Major alterations of any primary structure that require structural substantiation.

(d) Installation of a fuel tank in a wing which was not designed to contain a fuel tank.

(e) Replacing of fabic covering of a wing with metal covering.

(f) Installation of an engine and propeller other than listed in the aircraft specification.

(g) Installation of a propeller model not listed on the pertinent CAA aircraft specification.

(h) Converting from landing gear with tail wheel to a tricycle-type landing gear, such installation not listed on the CAA aircraft specification.

(i) Previously unapproved changes to engine adjustments and settings having an effect on power output, such as changes in carburetor settings and ignition timing.

(j) Changes to air intake, air scoop, or carburetor heat valve which may alter intake air flow, affect fuel metering, or change mixture distribution pattern.

(k) Changes to exhaust system which may increase back pressure and thereby decrease power output or reduce reliability.

(l) Changes reducing strength of power-plant components, such as adding openings in cowl or engine mount structure, cutting down edge distances on mounting flanges, increasing exhaust system overhang on exhaust parts, etc.

(m) Change in location or direction of motion of powerplant controls.

(n) Changes which might adversely influence the aerodynamic effect of the powerplant, such as adding or changing cowl flaps, increasing size of air inlets or outlets, or change in shape of cowling protuberances, etc.

(o) Powerplant changes which result in a change in c. g. range.

(p) Changes affecting cooling of engine, such as baffle changes, addition of holes in cowling and baffle parts, placing of obstructions in air flow path, or restricting air inlet or outlet openings. Exhaust system changes which cause an increase in back pressure usually have an adverse effect on engine cooling.

(q) Changes adversely affecting fuel flow to the engine, such as adding restrictions in the form of fittings, larger lines, finer mesh screens, or valve substitutions; altering flow characteristics by changes in fuel tank vents or relocation of fuel system components.

§ 18.12 *Flight tests.* No aircraft which has undergone any major repair or major alteration shall be operated when carrying passengers or being operated for hire, unless such aircraft has thereafter been test flown by a person holding a pilot certificate of at least private grade with appropriate ratings for such aircraft. The pilot shall make a written notation in the aircraft repair and alteration records to the effect that he has flown such aircraft and has found the flight operation to be satisfactory.[5]

§ 18.12–1 *Flight tests (CAA interpretations which apply to § 18.12).* (a) Any aircraft which has undergone a major repair or a major alteration must be given a flight test before it can be used for the carriage of passengers or be operated for hire. The purpose of the flight test is to confirm that the major alteration or major repair involved has had no adverse effect on the performance or flight characteristics of the aircraft. In order to accomplish this objective, it is necessary that the pilot conducting the flight test possess sufficient aeronautical background and experience to analyze the operation of airframes, powerplants, propellers, and appliances. Specifically, the pilot should be competent to analyze and report on the following:

(1) Engine operation, power output, engine temperature, and engine smoothness.

(2) Control response, performance, and proper rigging.

(3) The proper operation of appliances.

(4) Proper operation of propellers and their controls.

The pilot should also have sufficient experience so as to be familiar with any operational feature peculiar to the particular type of aircraft he is planning to test.

(b) The notation in the aircraft records referred to in § 18.12 must not be made until the pilot has satisfied himself that any discrepancy found as a result of the test flight has been corrected.

§ 18.12–2 *Flight test after component replacement (CAA policies which apply to § 18.12).* In addition to requiring the flight test of an aircraft which has undergone a major repair or major alterations, the aircraft should be test flown prior to returning it to service after such minor repairs as replacement of wings, wing tips, and control surfaces. A notation should be made in the aircraft records by the pilot after completion of a satisfactory flight test.

§ 18.13 *Aircraft operating limitations.* When a major repair or major alteration results in any change in the aircraft operating limitations or data contained in the approved airplane flight manual, appropriate amendments to the aircraft operating limitations shall be made in the form and manner approved by the Administrator.

§ 18.13–1 *Aircraft operating limitations (CAA policies which apply to § 18.13).* (a) Aircraft operating limitations are prescribed or approved by the CAA for each aircraft as part of the airworthiness certificate. Major repairs or alterations to the aircraft may render all or some of the operating limitations inapplicable. It is the responsibility of the person or agency authorized by § 18.11 (b) to approve and return to service aircraft which have been repaired or altered, to determine whether any of the operating limitations have been affected.

(b) The CAA has incorporated in the appropriate aircraft specifications the prescribed operating limitations for many of the common major aircraft alterations. In event the repair or alteration is not covered by an applicable CAA specification, the required limitations will be prescribed at the time the repair or alteration is submitted for approval. (See § 18.11 (b), footnote 4.)

(c) Prior to returning the aircraft to service, it should carry or display current operating limitations as set forth in § 43.10–1 of CAA Manual 43.

## MAINTENANCE, REPAIR, AND ALTERATION RECORDS

§ 18.20 *Required records and entries.* A permanent record of every maintenance (excepting preventive maintenance), repair, rebuilding, or alteration of any airframe, powerplant, propeller, or appliance shall be maintained by the owner (or in the case of an aircraft by the registered owner) in a logbook or other permanent record satisfactory to the Administrator, which shall contain at least the information specified in § 18.21. Entries in such records shall be made or caused to be made by the individual, repair station, air carrier, or manufacturer performing the work.

§ 18.20–1 *Flight time in aircraft record (CAA interpretations which apply to § 18.20.* A certificated mechanic performing a periodic inspection must make an entry of the inspection in the aircraft record. Such entry, to be complete, must reflect the flight time or tachometer reading at the time of the inspection.

§ 18.21 *Content of repair and alteration records.* The record of all maintenance, repair, rebuilding, and alteration of any airframe, powerplant, propeller, or appliance or the installation or removal of an appliance shall contain the information set forth in paragraphs (a) through (d) of this section:

(a) An adequate description of the work performed,

(b) The date of completion of the work performed,

(c) The name of the individual, repair station, manufacturer, or air carrier performing the work,

(d) The signature, and if a certificated mechanic or certificated repairman the certificate number, of the person approving as airworthy the work performed and authorizing the return of the aircraft or component to service.

§ 18.21–1 *Scope of repair and alteration records (CAA interpretations which apply to § 18.21 (a)).* (a) Section 18.21 (a) requires that the repair and alteration records contain an adequate description of the work performed. In lieu of describing in detail the work performed, reference may be made to data previously approved by the Administrator. In all cases, the entry should identify the type of work performed and the component repaired or altered. An example of such an entry could be: "Spliced rear spar, left wing outboard of strut fitting in accordance with figure 2-3 of CAM 18."

---

[5] The objectives of the flight test and the technical qualifications which should be possessed by the test pilot will be found in Civil Aeronautics Manual 18. (Also see footnote 4, *supra*, concerning major alteration which may require additional flight testing to determine compliance with the applicable airworthiness requirements.)

(b) The replacement of components, except those described in § 18.1-6 (preventive maintenance), with new, rebuilt or repaired components of similar design is a minor repair. An entry of this replacement should be made in the permanent record referred to in § 18.20. When the component was rebuilt or repaired by a certificated repair station or the manufacturer of the component and installed by another person, the installing agency should include in the description required by paragraph (a) of § 18.21 a statement identifying the repair station or manufacturer performing the work. An example of such an entry would be as follows:

> Installed left landing gear assembly which was rebuilt by Aircraft Services, Repair Station No. 0001. A description of the repair is on file at that agency under job number 386 dated June 1, 1953.

(c) The information to make an entry such as the above example would be obtained from the maintenance release furnished by the repair station or manufacturer repairing the component. The maintenance release is prepared by the repair station or manufacturer in accordance with the procedure set forth in § 18.22-2. The CAA considers such an entry to relieve the person installing the component of responsibility in connection with airworthiness of the repair but not the installation of the component.

§ 18.22 *Form and disposition of major repair or major alteration records.* All major repairs and major alterations to an airframe, powerplant, propeller, or appliance shall be entered on a form acceptable to the Administrator. Such form shall be executed in duplicate and shall be disposed of in such manner as, from time to time, may be prescribed by the Administrator.

§ 18.22-1 *Procedure for certificated mechanics (CAA rules which apply to § 18.22)*—(a) *Procedure.* The form and disposition of major repair and major alteration records for repairs or alterations accomplished by certificated mechanics shall be as follows:

(1) Form ACA-337 (Revised April 1952), Major Repair and Alteration Form, shall be used to record all major repairs and major alterations.

(2) The Form ACA-337 shall be executed in accordance with the instructions contained in Appendix A.

(3) The Form ACA-337 shall be executed in duplicate. After the repair or alteration has been examined, inspected, and approved or rejected, the original of the Form ACA-337 shall be given to the aircraft owner for retention as part of the permanent record referred to in § 18.20. The copy will be retained by the CAA.

§ 18.22-2 *Procedure for certificated repair stations and manufacturers (CAA rules which apply to § 18.22).*—(a) *Procedure.* The form and disposition of the major repair and major alteration records for repair and alteration accomplished by certificated repair stations and manufacturers shall be as follows:

(1) *Major alterations.* (i) All major alterations shall be entered on Form ACA-337, Major Repair and Alteration Form.

(ii) The Form ACA-337 shall be executed in accordance with the instructions contained in Appendix (a).

(iii) The form shall be executed in duplicate. The altering agency may prepare extra copies for their record; however, it is not mandatory. The original of the Form ACA-337 shall be given the aircraft owner for retention as part of the permanent record referred to in § 18.20. The copy shall be forwarded to the local CAA office within 48 hours of the time the aircraft, airframe, powerplant, propeller, or appliance is approved for return to service.

(2) *Major repairs.* (i) The Administrator will accept in lieu of Form ACA-337 for major repairs made only in accordance with a manual or specification approved by the Administrator, the customer's work order upon which repairs are recorded by the repair station or manufacturer. The original copy of the work order shall be furnished the owner or purchaser and the duplicate copy shall be retained at least two years by the repair station or manufacturer. The owner of the aircraft shall be furnished an official maintenance release for retention as part of the aircraft permanent record required by § 18.20. Where the repair is made on a component or accessory not yet identified with an aircraft, the release shall remain with the component or accessory until it is installed in an aircraft. At that time, the installing agency will make the maintenance release available to the owner for incorporation in the permanent aircraft record required by § 18.20.

(ii) The repair station or manufacturer may use a maintenance release of its own design provided the release incorporates the information set forth in subdivision (iii) of this subparagraph and is signed by an authorized representative of the repair station or manufacturer.

(iii) Maintenance release: The release[5] shall contain the identity of the aircraft or component. In the case of an aircraft, it will consist of at least the following: make of aircraft, model, serial number, nationality and registration mark, and location of repair. When the repair is to a spare component such as a wing, landing gear, propeller, powerplant, or appliance, the identification will include manufacturer's name, name of component, model and serial number, if any. The following statement shall also be included:

> The aircraft and/or component identified above was repaired and inspected in accordance with current Civil Air Regulations and was found airworthy for return to service.
>
> Pertinent details of the repair are on file at this agency under work order No. _____

Date __________________

Signed[6] ______________________ for
(Signature of authorized individual)

________________ ________________
(Agency Name) (Certificate No.)

__________________________________
(Address)

§ 18.23 *Provisions for air carrier records.* Required records and entries may be replaced, in the case of maintenance, repairs, or alterations to appropriately certificated air carrier aircraft, by a suitable system of recording maintenance, repairs, alterations, and signatures of responsible personnel: *Provided,* That the information specified in § 18.21 is furnished.

### PERFORMANCE RULES

§ 18.30 *Standard of performance; general.* All maintenance, repairs, and alterations shall be accomplished in accordance with methods, techniques, and practices approved by or acceptable to the Administrator.

(a) *Maintenance and repair.* All maintenance and repair shall be accomplished in such a manner and the materials used shall be of such quality and strength that the condition of the part of the aircraft on which such work has been performed shall, with regard to aerodynamic and mechanical function, structural strength, resistance to vibration and deterioration, and other qualities affecting airworthiness, be at least equivalent to its original or properly altered condition.

(b) *Alterations.* All alterations shall be so designed and accomplished that the altered airframe, powerplant, propeller, or appliance will comply with the airworthiness requirements for the airframe, powerplant, propeller, or appliance.

NOTE: Specific record or reporting requirements subsequently prescribed will be subject to the approval of the Bureau of the Budget pursuant to the Federal Reports Act of 1942.

§ 18.30-1 *Standard of performance (CAA interpretations which apply to § 18.30*—(a) *General.* All maintenance, repairs and alterations must be accomplished with the use of such tools, equipment, and test apparatus as are necessary to insure their completion in accordance with good accepted industry practices. Where special equipment or test apparatus is recommended by the manufacturer of the article involved, such equipment or apparatus, or equivalent acceptable to the Administrator must be used.

(b) *Methods, techniques and practices set forth in air carrier manuals for the performance of approved continuous airworthiness maintenance and inspection programs.* The maintenance manual or applicable maintenance portions of the air carrier manual required by Civil Air Regulations Parts 40, 41, and 42 for the maintenance of air carrier aircraft will, unless the air carrier is otherwise notified by the Administrator, constitute acceptable methods, techniques and practices for the performance of approved continuous airworthiness maintenance and inspection programs.

---

[5] The maintenance release may be combined with the "customer's work order" to provide one document so long as it contains the required information.

[6] Only those persons specifically authorized by the repair station or manufacturer management shall be permitted to sign the release.

§ 18.30–2 *Wood aircraft structures*[7]—(*CAA policies which apply to § 18.30*)—(a) *Materials.* Three forms of wood are commonly used in aircraft: solid wood, plywood, and laminated wood. Although several kinds of modified wood are sometimes used for special purposes, these three forms constitute the bulk of all wood aircraft construction materials.

(1) *Quality of wood.* All wood and plywood used in the repair of aircraft structures should be of aircraft quality. Table 2–1 lists the permissible variations in characteristics and properties of aircraft wood.

(2) *Species substitution.* The species used to repair a part should be the same as that of the original whenever possible; however, permissible substitutes are given in table 2–1.

(3) *Effects of shrinkage.* (i) When the moisture content of a piece of wood is lowered, its dimensions decrease. The dimensional change is greatest in a tangential direction (across the fibers and parallel to the growth rings), somewhat less in a radial direction (across the fibers and perpendicular to the growth rings), and is negligible in a longitudinal direction (parallel to the fibers).

(ii) These dimensional changes can have several detrimental effects upon a wood structure such as loosening of fittings and wire bracing, and checking or splitting of wood members.

(iii) A few suggestions for minimizing these shrinkage effects are:

(*a*) Use of bushings that are slightly short so that when the wood member shrinks, the bushings do not protrude and the fittings may be tightened firmly against the member.

(*b*) Gradual dropping off of plywood face plates either by feathering or by shaping as shown in figure 2–1.

(4) *Replacement of drain holes and skin stiffeners.* Whenever repairs are made that require replacing a portion that included drain holes, skin stiffeners, or any other items, the repaired portion should be provided with similar drain holes, skin stiffeners, or items of the same dimensions in the same location. Reinforcing, under skin repairs, that interferes with the flow of water from some source, such as inspection holes, should be provided with drain holes at the lowest points.

(5) *Flutter precautions.* When repairing control surfaces, especially on high-performance airplanes, care should be exercised that the repairs do not involve the addition of weight aft of the hinge line. Such a procedure may adversely disturb the dynamic and static balance of the surface to a degree which would induce flutter. As a general rule it will be required to repair control surfaces in such a manner that the structure is identical to the original so that the weight distribution and resulting mass balance are not affected in any way.

(6) *Glues and gluing.* Satisfactory glue joints in aircraft will develop the full strength of wood under all conditions of stress. To produce this result the gluing operation must be carefully controlled so as to obtain a continuous, thin, uniform film of solid glue in the joint with adequate adhesion to both surfaces of the wood. Some of the more important conditions involve:

Properly prepared wood surfaces.
Glue of good quality, properly prepared.
Good gluing technique.

(i) *Preparation of wood surfaces for gluing.* (*a*) It is recommended that no more than 8 hours be permitted to elapse between final surfacing and gluing. The gluing surfaces should be machined smooth and true with planers, jointers or special miter saws. Planer marks, chipped or loosened grain, and other surface irregularities should not be permitted. Sandpaper should never be used to smooth soft wood surfaces that are to be glued. Satisfactorily sawed surfaces should approach well-planed surfaces in uniformity, smoothness, and freedom from crushed fibers.

(*b*) Tooth-planing, or other means of roughening smooth, well-planed surfaces of normal wood before gluing, is not recommended. Such treatment of well-planed wood surfaces may result in local irregularities and objectionable rounding of edges. While sanding of planed surfaces is not recommended for soft woods, sanding is a valuable aid in improving the gluing characteristics of some hard plywood surfaces; wood that has been compressed through exposure to high pressures and temperatures; resin-impregnated wood (impreg and compreg); and laminated paper plastic (papreg).

(*c*) Wood surfaces for gluing should be free from oil, wax, varnish, shellac, lacquer, enamel, dope, sealers, paint, dust, dirt, old glue, crayon marks, and other extraneous materials.

(*d*) Wetting tests are useful as a means of detecting the presence of wax. Drops of water placed on the surface of wax-coated wood do not spread or wet the wood. At present, preliminary gluing tests appear to be the only positive means of actually determining the gluing characteristics of plywood surfaces.

(ii) *Glues.* Glues used in aircraft repair fall into two general groups: Casein glues, and resin glues. Any glue that meets the performance requirements of applicable United States Military specifications or has been previously accepted by the CAA, is satisfactory for use in certificated civil aircraft. In all cases glues are to be used strictly in accordance with the glue manufacturers' recommendations.

(*a*) *Casein glues.* Casein glues are probably more widely used than any of the resin glues in wood aircraft repair work. The forms, characteristics, and properties of water-resistant casein glues have remained substantially the same for many years except for the addition of preservatives. Casein glues for use in aircraft should contain suitable preservatives such as the chlorinated phenols and their sodium salts, to increase their resistance to organic deterioration under high humidity exposures. Most casein glues are sold in powder form ready to be mixed with water at ordinary room temperatures.

(*b*) *Synthetic resin glues.* (*1*) Synthetic resin glues for wood are outstanding in that they retain their strength and durability under moist conditions and even after exposure to water. The best-known and most commonly used synthetic resin glues are the phenol-formaldehyde, resorcinol-formaldehyde, and urea-formaldehyde types. Materials, such as walnut-shell flour or wood flour, are often added by the glue manufacturer to the resin glues to give better working characteristics and joint-forming properties. Table 2–2 has been prepared as an aid in the selection of cold-setting synthetic resin glues. It has been derived largely from the glue manufacturers' directions and instructions, the experience of the users of glues, and such test results as are available. This list is incomplete and subject to change as some brands of glues are discontinued, others modified, and new glues developed and marketed. The inclusion of any glue in this list does not constitute an endorsement on the part of any government agency nor does it assure that it will meet applicable specifications.

(*2*) The glues listed in this table are the room temperature setting type. The suitable curing temperatures for the urea-formaldehyde type vary from 70° to 75° F., and for the resorcinol glues from 70° F. up. The strength of the joint cannot be depended upon if assembled and cured at temperatures below 70° F.

(*c*) *Mixing of resin glues.* Liquid resin glues may come ready for use or in a form which requires only the addition of a hardener. In all cases the mixing, glue consistency, assembly time, etc., should comply with the glue manufacturers' recommendations and instructions. Cold-setting, synthetic-resin glues, when prepared for use, are usually sharply limited in working life, and care should be taken to discard the glue and clean the equipment before the end of the working-life period. In very warm weather it may be found advisable to keep the glue pot in a bath of cool water, approximately 70° F., to prolong the working life of the mixture.

(iii) *Gluing technique*—(*a*) *Spreading of glue.* To make a satisfactory glue joint, glue should be spread evenly on both of the surfaces to be joined. It is recommended that a clean brush be used and care taken to see that all surfaces are covered. The spreading of glue on but one of the two surfaces is not recommended.

(*b*) *Assembly time in gluing.* (*1*) Where pieces of wood are coated and exposed freely to the air, a much more rapid change in consistency of the glue occurs than where the pieces are laid together as soon as the spreading has been done. The condition of free exposure is conveniently referred to as "open assembly" and the other as "closed assembly."

---

[7] Complete information on the general design and fabrication of wood aircraft structures may be found in ANC–18, "Design of Wood Aircraft Structures," and ANC–19, "Wood Aircraft Inspection and Fabrication," copies of which may be obtained for $1.00 and $1.25, respectively, from the Superintendent of Documents, Government Printing Office, Washington 25, D. C.

(2) When cold-setting glues are coated on wood parts and left exposed to the atmosphere (open assembly), the time for complete assembly is appreciably reduced compared with closed assembly periods. Assembly times and gluing pressures should be as recommended by the glue manufacturer.

(3) The pressing time for casein and resin glue joints should, in general, be 7 hours or more. Other types of glue require various times and temperatures for curing. Glue joints increase in strength mainly as a result of drying; hence, where it is convenient to do so, it is better to maintain pressure from one day to the next. The longer pressing periods are desirable, as this enables the joints to reach a higher proportion of their final strength before being disturbed.

(c) *Gluing pressure.* (*1*) Pressure is used to squeeze the glue out into a thin continuous film between the wood layers, to force air from the joint, to bring the wood surfaces into intimate contact with the glue, and to hold them in this position during the setting of the glue.

(2) Pressure should be applied to the joint before the glue becomes too thick to flow and is accomplished by means of clamps, presses, or other mechanical devices.

(3) Nonuniform gluing pressure commonly results in weak and strong areas in the same joint. The amount of pressure required to produce strong joints in aircraft assembly operations may vary from 125 to 150 pounds per square inch for softwoods and 150 to 200 pounds per square inch for hardwoods. Insufficient pressure or poorly machined wood surfaces usually result in thick glue lines which indicate a weak joint and should be carefully guarded against.

(d) *Method of applying pressure.* (*1*) The methods employed in applying pressure to joints in aircraft gluing operations range from the use of brads, nails, screws, and clamps to the use of hydraulic and electric power presses. Hand nailing is used rather extensively in the gluing of ribs and in the application of plywood skins to the wing, control surfaces, and fuselage frames.

(2) On small joints such as found in wood ribs, the pressure is usually applied only by nailing the joint gussets in place after spreading the glue. Since small nails must be used to avoid splitting, the gussets must be comparatively large in area to compensate for the relative lack of pressure. At least 4 nails per square inch should be used and in no event should nails be more than three-fourths inch apart. Small brass screws may also be used advantageously where the particular parts to be glued are relatively small and do not allow application of pressure by means of clamps.

(3) Spar splices should always be clamped by means of cabinet-makers' parallel clamps or similar types. Hand-sprung clamps should be used in conjunction with softwood only. Due to their limited pressure area, they must be applied with a pressure distributing strip or block at least twice as thick as the member to be pressed.

(b) *Scarf joints*—(1) *General.* The scarf joint is the most satisfactory method of making a joint in the grain direction between two solid wood members. Both parts should be cut accurately because the strength of the joint depends upon maximum contact between the surfaces being glued.

(2) *Grain direction.* The scarf cut should be made in the general direction of the grain slope as shown in figure 2–2. (See figure for note concerning allowable deviation from grain direction.)

(c) *Spars*—(1) *Splicing of spars.* (i) A spar may be spliced at any point except under wing attachment fittings, landing gear fittings, engine-mount fittings, or lift and interplane strut fittings. These fittings should not overlap any part of the splice. Splicing under minor fittings such as drag wire, antidrag wire or compression strut fittings is acceptable under the following conditions:

(ii) The reinforcing plates of the splice should not interfere with the proper attachment or alinement of the fittings. The locations of pulley support brackets, bellcrank support brackets or control surface support brackets should not be altered.

(iii) The reinforcing plate may overlap drag or antidrag wire or compression strut fittings if the reinforcing plates are on the front face of the front spar or on the rear face of the rear spar. In such cases it will be necessary to install slightly longer bolts. The inside reinforcing plate should not overlap drag strut fittings unless such overlapping does not require sufficient shortening of compression struts or changes in drag truss geometry to prevent adjustment for proper rigging. Even though takeup is sufficient, it may be necessary to change the angles on the fittings. Splices should be spaced so that they do not overlap. Acceptable methods of splicing the various types of spars are shown in figures 2–3 through 2–6. Reinforcing plates must be used as indicated on all scarf repairs to spars and the slopes of scarfs shown are minimum slopes.

(2) *Splicing of box spar webs.* The method of splicing plywood webs is shown in figure 2–7. Plywood webs should always be spliced and reinforced with the same type of plywood. Solid wood should never be used to replace plywood webs as plywood is stronger in shear than solid wood of the same thickness due to the variation in grain direction of the individual plies. The face grain of plywood replacement webs and reinforcing plates should be in the same direction as the original member to insure that the new web will have the required strength.

(3) *Replacing solid-type spars with laminated type.* Solid spruce spars may be replaced with laminated ones or vice versa, provided the material is of the same high quality. External plywood reinforcement should always be replaced with plywood as in the original structure.

(4) *Longitudinal cracks and local damage.* Cracked spars (except box spars) may be repaired by gluing plates of spruce or plywood of sufficient thickness to develop the longitudinal shear strength of the spar to both sides of it. Such plates should extend well beyond the termination of the cracks as shown in figure 2–8. A method of repairing small local damage to either the top or bottom side of a spar is also shown in this figure.

(i) *Longitudinal cracking of wood wing spars in airplanes operating in arid regions.* (*a*) Airplanes having wood spars and being operated in arid regions may develop longitudinal spar cracks in the vicinity of the plywood reinforcing plates. These cracks result from the tendency of the spar to shrink when drying takes place. Plywood resists this tendency and causes a cross-grain tensile failure in the basic spar. Cracks start under the plywood plates, usually, but not necessarily, at a bolt hole or cutout and spread in each direction until, in most cases, they extend a short distance beyond the ends of the plates where the resistance to spar shrinkage disappears. Other factors which have been found conducive to the formation of cracks due to spar shrinkage in the region of plywood plates are poor protective finishes, large cutouts, and metal fittings which utilize two lines of large diameter bolts.

(*b*) The presence of cracks does not necessarily mean that the spar must be discarded. If the crack is not too long or too close to either edge and can be reinforced properly, it will probably be more economical and satisfactory to effect a repair than to install a new spar or section. However, a generally acceptable procedure suitable for all airplane models cannot be described here. In such instances, it is recommended that the manufacturer or the Civil Aeronautics Administration be contacted for specific instructions before making repairs not in accordance with the manufacturer's approved instructions or the recommendations of this manual, because of the possibility of strength deficiencies.

(5) *Elongated holes.* In cases of elongated bolt holes in a spar or cracks in the vicinity of bolt holes, a new section of spar should be spliced in or the spar replaced entirely, unless the method of repair is specifically approved by a representative of the Civil Aeronautics Administration. In many cases it has been found advantageous to laminate the new section of the spar (using aircraft plywood for the outer faces), particularly if the spar roots are being replaced.

(d) *Ribs*—(1) *General.* Complete ribs should be made from a manufacturer's approved drawing or from a drawing made by the repair agency and certified by the manufacturer as correct, except that the original rib may be used as a pattern in making the new rib if it is not too seriously damaged to permit comparison. Wood ribs should not be attached to wood spars by nails driven through the rib cap strips, as this weakens the rib materially. The attachment should be by means of glue, with cement-coated, barbed or spiraled nails driven through the vertical rib members on each side of the spar. The drawing or pattern should be retained by the repair agency for use by the aviation safety agent in making his inspection.

(2) *Repairs of wood structures at a joint, between joints, at trailing edges, or at spars.* Acceptable methods of re-

pairing damaged ribs are shown in figure 2–9.

(3) *Compression ribs.* Acceptable methods of repairing damaged compression ribs are shown in figure 2–10. (A) illustrates the repair of a compression rib of the "I" section type, i. e., wide, shallow cap strips, a center plywood web, with a rectangular compression member on each side of the web. The rib is assumed to be cracked through cap strips, web member, and compression member. Cut the compression member as shown in (D), remove, and replace the shortest section, adding the reinforcing blocks as also shown in (D). Cut and replace the aft portion of the cap strips, reinforcing as shown in figure 2–9, except that the reinforcing blocks are split in the vertical direction to straddle the center web. The plywood side plates, as indicated in (A), are glued on. These plates are added to reinforce the damaged web. (B) illustrates a compression rib of the type that is basically a standard rib with rectangular compression members added to one side and a plywood web to the other side. The method used in this repair is essentially the same as in (A) except that the plywood reinforcing plate shown solid black in section B–B is continued the full distance between spars. (C) illustrates a compression rib of the "I" type with a rectangular vertical member each side of the web. The method of repair is essentially the same as in (A) except that the plywood reinforcing plates on each side shown in solid black in section C–C are continued, as in (C), the full distance between spars.

(e) *Plywood skin*—(1) *General.* Extensive repairs to damaged stressed skin plywood structures should be made in accordance with specific recommendations from the manufacturer. It is recommended that repairs be made by replacing the entire panel from one structural member to the next if damage is very extensive. When damaged plywood skin is repaired, the adjacent internal structure should be carefully inspected for possible hidden damage. Any defective frame members should be repaired prior to making skin repairs.

(i) *Types of patches.* Four types of patches—the surface or overlay patch, the splayed patch, the plug patch, and the scarf patch—are acceptable for repairing plywood skins. Surface patches should not be used on skins over one-eighth-inch thick. Splayed patches should not be used on skins over one-tenth-inch thick. There are no skin thickness limitations for the use of scarf patches and plug patches.

(ii) *Determination of single or double curvature.* Much of the outside surface of plywood aircraft is curved. On such areas, plywood used for repairs to the skin must be similarly curved. Curved skins are either of single curvature or of double (compound) curvature. A simple test to determine which type of curvature exists may be made by laying a sheet of heavy paper on the surface in question. If the sheet can be made to fit the surface without wrinkling, the surface is either flat or has single curvature. If, however, the sheet cannot be made to fit the surface without wrinkling, the surface is of double curvature.

(iii) *Repairs to single curvature skin.* (*a*) Repairs to skins of single curvature may usually be formed from flat plywood, either by bending it dry or after soaking it in hot water. The degree of curvature to which a piece of plywood can be bent will depend upon the direction of the grain and the thickness. Table 2–3 is presented as a guide in determining which process of bending should be used for the curvature being considered.

(*b*) Plywood after softening may be bent on a cold ventilated form or it may be bent over the leading edge near the part being patched if space permits. In either method it should be allowed to dry completely on the form. When bending plywood over a leading edge, drying may be hastened by laying a piece of coarse burlap over the leading edge before using it as a bending form. A fan to circulate the air over the bent piece will speed the drying. In bending pieces of small radii or to speed up the bending of a large number of parts of the same curvature, it may be necessary to use a heated bending form. The surface temperature of this form may be as high as 149° C. (300° F.), if necessary, without danger of damage to the plywood. The plywood should be left on the form, however, only long enough to dry to room conditions.

(iv) *Repairs to double curvature skin.* The molded plywood necessary for a repair to a damaged plywood skin of double curvature cannot be made from flat plywood unless the area to be repaired is very small or is of exceedingly slight double curvature; therefore, molded plywood of the proper curvature must be on hand before the repair can be made. If molded plywood of the proper curvature is available, the repair may be made following the recommended procedures.

(2) *Splayed patch.* Small holes with largest dimensions not over 15 times the skin thickness, in skins not more than one-tenth-inch in thickness, may be repaired by using a circular splayed patch as illustrated in figure 2–11. The term splayed is used to denote that the edges of the patch are tapered but the slope is steeper than is allowed in scarfing operations. The following steps should be taken in making a splayed patch:

(i) Lay out the patch according to figure 2–11. Center the dividers as near to the damage as is possible or tack a small piece of plywood over the hole for a center point and draw two circles, the inner one to be the size of the hole and the outer one marking the limits of the taper. The difference between the radii is 5T (5 times the thickness of the skin). If one leg of the dividers has been sharpened to a chisel edge, the dividers may be used to cut the inner circle completely through.

(ii) Taper the hole evenly to the outer circle with a chisel, knife, or rasp.

(iii) Prepare a circular tapered patch to fit the prepared hole, and glue the patch into place with face grain direction matching that of the original surface.

(iv) Use waxed paper between the patch and a plywood pressure plate cut to the exact size of the patch. This prevents extruded glue from binding patch and plate together. Center the plate carefully over the patch.

(v) Apply pressure. As there is no reinforcing behind this patch, care must be used so that pressure is not great enough to crack the skin. On horizontal surfaces, weights or sandbags will be sufficient. On vertical surfaces apply hand clamps lightly but snugly. On patches too far in for the use of standard hand clamps, jaws of greater length may be improvised.

(vi) Fill, sand, and refinish the patch.

(3) *Surface patch.* Plywood skins that are damaged between or along framing members may be repaired by surface or overlay patches as shown in figure 2–13. The damaged skin should be trimmed to a rectangular or triangular shape and the corners rounded. The radius of rounded corners should be at least five times the skin thickness. Surface patches should be covered with fabric before finishing. Fabric should overlap the original skin at least 2 inches. Surface patches located entirely aft of the 10 percent chord line or which wrap around the leading edge and terminate aft of the 10 percent chord line are permissible. Patches located entirely aft of the 10 percent chord line should have their forward edges beveled to 4 times the skin thickness. Surface patches may have as much as a 50-inch perimeter and may cover as much as 1 frame (or rib) space. The face grain direction should be the same as the original skin.

(4) *Scarf patch*—(i) *General.* (*a*) A properly prepared and inserted scarf patch is the best repair for damaged plywood skins. It is the preferred type for most skin repairs. Figure 2–14 shows the details and dimensions to be used when installing typical scarf skin patches when the back of the skin is accessible. Figure 2–15 should be followed when the back of the skin is not accessible. The scarf slope of 1 in 12 shown in both figures is the steepest slope permitted for all species of plywood. If the radius of curvature of the skin at all points on the trimmed opening is greater than 100 times the skin thickness, a scarf patch may be installed.

(*b*) Scarf cuts in plywood may be made by hand plane, spoke shave, scraper or accurate sandpaper block. Rasped surfaces, except at the corners of scarf patches, and sawed surfaces are not recommended as they are likely to be rough or inaccurate.

(*c*) Nail strip gluing is often the only method available for gluing scarf joints in plywood when used in repair work; therefore it is essential that all scarf joints in plywood be backed with plywood or solid wood to provide adequate nail-holding capacity. The face grain direction of the plywood patch should be the same as that of the original skin.

(ii) *Scarf patches (back of skin accessible).* (*a*) When the back of a damaged plywood skin is accessible (such as a fuselage skin), it should be repaired with scarf patches following the details shown in figure 2–14. Whenever possible the edge of the patch should be supported as shown in section C–C. When the damage follows or extends to a framing member, however, the scarf may be supported as shown in section B–B.

(*b*) Damages that do not exceed 25 times the skin thickness in diameter after being trimmed to a circular shape, and if the trimmed opening is not nearer than 15 times the skin thickness to a framing member, may be repaired as shown in figure 2–14, section D—D. The backing block is especially shaped from solid wood and fitted to the inside surface of the skin, and is temporarily held in place with nails. A hole, the exact size of the inside circle of the scarf patch, is made in the block and is centered over the trimmed area of damage. The block is removed after the glue on the patch has set, and leaves a flush surface to the repaired skin.

(iii) *Steps in making scarf patch (back of skin not accessible)*. (*a*) After removing damaged sections, install backing strips, as shown in figure 2–15, along all edges that are not fully backed by a rib or a spar. To prevent warping of the skin, backing strips should be made of a soft-textured plywood, such as yellow poplar or spruce, rather than solid wood. All junctions between backing strips and ribs or spars should have the end of the backing strip supported by a saddle gusset of plywood.

(*b*) If needed, nail and glue new gusset plate to rib. It may be necessary to remove and replace the old gusset plate by a new saddle gusset or it may be necessary to nail a saddle gusset over the original.

(*c*) Attach nailing strips to hold backing strips in place while the glue sets. Use bucking bar where necessary to provide support for nailing. Unlike the smaller patches made in a continuous process, work on the airplane must wait while the glue holding the backing strips sets. After setting, complete finishing in usual manner.

(5) *Plug patches*—(i) *General*. Two types of plug patches, oval and round, may be used on plywood skins provided the damage can be covered by the patches whose dimensions are given in figures 2–12 and 2–16. As the plug patch is strictly a skin repair it should be used only for damage that does not involve the supporting structure under the skin. Oval patches must be prepared with the face grain carefully oriented to the same direction as the original skin. Orientation of the face grain direction of the round plug patch to that of the skin surface is no problem, as the round patch may be rotated until grain directions match.

(ii) *Steps in making oval plug patch*. (*a*) Explore the area about the hole to be sure it lies at least the width of the oval doubler from a rib or a spar. Refer to figure 2–12 for repair details.

(*b*) Lay a previously prepared oval plug patch over the damage and trace the patch. Saw to the line and trim the hole edges with a knife and sandpaper.

(*c*) Mark the exact size of the patch on one surface of the oval doubler and apply glue to the area outside the line. The oval doubler should be made of some soft-textured plywood, such as yellow poplar or spruce. Insert doubler through the hole and bring it, glue side up, to the underside of the skin with its pencil outline of the patch matching the edges of the hole. If the curvature of the surface to be repaired is greated than a rise of one-eighth inch in 6 inches, the doubler should be preformed, by hot water or steam bending, to the approximate curvature.

(*d*) Apply nailing strips, outlining the hole, to apply glue pressure between doubler and skin. Use bucking bar to provide support for nailing. When two rows of nails are used, stagger nail spacing.

(*e*) Apply glue to remaining surface and to an equivalent surface on the patch.

(*f*) Lay the patch in position over the doubler and screw the pressure plate to the patch assembly using a small nail to line up the holes that have been previously made with patch and plate matching. No. 4 round-head screws are used. Lead holes in the plywood doubler are not necessary. Waxed paper or cellophane between the plate and patch prevents glue from sealing the plate to the patch. No clamps or further pressure need be applied as the nailing strips and screws exert ample pressure. Hot sandbags, however, may be laid over the patch to speed the setting of the glue. Finish in the usual manner.

(iii) *Round plug patch*. The steps in making a round plug patch shown in figure 2–16 are identical with those for making the oval patch except the insertion of the doubler. In using the round patch, where access is from only one side, the round doubler cannot be inserted unless it has been split.

(6) *Fabric patch*. Small holes not exceeding 1 inch in diameter, after being trimmed to a smooth outline, may be repaired by doping a fabric patch on the outside of the plywood skin. The edges of the trimmed hole should first be sealed, and the fabric patch should overlap the plywood skin by at least 1 inch. Holes nearer than 1 inch to any frame member or in the leading edge, or frontal area of the fuselage should not be repaired with fabric patches.

(f) *Finishing structural repairs*—(1) *General*. Any repair to spars, ribs, skin surfaces, or other structural parts of the airframe involves finishing as the final step in the job.

(2) *Precautions to be observed*. (i) When making repairs, avoid excessive contamination of surfaces with glue squeeze-out at joints and on all surfaces. Excess glue should always be removed before applying finish. Because paints and glues are incompatible, even a slight amount of glue underneath the finish may cause premature deterioration.

(ii) Soiling substances, such as oil and grease, should be removed as completely as possible. Naphtha may be used to sponge off oil and grease. Markings that are made by grease pencils or lumber crayons containing wax are harmful and should be removed, but marks made by ordinary soft graphite pencils and nonblotting stamp-pad inks may be safely finished over. All dust, sander dust, dirt, and other solid particles should be cleaned off.

(iii) Sawdust, shavings, and chips should be removed from enclosed spaces before they are sealed off by replacement of skin. A vacuum cleaner is useful for such cleaning.

(iv) Since no satisfactory gluable sealer has yet been developed, it is necessary to avoid applying sealer over the areas where glue will be applied. Areas to receive glue should be marked off with pencil, allowing an additional one-fourth inch on each side of the glue area to provide for misalinement when mating the parts. It is preferable to leave some unsealed areas rather than risk weakening the glue joint by accidental overlap of the sealer into the glued areas.

(v) Finish is likely to crack when applied over flush-driven nails and screws. To avoid this a strip of tape may be applied over the heads after application of sealer and before the final finish is applied.

(vi) Fill all holes left from nail-strip gluing or countersunk nails and screws with a wood filler before finishing the surface. It may be necessary to cover with a patching putty the slight depressions left after applying filler if a completely smooth surface is desired, but as a rule patching putty may be dispensed with safety.

(vii) Surfaces which are likely to come in contact with fabric during the doping process should be treated with a dope-proof paint, cellophane tape, etc., to protect them against the action of the solvents in the dope.

(3) *Finishing of interior surfaces*. Repaired ribs, spars, interior of plywood skin, and other internal members, including areas of contact between metal and wood, should be finished by applying at least two coats of spar varnish. Built-up box spars and similar closed structures should be protected on the interior by at least one heavy coat of spar varnish or lionoil. Where better protection is required, as on the surfaces of wheel wells and the bottoms of hulls below the floor boards, an additional coat of aluminized sealer consisting of 12 to 16 ounces of aluminum paste per gallon of sealer may be applied.

(4) *Finishing of exterior surfaces*. Exterior surfaces should first be sealed with at least two coats of sealer or spar varnish. The surface finish should then be completed by the application of enamel, aluminized varnish or other special finish as required to duplicate the original finish. If dope or lacquer is used to complete the finish, the sealer coats should be dope-proof. Spar varnish or sealer conforming to Specification MIL–V–6894 is satisfactory.

(5) *Finishing of end-grain surfaces*. (i) End-grain surfaces, such as edges of plywood skins and holes in spars and other primary structural members, require careful protection. Sand these surfaces smooth. Apply two coats of a highly pigmented sealer, or 1 coat of wood filler, and 1 coat of clear sealer to end-grain interior surfaces and cut holes. Exterior end-grain surfaces (except those covered with doped fabric) require

an additional (third) coat of clear sealer. A final coat of aluminized varnish may be applied to end-grain surfaces. If the surfaces are to be finished with dope or lacquer, a dope-proof sealer similar to Specification MIL–V–6894 should be used.

(ii) Exposed end-grain includes such surfaces as those around vent holes, inspection holes and fittings, and exposed scarfed or tapered surfaces such as those of tapered blocking.

(6) *Finishing with fabric or tape.* (i) To refinish with fabric or tape, it is first necessary to insure that paint has been removed from an area greater than that to be covered by the fabric.

(ii) Apply 2 brush coats of a dope-proof sealer similar to Specification MIL–V–6894, allowing the first coat to dry 2 hours and the second coat at least 6 hours. Follow with 1 coat of clear dope, and allow it to dry 45 minutes. Apply a second coat of clear dope and lay into the wet film a piece of pinked-edge airplane cloth. All air bubbles should be worked out by brushing to insure maximum adherence. Allow this to dry 45 minutes. Apply 1 brush coat to insure proper penetration and at least 1 spray coat of clear dope, allowing each to dry 45 minutes. The dried spray coat may be scuffed with fine sandpaper to obtain a smoother finish. Complete the refinishing of the surface by application of lacquer, enamel, or aluminized varnish as required to match the adjacent area.

(iii) The size of the fabric patch should be such as to extend at least one-half inch on each side of any crack or group of cracks, at least 1 inch on each side of a scarfed joint glue line, and at least 2 inches beyond any edge of a skin patch, to insure proper adhesion.

§ 18.30–3 *Fabric covering (CAA policies which apply to § 18.30)*—(a) *Textile materials.* All fabric, surface tape, reinforcing tape, machine thread, lacing cord, etc., used for re-covering or repairing an aircraft structure should be of high-grade aircraft textile material of at least as good quality and equivalent strength as those described in subparagraphs (1) through (7) of this paragraph.

(1) *Aircraft fabric.* Acceptable fabric such as cotton and linen for covering wings, control surfaces, and fuselages are listed in table 3–1. Fabrics conforming to the Automotive Material Specifications incorporate a continuous marking showing the specification number to permit identification of the fabric in the field. (See § 18.30–8 (e).)

(2) *Re-covering aircraft with original type fabric.* Aircraft should be re-covered or repaired with fabric of at least as good quality and equivalent strength as that originally used on the aircraft. In re-covering aircraft which were originally covered with low strength or "so called" glider cloth, however, it is considered more desirable to use Grade A or intermediate fabric conforming to AMS 3806 or 3804, as amended, respectively.

(3) *Reinforcing tape.* Acceptable reinforcing tape is listed in table 3–2. Reinforcing tape should be of similar quality to the fabric and at least one-half the strength of that conforming to specification MIL–T–5661.

(4) *Surface tape.* Surface tape (also finishing tape) should have approximately the same properties as the fabric used. See table 3–2.

(5) *Lacing cord.* Lacing cord should have the strength of at least 80 pounds double or 40 pounds single strand. Acceptable lacing cord is listed in table 3–2.

(6) *Machine thread.* Machine thread should have a strength of at least 5 pounds single strand (Table 3–2).

(7) *Hand-sewing thread.* Hand-sewing thread should have a strength of at least 14 pounds single strand (Table 3–2).

(b) *Covering practices*—(1) *General.* The method of fabric attachment should be identical, as far as strength and reliability are concerned, to the method used by the manufacturer of the airplane to be re-covered or repaired. Fabric may be applied so that either the warp or fill threads are parallel to the line of flight. Either the envelope method or blanket method of covering is acceptable. (See subparagraph (5) of this paragraph.)

(2) *Flutter precautions.* When repairing control surfaces, especially on high-performance airplanes, care should be exercised that the repairs do not involve the addition of weight aft of the hinge line. Such a procedure may adversely disturb the dynamic and static balance of the surface to a degree which would induce flutter. As a general rule, it will be required to repair control surfaces in such a manner that the structure is identical to the original so that the weight distribution and mass balance are not affected.

(3) *Preparation of the structure for covering.* One of the most important items in covering aircraft is proper preparation of the structure. Dope-proofing, covering edges which are likely to wear the fabric, preparation of plywood surfaces and similar operations, if properly done, will do much toward insuring an attractive and long-lasting job.

(i) *Dope-proofing.* Treat all parts of the structure which come in contact with doped fabric with a protective coating such as aluminum foil, dope-proof paint or cellulose tape. Clad aluminum and stainless steel parts need not be dope-proofed.

(ii) *Chafe points.* All points of the structure such as sharp edges, bolt heads, etc., which are likely to chafe or wear the covering should be covered with doped-on fabric strips or covered with an adhesive tape. After the cover has been installed, the chafe points of the fabric should be reinforced by doping of fabric patches. Where a stronger reinforcement is required, a cotton duck or leather patch should be sewed to the fabric patch and then doped in place. All portions of the fabric pierced by wires, bolts, or other projections should be reinforced.

(iii) *Inter-rib bracing.* Conventional wing ribs, which do not have permanent interrib bracing, should be tied in position by means of cotton tape running parallel to the beams. Apply the tape bracing to both the top and bottom capstrips, maintained parallel to the plane of the cover rather than diagonally between the top and bottom capstrips. Apply the tape continuously with one turn around successive capstrips, arranged so that the tape between the ribs is separated from the cover by a distance equal to the depth of the capstrip. Tie the turn of tape around each capstrip by means of a short length of lacing cord.

(iv) *Preparation of plywood surfaces for covering.* Prior to covering plywood surfaces with fabric, prepare the surface by cleaning and applying sealer and dope.

(*a*) *Cleaning.* Sand all surface areas which have been smeared with glue in order to expose a clean wood surface. Remove loose deposits such as wood chips and sawdust. Remove oil or grease spots by carefully washing with naphtha.

(*b*) *Application of sealer and dope.* Apply one brush coat or two dip coats (wiped) of a dope-proof sealer such as that conforming to Specification MIL–V–6894 thinned to 30 percent nonvolatile content and allow to dry 2 to 4 hours. Finally, before covering, apply two brush coats of clear dope allowing the first coat of dope to dry approximately 45 minutes before applying the second coat.

(4) *Seams*—(i) *Location of seams.* Seams parallel to the line of flight are preferable; however, spanwise seams are acceptable.

(ii) *Sewed seams*—(*a*) Machine-sewed seams (parts D, E, and F of figure 3–1) should be of the folded-fell or French-fell types. Where selvage edges or pinked edges are joined, a plain lap seam is satisfactory.

(*b*) Hand-sewing or tacking should begin at the point where machine-sewing stops and should continue to the point where machine-sewing or uncut fabric is again reached. Hand-sewing should be locked at intervals of 6 inches, and the seams should be properly finished with a lock stitch and a knot (fig. 3–5). At the point where the hand sewing or permanent tacking is necessary, the fabric should be so cut that it can be doubled under before sewing or permanent tacking is performed (figure 3–1C). After hand-sewing has been completed, the temporary tacks should be removed. In hand-sewing there should be a minimum of four stitches per inch.

(*c*) A sewed spanwise seam on a metal or wood-covered leading edge should be covered with pinked-edge surface tape at least 4 inches wide.

(*d*) A sewed spanwise seam at the trailing edge should be covered with pinked-edge surface tape at least 3 inches wide. Notches at least 1 inch in depth and 1 inch in width should be cut into both edges of surface tape if it is used to cover spanwise seams on trailing edges especially the trailing edges of control surfaces. The notches should be spaced at intervals not exceeding 6 inches. On tape less than 3 inches wide, the notches should be one-third the tape width. In the event that the surface tape begins to separate because of poor adhesion or other causes, the tape will tear at a notched section thus preventing progressive loosening of the entire length of tape.

(*e*) A double stitched lap joint should be covered with pinked edge surface tape at least 4 inches wide.

(*f*) Sewed spanwise seams on the upper or lower surface should be made in a manner that the amount of protuberance is a minimum. The seam should be covered with pinked edge tape at least 3 inches wide.

(*g*) Sewed seams parallel to the line of flight (chordwise) should not be placed over a rib or be so placed that the lacing will be through or across such a seam.

(iii) *Doped seams.* (*a*) A lapped and doped spanwise seam on a metal or wood-covered leading edge should be lapped at least 4 inches and covered with pinked edge surface tape at least 8 inches wide.

(*b*) A lapped and doped spanwise seam at the trailing edge should be lapped at least 4 inches and covered with pinked edge surface tape at least 3 inches wide. It should be notched at intervals not exceeding 6 inches. (See subdivision (ii) (*d*) of this subparagraph for notch configuration.)

(5) *Covering methods*—(i) *The envelope method.* The envelope method of covering is accomplished by sewing together widths of fabric cut to specified dimensions and machine-sewn to form an envelope which can be drawn over the frame. The trailing and outer edges of the covering should be machine sewn unless the component is not favorably shaped for sewing, in which case the fabric should be joined by hand sewing.

(ii) *The blanket method.* The blanket method of covering is accomplished by sewing together widths of fabrics of sufficient lengths to form a blanket over the surfaces of the frame. The trailing and outer edges of the covering should be joined by a plain overthrow or baseball stitch. For airplanes with placard never-exceed speed of 150 miles per hour or less, the blanket may be lapped at least 1 inch and doped to the frame or the blanket, lapped at least 4 inches at the nose of metal or wood-covered leading edges, doped, and finish with pinked-edge surface tape at least 8 inches wide. In fabricating both the envelope and blanket coverings, the fabric should be cut in lengths sufficient to pass completely around the frame, starting at the trailing edge and returning to the trailing edge.

(6) *Reinforcing tape.* Reinforcing tape of at least the width of the capstrips should be placed under all lacing. In the case of wings with plywood or metal leading-edge covering, the reinforcing tape need be brought only to the front spar on the upper and lower surfaces.

(i) *Use of antitear strips.* On aircraft with never-exceed speed in excess of 250 miles per hour, antitear strips are recommended under reinforcing tape on the upper surface of wings, and the bottom surface of that part of the wing in the slipstream. Where the antitear strip is used on both the top and bottom surfaces, pass it continuously up to and around the leading edges and back to the trailing edge. Where the strip is used only on the top surface, carry it up to and around the leading edge and back on the lower surface as far aft as the front beam. For this purpose the slipstream should be considered as being equal to the propeller diameter plus one extra rib space on each side. Cut antitear strips from the same material as used for covering and wide enough to extend beyond the reinforcing tape on each side so as to engage the lacing cord. Attach the strips by applying dope to that part of the fabric to be covered by the strip and applying dope freely over the strip.

(7) *Lacing*—(i) *Wing lacing.* Both surfaces of fabric covering on wings and control surfaces should be securely fastened to the ribs by lacing cord or any other method originally approved for the aircraft. Care should be taken to insure that all sharp edges against which the lacing cord may bear are protected by tape in order to prevent abrasion of the cord. Separate lengths of lacing cord should be joined by the splice knot shown in figure 3–4. The common square knot, which has a very low slippage resistance, should not be used for this purpose. The utmost care should be exercised to assure uniform tension and security of all stitches. The first or starting stitch should be made with a double loop by the method illustrated in figure 3–6. All subsequent stitches should be made with a single loop and tied off with the standard knot for rib lacing (modified seine type), shown in figure 3–5. The spacing between the starting stitch and the next stitch should be one-half the normal stitch spacing. All tie-off knots should be placed on the middle of the reinforcing tape on the bottom surface, or along the edge of the lower capstrip. The seine knot admits a possibility of improper tightening, resulting in a false (slip) form with greatly reduced efficiency and should not be used for stitch tie-offs. The tie-offs knot for the last stitch should be locked by an additional half-stitch. Where stitching ends, as at the rear beam and at the trailing edge, the last two stitches should be spaced at one-half normal spacing. Under no circumstances should tie-off knots be pulled back through the lacing holes.

(ii) *Double-loop lacing.* The double-loop lacing illustrated in figure 3–7 represents a method for obtaining higher strengths than possible with the standard single lacing. When using the double-loop lacing, the tie-off knot should be made by the method shown in figure 3–8.

(iii) *Fuselage lacing.* Fabric lacing is also necessary in the case of deep fuselages, and on fuselages where former strips and ribs shape the fabric to a curvature. In the latter case the fabric should be laced at intervals to the formers. The attachment of the fabric to fuselages should be so accomplished as to be at least the equivalent in strength and reliability to that used by the manufacturer of the airplane.

(8) *Stitch spacing.* The stitch spacing should not exceed the spacing approved on the original aircraft. In case the spacing cannot be ascertained due to destruction of the covering, acceptable rib-stitch spacing may be found in figure 3–2. The lacing holes should be placed as near to the capstrip as possible in order to minimize the tendency of the cord to tear the fabric. All lacing cord should be lightly waxed with beeswax for protection. In case waxed braided cord is used, this procedure is unnecessary. (See table 3–2 for acceptable lacing cords.)

(9) *Surface tape (finishing tape).* All lacing should be covered with tape of at least the quality and width as was used on the original airplane. This tape should not be applied until the first coat of dope has dried. All inspection openings should be reincorporated into the covering, and the fabric around them and along leading edges reinforced with tape. Where wear or friction is induced by moving parts or fittings, a leather patch should be sewed to a fabric patch and doped in place. Pinked surface tape is sometimes applied over the trailing edges of control surfaces and airfoils. For such application the tape should be at least 3 inches in width and should be notched along both edges at intervals not exceeding 6 inches. (See subparagraph (4) (ii) (*d*) of this paragraph for notch configuration.) If separation of the tape from the trailing edge begins it will tear at a notched section and thereby prevent loosening of the entire strip.

(10) *Special fasteners.* (i) When repairs are made to fabric surfaces attached by special mechanical methods, the original type of fastening should be duplicated.

(ii) When selftapping screws are used for the attachment of fabric to the rib structure, the following procedure should be observed:

(*a*) The holes should be redrilled where found necessary due to wear, distortion, etc., and in such cases a screw one size larger should be used as a replacement.

(*b*) The length of the screw should be sufficient so that at least two threads of the grip (threaded part) extend beyond the rib capstrip.

(*c*) A thin washer, preferably celluloid, should be used under the heads of screws and pinked-edge tape should be doped over each screw head.

(c) *Doping*—(1) *Thinning of dopes.* Dopes are generally supplied at a consistency ready for brush coats. For spraying operations practically all dopes require thinning. Thinning directions are usually listed on the container label. Where thinning operations are not supplied, thin the dope with a thinner made for the type of dope being used, until suitable brushing and/or spraying properties are obtained. The amount of thinner to be used will depend on the dope, atmospheric conditions, the spraying equipment, the spraying technique of the operator, and the type of thinner employed. The thinning of dopes influences the drying time and tautening properties of the finish and it is necessary that it be done properly. Determine the amount of thinner necessary by using experimental panels in order to ascertain the conditions which prevail locally at the time of application of the dope.

(2) *Blushing and use of blush-retarding thinner.* (i) Blushing of dopes is very common when doping is accomplished under humid conditions. The condition is caused by the rapid evaporation of thinners and solvents, which lowers the temperature on the surface, causing condensation of moisture and producing the white appearance known as blush. Blushing tendencies are also increased if strong currents of air flow over the surface when applying dopes or immediately thereafter.

(ii) A blushed finish has very little protective or tautening value. Where the relative humidity is such that only a small amount of blushing is encountered in doping, this condition may be eliminated by thining the dope with a blush-retarding thiner and slightly increasing the room temperature. If it is not possible to correct humidity conditions in the dope room, suspend doping operations until more favorable atmospheric conditions prevail. The use of a large amount of blush-retarding thinner is not advisable because of the undesirable drying properties accompanying the use of this material.

(3) *Number of coats.* The total number of coats of dope should not be less than that necessary to result in a taut and well-filled finish job. A guide for finishing fabric-covered aircraft follows:

(i) Two coats of clear dope, brushed on and sanded after the second coat.

(ii) One coat of clear dope, either brushed or sprayed, and sanded.

(iii) Two coats of aluminum pigmented dope, sanded after each coat.

(iv) Three coats of pigmented dope (the color desired), sanded and rubbed to give a smooth glossy finish when completed.

(v) Care should be taken not to sand heavily over the center portion of pinked tape and over spars in order not to damage the rib-stitching cords and fabric.

(4) *Technique.* (i) Apply the first two coats of dope by brush and spread on the surface as uniformly as possible and thoroughly work into the fabric. Exercise care not to work the dope through the fabric so that an excessive film is formed on the reverse side. The first coat should produce a thorough and uniform wetting of the fabric. To do so, work the dope with the warp and the filler threads for three or four brush strokes and stroke away any excess material to avoid piling up or dripping. Apply succeeding brush or spray coats with only sufficient brushing to spread the dope smoothly and evenly.

(ii) When doping fabric over plywood or metal-covered leading edges, care should be taken to insure that an adequate bond is obtained between the fabric and the leading edge. Care should also be taken when using predoped fabric to use a thinned dope in order to obtain a good bond between the fabric and the leading edge.

(5) *Applying surface tape and reinforcing patches.* Apply surface tape and reinforcing patches with the second coat of dope. Apply surface tape over all rib lacing and over all sewed seams as well as at all other points of the structure where tape reinforcements are indicated.

(6) *Installation of drainage grommets.* With the second coat of dope, install drainage grommets on the underside of airfoils at the trailing edge and as close to the rib as practicable. On fuselages, install drainage grommets at the center of the underside in each fuselage bay, located so that the best possible drainage is effected. On seaplanes it is recommended to install special shielded grommets, sometimes called marine grommets, to prevent the entry of spray. Also use this type of grommet on landplanes in that part of the structure which is subject to splash from the landing gear when operating from wet and muddy fields. Plastic-type grommets are doped directly to the covering. Where brass grommets are used, mount them on fabric patches and then dope to the covering. After the doping scheme is completed, open the drain holes by cutting out the fabric with a small-bladed knife. Do not open drainage grommets by punching.

(7) *Use of fungicidal dopes.* (i) Fungicidal dope is normally used as the first coat for fabrics to prevent rotting. While it may be more advisable to purchase dope in which the fungicide has already been incorporated, it is feasible to mix the fungicide with the dope. Specification MIL–D–7850 specifies that the requirements for cellulose acetate butyrate dope incorporate a fungicide for first coat use on aircraft. The fungicide specified in this specification is zinc dimethyldithiocarbonate which forms a suspension with the dope. This material is a fine powder, and if it is mixed with the dope, it should be made into a paste using dope and then diluted to the proper consistency according to the manufacturer's instructions. It is not practicable to mix the powder with a large quantity of dope.

(ii) Copper napthonate is also used as a fungicide and forms a solution with dope. However, this material has a tendency to bleed out especially on light-colored fabric. It is considered satisfactory from a fungicidal standpoint.

(iii) The first coat of fungicidal dope should be applied extremely thin so that the dope can thoroughly saturate both sides of the fabric. Once the fabric is thoroughly saturated subsequent coats can be applied at any satisfactory working consistency.

(8) *Rejuvenation of fabric.* When using this technique of improving the appearance or condition of the doped surface, care should be exercised to establish initially that the fabric strength itself has not deteriorated beyond safe limits. Experience indicates that rejuvenation may at times cause fabric sag rather than tautening.

(9) *Common dope troubles.* (i) In cold weather, dopes become quite viscous. Cold dopes pull and rope under the brush, and if thinned sufficiently to spray, lack body when dry. Prior to use, allow dopes to come to a temperature approximately that of the dope room, 24° C. (75° F.).

(ii) Orange peel and pebble effect result from insufficiently thinned dope or when the spray gun is held too far from the surface being sprayed.

(iii) Runs, sags, laps, streaks, high and low spots are caused by improperly adjusted spraying equipment or improper spraying technique.

(iv) Blisters may be caused by water or oil entering the spray gun. Drain air compressors, air regulators, and air lines daily.

(v) Pin holes may be caused by not allowing sufficient time for drying between coats or after water sanding, or they may be due to insufficiently reduced dope.

(vi) Wet areas on a doped surface indicate that oil, grease, soap, etc., had not been properly removed before doping.

(d) *Repairs to fabric covering.* Repairs to fabric-covered surfaces should be made in a manner that will return the original strength and tautness to the fabric. Sewed repairs and unsewed (doped-on patches or panels) may be made. No fabric or tape should be doped onto a surface which contains aluminum or other color coats. Whenever it is necessary to add fabric reinforcement, the old dope should be removed either by softening and scraping or by sanding down to the point where the base coat or clear coat is exposed. Clear dope should be used in doping the fabric to the surface. After reinforcement is made, normal finishing procedures may be followed.

(1) *Repair of tears in fabric.* Tears should be repaired as shown in figure 3–3 by sewing the torn edges together using a baseball stitch and doping a piece of pinked-edge fabric over the tear. If the tear is a straight rip, the sewing is started at one end so that as the seam is made the edges will be drawn tightly together throughout its entire length. If the opening is V-shaped, as is often the case when openings are cut in wings to inspect the internal structure, the sewing should start at the corner or point so that the edges of the cover will be held in place while the seams are being made. The sewing is done with a curved needle and well-waxed thread. Clean the surface to be covered by the patch by rubbing the surface with a rag dipped in dope and wiping dry with a clean rag, or by scraping the surface with a putty knife after it has been softened with fresh dope. Dope solvent or acetone may be used for the same purpose but care should be taken that it does not drop through on the inside of the opposite surface causing the dope to blister. A patch of sufficient size should be cut from airplane cloth to cover the tear and extend at least 1½ inches beyond the tear in all directions. The edges of the patch should either be pinked similar to surface tape or frayed out about one-fourth inch on all edges.

(2) *Sewed patch repair.* When the damage is such that it will not permit sewing the edges together, a sewed-in repair patch may be used if the damage is not longer than 16 inches in any one direction (see fig. 3–3). Cut out the damaged section making a round or oval-shaped opening trimmed to a smooth contour. Clean the area of the old fabric to be doped as indicated in subparagraph (1) of this paragraph. Turn the edges of the patch one-half inch and sew to the edges of the open-

ing. Before sewing, fasten the patch at several points with a few temporary stitches to facilitate sewing the seams. After the sewing is completed, clean the area of the old fabric to be doped as indicated for small repairs and then dope the patch in the regular manner. Apply surface tape over the seams with the second coat of dope. If the opening extends over or closer than 1 inch to a rib or other laced member, the patch should be cut to extend 3 inches beyond the member. After sewing has been completed the patch should be laced to the rib over a new section of reinforcing tape using the methods of paragraph (b) (7) (i) of this section. The old rib lacing and reinforcing tape should not be removed.

(3) *Repair by sewing in repair panel.* When the damaged area exceeds 16 inches in any direction a new panel should be installed.

(i) Remove the surface tape from the ribs adjacent to the damaged area and from the trailing and leading edges of the section being repaired. Leave the old reinforcing tape in place.

(ii) Cut the old fabric along a line approximately 1 inch from the center of the ribs on the sides nearest to the injury, and continue the cuts to completely remove the damaged section. The old fabric should not be removed from the leading and trailing edge unless both upper and lower surfaces are being re-covered. Do not remove the reinforcing tape and lacing at the ribs.

(iii) Cut a patch to extend from the trailing edge up to and around the leading edge and back approximately to the front beam. The patch should extend approximately 3 inches beyond the ribs adjacent to the damage.

(iv) Clean the area of the old fabric to be covered by the patch, put the patch in place, stretch taut and pin. After the patch is pinned in place, fold under the trailing and leading edges of the patch one-half inch and sew to the old fabric. Fold the side edges under one-half inch and sew to the old cover. After completion of the sewing, place reinforcing tape over the ribs under moderate tension and lace down using the methods of paragraph (b) (7) (i) of this section. Remove the temporary pinning.

(v) Give the panel a coat of clear dope and allow to dry. Install surface tape with the second coat of dope, over the reinforcing tape and over the edges of the panel. Finish the doping scheme using regular doping procedures.

(vi) This type of repair may be extended to cover both the upper and lower surfaces and to cover several rib bays if necessary. The panel must be laced to all the ribs covered.

(4) *Unsewed (doped on) repairs.* (i) Unsewed (doped on) repairs may be made on all aircraft fabric-covered surfaces provided the never-exceed speed is not greater than 150 miles per hour. A doped patch repair may be used if the damage does not exceed 16 inches in any direction. Cut out the damaged section making a round or oval-shaped opening trimmed to a smooth contour. Clean the edges of the opening which are to be covered by the patch with grease solvent. Sand or wash off the dope from the area around the patch with dope thinner. Support the fabric from underneath while sanding.

(ii) For holes up to 8 inches in size, make the fabric patch of sufficient size to provide a lap of at least 2 inches around the hole. On holes over 8 inches in size, make the overlap of the fabric around the hole at least one-fourth the hole diameter with a maximum limit of lap of 4 inches. If the hole extends over a rib or closer than the required overlap to a rib or other laced member, the patch should be extended at least 3 inches beyond the rib. In this case, after the edges of the patch have been doped in place and the dope has dried, the patch should be laced to the rib over a new section of reinforcing tape in the usual manner. The old rib lacing and reinforcing tape should not be removed. All patches should have pinked edges, or if smooth, finished with pinked-edge surface tape.

(5) *Repair by a doped-in panel.* When the damage exceeds 16 inches in any direction, make the repair by doping in a new panel. This type of repair may be extended to cover both the upper and lower surfaces and to cover several rib bays if necessary. The panel should be laced to all the ribs covered, and doped or sewed as in the blanket method.

(i) Remove the surface tape from the ribs adjacent to the damaged area and from the trailing and leading edges of the section being repaired. Leave the old reinforcing tape and lacing in place. Next cut the fabric along a line approximately 1 inch from the ribs on the sides nearest to the injury, and continue the cuts to completely remove the damaged section. The old fabric should not be removed from the leading and trailing edge unless both upper and lower surfaces are being re-covered.

(ii) (*a*) Cut a patch to run around the trailing edge 1 inch and to extend from the trailing edge up to and around the leading edge and back approximately to the front beam. The patch should extend approximately 3 inches beyond the ribs adjacent to the damage.

(*b*) As an alternative attachment on metal or wood-covered leading edges, the patch may be lapped over the old fabric at least 4 inches at the nose of the leading edge, doped, and finished with at least 8 inches of pinked-edge surface tape.

(iii) Clean the area of the old fabric that is to be covered by the patch and apply a generous coat of dope to this area. Put the new panel in place, pull as taut as possible, and apply a coat of dope to the portion of the panel which overlaps the old fabric. After this coat has dried, apply a second coat of dope to the over-lapped area and let dry.

(iv) Place reinforcing tape over the ribs under moderate tension and lace down in the approved manner.

(v) Give the panel a coat of clear dope and allow to dry. Install surface tape with the second coat of dope over the reinforcing tape and over the edges of the panel. Finish the doping scheme using the regular doping procedure.

(e) *Testing of fabric covering.* Tensile testing of fabric is a practical means for determining whether a fabric covering has deteriorated to a point where recovering is necessary. The testing may be carried out in accordance with the procedures set forth in existing industry or Government specifications such as Federal Specification CCC-T-191a, American Society for Testing Materials D39-39, and others. In all cases the specimens should be tested in the undoped condition. The use of acetone or dope thinner is suggested as a means of removing the dope.

(1) *Strength criteria for aircraft fabric.* (i) Present minimum strength values for new aircraft fabric covering are contained in table 3-1.

(ii) The maximum permissible deterioration for used aircraft fabric based on a large number of tests is 30 percent. Fabric which has less than 70 percent of the original required tensile strength would not be considered airworthy. Table 3-1 contains the minimum tensile strength values for deteriorated fabric as tested in the undoped condition.

(iii) In cases where light aircraft operators use the Grade "A" type fabric, but are only required to use "Intermediate" grade fabric, the Grade "A" material is still considered airworthy, provided it has not deteriorated, as tested in the undoped condition, below 46 pounds, i. e., 70 percent of the originally required tensile strength value for new "Intermediate" fabric.

(f) *Replacement of fabric covering with metal sheet.* (1) Some thought has been given to replacing fabric covering with metal sheet. The following remarks are intended to serve as a guide when such a modification is contemplated.

(2) Fabric may be replaced with metal sheet provided that the increase in weight does not cause the center of gravity travel to exceed its limits, that the gross weight of the aircraft remains within the operating limits and that the original structural integrity of the aircraft is not impaired by the alteration. With regard to the latter it should be noted that rivet holes in primary structural members are permissible for skin attachment only to the extent that the resultant cross-sectional area of the member is not less than the original minimum cross-sectional area. The selection of rivet patterns at skin joints is critical, especially in wings, as is also the effect of increased weight on wing moment of inertia. In view of the complexity of this modification it would be advisable to obtain CAA engineering approval of the alteration prior to its completion.

§ 18.30-4 *Metal aircraft structures (CAA policies which apply to § 18.30)*—(a) *Metal construction*—(1) *Identification and inspection of materials.* Identification and inspection of materials should be conducted in accordance with § 18.30-8.

(2) *Corrosion prevention treatment, cleaners, and paint removers.* Corrosion prevention treatment, cleaning and paint removing should be accomplished in accordance with § 18.30-7.

(3) *Bolts, screws, and fasteners.* Acceptable means of attachment are listed in § 18.30-6.

(4) *Flutter precautions.* When repairing control surfaces, especially on high-performance airplanes, care should be exercised that the repairs do not involve the addition of weight aft of the hinge line. Such procedure may adversely disturb the dynamic and static balance of the surface to a degree which would induce flutter. As a general rule it will be necessary to repair control surfaces in such a manner that the structure is identical to the original so that the weight distribution is not affected in any way.

(5) *Brazing.* (i) Brazing may be used for repairs to primary aircraft structures only if brazing was originally approved for the particular application. Brazing is not suitable for repair of welds in steel structures due to lower strength values of the brazed joint as compared to welded joints. Brazing may be used in the repair of secondary structures.

(ii) Due to the large number of brazing alloys used, it is difficult to be certain that the one used for repairing a brazed joint would not combine with the original brazing alloy to produce a low strength joint.

(iii) In cases where it is necessary to re-apply copper alloy brazing material on a steel surface more than once, and particularly if temperatures over 2,000° F. are reached, there is a possibility that brazing metal may penetrate between the grains in the steel to an extent that may cause cracking.

(iv) Copper brazing of steel is normally done in a special furnace having a reducing atmosphere, and at a temperature so high that field repairs are seldom feasible. If copper brazing is attempted without a controlled atmosphere, the copper will probably not completely wet and fill the joint.

(b) *Welded steel structures*—(1) *General.* Oxyacetylene or electric arc welding may be utilized for repair of aircraft structural elements. Most aircraft structures are fabricated from one of the weldable alloys; however, careful consideration should be given to the alloy being welded since all alloys are not readily weldable. In general, the more responsible an alloy steel is to heat treatment, the less suitable it is for welding, because the greater will be its tendency to become brittle and lose its ductility in the welded area. The following steels are readily weldable: plain carbon, nickel steels of the SAE 2300 series, chrome-nickel alloys of the SAE 3100 series, chrome-molybdenum steels of the SAE 4100 series and low nickel-chrome-molybdenum steel of the SAE 8600 series.

(i) *Preparation for welding.* The elements to be welded should be properly held in place by welding jigs or fixtures which are sufficiently rigid to prevent misalinement due to expanson and contraction of the heated material and which positively and accurately position the pieces to be welded together.

(ii) *Cleaning prior to welding.* The parts to be welded should always be cleaned by wire brushing or other similar methods. When a wire brush is used, care should be taken never to use a brush of dissimilar metal, for example, brass or bronze. The small deposit left by a brass or bronze brush will materially weaken the weld and may cause cracking and subsequent failure of the weld. In case members were metallized, the surface metal may be removed by careful sandblasting followed by a light buffing with emery cloth.

(iii) *Condition of completed weld.* The finished weld should incorporate the following characteristics:

(*a*) The seam should be smooth and of uniform thickness.

(*b*) The weld metal should taper off smoothly into the base metal.

(*c*) No oxide should be formed on the base metal at a distance of more than one-half inch from the weld.

(*d*) The weld should show no signs of blow holes, porosity or projecting globules.

(*e*) The base metal should show no signs of pitting, burning, cracking, or distortion.

(*f*) The depth of penetration should have been sufficient to insure fusion of base metal and filler rod.

(*g*) Welding scale should have been removed by wire brushing or sandblasting.

(iv) *Practices to guard against.* No welds should be filed in an effort to make a smooth appearing job, as such treatment causes a loss in strength. Welds should not be filled with solder, brazing metal, or any other filler. When it is necessary to reweld a joint which was previously welded, all old-weld material should be thoroughly removed before rewelding. Never weld over a weld if it can be avoided because continual reheating may cause the material to lose its strength and to become brittle. Never weld a joint which has been previously brazed.

(v) *Torch size (oxyacetylene welding).* Torch tip size is dependent upon the thickness of the material to be welded. Commonly used sizes proved satisfactory by experience are:

| Thickness of steel in inches | Diameter of hole in tip | Drill size |
|---|---|---|
| 0.015 to 0.031 | 0.026 | 71 |
| 0.031 to 0.065 | .031 | 68 |
| 0.065 to 0.125 | .037 | 63 |
| 0.125 to 0.188 | .042 | 58 |
| 0.188 to 0.250 | .055 | 54 |
| 0.250 to 0.375 | .067 | 51 |

(vi) *Welding rods and electrodes.* Welding rods and electrodes for various applications have special properties suitable for the application intended. Table 4–1 outlines oxy-acetylene welding rod properties, and table 4–2 outlines arc welding electrode properties.

(vii) *Rosette welds.* Rosette welds are generally employed to fuse an inner reinforcing tube (liner) with the outer member. Where a rosette weld is used, the hole should be made in the outside tube only and be of a sufficient size to insure fusion of the inner tube. A hole diameter of approximately one-fourth the tube diameter of the outer tube has been found to serve adequately for this purpose. In cases of tightly fitting sleeves or inner liners, the rosettes may be omitted.

(viii) *Heat-treated members.* Members which depend on heat-treatment for their original physical properties should be welded using a welding rod suitable for producing heat-treated values comparable to those of the original members (see subdivision (vi) of this subparagraph). Such members should be reheat-treated to the manufacturer's specifications after welding.

(ix) *Steel parts not to be welded*—(*a*) *Brace wires and cables.* Airplane parts that depend for their proper functioning on strength properties developed by cold working should not be welded. In this classification are streamlined wires and cables.

(b) *Brazed and soldered parts.* Brazed or soldered parts should not be welded, as the brazing mixture or solder will penetrate the hot steel and weaken it.

(*c*) *Alloy steel parts.* Alloy steel parts such as aircraft bolts, turnbuckle ends, axles and other heat-treated alloy steel parts, which have been heat-treated to improve their mechanical properties, should not be welded.

(2) *Repair of tubular members*—(i) *Inspection.* Prior to repairing tubular members, the structure surrounding any visible damage should be carefully examined to insure that no secondary damage remains undetected. Secondary damage may be produced in some structure remote from the location of the primary damage by the transmission of the damaging load along the tube. Damage of this nature usually occurs where the most abrupt change in direction of load travel is experienced. If this damage remains undetected, loads applied in the normal course of operation may cause failure of the part.

(ii) *Location and alinement of welds.* Unless otherwise noted welded steel tubing may be spliced or repaired at any joint along the length of the tube. Particular attention should be paid to proper fit and alinement to avoid eccentricities.

(iii) *Members dented at a cluster.* Dents at a steel tube cluster joint may be repaired by welding a specially formed steel patch plate over the dented area and surrounding tubes, as shown in figure 4–1. To prepare the patch plate, cut a section of steel sheet of the same material and thickness as the heaviest tube damaged. Trim the reinforcing plate so that the fingers extend over the tubes a minimum of 1.5 times the respective tube diameter as shown in the figure. Remove all the existing finish on the damaged cluster joint area to be covered by the reinforcing plate. The reinforcing plate may be formed before any welding is attempted, or it may be cut and tack-welded to one or more of the tubes in the cluster joint, then heated and formed around the joint to produce a smooth contour. Apply sufficient heat to the plate while forming so that there is generally a gap of no more than one-sixteenth inch from the contour of the joint to the plate. In this operation avoid unnecessary heating and exercise care to prevent damage at the apex of the angle formed by any two adjacent fingers of the plate. After the plate is formed and tack-welded to the cluster joint, weld all the plate edges to the cluster joint.

(iv) *Members dented in a bay.* Dented, bent, cracked or otherwise damaged tubular members may be repaired by using a split sleeve reinforcement, after first carefully straightening the damaged member, and in the case of cracks, drilling No. 40 (0.098) stop holes at the ends of the crack.

(*a*) *Repair by welded sleeve.* This repair is outlined in figure 4–2. Select a length of steel tube sleeve having an inside diameter approximately equal to the outside diameter of the damaged tube and of the same material and at least the same wall thickness. Diagonally cut the sleeve reinforcement at a 30° angle on both ends so that the minimum distance of the sleeve from the edge of the crack or dent is not less than 1½ times the diameter of the damaged tube. Cut through the entire length of the reinforcing sleeve and separate the half sections of the sleeve. Clamp the two sleeve sections to the proper positions on the affected areas of the original tube. Weld the reinforcing sleeve along the length of the two sides, and weld both ends of the sleeve to the damaged tube as shown in the figure. The filling of dents or cracks with welding rod in place of reinforcing the member is not acceptable.

(*b*) *Repair by bolted sleeve.* Due to the large percentage of the tube area removed by the bolt holes, bolted sleeve repairs should not be used on welded steel structures without prior approval of the repair by the Civil Aeronautics Administration.

(v) *Welded-patch repair.* Dents or holes in tubing may be repaired by a welded patch of the same material and one gage thicker, as shown in figure 4–3 provided:

(*a*) *Dented tubing.* (*1*) Dents are not deeper than one-tenth of tube diameter, do not involve more than one-fourth of the tube circumference, and are not longer than tube diameter.

(*2*) Dents are free from cracks, abrasions and sharp corners.

(*3*) The dented tubing can be substantially re-formed without cracking before application of the patch.

(*b*) *Punctured tubing.* Holes are not longer than tube diameter and involve not more than one-fourth of tube circumference.

(*c*) *Location of patch.* No part of the patch is permitted in the middle third of the tube. The patch should not overlap a tube joint.

(vi) *Splicing by inner sleeve method.* (*a*) If the damage to a structural tube is such that a partial replacement of the tube is necessary, the inner sleeve splice shown in figure 4–4 is recommended, especially where a smooth tube surface is desired. Diagonally cut out the damaged portion of the tube, and remove the burr from the edges of the cut by filing or similar means. Diagonally cut a replacement steel tube of the same material and diameter and at least the same wall thickness to match the length of the removed portion of the damaged tube. At each end of the replacement tube allow a one-eighth-inch gap from the diagonal cuts to the stubs of the original tube. Select a length of steel tubing of the same material and at least the same wall thickness and of an outside diameter approximately equal to the inside diameter of the damaged tube. This inner sleeve tube material should fit snugly within the original tube, with a maximum diameter difference of one-sixteenth inch. From this inner sleeve tube material cut 2 sections of tubing, each of such a length that the ends of the inner sleeve will be a minimum distance of 1½ tube diameters from the nearest end of the diagonal cut.

(*b*) If the inner sleeve fits very tightly in the replacement tube, chill the sleeve with dry ice or in cold water. If this is insufficient, polish down the diameter of the sleeve with emery cloth. Weld the inner sleeve to the tube stubs through the one-eighth-inch gap between the stubs, completely filling the one-eighth-inch gap forming a weld bead over the gap.

(vii) *Splicing by outer sleeve method.* (*a*) If partial replacement of a tube is necessary, an outer sleeve splice using a replacement tube of the same diameter may be made. However, the outer sleeve splice requires the greatest amount of welding and, therefore, it should be used only where the other splicing methods are not suitable. Information on the replacement by use of the welded outside sleeve method is given in figures 4–5 and 4–6.

(*b*) Squarely cut out the damaged section of the tube. Cut a replacement steel tube of the same material and diameter and at least the same wall thickness to match the length of the removed portion of the damaged tube. This replacement tube must bear against the stubs of the original tube with a total tolerance not to exceed one-thirty-second inch. Select a length of steel tubing of an inside diameter approximately equal to the outside diameter of the damaged tube, of the same material and at least the same wall thickness. This outer sleeve tube material should fit snugly about the original tube with a maximum diameter difference of one-sixteenth inch. From this outer sleeve tube material, cut 2 sections of tubing diagonally or fishmouth, each of such a length that the nearest ends of the outer sleeve are a minimum distance of 1½ tube diameters from the ends of the cut on the original tube. Use a fishmouth-cut sleeve wherever possible. Remove the burr from all the edges of the sleeves, replacement tube, and original tube stubs. Slip the two sleeves over the replacement tube, line up the replacement tube with the original tube stubs, and slip the sleeves out over the center of each joint. Adjust the sleeves to suit the area and to provide maximum reinforcement. Tack-weld the 2 sleeves to the replacement tube in 2 places before welding. Apply a uniform weld around both ends of one of the reinforcing sleeves and allow the weld to cool. Then weld around both ends of the remaining reinforcing tube. Allow one sleeve weld to cool before welding the remaining tube, to prevent undue warping.

(viii) *Splicing using larger diameter replacement tubes.* (*a*) This method of splicing structural tubes shown in figure 4–7 requires the least amount of cutting and welding. However, this splicing method cannot be used where the damaged tube is cut too near the adjacent cluster joints or where bracket mounting provisions make it necessary to maintain the same replacement tube diameter as the original. As an aid in installing the replacement tube, squarely cut the original damaged tube, leaving a minimum short stub equal to 2½ tube diameters on one end and a minimum long stub equal to 4½ tube diameters on the other end.

(*b*) Select a length of steel tube of the same material and at least the same wall thickness, having an inside diameter approximately equal to the outside diameter of the damaged tube. This replacement tube material should fit snugly about the original tube with a maximum diameter difference of one-sixteenth inch. From this replacement tube material, cut a section of tubing diagonally or fishmouth of such a length that each end of the tube is a minimum distance of 1½ tube diameters from the end of the cut on the original tube. Use a fishmouth-cut replacement tube wherever possible. Remove the burr from the edges of the replacement tube and the original tube studs. If a fishmouth cut is used, file out the sharp radius of the cut with a small, round file. Spring the long stub of the original tube from the normal position; slip the replacement tube over the long stub, then back over the short stub. Center the replacement tube between the stubs of the original tube. In several places tack-weld one end of the replacement tube; then weld completely around the end. In order to prevent distortion, allow the weld to cool completely; then weld the remaining end of the replacement tube to the original tube.

(*3*) *Repairs at built-in fuselage fittings.* Repairs of built-in fuselage fittings may be accomplished in a manner as shown in figure 4–8. Splices should be made in accordance with the methods described in the foregoing sections. The following sections outline the different methods as shown in the figure.

(i) *Tube of larger diameter than original.* A tube (sleeve) of larger diameter than original is used in the method shown in figure 4–9. This necessitates reaming the fitting holes (at longeron) to a larger diameter. The sleeve should extend approximately 6 inches forward (left of fitting) of the joint and 8 inches aft (right of fitting). The forward splice should be a 30° scarf splice. The rear longeron (right) should be cut off approximately 4 inches from the centerline of the joint and a spacer 1 inch long fitted over the longeron. This spacer and longeron should be edge welded. A tapered V-cut approximately 2 inches long should then be made in the aft end of the outer sleeve. The end of the outer sleeve should be swaged to fit the longeron and welded.

(ii) *Tube of same diameter as original.* In this method, shown in figure 4–9, the new section of tube is the same size as the longeron forward (left) of the fitting. The rear end (right) of the tube is cut at 30° and forms the outside sleeve of a scarf splice. A sleeve is centered over the forward joint as indicated.

(iii) *Simple sleeve.* The longeron is assumed the same size on each side of the fitting in this case, in figure 4–9, and is repaired by a simple sleeve of larger diameter than the longeron.

(iv) *Large difference in longeron diameter each side of fitting.* Figure 4–9 (D) assumes that there is a quarter of an inch difference in the diameter of the longeron on the two sides of the fitting. The section of longeron forward (left) of the fitting is cut at 30° and a section of tubing of the same size as this tube and of such length as to extend well to the rear (right) of the fitting is slipped through it. One end is cut at 30° to fit the 30° scarf at left and the other end fishmouthed as shown. This makes it possible to insert a tube of such diameter as to form an inside sleeve for the tube on the left of the fitting and an outside sleeve for the tube on the right of the fitting.

(4) *Engine mounts*—(i) *General.* All welding on an engine mount should be of the highest quality, since vibration tends to accentuate any minor defect present. Engine mount members should preferably be repaired by using a larger diameter replacement tube telescoped over the stub of the original member and using fishmouth and rosette welds. However, 30° scarf welds in place of the fishmouth welds will be considered acceptable for engine mount repair work.

(ii) *Check of alinement.* Repairs to engine mounts should be governed by accurate means of checking alinement. When tubes are used to replace bent or damaged ones, the original alinement of the structure must be maintained. This can be done by measuring the distance between points of corresponding members that have not been distorted, and by reference to the manufacturer's drawings.

(iii) *Cause for rejection.* If all members are out of alinement, the engine mount should be replaced by one supplied by the manufacturer or one which has been built to conform to the manufacturer's drawings. The method of checking the alinement of the fuselage or nacelle points should be requested from the manufacturer.

(iv) *Engine mount ring damage.* Minor damage such as a crack adjacent to an engine attachment lug may be repaired by rewelding the ring and extending a gusset or a mounting lug past the damaged area. Engine mount rings which have been extensively damaged should not be repaired but should be replaced unless the method of repair is specifically approved by an authorized representative of the Civil Aeronautics Administration.

(5) *Landing gears*—(i) *Round tube construction.* Landing gears made of round tubing may be repaired using standard repairs and splices, as shown in figures 4–2 and 4–8.

(ii) *Streamline tube construction.* Landing gears made of streamlined tubing may be repaired by any one of the methods shown in figures 4–9 and 4–12.

(iii) *Axle assemblies.* (*a*) Representative types of repairable and nonrepairable landing gear axle assemblies are shown in figure 4–13. The types as shown in A, B, and C of this figure are formed from steel tubing and may be repaired by any applicable method shown in figures 4–2 to 4–12 in this manual. However, it will always be necessary to ascertain whether or not the members are heat-treated.

(*b*) The axle assembly as shown in figure 4–13 D is, in general, of a nonrepairable type for the following reasons:

(*1*) The axle stub is usually made from a highly heat-treated nickel alloy steel and carefully machined to close tolerances. These stubs are usually replaceable and should be replaced if damaged.

(*2*) The oleo portion of the structure is generally heat-treated after welding and is perfectly machined to assure proper functioning of the shock absorber. These parts would be distorted by welding after machining.

(iv) *Ski pedestals.* Damaged pedestals made of steel tubing may be repaired by using any applicable method shown in figures 4–2 through 4–12.

(6) *Built-up tubular wing or tail surface spars.* Built-up tubular wing or tail surface spars may be repaired by using any of the applicable splices and methods of repair shown in figures 4–2 to 4–12 provided the spars are not heat-treated. In the case of heat-treated spars, the entire spar assembly would have to be reheat-treated to the manufacturer's specifications after completion of the repair. In general, this will be found less practicable than replacing the spar with one furnished by the manufacturer.

(7) *Wing and tail surface brace struts.* In general it will be found advantageous to replace damaged wing brace struts made either from round or streamlined tubing by new members purchased from the original manufacturer. However, there is no objection from an airworthiness point of view to repairing such members in a proper manner. An acceptable method in case streamlined tubing is used will be found in figure 4–10. Similar members made of round tubes may be repaired using a standard splice, as shown in figures 4–2, 4–4, or 4–5.

(i) *Location of splices.* Steel brace struts may be spliced at any point along the length of the strut provided the splice does not overlap any part of an end fitting. The jury strut attachment is not considered an end fitting; therefore, a splice may be made at this point. The repair procedure and workmanship should be such as to minimize distortion due to welding and the necessity for subsequent straightening operations. Every repaired strut should be carefully observed during initial flights to ascertain that the vibration characteristics of the strut and attaching components have not been adversely affected by the repair. The check should cover a wide range of speed and engine power combinations.

(ii) *Fit and alinement.* When making repairs to wing and tail surface brace members, particular attention should be paid to proper fit and alinement to avoid eccentricities.

(8) *Repairs to welded parts.* Repairs to welded assemblies may be made by either of the following methods:

(i) *Replacing welded joints.* Cutting out the welded joint and replacing it with one properly gusseted.

(ii) *Replacing weld deposit.* Chipping out the metal deposited by the weld process and rewelding after properly reinforcing the joint by means of inserts or external gussets.

(c) *Stainless steel structures*—(1) *General.* Structural components made from stainless steel, particularly the "18–8" variety (18 percent chromium, 8 percent nickel), joined by spot welding, should be repaired only at the factory of origin or by a repair station designated by the manufacturer and rated by the Civil Aeronautics Administration to perform this type of work, unless the repair is made using bolted or riveted connections which are specifically approved by an authorized representative of the Civil Aeronautics Administration.

(2) *Secondary structural and nonstructural elements.* Elements such as tip bows or leading and trailing edge tip strips of wing and control surfaces may be repaired by soldering with a 50–50 lead-tin solder or a 60–40 alloy of these metals. For best results a flux of phosphoric acid (syrup) should be used. Since the purpose of a flux is to attack the metal so that the soldering will be effective, any excess flux should be removed by washing the joint. Due to the high heat conductivity of stainless steel, a soldering iron large enough to do the work properly must be used. Leaky spot welded seams in boat hulls, fuel tanks, etc., should be repaired in a similar manner.

(d) *Riveted or bolted steel truss type structures.* Repairs to riveted or bolted steel truss type structures should be made employing the general principles outlined in the following sections on aluminum alloy structures. Methods of repair of vital members should specifically be approved by a representative of the Civil Aeronautics Administration.

(e) *Aluminum alloy structures*—(1) *General.* Extensive repairs to damaged stressed skin on monocoque types of aluminum alloy structures should be made at the factory of origin or by a repair station rated for this type of work. In any event such work should be undertaken only by a certificated mechanic thoroughly experienced in this type of work. The repairs should preferably be made in accordance with specific recommendations of the manufacturer of the aircraft. In many cases repair parts, joints, or reinforcements can be designed and proof of adequate strength shown, without the calculation of the design loads and stresses, by properly considering the material and dimensions of the original parts and the riveted attachments. Examples illustrating the principles of this method as applied to typical repairs are given in this manual or may be found in textbooks on metal structures. An important point to bear in mind making repairs on monocoque structures is that a repaired part must be as strong as the original with respect to all types of loads and general rigidity.

(i) *Use of annealed alloys for structural parts.* The use of annealed 17S or 24S alloys for any structural repair of an aircraft is not considered satisfactory on account of their poor corrosion resisting properties.

(ii) *Hygroscopic materials improperly moisture-proofed.* The use of hygroscopic materials improperly moisture-proofed such as impregnated fabrics, leather and the like, in attempting to effect watertightness of joints and seams is not considered acceptable practice.

(iii) *Drilling oversized holes.* Great care should be exercised to avoid drilling over-size holes or otherwise decreasing the effective tensile area of wing spar capstrips, wing, fuselage, or fin longitudinal stringers, or other highly stressed tensile members. All repairs or reinforcements to such members should be done in accordance with factory recommendations or with the specific approval of a representative of the Civil Aeronautics Administration.

(iv) *Disassembly prior to repairing.* If the parts to be removed are essential to the rigidity of the complete structure, the remaining structure should be adequately supported prior to disassembly, in such a manner as to prevent distortion and permanent damage to the remainder of the structure. Rivets may be removed by using special tools developed for the purpose or by center-punching the heads, drilling not quite through with a drill of the same size as the rivets, and shearing the heads off by a sharp blow with a small cold chisel. Rivet joints adjacent to the damaged parts should be inspected for partial failure (slippage) by removing one or more rivets to see if the holes are elongated or the rivets have started to shear.

(2) *Selection of material for replacement parts.* In selecting the alloy, it is usually satisfactory to use 24S in place of 17S since the former is stronger. Hence, it will not be permissible to replace 24S by 17S unless the deficiency in strength of the latter material has been compensated by an increase in material thickness or the structural strength has been substantiated by tests or analyses. Information on the comparative strength properties of these alloys as well as 14S, R–301, 61S, 75S, etc., is contained in ANC–5, "Strength of Metal Aircraft Elements." The choice of temper depends upon the severity of the subsequent forming operations. Parts having single curvature and straight bend lines with a large bend radius may be advantageously formed from heat-treated material, while a part such as a fuselage frame would have to be formed from soft annealed sheet and heat-treated after forming. Sheet metal parts which are to be left unpainted should be made of clad (aluminum coated) material. All sheet material and finished parts should be free from cracks, scratches, kinks, tool marks, corrosion pits, and other defects which may be factors in subsequent failure.

(i) *Forming sheet metal parts.* Bend lines should preferably be made to lie at an angle to the grain of the metal (preferably 90°). Before bending, all rough edges should be smoothed, burrs removed and relief holes drilled at the ends of bend lines and at corners to prevent cracks from starting. For material in the heat-treated condition, the bend radius should be large. See table 4–3 for recommended bend radii.

(3) *Heat treatment*—(i) *General.* All structural aluminum alloy parts should be heat treated in accordance with the heat treatment instructions issued by the manufacturers of the materials. If the heat treatment produces warping, the parts should be strengthened immediately after quenching. Riveted parts should be heat-treated before riveting, to preclude warping and corrosion. When riveted assemblies are heated in a salt bath, the salt cannot be entirely washed out of the crevices, thus causing corrosion.

(ii) *Quenching in hot water or air.* The quenching of 17S or 24S alloys in water above 100° F., or air at any temperature after heat treatment will not be satisfactory. For clad material, when the use of cold water will result in too great a distortion of the finished part, the use of oil, hot water, water spray or forced air draft is satisfactory, provided the parts will not be subject to severe corrosion in service. Quenching in still air is not satisfactory.

(iii) *Transferring too slowly from heat treatment medium to quench tank.* Transfer of 17S or 24S alloys from the heat treatment medium to the quench tank should be accomplished as quickly as possible. An elapsed time of 10 to 15 seconds will, in many cases, result in noticeably impaired corrosion resistance.

(iv) *Reheating at temperatures above boiling water.* Reheating at temperatures above that of boiling water of 17S or 24S alloys after heat treatment, and the baking of primers at temperatures above that of boiling water, will not be considered acceptable without subsequent complete and correct heat treatment, as such practice tends to impair the original heat treatment.

(4) *Riveting*—(i) *Identification of rivet material.* Identification of rivet material is contained in § 18.30–6.

(ii) *Replacement of aluminum alloy rivets.* All protruding head rivets, (roundhead, flathead, and brazier-head) may be replaced by rivets of the same type or by AN–470 Universal-head rivets. Flushhead rivets should be used to replace flushhead rivets.

(*a*) *Replacement rivet size and strength.* Replacements should be made with rivets of the same size and strength wherever possible. If the rivet hole has become enlarged, deformed, or otherwise damaged, the hole should be drilled or reamed for the next larger size rivet, care being taken, however, that the edge distances and spacings are not less than minimums listed in (*b*) of this subdivision. Rivets may not be replaced by a type of lower strength properties, unless the lower strength is adequately compensated for by an increase in size or a greater number of rivets.

(*b*) *Replacement rivet edge distances and spacings for sheet joints.* Rivet edge distance is defined as the distance from the center of the rivet hole to the nearest edge of the sheet. Rivet spacing is the distance from the center of the rivet hole to the center of the adjacent rivet hole. Edge distances and spacings should not be less than the following:

(*1*) *Single row.* Edge distances not less than 2 times the diameter of the rivet and spacing not less than 3 times the diameter of the rivet.

(*2*) *Double row.* Edge distance and spacing not less than the minimums shown in figure 4–14.

(*3*) *Triple or multiple rows.* Edge distance and spacing not less than the minimums shown in figure 4–14.

(iii) *Use of A17S–T3 aluminum alloy replacement rivets.* It will be considered acceptable to replace all 17S–T3 rivets of three-sixteenths-inch diameter or less, and also all 24S–T4 rivets of five-thirty-seconds-inch diameter or less with A17S–T3 rivets for general repairs, provided the replacement rivets are one-thirty-second-inch greater in diameter than the rivets they replace, and provided the edge distances and spacings are not less than the minimums listed in subdivision (ii) (*b*) of this subparagraph.

(iv) *Driving of rivets.* A17S rivets may be driven in the condition received, but 17S rivets above three-sixteenths inch in diameter, and all 24S rivets should either be kept refrigerated in the "as quenched" condition until driven or be reheat-treated just prior to driving as they would otherwise be too hard for satisfactory riveting. Dimensions for formed flat rivet heads are shown in figure 4–15, together with commonly found rivet imperfections, which should be guarded against.

(v) *Blind-type and hollow rivets.* (*a*) Hollow rivets should not be substituted for solid rivets in load-carrying members without specific approval of the application by a representative of the Civil Aeronautics Administration.

(*b*) Blind rivets may be used in blind locations in accordance with the conditions listed in § 18.30–6, provided the edge distances and spacings are not less than the minimums listed in subdivision (ii) (*b*) of this subparagraph.

(vi) *New and revised rivet patterns.* (*a*) A new or revised rivet pattern should be designed for the strength required in accordance with the specific instructions in subparagraphs (5) (vi) and (viii) (*d*) of this paragraph.

(*b*) A general rule for the diameter of rivets used to join dural sheets is to use a diameter approximately three times the thickness of the sheet, or somewhat larger for thin sheet. Rivets should not be used where they would be placed in tension tending to pull the heads off. A lap joint of thin sheets should be "backed up" by a stiffening section.

(5) *Repair methods*—(i) *Precautions.* (*a*) When adding or replacing rivets adjacent or near to 17S or 24S rivets which have been installed previously, great care should be exercised or the older rivets will be loosened or may fail due to sharp vibrations in the structures caused by the action of the rivet gun and bucking bar. In every case all adjacent rivets should be carefully examined after the repair or alteration is finished to

ascertain that they have not been harmed by operations in adjacent areas.

(*b*) Rivet holes should be drilled, round, straight, and free from cracks. The snap used in driving the rivets should be cupped slightly flatter than the rivet heads shown in figure 4–15. Rivets should be driven straight and tight, but not overdriven or driven while too hard, since the finished rivet must be free from cracks. Information on special methods of riveting, such as flush riveting, usually may be obtained from manufacturer's service manuals.

(ii) *Splicing of tubes.* (*a*) Round or streamline tubular members may be repaired by splicing as shown in figure 4–16. Splices in struts should not overlap the fittings.

(*b*) When solid rivets go completely through hollow tubes, their diameter should be at least one-eighth of the outside diameter of the outer tube. Rivets which are loaded in shear should be hammered only enough to form a small head, and no attempt should be made to form the standard round head. The amount of hammering required to form the standard round head often causes the rivet to buckle inside the tube. Satisfactory rivet heads may be produced in such installations by spinning, if the proper equipment is available. Correct and incorrect examples of this type of rivet application are incorporated in figure 4–16.

(iii) *Repairs to aluminum alloy members.* Repairs to aluminum alloy members should be made with the same material or with suitable material of higher strength. The 75S alloy has greater tensile strength than other commonly used aluminum alloys such as 14S and 24S but it is subject to somewhat greater notch sensitivity. In order to take advantage of its higher strength characteristics, particular attention should be paid in design of parts to avoid notches, small radii, large or rapid changes in cross-sectional area. In fabrication, care should be taken to avoid processing and handling defects, such as machine marks, nicks, dents, burrs, scratches and forming cracks. Cold straightening or forming of 75S–T6 can cause cracking; hence, it may be advisable to limit this processing to minor cold straightening.

(iv) *Wing and tail surface ribs.* Damaged aluminum alloy ribs either of the stamped sheet-metal type or the built-up type employing special sections, square or round tubing, may be repaired by the addition of suitable reinforcement. Acceptable methods of repair are shown in figures 4–17 and 4–18. These examples deal with types of ribs commonly found in small and medium aircraft. Any other method of reinforcement should be specifically approved by a representative of the Civil Aeronautics Administration.

(*a*) *Trailing and leading edges and tip strips.* Repairs to wing and control surface trailing and leading edges and tip strips should be made by properly executed and reinforced splices. Acceptable methods of trailing edge repairs are shown in figure 4–19.

(v) *Repair of damaged skin*—(*a*) *Replacement of skin panels.* In case metal skin is damaged extensively, repairs should be made by replacing an entire sheet panel from one structural member to the next. The repair seams should be made to lie along stiffening members, bulkheads, etc., and each seam should be made exactly the same in regard to rivet size, spacing, and rivet pattern as the parallel manufactured seams at the edges of the original sheet. If the two manufactured seams are different, the stronger one should be copied. See figure 4–20 for typical acceptable methods of repairs.

(*b*) *Patching of small holes.* (*1*) Small holes in skin panels which do not involve damage to the stiffening members may be patched by covering the hole with a patch plate in the manner shown in figure 4–20.

(*2*) Flush type patches also can be installed in stressed skin type of construction. An acceptable and easy flush patch can be made by trimming out the damaged area and then installing a conventional patch on the underneath side or back of the sheet being repaired. A plug patch plate of the same size as the opening can then be inserted and riveted to the patch plate installed as above. This will complete an acceptable flush type patch. Other types of flush patches similar to those used for patching plywood, reference figure 2–16, also can be used. The riveting pattern used, however, should follow standard practice so as to maintain satisfactory strength in the sheet. (See subdivision (i) of this subparagraph.)

(*3*) In general, patches in metal skin are not restricted as to size or shape; however, those of rectangular, circular, square, oval, and rectangular with round ends usually are more desirable as to appearance and ease of installation.

(vi) *Splicing of sheets.* In some cases the method of copying the seams at the edges of a sheet may not be satisfactory; for example, when the sheet has cutouts, or doubler plates at an edge seam, or when other members transmit loads into the sheet. In these cases, the splice should be designed as illustrated in the following example:

Material: Clad 17S sheet, 0.032 inch thickness. Width of sheet (i. e. length at splice) =“W”=10 inches.

To determine rivet size and pattern for a single-lap joint, similar to figure 4–14:

(*a*) Use rivet diameter of approximately three times the sheet thickness $3 \times 0.032 = 0.096$ inch. Use one-eighth A17S–T3 rivets ($\frac{5}{32}$ A17S–T3 would also be satisfactory).

(*b*) Determine the number of rivets required per inch of width, “W”, from table 4–5. Number per inch$=4.9 \times .75 = 3.7$. Total number of rivets required$=10 \times 3.7 = 37$ rivets.

(*c*) Lay out rivet pattern with spacing not less than those shown in figure 4–14. Referring to figure 4–14A, it is seen that a double-row pattern with the minimum spacing will give a total of 40 rivets. However, as only 37 rivets are required, 2 rows of 19 rivets each, equally spaced over the 10 inches will result in a satisfactory splice.

(vii) *Straightening of stringers or intermediate frames*—(*a*) *Members slightly bent.* Members which are slightly bent may be straightened cold and examined with a magnifying glass for injury to the material. The straightened parts should then be reinforced to an extent depending upon the condition of the material and the magnitude of any remaining kinks or buckles. If any strain cracks are apparent, complete reinforcements should be added by following the manufacturer's recommendations and the attachment of the reinforcements should be made in sound metal beyond the damaged portion.

(*b*) *Local heating.* Local heating should never be applied to facilitate bending, swaging, flattening, or expanding operations on heat-treated aluminum alloy members, as it is difficult to control the temperatures closely enough to prevent possible damage to the metal and it may impair its corrosion resistance.

(viii) *Splicing of stringers and flanges.* (*a*) Splices should be made in accordance with the manufacturer's recommendations, which are usually contained in a repair manual.

(*b*) Typical splices for various shapes of sections are shown in figures 4–21 and 4–23. Splices should be designed to carry both tension and compression and the splice shown in figure 4–22 will be used as an example illustrating the following general principles:

(*1*) *Statement of principles.* (*i*) To avoid eccentric loading and consequent buckling in compression, splicing or reinforcing parts should be placed as symmetrically as possible about the centerline of the member and attachment made to as many elements as necessary to prevent bending in any direction.

(*ii*) To avoid reducing the strength in tension of the original bulb angle, the rivet holes at the ends of the splice are made small (no larger than the original skin attaching rivets), and the second row of holes (those through the bulbed leg) are staggered back from the ends. In general the rivets should be arranged in the splice so that the design tensile load for the member and splice plate can be carried into the splice without failing the member at the outermost rivet holes.

(*iii*) To avoid concentration of load on the end rivet and consequent tendency toward progressive rivet failure, the splice is tapered off at the ends, in this case by tapering the backing angle and by making it shorter than the splice bar (see fig. 4–22).

The preceding principles are especially important in splicing stringers on the lower surface of stressed skin wings, where high tension stresses may exist. When several adjacent stringers are spliced, the splices should be staggered if possible.

(*2*) *Size of splicing members.* When the same material is used for the splicing member as for the original member, the net cross section area (i. e., the shaded areas in fig. 4–21) of the splicing member should be greater than the area of the section element which it splices. The area of a section element (e. g. each leg of an angle or channel) is equal to the width multiplied by the thickness. For example, in figure 4–22, the bar, “B,” is assumed to splice the upper leg of the stringer, and the angle, "A," to splice the bulbed leg of the stringer. Since the splice bar, "B," is not as wide as the adjacent leg, and since the rivet diameter is also subtracted from the width, the bar is made twice as thick in order to obtain sufficient net area.

(3) *The diameter of rivets in stringers.* The diameter of rivets in stringers should preferably be between 2 and 3 times the thickness, "t," of the leg, but should not be more than one-fourth the width, "W," of the leg. Thus, one-eighth-inch rivets are chosen in the example, figure 4–22. If this splice were in the lower surface of a wing, the end rivets would be made the same size as the skin attaching rivets, say three thirty-seconds.

(4) *The number of rivets.* (*i*) The number of rivets required on each side of the cut in a stringer or flange may be determined from standard textbooks on aircraft structures, or may be found from tables 4–4, 4–5, or 4–6. In determining the number of rivets required in the example, figure 4–22, for attaching the splice bar, "B," to the upper leg, the thickness "t" of the element of area being spliced is one-sixteenth inch (use 0.064), the rivet size is one-eighth inch, and table 4–5 shows that 9.9 rivets are required per inch of width. Since the width, "W," is one-half inch, the actual number of rivets required to attach the splice bar to the upper leg, on each side of the cut, is 9.9 (rivets per inch) ×0.5 (inch width) =4.95; use 5 rivets.

(*ii*) For the bulbed leg of the stringer, "t"=1/16 inch (use 0.064), AN–3 bolts are chosen and the number of bolts required per inch of width=3.3. The width, "W," for this leg, however, is 1 inch, and the actual number of bolts required on each side of the cut is 1×3.3=3.3; use 4 bolts. When both rivets and bolts are used in the same splice, the bolt holes should be accurately reamed to size. It is preferable to use only one type of attachment, but in the above example, the dimensions of the legs of the bulb angle indicated rivets for the upper leg and bolts for the bulb leg.

(5) *Splicing of intermediate frames.* (*i*) The same principles that are used for stringer splicing may be applied to intermediate frames, when the following point is also considered:

(*ii*) Conventional frames of channel or Z section are relatively deep and thin compared to stringers, and usually fail by twisting or by buckling of the free flange. The splice joint should be reinforced against this type of failure by using a splice plate heavier than the frame and by splicing the free flange of the frame with a flange of the splice plate, as illustrated in figure 4–24. Since a frame is likely to be subjected to bending loads, the length of splice plate "L" should be more than twice the width, "$W_2$," and the rivets spread out to cover the plate.

(ix) *Repairing cracked members.* Acceptable methods of repairing various types of cracks occurring in service in structural elements from various causes are shown in figures 4–25 to 4–28. The following general procedure should be followed in repairing such defects:

(*a*) Small holes three thirty-seconds inch (or 1/8 inch) should be drilled at the extreme ends of the cracks to mitigate the possibility of their spreading further.

(*b*) Reinforcements as shown in these figures should be added to carry the stresses across the damaged portion and to stiffen the joints.

The condition causing such cracks to develop at a particular point is stress concentration at that point in conjunction with repetition of stress (such as produced by vibration of the structure). The stress concentration may be due to the design or to defects such as nicks, scratches, tool marks, and initial stresses or cracks from forming or heat-treating operations. It should be noted that an increase in sheet thickness alone is usually beneficial but does not necessarily remedy the conditions leading to cracking.

(f) *Fittings*—(1) *Steel fittings*—(i) *Inspections for defects.* (*a*) Fittings should be free from scratches, vise and nibbler marks, and sharp corners. A careful examination of the fitting with a medium power (at least 10 power) magnifying glass will be considered an acceptable inspection.

(*b*) When repairing aircraft after an accident or in the course of a major overhaul, all highly stressed main fittings should be inspected in accordance with the provisions of § 18.30–8, and, if necessary, corrosion prevention measures taken as recommended in § 18.30–7.

(ii) *Torn, kinked, or cracked fittings.* Torn, kinked, or cracked fittings should be replaced and not repaired.

(iii) *Elongated or worn bolt holes.* Elongated holes in fittings which were designed without bushings should not be reamed oversize but such fittings should be replaced unless the method of repair is approved by a representative of the Civil Aeronautics Administration. Holes should not be filled with welding rod. Acceptable methods of repairing elongated or worn bolt holes in landing gear, stabilizer, interplane or cabane strut ends only, not originally equipped with pin plates, are shown in figure 4–29. (See also figure 4–8 on longeron repair at a fitting.)

(2) *Aluminum and aluminum alloy fittings.* Damaged fittings should be replaced with new parts having the same material specifications or the method of repair should be specifically approved by a representative of the Civil Aeronautics Administration.

(g) *Castings.* Damaged castings should be replaced and not repaired unless the method of repair is specifically approved by a representative of the Civil Aeronautics Administration.

§ 18.30–5 *Control cables and terminals (CAA policies which apply to § 18.30)*—(a) *Control cables and wires.* Control cables and wires should be replaced if injured, distorted, worn, or corroded even though the strands are not broken. However, cable sections may be spliced using the procedures of subparagraph (1) of this paragraph. Cable tension should be checked after installation to insure proper rigging.

(1) *Splicing.* (i) Control cables may be spliced when they become worn, distorted, corroded, or otherwise injured. The cable, thimbles, shackles, turnbuckles, bolts, and other parts should be of the same size, material, and quality as the original parts or of such size that the repaired cable will be of strength equivalent to the original. However, AN–666 through AN–669 standard swaged cable terminals develop the full cable strength and may be substituted for the original terminals wherever practical. If facilities and supplies are limited, repair may sometimes be accomplished, using thimbles, bushings, and turnbuckles in place of original terminals. When this is done, flexible cables 7 x 7 and 7 x 19, having a diameter of three thirty-seconds inch or over, may be woven spliced by means of the 5-tuck method. Flexible cable less than three thirty-seconds inch in diameter and nonflexible carbon steel 19 wire cable (MIL–C–6940) may be wrap-soldered. Directions for fabricating these splices and limitations as to their use are contained in the following paragraphs.

(ii) All splices should be installed so that no portion of the splice comes closer than 2 inches to any fairlead or pulley and the connections should not be located at points where jamming may occur during any portion of the travel of either the loaded cable or the slack cable in the deflected position.

(2) *Substitution of cable.* Substitution of control cable (aircraft cord) for hard or streamlined wires will not be acceptable unless specifically approved by a representative of the Civil Aeronautics Administration.

(3) *Cutting and heating.* Cables should be cut to length only by mechanical means. The use of a torch in any manner is not permitted. Wires and cables should never be subjected to excessive temperature. Soldering bonding braid to control cable will not be considered satisfactory.

(4) *Rust prevention.* If the cables are made from tinned steel, the cable should be coated with rust preventive oil. It is to be noted that corrosion-resistant steel cable does not require this treatment for rust prevention.

(b) *Swaged terminals.* Swaged cable terminals as for instance AN–666 through AN–669 manufactured in accordance with Air Force-Navy Aeronautical Standard Specifications are suitable for use in civil aircraft for loads up to and including the maximum cable loads permitted by the specification. Limits and tolerances for critical dimensions, before and after swaging, are specified on the AN standard cable terminal drawings and also in the literature issued by manufacturers of swaging tools. When such tools are used, it is important that the instructions supplied by the manufacturer including "go" and "no go" after swaging dimensions, be followed in detail in order that defective and inferior swaging will be avoided. Observance of all instructions should result in a swaged terminal developing the full rated strength of the cable.

(1) *Cable slippage in terminal.* Care should be exercised to insure the cable is properly inserted in the band after the swaging operation is completed as instances have been noted of cases wherein only one-fourth inch of the cable was

properly swaged in the terminal. Observance of the following precautions should minimize this possibility:

(i) Measure the length of the terminal end of the fitting to determine the proper length of cable to be inserted in the barrel of the fitting.

(ii) Lay off this length at the end of the cable and mark with masking tape. Since the tape will not slip, it will provide a positive marking during the swaging process.

(iii) After swaging, check the tape marker to make certain that the cable did not slip during the swaging operation.

(iv) Check swaged fitting with a "go"-"no go" gage to see that the fitting is properly compressed.

(v) Remove the tape and, using red paint, paint the junction of the swaged fitting and cable.

(vi) At all subsequent service inspections of the swaged fitting, check for a gap in the painted section to see if cable slippage has occurred.

(2) *Ball-and-socket-type terminals.* Ball-and-socket-type swaged terminals and other types that do not positively prevent cable untwisting should not be used for general replacement except where they were utilized on the original installation by the aircraft manufacturer.

(c) *Woven splice terminal.* (1) The 5-tuck woven splice terminals shown in figure 5-1 may be utilized on 7 x 7 flexible and 7 x 19 extra flexible cables of three thirty-seconds inch diameter or greater. This type of terminal will develop only 75 percent of the cable strength and should not be used to replace swaged or other high efficiency terminals unless it is definitely known that the design load for the cable is not greater than 75 percent of the cable minimum breaking strength (see table 5-1).

(2) In some cases it will be necessary to splice one end of the cable on assembly. For this reason, investigate the original installation for pulleys and fair leads that might restrict the passage of the splice. The procedure for the fabrication of a woven splice is as follows: See figure 5-1 for the designation of numbers and letters referred to in this sequence of operations.

(i) Secure the cable around a bushing or thimble by means of a splicing clamp in a vise with the free end to the left of the standing wire and away from the operator. If a thimble is used as the end fitting, turn to point outward approximately 45°.

(ii) Select the free strand (1) nearest the standing length at the end of the fitting and free this strand from the rest of the free ends. Next, insert a marlinspike under the first three strands (A, B, C) of the standing length nearest the separated strand of the free end and separate them momentarily by twisting the marlinspike. Insert the free strand (1) under the three separated strands through the opening created by the marlinspike. Pull the free end taut by means of pliers.

(iii) Unlay a second strand (2) located to the left of the first strand tucked, and insert this second strand under the first two standing strands (A, B). Loosen the third free length (3) located to the left of the first two, and insert it under the first standing strand (A) of the original three (section AA).

(iv) Remove the center or core strand (7) from the free end and insert it under the same standing strands (A, B). Temporarily secure the core strand to the body of the standing cable (see detail B). Loosen the last free strand (6) located just to the right of the first (1) and tuck it under the last two strands (E, F) of the standing cable. Tuck the fifth free end (5) around the fifth standing strand (E). Tuck the fourth free end (4) around the sixth standing strand (F) (see details B and E). Pull all strands snug toward the end fitting with the pliers. This completes the first tuck.

(v) Begin with the first free strand (1) and work in a counterclockwise direction, tucking free strands under every other strand. After the completion of every tuck, pull the strands tight with pliers. Pull toward the end fitting (see detail C). After the completion of the third complete tuck, cut in half the number of wires in each free strand. Make another complete tuck with the wires remaining. At the completion of the fourth tuck, again halve the number of wires in the free strands and make one final tuck with the wires remaining. Cut off all protruding strands and pound the splice with a wooden or rawhide mallet to relieve the strains in the wires. Serve the splice with waxed linen cord (6 ply, type B, Federal Specification V-T-291).

(vi) Start one-fourth inch from the end of the splice and carry the wrapping over the loose end of the cord and along the tapered splice to a point between the second and third tucks. Insert the end of the cord back through the last five wrappings and pull snug. Cut off the end, and if a thimble is used as an end fitting bend down the points. Apply 2 coats of shellac to the cord, allowing 2 hours between coats (see detail D). Carefully inspect the cable strands and splices for local failure. Weakness in a woven splice is made evident by a separation of the strand of serving cord.

(d) *Wrap-soldered splice.* The wrap-soldered splice terminal shown in figure 5-2 may be utilized on flexible cables less than three thirty-seconds inch in diameter and on nonflexible single-strand (19-wire) cable (MIL-C-6940). This type of terminal will develop only 90 percent of the cable strength and should not be used to replace swaged or other high efficiency terminals unless it is definitely known that the design load for the cable is not greater than 90 percent of the cable minimum breaking strength (see table 5-1). The method of making the wrapped and soldered splice is as follows:

(1) The serving or wrapping wire should be of commercial soft-annealed steel wire or commercial soft iron wire, thoroughly and smoothly tinned or galvanized.

(2) The solder should be half tin and half lead conforming to Federal Specification QQ-S-571. The melting point of this solder varies from 320° to 390° F., and the tensile strength is approximately 5,700 pounds per square inch.

(3) Solder flux should be a compound of stearic acid (there should be no mineral acid present) and resin, with a composition of 25 to 50 percent resin. A warming gluepot to keep the flux in fluid state is desirable.

(4) Before the cable is cut the wires are soldered to prevent slipping. The preferred process is to tin and solder the cable thoroughly for 2 or 3 inches by placing in a solder trough, finishing smooth with a soldering tool. The cable may be cut diagonally to conform to the required taper finish.

(5) After being soldered and cut the cable is securely bent around the proper size thimble and clamped, taking care that the cables lie close and flat and that the taper end for finish lies on the outside. If it is necessary to trim the taper at this point in the process, it is preferable that it be done by nipping, but grinding is permissible, provided a steel guard at least 3 inches long and one-thirty-second-inch thick is placed between the taper end and the main cable during the operation, and that the heat generated from the grinding does not melt the solder and loosen the wires.

(6) Serving may be done by hand or machine, but in either case each serving convolution must touch the adjoining one and be pulled tightly against the cable, with spaces for permitting a free flow of solder, and inspection.

(7) Care should be exercised to prevent drawing of the temper of any cable wires by excessive temperature or duration of applied heat. The flux used in this soldering should be stearic acid and resin. The use of sal ammoniac or other compounds having a corrosive effect is not permitted as a flux.

(8) Soldering is accomplished by immersing the terminal alternately in the flux and in the solder bath, repeating the operation until thorough tinning and filling with solder under the serving wire and thimble is obtained. The temperature of the solder bath and place where terminal is withdrawn should not be above 450° F. A soldering iron may be used in the final operation to give a secure and good-appearing terminal. Care should be taken that the solder completely fills the space under the serving wire and thimble. A slightly hollowed cast iron block to support the splice during soldering may help in securing the best results. The use of abrasive wheels or files for removing excess solder is not permissible.

(9) As an alternative process for making terminals for nonflexible cable, the oxyacetylene cutting method and the presoldering method (soldering before wrapping) are permitted, but only on the following conditions:

(i) That the process of cutting securely welds all wires together;

(ii) That the annealing of the cable does not extend more than one cable diameter from the end;

(iii) That no filing be permitted either before or after soldering;

(iv) For protection during the operation of grinding the tapered end of the cable, a steel guard at least 3 inches in length and one-thirty-second-inch thick should be placed between the taper and the main cable;

(v) The heat from grinding should not draw the temper of the cable.

(10) Wrap-soldered splice terminals should not be used ahead of the firewall, or in other fire zones, or in other locations where they might be subjected to high temperature.

(e) *Safetying of turnbuckles.* All turnbuckles should be safetied with safety wire using either the double or single wrap method, or with any appropriate approved special safetying device complying with the requirements of CAA Technical Standard Order No. TSO–C21. For safety wire sizes and materials refer to table 5–2. Safety wire should never be reused. The turnbuckle should be adjusted to the correct cable tension so that no more than three threads are exposed on either side of the turnbuckle barrel. Turnbuckles should never be lubricated.

(1) *Double wrap method.* (i) (*a*) Of the methods using safety wire for safetying turnbuckles, the method described here is preferred, although either of the other methods described is also satisfactory. This method of double wrap safetying is shown in figure 5–3 (A). Use two separate lengths of the proper wire (see table 5–2). Run one end of one wire through the hole in the barrel of the turnbuckle and bend the ends of the wire toward opposite ends of the turnbuckle. Then pass the second length of the wire into the hole in the barrel and bend the ends along the barrel on the side opposite the first length. Spiral the two wires in opposite directions around the barrel to cross each other twice between the center hole and the ends. Then pass the wires at the end of the turnbuckle in opposite directions through the holes in the turnbuckle eyes or between the jaws of the turnbuckle fork, as applicable, laying one wire along the barrel and wrapping the other at least four times around the shank of the turnbuckle and binding the layed wires in place before cutting the wrapped wire off. Wrap the remaining length of safety wire at least four turns around the shank and cut it off. Repeat the procedure at the opposite end of the turnbuckle.

(*b*) When a swaged terminal is being safetied, pass the ends of both wires, if possible, through the hole provided in the terminal for this purpose and wrap both ends around the shank as described above. When the hole in the terminal is not large enough to accommodate the ends of both wires, the hole may be enlarged in accordance with note 3 of table 5–2 and the safetying completed as described above. If the hole is not large enough to allow passage of both wires, pass the wire through the hole and loop it over the free end of the other wire, and then wrap both ends around the shank as described.

(ii) Another satisfactory double wrap method, similar to subdivision (i) of this subparagraph, except that the spiraling of the wires is omitted, is shown in figure 5–3 (B).

(iii) The wrapping procedures described and shown on AND 10482 may be used in lieu of the other safetying methods shown herein.

(2) *Single wrap method.* The single wrap methods described below and illustrated in figures 5–3 (C) and (D) are acceptable but are not the equal of the double-wrap methods.

(i) Pass a single length of wire through the cable eye or fork or through the hole in the swaged terminal at either end of the turnbuckle assembly. Spiral each of the wire ends in opposite directions around the first half of the turnbuckle barrel so as to cross each other twice. Thread both wire ends through the hole in the middle of the barrel so that the third crossing of the wire ends is in the hole. Again spiral the two wire ends in opposite directions around the remaining half of the turnbuckle crossing them twice. Then pass one wire end through the cable eye or fork or through the hole in the swaged terminal, in the manner described in subparagraph (1) (i) of this paragraph, wrap both wire ends around the shank for at least four turns each, cutting off excess wire. This method is shown in figure 5–3 (C).

(ii) Pass one length of wire through the center hole of the turnbuckle and bend the wire ends toward opposite ends of the turnbuckle. Then pass each wire end through the cable eye or fork, or through the hole in the swaged terminal and wrap each wire end around the shank for at least four turns, cutting off excess wire. This method is shown in figure 5–3 (D). After safetying, no more than three threads of the turnbuckle threaded terminals should be exposed.

§ 18.30–6 *Bolts, screws, and miscellaneous fasteners (CAA policies which apply to § 18.30)*—(a) *Bolts.* Most bolts used in aircraft structures are either general purpose AN bolts, or NAS (National Aircraft Standard) internal wrenching or close-tolerance bolts. In certain cases aircraft manufacturers make up special bolts for a particular application and it is necessary to use them or their equivalent in replacement.

(1) *Identification.* (i) AN-type aircraft bolts can be identified by the code markings on the bolt heads. The markings generally denote the bolt manufacturer, the material of which the bolt is made, and whether the bolt is a standard AN-type or a special purpose bolt.

(ii) AN standard steel bolts are marked with either a raised dash or asterisk, corrosion-resistant steel is indicated by a single raised dash, and AN aluminum alloy bolts are marked with two raised dashes. The strength and dimensional details of AN bolts are specified on the Army-Navy Aeronautical Standard Drawings.

(iii) Special purpose bolts include the high-strength and low-strength types, close-tolerance types, and bolts inspected by magnetic, fluorescent, or equivalent inspection methods.

(iv) Typical markings include "SPEC" (usually highly heat treated), an aircraft manufacturer's part number stamped on the head, or plain heads (low strength). Close-tolerance National Aircraft Standards (NAS) bolts are marked with either a raised or recessed triangle. The material markings for NAS bolts are the same as for AN bolts, except that they may be either raised or recessed. Bolts inspected magnetically (Magnaflux) or by fluorescent means (Zyglo) are identified by means of colored lacquer or a head marking of a distinctive type. Figure 6–1 shows the typical coding used on aircraft bolt heads.

(2) *Grip length.* In general, bolt grip lengths should equal the material thickness. However, bolts of slightly greater grip length may be used provided washers are placed under the nut or the bolt head. In the case of plate nuts, shims may be added under the plate. For proper washers refer to paragraph (e) of this section.

(3) *Locking or safetying of bolts.* All bolts and/or nuts, except self-locking nuts, should be suitably locked or safetied. Cotter pins and safety wire should not be reused.

(4) *Bolt fit.* Many bolt holes, in particular those in primary connecting elements, should have close tolerances. Generally, it is permissible to use the first lettered drill size larger than the nominal bolt diameter except where the AN hexagon bolts are used in light-drive fit (reamed) applications and where NAS close-tolerance bolts or AN clevis bolts are used. Bolt holes should be normal to the surface involved to provide full bearing surface for the bolt head and nut and should not be oversize or elongated. In case of oversize or elongated holes, in critical members, advice should be obtained from an Aviation Safety agent or engineer, or the aircraft manufacturer before drilling or reaming the hole to take the next larger bolt, as usually items such as edge distance, clearance, etc., must be considered.

(5) *Torques.* (i) Table 6–1 gives the recommended torque values for both the fine and coarse thread series of nuts. These values should be followed unless other instructions require a specific torque for a given nut. Bolts and nuts should be clean, dry, and thoroughly degreased before installation. Threads should not be oiled. Nuts should be torqued in all important places, such as wing-joint bolts, engine-support bolts, landing-gear bolts, and the like.

(ii) When tightening castellated nuts on bolts, the cotter-pin holes may not line up with the slots in the nuts for the range of recommended values listed in table 6–1. Except in cases of highly stressed engine parts, the nut may be over-tightened to permit lining up the next slot with the cotter pin hole.

(6) *Hex-head bolts (AN–3 through AN–20).* The hex-head aircraft bolt is an all-purpose structural bolt used for general applications involving tension or shear loads. Alloy steel bolts smaller than No. 10–32 and aluminum alloy bolts smaller than ¼-inch diameter should not be used in primary structure. Aluminum alloy bolts and nuts should not be used where they will be repeatedly removed for purpose of maintenance and inspection. Aluminum alloy nuts may be used with cadmium-plated steel bolts loaded in shear on land airplanes, but are not to be used on seaplanes due to the possibility of dissimilar metals corrosion.

(7) *Close-tolerance bolts (AN-173 through AN-186) (hex-head), and (NAS-80 through NAS-86) (100° countersunk)*. Close-tolerance bolts are used in high-performance aircraft in applications where the bolted joint is subject to severe load reversals and vibration. The standard AN hex-head bolts may be used for the same applications provided a light-drive fit is accomplished.

(8) *Internal wrenching bolts (MS-20004 through MS-20024 or NAS-495)*. These bolts are suitable for use both in tension and shear applications. In steel parts, either the bolt hole should be countersunk to seat the large radius of the shank at the head or, as in aluminum alloys, a special heat-treated washer (NAS-143C) should be used to fit the head and to provide adequate bearing area. A special heat-treated plain washer (NAS-143) is used under the nut. Special high-strength nuts should be used on these bolts. (Refer to paragraph (d) (3) (vii) of this section.) All internal wrenching bolts should be replaced by another internal wrenching bolt. Standard AN hex-head bolts and washers cannot be substituted for them, as they do not have the required strength.

(9) *Drilled-head bolts (AN-73 through AN-81)*. The AN drilled-head bolt is similar to the standard hex-bolt, but has a deeper head which is drilled to receive wire for safetying. The AN-3 and the AN-73 series of bolts are interchangeable for all practical purposes from the standpoint of tension and shear strengths.

(b) *Screws*. In general, screws differ from bolts by the following characteristics: Usually lower material strength, a looser thread fit (No. 2), head shapes formed to engage a screwdriver, and the shank threaded along its entire length without a clearly defined grip. However, several types of structural screws are available that differ from the standard structural bolts only in the type of head. The material is equivalent and a definite grip is provided. The AN-525 washerhead screws, the AN-509-100° countersunk structural screws, and the NAS-204 through NAS-235 are such parts. The material markings are the same as those used on AN standard bolts.

(1) *Structural screws (NAS-204 through NAS-235) (AN-509 and AN-525)*. This type of screw, when made of alloy steel such as SAE-4130, NE-8630, or equivalent, and heat-treated from 125,000 to 145,000 p. s. i., may be used for structural assembly in shear applications similar to structural bolts.

(2) *Self-tapping screws*. The AN-504 and AN-506 screws are used for attaching minor removable parts such as nameplates and the like. AN-530 and AN-531 are used in blind applications for the temporary attachment of sheet metal for riveting and the permanent assembly of nonstructural assemblies. AN-535 is a plain head self-tapping screw used in the attachment of nameplates or in sealing drain holes in corrosion-proofing tubular structures and is not intended to be removed after installation. Self-tapping screws should never be used to replace standard screws, nuts, bolts, or rivets in the original structure.

(c) *Pins*. The three types of pins used in aircraft structures are: The taper pin, the flathead pin, and the cotter pin. Pins are used in shear applications and for safetying.

(1) Taper pins (AN-385 and AN-386) plain and threaded, are used in joints which carry shear loads and where absence of play is essential. The plain taper pin is drilled and usually safetied with wire. The threaded taper pin is used with a taper-pin washer (AN-975) and shear nut (safetied with cotter pin) or self-locking nut.

(2) The flathead pin (AN-392 through AN-406) commonly called a clevis pin, is usually used in conjunction with tie rod terminals and in secondary controls which are not subject to continuous operation. The pin should be safetied with a cotter pin and is customarily installed with the head up so that if the cotter pin fails or works out, the pin will remain in place.

(3) The AN-380 cotter pin is used for safetying bolts, screws, nuts, other pins, and in various applications where such safetying is necessary. The AN-381 cotter pin is used in locations where nonmagnetic material is required, or in locations where resistance to corrosion is desired.

(d) *Nuts*—(1) *Self-locking nuts*. Self-locking nuts are acceptable for use on certificated aircraft subject to the restrictions on the pertinent "Manufacturers' Recommended Practice Sheets." Self-locking nuts are used on aircraft to provide tight connections which will not shake loose under severe vibration. Two types of self-locking nuts are currently in use, the all-metal type and the fibre or nylon lock type. Self-locking nuts should not be used at joints which subject either the nut or bolt to rotation. They may be used with antifriction bearings and control pulleys provided the inner race of the bearing is clamped to the supporting structure by the nut and bolt. Nuts which are attached to the structure should be attached in a positive manner to eliminate rotation or misalinement when tightening the bolts or screws.

(i) All-metal lock nuts are constructed with either the threads in the locking insert out-of-phase with the load-carrying section or with a saw-cut insert with a pinched-in thread in the locking section. The locking action of the all-metal nut depends upon the resiliency of the metal when the locking section and load-carrying section are engaged by screw threads.

(ii) Fiber or nylon lock nuts are constructed with an unthreaded fiber locking insert held securely in place. The fiber or nylon has a smaller diameter than the nut, and when a bolt or screw is entered, it taps into the insert, producing a locking action. After the nut has been tightened, one full thread of the bolt or screw should extend through the nut. When fiber-type self-locking nuts are reused, care should be exercised that the fiber has not lost its locking friction or become brittle. They should not be reused if they can be run up finger tight. Bolts five-sixteenth-inch diameter and over with cotter-pin holes may be used with self-locking nuts but only if free from burrs around the holes. Bolts with damaged threads and rough ends should never be used. Do not tap the fiber-locking insert.

(iii) (*a*) Self-locking nut bases are made in a number of forms and materials for riveting and welding to aircraft structure or parts.

(*b*) Certain applications require the installation of self-locking nuts in channels, an arrangement which permits the attachment of many nuts with only a few rivets. These channels are track-like bases with regularly spaced nuts which are either removable or nonremovable. The removable type carries a floating nut which can be snapped in or out of the channel thus making possible the ready removal of damaged nuts. Nuts such as the clinch-type and spline-type which depend on friction for their anchorage are not acceptable for use in aircraft structures.

(iv) Self-locking nuts may be used on aircraft engines and accessories when their use is specified by the engine manufacturer in his bulletins or manuals. Refer to § 18.30-14 for detailed installation instructions.

(2) *Aircraft castle nut (AN-310)*. The castle nut is used with drilled-shank AN hex-head bolts, clevis bolts, eye bolts, drilled-head bolts or studs, and is designed to accommodate a cotter pin or lock wire as a means of safetying.

(3) *Miscellaneous aircraft nuts*. (i) The plain nut (AN-315 and AN-335) has limited use on aircraft structures and requires an auxiliary locking device such as a check nut or lock washer.

(ii) Light hex nuts (AN-340 and AN-345) are used in miscellaneous applications and must be locked by an auxiliary device.

(iii) The check nut AN-316 is used as a locking device for plain nuts, screws, threaded rod ends and other devices.

(iv) The castellated shear nut AN-320 is designed for use with clevis bolts and threaded taper pins, which are normally subjected to shearing stress only.

(v) Wing nuts AN-350 are intended for use on hose clamps and battery connections, etc., where the desired tightness is ordinarily obtained by the use of the fingers or hand tools.

(vi) Sheet spring nuts, such as speed nuts, are used with standard and sheet metal self-tapping screws in nonstructural locations. They find various uses in supporting line clamps, conduit clamps, electrical equipment, access doors, and the like, and are available in several types.

(vii) Two commercial types of high-strength internal or external wrenching nuts are available, the internal and external wrenching Elastic Stop Nut and the Unbrako internal and external wrenching nut. Both are of the self-locking type, are heat-treated, and are capable of carrying the high-strength bolt tension load.

(e) *Washers*. The types of washers used in aircraft structure are: Plain washers, lock washers, and special washers.

(1) Plain washers AN-960 and AN-970 are widely used under hex nuts to provide a smooth bearing surface, to act as a shim and to adjust the position of castellated nuts with respect to drilled cotter-pin holes in bolts. Plain washers should be used under lock washers to prevent damage to surfaces. Cadmium-plated steel washers should be used under bolt heads or nuts on aluminum alloy or magnesium structures where corrosion if it occurs will then be between the washer and the steel. The AN-970 steel washer provides a greater bearing area than the plain type and is used in wooden structures under both bolt heads and nuts to prevent local crushing of the surface.

(2) Lock washers AN-935 and AN-936 may be used with machine screws or bolts whenever the self-locking or castellated type of nut is not applicable. They should not be used as fastenings to primary or secondary structures or where subject to frequent removal or corrosive conditions.

(3) Ball-socket and seat-washers AN-950 and AN-955 are used in special applications where the bolt is installed at an angle to the surface, or where perfect alinement with the surface is required at all times. These washers are used together.

(4) Taper-pin washers AN-975 are used with the threaded taper pin.

(5) NAS-143 washers for internal wrenching nuts and bolts are used with NAS internal wrenching bolts. Type "C" is countersunk to seat the bolthead shank radius and a plain-type washer is used under the nut. Both of these washers are heat-treated from 125,000 to 145,000 p. s. i.

(f) *Rivets*—(1) *Standard solid-shank rivets.* (i) The universal-head rivets AN-470 are used in aircraft construction in both interior and exterior locations.

(ii) Roundhead rivets AN-430 and AN-435 are used in the interior of aircraft except where clearance is required for adjacent members.

(iii) Flathead rivets AN-441 and AN-442 are used in the interior of the aircraft where interference of adjacent members does not permit the use of roundhead rivets.

(iv) Brazier-head rivets AN-455 and AN-456 are used on the exterior surfaces of aircraft where flush riveting is not essential.

(v) All protruding-head rivets may be replaced by AN-470 universal-head rivets. This rivet has been adopted as the standard for protruding-head rivets in this country.

(vi) Countersunk-head rivets AN-426 (100°), AN-425 (78°), and AN-420 (90°) are used on the exterior surfaces of aircraft to provide a smooth aero-dynamic surface, and in other applications where a smooth finish is desired. The 100° countersunk-head has been adopted as the standard in this country.

(vii) Material applications:

(*a*) A-17S-T3 is the most commonly used rivet material utilized in aluminum alloy structures. Its main advantage lies in the fact that it may be used in the condition received without any further treatment.

(*b*) The 17S-T3 and 17S-T31 and 24S-T4 rivets are used in aluminum alloy structures where strength higher than that of the A17S-T3 rivet is needed. (See ANC-5 for differences between the 2 types of 17ST rivets specified here.)

(*c*) The 2S rivet of pure aluminum is used for riveting nonstructural parts fabricated from the softer aluminum alloys, such as 2S, 3S, and 52S.

(*d*) When riveting magnesium alloy structures, 56S rivets are used exclusively due to their corrosion-resistant qualities in combination with the magnesium alloys.

(*e*) Mild steel rivets are used primarily in riveting steel parts. Galvanized rivets should not be used on steel parts subjected to high heat.

(*f*) Corrosion-resistant steel rivets are used primarily in riveting corrosion-resistant steel parts, such as firewalls, exhaust stack bracket attachments and similar structures.

(*g*) Monel rivets are used in special cases for riveting high nickel steel alloys and nickel alloys. They may be used interchangeably with stainless steel rivets as they are more easily driven. However, it is preferable to use stainless steel rivets in stainless steel parts.

(*h*) Copper rivets are used for riveting copper alloys, leather, and other nonmetallic materials. This rivet has only limited usage in aircraft.

(2) *Blind rivets.* Blind rivets MS-20600, MS-20601, MS-20602, MS-20603 may be substituted for the normally required solid rivets in accordance with the blind rivet manufacturer's recommendations. They should not be used where the failure of a few rivets will seriously impair the airworthiness of the aircraft. Design allowables for blind rivets are specified in ANC-5 "Strength of Metal Aircraft Elements."

(3) *Hi-shear rivets.* (i) Hi-shear rivets are sometimes used in connections where the shearing loads are the primary design consideration. Their use is restricted to such connections. It should be noted that hi-shear rivet patterns are not to be used for the installation of control surface hinges and hinge brackets. Also, they should not be painted prior to assembly even where dissimilar metals are being joined, but each end should be touched up with zinc chromate primer to allow the later application of the general airplane finish schedule.

(ii) Hi-shear rivets should be replaced only by the same type rivet. The installation and inspection should be in accordance with procedures recommended by the manufacturer.

(g) *Fasteners (cowl and fairing).* A number of patented fasteners are in use on aircraft. A variety of these fasteners are commercially available and the manufacturer's recommendations concerning the proper use of these types of fasteners should always be considered in other than replacement application.

(h) *Unconventional attachments.* Unconventional or new attachment devices should not be used in the primary structure unless approved by a representative of the Civil Aeronautics Administration.

§ 18.30-7 *Corrosion protection, cleaners, and paint removers (CAA policies which apply to § 18.30)*—(a) *Corrosion protection.* Almost all metals used in aircraft are subject to corrosion. Materials such as steel will rust, and aluminum and magnesium will form corrosion products, unless properly protected. Stainless steel, brasses, and copper alloys normally form a surface film which prevents further surface corrosion; however, under certain conditions, particularly when in contact with dissimilar metals, even these alloys must be protected. Corrosion is promoted by contact of metals with materials that absorb water. For example: wood, sponge rubber, felt, etc., may be sources of serious corrosion unless proper protection is used. Specific aspects of the more common types of corrosion are covered in subparagraphs (1) through (5) of this paragraph.

(1) *Dissimilar metals corrosion.* (i) When two dissimilar metals are in contact and are connected by an electrolyte (water), accelerated corrosion of one of the metals may occur. For this reason metals have been divided into certain groups, based on their susceptibility to this form of corrosion. Unprotected contact between metals of different groups may result in dissimilar metals corrosion; therefore, contact between metals of dissimilar groups should be prevented or the contact surface should be adequately protected.

(ii) Similar metal groups (refers to surface of metal).

Group 1—Magnesium alloys.
Group 2—Zinc, cadmium, lead, tin, steel.
Group 3—Copper and its alloys, nickel and its alloys, chromium and stainless steels.
Group 4—All aluminum alloys.

(iii) Aluminum alloys (group 4) may be further subdivided into the following subgroups:

Subgroup A—2S, 3S, 52S, 61S, 220, 355, 356, all clad alloys, such as Alclad and Pureclad.
Subgroup B—14S, 17S, 24S, 75S, 195.

(iv) Under severe corrosive conditions, the above subgroups should be considered as dissimilar metal groups insofar as corrosion protection is concerned. This is particularly true where a relatively large area of an alloy classified in subgroup B is in contact with a relatively small area of subgroup A, in which case severe corrosion of the subgroup A alloy may be expected.

(2) *Intergranular corrosion.* Intergranular corrosion occurs in certain aluminum alloys which are improperly heat-treated. For example, 24S alloys should be quenched quickly after heat-treatment in order to prevent intergranular corrosion. Since 24S alloy contains metals other than aluminum, particularly copper, severe corrosion may result if this alloy is quenched slowly, and a reduction in strength may result in improperly quenched 24S alloys when subjected to corrosive conditions. This type of corrosion is difficult to detect in its original stage except by microscopic examinations. When well advanced it is characterized by scaling and blistering. Surface protection of slowly quenched 24S alloy will retard intergranular corro-

sion, but diffusion of the base metal into the surface coating will eventually destroy its effectiveness. The only protection which is regarded as being sufficiently adequate for air-quenched 24S is cladding of the aluminum alloy with pure aluminum. It should be noted that in some cases even clad alloys may be susceptible to intergranular corrosion. Other surface protection, such as anodizing, and subsequent coatings, such as zinc chromate primer, heavy greases, etc., may also prevent intergranular corrosion in cases where susceptibility of the alloy to intergranular corrosion is not too great.

(3) *Stress corrosion.* This type of corrosion occurs when certain metals, mostly aluminum and magnesium alloys, are exposed to high stress and corrosive conditions. Stress corrosion has occurred in aluminum when steel bushings were pressed into the aluminum parts with too tight a fit, and were exposed to corrosive conditions. Stress corrosion can also occur in cold-worked metals which are not properly stress relieved.

(4) *Chemical.* (i) Corrosion protection against chemicals used in dusting and spraying operations is covered in detail in Civil Aeronautics Manual 8, Aircraft Airworthiness, Restricted Category. Reference should be made to that document for detailed information.

(ii) In general, corrosion protection measures against chemicals involves cleaning and/or surface protection and specific rules can be laid down only for the particular chemicals used. Operators are warned against the use of mercury compounds as their corrosive effects are particularly rapid. Under certain conditions some of the mercury compounds may cause structural failure within an hour.

(5) *Fretting.* Fretting corrosion is a surface phenomenon which may occur when repeated relative motion of small amplitude is allowed to take place between closely fitting components. It is characterized by surface stains, corrosion, pitting and the generation of oxides. Certain aircraft parts have been known to fail by fretting corrosion, as for instance, antifriction bearings, connecting rods, knuckle pins, splined shafts, and clamped or bolted flanges; and close periodic inspections should be made of such parts. Where evidence of fretting corrosion is found, the affected parts should be replaced.

(b) *Corrosion protection measures.* Surfaces which are completely dry cannot corrode. If a metal can be protected from moisture due to rain, condensation, or other causes, corrosion need not be feared. Dirt, surface film, etc., on metal surfaces tend to retain moisture and hence promote corrosion. Water-absorbing materials, such as certain cleaners and calcium chloride, which may occasionally be used as a snow remover on runways are especially dangerous in this regard.

(1) *Anodizing and related processes.* In anodizing, aluminum alloys are placed in an electrolytic bath, causing a thin film of aluminum oxide to form on the surface of the aluminum. This film is resistant to corrosion and affords a good paint base. Other processes which do not provide as good a corrosive protection as anodizing are, however, good paint bases. These processes are:

(i) Alkaline cleaning followed by chromic acid dip.

(ii) Alcoholic phosphoric acid cleaner.

(iii) Alkaline dichromate treatment.

(2) *Plating.* Steels are commonly plated with other metals to prevent corrosion. Plating is accomplished by placing the article in an electrolytic bath and metal from the plating solution is deposited on it. Various metals used in plating vary in the corrosion protection they afford steel. For instance, cadmium and zinc corrode before the steel does, hence slight breaks or cracks through the plating of these metals will not result in rusting of the exposed steel, since the surface metal is corroded and protects the steel. Chromium does not protect steel by this method, as steel will corrode before the chromium does, and thus depends for its protection on the tightness of the plate.

(3) *Parkerizing and bonderizing.* These processes do not appear to be equal in corrosion protection to plating and are not generally acceptable as a substitute for plating; however, both are good paint bases.

(4) *Dichromate treatment for magnesium.* The dichromate treatment consists of boiling magnesium parts in a solution of sodium dichromate, resulting in a coating with little resistance to corrosion but which is a good paint base.

(5) *Chromium pickle treatment for magnesium.* In this process the magnesium parts are placed in a solution of nitric acid and sodium dichromate. This will protect the magnesium during storage and acts as a bond for subsequent organic finishes.

(6) *Galvanic anodizing treatment for magnesium.* This is an electrolytic process used to provide a paint base and corrosion preventive film on magnesium alloys containing manganese.

(7) *Cladding.* Aluminum alloys which are susceptible to corrosion are frequently clad with pure aluminum. Slight pits, scratches, or other defects through the cladding material will not result in corrosion of the core, since the pure aluminum on the edges of the defect will be preferentially corroded, protecting the core.

(8) *Metal spraying.* In this process metallic wire such as aluminum or zinc is fed into a special spray gun. The metal is melted and sprayed on the object to be protected, which must be thoroughly clean to prevent peeling of the sprayed coat. A "metallized" surface has very good resistance to corrosion if properly applied and of sufficient thickness.

(9) *Organic coatings.* Zinc chromate primer, enamels, chlorinated rubber compounds, etc., are organic coatings commonly used on metals to protect them. The finishes should be applied according to the instructions of the manufacturer.

(10) *Dope-proofing.* When doped fabrics are applied over an organic finished metal structure, the dope will have a tendency to loosen the finish on the metal. For this reason, organic coatings on the metal are usually covered with a dope-proof paint, with metal foil, or with cellulose tape to prevent the dope from striking through.

(11) *Tube interiors.* The interiors of structural steel and aluminum tubing should be protected against corrosion. A small amount of water entrapped in a tube can corrode entirely through the tube thickness in a short period of time. For this reason, most structural tubing is flushed with hot linseed oil, paralketone, or other corrosion inhibitor. Hot flushing results in a good coating. The flushing liquid is usually introduced through small holes drilled in the tubing. These holes should be plugged with a screw or by other means to prevent entry of moisture. Air and watertight sealing of the tubing will also give adequate protection against corrosion if the tubing is internally dry before being sealed.

(c) *Corrosion-proofing of landplanes and seaplanes.* In the repair or alteration of aircraft, corrosion-proofing the same or equivalent to that originally applied should be used unless the repair or alteration would result in increased susceptibility to corrosion, in which case additional corrosion protection measures should be employed.

(d) *Corrosion-proofing of landplanes converted to seaplanes.* A special problem is encountered in the conversion of landplanes to seaplanes. In general, landplanes do not receive corrosion proofing to the same extent as do seaplanes manufactured as such. Corrosion-proofing standards for landplanes converted to seaplanes are divided into two classes: necessary minimum precautions and recommended precautions.

(1) *Necessary minimum precautions.* The following procedures are considered the minimum which should be performed in order to safeguard the airworthiness of the converted aircraft and are not in themselves intended to maintain airworthiness for an indefinite period.

(i) Unless already protected, exposed fittings or fittings which can be reached through inspection openings should be covered with two coats of zinc chromate primer, paralketone, non-water-soluble heavy grease, or comparable materials. This applies to items such as wing-root fittings, wing-strut fittings, control-surface hinges, horns, mating edges of fittings and attach bolts, etc.

(ii) Nonstainless control cables should be coated with grease or paralketone or other comparable protective coating, if not replaced with corrosion-resistant cables.

(iii) Inspection should be made of all accessible sections of the aircraft structure. Structural parts showing corrosion should be cleaned and refinished if corrosion attack is superficial. If a part is severely corroded, it should be replaced with adequately corrosion-proofed parts.

(2) *Recommended precautions.* The recommended precautions are those which are suggested as a means of maintaining such aircraft in condition for safe operation over extended periods of time.

(i) Provision of additional inspection openings should be made to assist in detecting corrosion. Experience has shown openings to allow inspection of lower and rearward portion of the fuselage to be particularly desirable.

(ii) Additional provision for free drainage and ventilation of all interiors should be made to prevent collection of moisture (scoop-type drain grommets).

(iii) Protection for the interiors of structural steel tubing should be provided. This may be done by air-and-watertight sealing or by flushing with hot linseed oil and plugging openings. Tubing should be inspected for missing sealing screws and the presence of entrapped water. Inspection should also be made for local corrosion around sealing screws, welded clusters and bolted fittings, which may be indicative of entrapped moisture.

(iv) The fabric of fabric-covered aircraft should be slit longitudinally on the bottom of the fuselage and tail structure for access to these sections. The lower structural members should be coated with zinc chromate primer (two coats), followed by dope-proof paint or wrapping with cellophane tape and rejoining the fabric. This precaution is advisable within a few months after start of operation as a seaplane.

(v) Interiors of metal-covered wings and fuselages should be sprayed with an adherent corrosion inhibitor.

(vi) Bags of potassium or sodium dichromate should be placed in the bottom of floats and boat hulls to inhibit corrosion.

(vii) Exterior surfaces of seaplanes should be washed with clear fresh water immediately following extended water operation, or at least once a day when operated in salty or brackish water. Interior surfaces of seaplanes exposed to spray should also be washed, taking care to prevent damage to electrical circuits or other items subject to injury.

(viii) Openings into the wings, fuselage, and control-surface members, such as tail-wheel wells, openings for control cables, etc., should be sealed as completely as possible to prevent entry of water.

(e) *Cleaners, polishes, brighteners, and paint removers.* It is important that aircraft be kept thoroughly clean of deposits of contaminating substances such as oil, grease, dirt, and other foreign materials. The presence of such substances in any appreciable amount constitutes a potential hazard.

(1) *Materials.* To avoid damage to aircraft through the use of harmful cleaning, polishing, brightening, or paint-removing materials, only those compounds which conform to existing government or established industry specifications or which are products that have been specifically recommended by the aircraft manufacturer as being satisfactory for the intended application, should be used. The product manufacturer's recommendations concerning use of his agent should be observed.

(2) *Removal of corrosion deposits from aluminum.* After removing the paint and primers from the surfaces of both bare and clad aluminum alloys, the corroded area should be washed with clean fresh water. Corrosion products such as metal flakes, scale, powder and salt deposits may be removed by using fine emery, wire brush or sandpaper. The loose particles may subsequently be washed off with thinner or mineral spirits. In all cases the minimum treatment to produce a smooth clean surface should be used.

(3) *Surface stains.* To remove surface stain and superficial etching of light metals, use a 5-percent-by-weight water solution of sodium bichromate or potassium dichromate. This solution should be allowed to dry on the surface after which excess chromate crystals must be brushed off and the surface subsequently primed and painted.

(4) *Light duty cleaners.* Removal of dirt and grease from the surfaces of external parts of the aircraft may be accomplished by ordinary washing with water. Let the surface dry before further attempting to clean obstinate spots.

One part aircraft cleaning compound, AAF Specification No. 20015 or Navy Specification No. C-147, with 20 parts water may be used on any aircraft, but it is most effective on fabric covered aircraft where the mixture is applied with a rag or mop, then wiped off with a dry rag. The water mixture may be sprayed on, allowed to remain for 5 to 10 minutes, and then hosed down with water.

(5) *Removal of spilled battery acid.* For the neutralization of spilled battery acid, use sodium bicarbonate (baking soda), or sodium borate (borax) dissolved in water. The alkali salt should be removed completely after neutralization with copious quantities of water to prevent corrosion.

§ 18.30-8 *Identification and inspection of material (CAA policies which apply to § 18.30)*—(a) *Identification of steel stock.* (1) The Society of Automotive Engineers (SAE) and the American Iron and Steel Institute (A. I. S. I.) use a numerical index system to identify the composition of various steels. The numbers assigned, in the combined listing of standard steels issued by these groups, represent the type of steel and make it possible to readily identify the principal elements in the material.

(2) The first digit of the four number designation indicates the type to which the steel belongs. Thus "1" indicates a carbon steel, "2" a nickel steel, "3" a nickel chromium steel, etc. In the case of simple alloy steels, the second digit indicates the approximate percentage of the predominant alloying element. The last two digits usually indicate the mean of the range of carbon content. Thus the symbol "1020" indicates a plain carbon steel lacking a principal alloying element and containing an average of 0.20 percent (0.18 to 0.23) carbon. The symbol "2330" indicates a nickel steel of approximately 3 percent (3.25 to 3.75) nickel and an average of 0.30 percent, (0.28 to 0.33) carbon content. The symbol "4130" indicates a chromium-molybdenum steel of approximately 1 percent (0.80 to 1.10) chromium, 0.20 percent (0.15 to 0.25) molybdenum, and 0.30 percent (0.28 to 0.33) carbon. The basic numbers for the four digit series of the carbon and alloy steels may be found in table 8-1.

(3) Interchangeability of steel tubing: (i) "1025" welded tubing as per Specification MIL-T-5066, and "1025" seamless tubing conforming to Specification MIL-T-5066A, are interchangeable.

(ii) "4130" welded tubing as per Specification MIL-T-6731, and "4130" seamless tubing conforming to Specification MIL-T-6736, are interchangeable.

(iii) NE-8630 welded tubing conforming to Specification MIL-T-6734, and NE-8630 seamless tubing conforming to Specification MIL-T-6732, are interchangeable.

(b) *Identification of aluminum.* To provide a visual means for identifying the various grades of aluminum and aluminum alloys such metals are usually marked with symbols such as Government Specification Number, the temper or condition furnished, or the commercial code marking. Plate and sheet are usually marked with specification numbers or code markings in rows approximately 5 inches apart. Tubes, bars, rods, and extruded shapes are marked with specification numbers or code markings at intervals of 3 to 5 feet along the length of each piece. The commercial code marking consists of a number which identifies the particular composition of the alloy. A letter preceding the number indicates a modification of the alloy. In addition letter suffixes designate the following:

S—Wrought.
O—Annealed, recrystallized (wrought products only).
H—Strain-hardened. Fractions preceding the letter indicate intermediate tempers as 1/2H, 3/4H, etc.
W—Solution heat-treated—unstable temper.
T—Heat-treated and aged to produce stable tempers other than O or H.
RT—Temper resulting from cold working after heat treatment and aging.

(1) *Clad aluminum alloys.*—Clad alloys have surface layers of pure aluminum or corrosion-resistant aluminum alloy bonded to the core material to inhibit corrosion. Presence of such a coating may be determined under a magnifying glass by examination of the edge surface which will show three distinct layers.

(2) *A test for distinguishing heat-treatable and nonheat-treatable aluminum alloys.* If for any reason the identification mark of the alloy is not on the material, it is possible to distinguish between some heat-treatable alloys and some nonheat-treatable alloys by immersing a sample of the material in a 10-percent solution of caustic soda (sodium hydroxide). Those heat-treatable alloys containing several percent of copper (14S, 17S, 24S) will turn black due to the copper content. High copper alloys when clad will not turn black on the surface, but the edges will turn black at the center of the sheet where the core is exposed. If the alloy does not turn black in the caustic soda solution it is not evidence that the alloy is not heat-treatable, as various high strength heat-treatable alloys are not based primarily on the use of copper as an alloying agent. These include among others, 53S, 61S, 75S, R353, and R361 alloys. The composition and heat-treatability of alloys which do not turn black in a caustic

soda solution can be established only by chemical or spectro-analysis.

(c) *Hardness testing.* Hardness testing provides a convenient means for determining within reasonable limits the tensile strength of steel. It has several limitations in that it is not suitable for very soft or very hard steels. In hardness testing the thickness of the specimen being tested and the edge distance should be such that distortion of the metal due to these factors is eliminated. Several readings should be taken and the results averaged. In general, the higher the tensile strength, the greater is its hardness. Common methods of hardness testing are outlined below. These tests are suitable for determining the tensile properties resulting from the heat treatment of steel. Care should be taken to have case hardened, corroded, pitted, decarburized or otherwise nonuniform surfaces removed to a sufficient depth. Also exercise caution not to cold-work and consequently harden the steel during removal of the surface. The relationship between tensile strength and hardness is indicated in table 8–2.

(1) *Brinnell hardness test.* In this test a standard load is applied to a smooth surface of metal through a hardened steel ball 1 centimeter in diameter. The numerical value of Brinnell hardness is equal to the load divided by the surface area of the resulting spherical impression.

(2) *Rockwell hardness test.* In this test a standard minor load is applied to seat a hardened steel ball or a diamond cone in the surface of the metal, followed by the application of a standard major load. The hardness is measured by depth of penetration. Rockwell superficial hardness tests are made using light minor and major loads and a more sensitive system for measuring depth of indentation. It is useful for thinner sections, very small parts, etc.

(3) *Vickers hardness test.* In this test a small pyramidal diamond is pressed into the metal. The hardness number is the ratio of the load to the surface area of indentation.

(4) *Testing of aluminum.* Hardness tests are useful for testing aluminum alloy chiefly as a means of distinguishing between annealed, cold-worked, heat-treated, and heat-treated and aged material. It is of little value in indicating the strength or quality of heat treatment. Typical hardness values for aluminum alloys are shown in table 8–3.

(d) *Inspection of metals*—(1) *Inspection by magnifying glass after welding.* Careful examination of all joints with a medium-power magnifying glass (at least 10 power) after first removing all scale is considered an acceptable method of inspection for repaired structures. The practice of filling steel tubular structures with hot linseed or petroleum base oils, under pressure, in order to coat the inside surface and inhibit corrosion, assists in the detection of weld cracks as the hot oil will seep through cracks invisible to the eye. This practice, though not justifiable in all cases, is suggested where a very large portion of the structure has been rewelded.

(2) *Magnetic particle inspection.* Magnetic particle inspection or Magnaflux (a patented trade name used by the Magnaflux Corp.) can be used only on magnetic materials; i. e., iron and steel. Most stainless or high chromium nickel and manganese alloy steels, being nonmagnetic, cannot be inspected by this method. The method consists essentially of detection of discontinuities (cracks, voids, defects, pits, subsurface holes, etc.) by means of accumulation of magnetic particles on the discontinuities when the part has been magnetized. The magnetic particles are applied either dry as a powder or suspended in light oil. For complete magnetic inspection, both circular and longitudinal magnetization should be employed.

(i) Circular magnetization is produced by transmitting an electric current directly through the article being tested, or through a central conductor placed through the part, in which case defects parallel to the flow of current may be detected. As an example, circular magnetization of a round steel bar would be produced by placing the ends of the steel bar between the heads of the magnetic inspection machine and passing a current through the bars. Magnetic particles, applied either during or after the passage of the current or after the current in magnetically retentive steels would disclose discontinuities parallel to the axis of the bar.

(ii) Longitudinal magnetization is induced in a part by placing the part in a strong magnetic field, such as the center of a coil. Thus longitudinal magnetization of a round steel bar would be produced by placing the ends of the bar between the heads of a magnetic-inspection machine and placing the DC solenoid around the bar. After application of the magnetic particles either during or subsequent to magnetization, discontinuities perpendicular to the axis of the bar would be disclosed.

(iii) Red, black, and sometimes gray particles are used in the wet or dry methods. In the case of wet inspection, a fluorescent magnetic particle may also be used. This process is commercially known as Magnaglo. Articles inspected using this latter medium are illuminated by so-called black light, and the magnetic particles glow by fluorescence causing any defects or indications to be easily visible. The wet inspection procedure provides better control and standardization of the concentration of magnetic particles, easier application to complex shapes, and indications that are easier to interpret. This is due to the difficulty of obtaining efficient distribution of the dry powder during magnetization. The dry procedure is particularly suitable for detecting subsurface defects, such as when heavy welds, forgings, castings, etc., should be tested. The wet continuous process is recommended for most aircraft work.

(iv) The appearance of accumulations of magnetic particles in magnetic inspection does not necessarily mean that a defect exists. Changes in section of the part, particularly where the change in section is very sharp, and also holes drilled through a part, will frequently cause indications. Surface defects are most easily detected, however, since a crack will cause a sharp line of magnetic particles to appear. Subsurface defects are less easily detected, since only a general collection of magnetic particles will be observed. However, since subsurface defects very rarely occur in wrought materials, that is not important in most aircraft applications.

(v) After magnetic inspections, parts should be carefully cleaned and demagnetized.

(3) *Portable magnetic particle inspection.* Portable type magnetic particle inspection equipment such as Sonoflux have been developed for use in the detection of surface or slightly subsurface discontinuities in ferromagnetic aircraft materials and parts. This type equipment gives better results when the wet suspension type of indicator, such as that conforming to Specification MIL–I–6868, is used with the powder supplied by the equipment manufacturer. As in other inspection methods, extreme care should be taken by the user in following the manufacturer's recommendations concerning use of the procedure.

(4) *X-ray or radiographic inspection.* (i) X-ray may be used on either magnetic or nonmagnetic materials for detecting subsurface voids such as open cracks, blow holes, etc. When a photographic film or plate is used to record the X-ray (in a similar manner to exposing a photographic film), the process is known as radiography. When the X-rays are projected through the part onto a fluorescent screen, the process is known as fluoroscopy. The technique used for radiography should be capable of indicating the presence of defects having a dimension parallel to the X-ray beam of 3 percent of the thickness of the part being radiographed for magnesium alloys and 2 percent for all other metals and alloys. Inspection using a fluoroscopic screen is much less sensitive. Consequently, the radiographic method is usually used for inspection and the fluoroscopic method is used for culling.

(ii) Radiographic inspection is extensively used in the aircraft industry for the inspection of all types of casting including sand castings, permanent-mold castings, die castings, etc. X-ray is particularly useful for this application, since it is capable of disclosing defects which exist below the surface and also since the open types of defects which occur in castings (shrinks, blow holes, dross inclusions, etc.) are readily disclosed by X-rays. In the inspection of forged or wrought metals, on the other hand, X-ray inspection is not used so extensively. This is due to the fact that the process of forging or working causes most defects which originally existed in the metal to become tightwalled cracks which are somewhat difficult to disclose by X-rays.

(iii) If doubt exists as to the suitability of the X-ray examination, a laboratory familiar with the X-ray examination of aircraft parts should be consulted.

(5) *Fluorescent penetrant.* (i) In this method of inspection (Zyglo), the article, which may be of metal, plastic material, etc., is first carefully cleaned to permit the fluorescent material to penetrate cracks and defects. It should be noted that cleaning of aluminum may necessi-

tate stripping of any anodizing, since the anodized film, if formed after the defect, could prevent penetration of the fluorescent material and an anodized film tends to hold penetrants which may obscure defect indications. After the article is cleaned, it is either sprayed, painted, or immersed in a bath of fluorescent penetrant. The penetrant is a light oil which has the property of fluorescing or emitting visible light when excited by invisible radiation in the near ultra-violet range (so-called black light). It is important that the penetrant be given sufficient time to penetrate cracks and defects, and for fatigue cracks a minimum of 30 minutes is stipulated by MIL-I-6866. Heat may also be applied to facilitate entry of the penetrant. After the penetrant has had sufficient time to enter any defects, the excess on the surface of the article is washed off by water spray. This washing should be checked by inspection with black light, by which means any penetrant left on the surface may be detected. After washing, a developer is used to bring out the indication. This developer may be in a liquid form or may be a light powder that absorbs the penetrant as it oozes from cracks and defects in the part. The development may also be aided by application of heat to the part. After the indications have been developed, the part is inspected under black light. Any crevices into which the fluorescent material has penetrated will show as luminous areas.

(ii) Indications which appear are usually checked by close inspection with a magnifying glass, by etching with a suitable acid or caustic solution, or it may be necessary to cross-section that part, a procedure which, of course, destroys its usefulness. Usually a skilled operator can determine whether an indication actually shows a defect or whether it is a false indication. Also, the internal extent of the defect can sometimes be estimated with fair accuracy.

(iii) It should be noted that this process of inspection, like all others, has its limitations. If the fluorescent material for any reason is not able to penetrate into a defect, such a defect cannot be detected.

(6) *Dye penetrants.* Several dye penetrant type inspection kits are now available which will reveal the presence of surface cracks or defects and subsurface flaws which extend to the surface of the part being inspected. These penetrant type inspection methods are considered acceptable, providing the part being inspected is thoroughly cleaned, all areas are readily accessible for viewing, and the manufacturer's recommendations as to method of application are closely followed.

(i) *Cleaning.* An inspection is initiated by first cleaning the surface to be inspected of dirt, loose scale, oil, and grease. Pre-cleaning may usually be accomplished by vapor degreasing, or with volatile cleaners. The cleaner should be volatile so that it will evaporate from the defects before applying the penetrant dye. Sand blasting is not desirable as a cleaning method since surface indications may be obscured. It is not necessary to remove anodic films from parts to be inspected since the dye readily penetrates such films. Special procedures for removing excess dye should be followed, however.

(ii) *Application of penetrant.* The penetrant is applied by brush, spray, or by dipping and allowed to stand for a minimum of 2 minutes. Dwell time may be extended up to 15 minutes depending upon the temperature of the part and fineness of the defect or when the surface being inspected is ground. Parts being inspected should be dry and heated to at least 70° F., but not over 130° F. Very small indications require increased penetration periods.

(iii) *Removal of dye penetrant.* Surplus penetrant is usually removed by application of a special cleaner or remover, or by washing with plain water and the part is then allowed to dry. Water rinse may also be used in conjunction with the remover, subject to the manufacturer's recommendations.

(iv) *Application of developer.* A light and even coat of developer is applied by spraying, brushing or dipping. When dipping, care should be exercised to avoid excess accumulation. Penetrant which has penetrated into cracks or other openings in the surface of the material will be drawn out by the developer resulting in a bright red indication. Some idea of the size of the defect may be obtained after experience by watching the size and rate of growth of the indication.

(e) *Identification of fabric.* Cotton fabric is used extensively as covering for wing, fuselage, and control surfaces of aircraft. Acceptable grades of fabrics for use on civil aircraft may be found in table 3-1 of § 18.30-3. In general, the fabric can be readily identified by a continuous marking to show the manufacturer's name or trademark and specification number. This marking may be found stamped along the selvage. The specification number for grade "A" fabric is AMS-3806, and for the intermediate grade AMS-3804. The corresponding CAA Technical Standard Order Numbers for these materials are TSO-C-15 and TSO-C-14, respectively. Increasing interest in the use of linen and certain synthetic fabrics in lieu of cotton has been noted. Identity of such materials should always be verified by the user. (See table 3-1.)

(f) *Identification of plastics.* Plastics cover a broad field of organic synthetic resins and may be divided into two main classifications—thermoplastic and thermosetting plastics.

(1) *Thermoplastics.* Thermoplastics may be softened by heat and can be dissolved in various organic solvents. Two kinds of transparent thermoplastic materials are commonly employed in windows, canopies, etc. These materials are known as acrylic plastics and cellulose acetate plastics. These two plastics may be distinguished by the absence of color, the greater transparency, and the greater stiffness of the acrylic, as compared to the slight yellow tint, lower transparency, and greater flexibility of cellulose acetate.

(2) *Thermosetting plastics.* Thermosetting plastics do not soften appreciably under heat but may char and blister at temperatures of 204° to 260° C. (400° to 500° F.). Most of the molded products of synthetic resin composition, such as phenolic, urea-formaldehyde and melamine-formaldehyde resins, belong to the thermosetting group.

§ 18.30-9 *Aircraft equipment* (CAA *policies which apply to § 18.30*)—(a) *General.* Aircraft equipment is usually considered as a part of the airplane and many of the maintenance and repair procedures pertinent to the airplane are equally applicable to the various major items of equipment. However, the following general information should be helpful in maintaining the essential equipment items in an airworthy condition.

(b) *Landing gear equipment*—(1) *Wheels.* Wheels should be inspected at periodic intervals for cracks, corrosion, dents, distortion, and faulty bearings. In split-type wheels, bolt holes which may have become elongated due to some play in the through-bolt should be reconditioned by the use of Rosan inserts or other suitable means. The bolts should also be inspected for wear; if excessive wear is evident, the bolts should be replaced. In bolting the wheel halves together, care should be taken to have the nuts properly tightened. These should be inspected periodically to be sure that they are tight so that there will be no movement between the two halves of the wheel. This movement causes elongation of the bolt holes. If the wear is too great to be corrected as stated above, it may necessitate scrapping of the wheel. Grease-retaining felts in the wheel assembly should be kept in a soft, absorbent condition. If they have become hardened they should be cleaned in gasoline; if this fails to soften them, they should be replaced.

(i) *Corrosion of wheels.* Wheels should be thoroughly cleaned if corroded and then examined for soundness. If bare, corroded spots appear, they should be smoothed up and repainted with a protective coating such as zinc chromate primer and aluminum lacquer or some other equally effective coating to prevent further corrosion. Wheels with severe corrosion which might affect their strength should be replaced.

(ii) *Dented or distorted wheels.* Wheels which wobble excessively due to deformation resulting from a severe side load impact should be replaced. In questionable cases, the local representative of the Civil Aeronautics Administration should be consulted concerning the airworthiness of the wheels. Dents of a minor nature do not affect the serviceability of a wheel.

(iii) *Wheel bearings.* Wheel bearings should be inspected periodically to detect damage caused by maladjustment or foreign material. Damaged or excessively worn parts should be replaced. Bearing cones should be packed with a high melting point grease prior to their installation. When assembling the wheel to the airplane, the axle nut should be tightened just enough to eliminate any drag or wheel side play on the axle.

(2) *Brakes.* The clearance between moving and stationary parts of a brake should be maintained in accordance with

the manufacturer's recommendations. The brake should be disassembled and inspected periodically and the parts examined for wear, cracks, warpage, corrosion, elongated holes, etc. If any of these or other faults are indicated the affected parts should be repaired, reconditioned, or replaced, depending on the seriousness of the difficulty, in accordance with the manufacturer's recommendations. Surface cracks on the friction surfaces of brake drums occur frequently due to high surface temperature. These may be disregarded as seriously affecting the airworthiness until they become cracks of approximately one inch in length. The brake drums or surfaces then should be replaced.

(i) *Hydraulic brakes.* For proper maintenance, the entire hydraulic system from the reservoir to the brakes should be inspected. The fluid in the reservoir should be maintained at the recommended level with the proper brake fluid. Flexible hydraulic hose which has deteriorated due to long periods of service should be replaced. When air is present in the hydraulic system, the system should be bled in accordance with the manufacturer's instructions. Hydraulic piston seal gaskets should be replaced when there is evidence of leakage.

(ii) *Mechanical brakes.* The working parts of mechanically operated brakes should be kept free of dirt and foreign matter and should work freely at all times. Excessive play in the linkage system should be kept to a minimum.

(3) *Tires*—(i) *Inspection.* For maximum safety, it is essential that tires be inspected frequently for cuts, worn spots, bulges on the sidewalls, and foreign bodies imbedded in the treads and any repairs which are necessary should be made.

(ii) *Repair.* It is recommended that repairs be made by either the original tire manufacturer or reliable local tire repair agencies in accordance with procedures outlined in military specification MIL–C–7726 pertaining to repair and recapping of used pneumatic aircraft tires. The specification states that tires should not be repaired if any of the following conditions are found during inspection:

(*a*) Flex breaks or evidence thereof.

(*b*) Bead injuries which extend into more than 3 plies of a tire having 16 or more plies or into 25 percent of the plies on all other tires.

(*c*) Evidence of separation between plies or around bead wire.

(*d*) Injuries requiring inside reinforcement. This includes all casings needing section repairs.

(*e*) Kinked or broken beads.

(iii) *Clearance.* For retractable landing gears there should be ample clearance between the tires and the landing gear wells or adjacent structure, otherwise jamming of the retracted landing gear may result. This clearance and the clearance between the tire and fork or other landing gear members should be checked carefully when tires are retreaded because the growth of the original tire and the use of a heavier tread stock may increase the tire diameter and cross section.

(iv) *Treading*—(*a*) In treading tires, three basic methods of applying new tread stock to a tire are in use which are known as top capping, full capping, and retreading. In top capping, the tread is buffed across the top of the tire and new tread material known as capping stock is applied. The capping stock has an abrupt bevel and when cured onto the remaining tread material of the tire, the line of contact between the old and new rubber may show, enabling a top cap job to be readily detected in such cases. In the full capping process, the buffing is usually carried down on the shoulders to the sidewall ring to receive the new tread material known as camelback. This material is similar to capping stock except that it is wider and the abrupt bevel is replaced by longer, tapering sides. Since the camelback replaces the old tread from one sidewall ring around to the other, the tire has more of a new tire appearance particularly if the sidewalls to the bead are unbroken or unmarred. In retreading (sometimes called remolding), old rubber is rasped from bead to bead and replaced unit new camelback and sidewall material which results in a new tire appearance. These three methods are in accord with Military Specification MIL–C–7726 which is used by many treading agencies having a reputation for reliable, high-grade work. A recent development is the flex-to-flex retread which can be classified as being in between the full cap and retread process. In this method, a very wide camelback is used and new sidewall material is then applied which reconditions or covers the flex area. This new sidewall material does not extend down to the bead as it does in the full retread method.

(*b*) Because of the fact that poorly treaded tires may throw the tread material off in service thereby causing an accident or damaging the aircraft, treading work should be given only to agencies having the equipment, knowledge, and ability to tread aircraft tires satisfactorily.

(*c*) The number of times a tire may be treaded can be determined only by a thorough inspection which would disclose any sidewall bruises, ply separation, broken bead wire, or other defects that indicate the carcass is not sound enough to justify an additional tread. When a carcass has been recapped or retreaded 3 times its airworthiness may be questioned although there have been tires which gave satisfactory performance with more than 3 such treads. The carcass construction, use of rayon or nylon cord, the carcass age and condition, the type of operation involved, etc. should be evaluated collectively before a decision is made as to whether or not a tire should be treated again.

(4) *Tubes.* Punctured tubes may be repaired by the use of cemented or vulcanized patches. The procedure of making such repairs is substantially identical to that used in connection with automobile tires. The size of the patch should be kept to a minimum and the use of an excessive number of patches, particularly in one area, should be avoided as the weight of the material may contribute to excessive wheel vibration due to tube unbalance. The use of vulcanized patches is recommended because they are considerably more reliable. For such work a reputable local tire repair agency should be engaged. Reinstalled tires should be inflated, deflated, and again inflated to insure that the inner tube is not pinched. A pinched tube will chafe against the walls of the carcass and a thin spot will result in the rubber. In time, the tube wall will leak at this point. The pinching generally is due to the sticking of the tube to the carcass wall during the first inflation and the failure of the carcass to push out to properly seat against the flange. The tube is then confined to a smaller space and wrinkling (pinching) of the tube results. Complete deflation followed by inflation allows the tube to properly accommodate itself to the carcass which should now seat itself tightly against the flanges.

(5) *Floats.* In order to maintain floats in an airworthy condition, frequent inspection should be made on account of the rapidity with which corrosion takes place on aluminum alloy metal parts, particularly when the aircraft is operated in salt water. Metal floats and all metal parts on wooden floats should be carefully examined for corrosion and corrective action taken in accordance with the procedures described in § 18.30–7. Damage to metal floats should be repaired in the general manner as outlined in § 18.30–4 (e) pertaining to aluminum and aluminum alloy structures. In the case of wooden floats, repairs should be made in accordance with the general procedure outlined in § 18.30–2.

(6) *Skis and ski installations.* It is advisable to examine ski installations frequently to keep them maintained in airworthy condition. If shock cord is used to keep the ski runner in proper trim, an examination should be made to see that the cord has enough elasticity to keep the runner in its required attitude and the condition of the cord should be checked to see that it is not becoming loose or badly frayed. If old, weak shock cords are found, they should be replaced. When other means of restraint are provided, they should be examined for excessive wear and binding and replacements should be made when such conditions are found. The points of cable attachment, both on the ski, and the airplane structure, should be examined for bent lugs due to excessive loads having been imposed while taxiing over rugged terrain or by trying to break frozen skis loose. If skis which permit attachment to the wheels and tires are used, proper tire pressure should be maintained; under-inflated tires may push off the wheels if appreciable side loads are developed in landing or taxiing.

(i) *Repair of ski runners.* Fractured wooden ski runners usually require replacement. If a split at the rear end of the runner does not exceed 10 percent of the ski length, it may be repaired by attaching one or more wooden cross pieces across the top of the runner using glue and bolts. Bent or torn metal runners may be straightened if minor bending has taken place and minor tears may be repaired in accordance with procedures recommended in § 18.30-4 relative to repairs of metal structures.

(ii) *Ski pedestals*—(*a*) *Tubular pedestals.* Damaged pedestals made of steel tubing may be repaired by using standard tube splices as shown in figures 4-2 and 4-12.

(*b*) *Cast pedestals.* Cast pedestals should not be repaired but should be replaced unless the method of repair is specifically approved by a representative of the Civil Aeronautics Administration.

(*c*) *Sheet metal pedestals.* Damaged pedestals made of aluminum alloy sheet should be repaired in the general manner as outlined in § 18.30-4 (e).

(c) *Flares.* Parachute flares are made of materials which are subject to decomposition upon aging. Humidity affects the small igniting charge and also the materials of the candle (illuminant). Hence, the percentage of misfires in old flares is likely to be quite high. To assure unfailing performance of flares, periodic inspection of the flare installation should be made. The inspection should include the entire system starting at the release mechanism in the cockpit and ending at the flare. Such inspection should be attempted only by qualified personnel since inadvertent discharge of such pyrotechnics may cause serious damage. Past experience has indicated that all electrically or pistol-operated flares should be returned to the manufacturer for reconditioning within a maximum period of 3 years and that for mechanically operated flares, this should be done within a maximum period of 4 years.

(d) *Life preservers and life rafts*—(1) *General.* Inflatable life preservers and life rafts are subject to general deterioration due to aging. Experience has indicated that such equipment may be in need of replacement at the end of 5 years due to porosity of the rubber-coated material. Wear of such equipment is accelerated when stowed on board aircraft because of vibration which causes chafing of the rubberized fabric. This ultimately results in localized leakage. Leakage is also likely to occur where the fabric is folded because sharp corners are formed. When these corners are in contact with the carrying cases, or with adjacent parts of the rubberized fabric, they tend to wear through due to vibration.

(2) *Inspection procedure for life preservers.* (i) At 3-month intervals, all life preservers should be inspected for airworthiness. The rubberized material should be examined for cuts, tears, and abrasions and the mouth valves and tubing should be checked for leakage, corrosion, and deterioration. The carbon dioxide cylinder should be removed and the discharge mechanism checked by operating the lever to ascertain that the pin operates freely. The gaskets and valve cores of the cylinder container and the pull cord should be checked for deterioration. If no defects are found, the preserver should be inflated by air to a 2-pound pressure and left for 12 hours. If the preserver still has adequate rigidity at the end of that time, it should be deflated and fitted with $CO_2$ cylinders having weights not less than that indicated on them by the manufacturer. All cylinders made in accordance with joint Army-Navy Specification No. JAN-C-601 are so stamped and have a minimum permissible weight stamped on them. The use of such $CO_2$ cylinders is recommended. These cylinders have the five-thirty-second-inch end disc sealed by an electric welding process which is intended to provide a superior seal compared to the older type which makes use of a similar disc surrounded by a thin rubber seal. Inasmuch as the rubber is subject to deterioration, its ability to maintain pressure will likely be affected. Leaky electrically welded seals are very likely to be discovered upon final inspection at the manufacturer's plant. If such a cylinder is up to weight at the end of 3 months, in all probability it will remain so until used whereas the old type with the rubber seal is apt to lose its pressure with age. Having fitted the preserver with an adequately charged cylinder, the preserver should be stamped with the date of inspection as a matter of record and packed into its container.

(ii) It is recommended that the above procedure be repeated every 12-month period, using the $CO_2$ cartridge for inflation. The carbon dioxide permeates the rubberized fabric at a faster rate than air and will indicate if the porosity of the material is excessive.

(3) *Repair of life preservers.* Leaks, as disclosed by immersion in soapy water, should be repaired by the use of patches in accordance with the recommendations of the manufacturer. Corroded metal parts should be cleaned and missing or weakened ties replaced by machine stitching in place as originally done by the manufacturer. Weakened lanyards should also be replaced. Life preservers which do not retain sufficient rigidity after the 12-hour period because of general deterioration and porosity of the fabric are beyond economical repair and should be replaced.

(4) *Inspection procedure for life rafts.* (i) Life rafts should be inspected at 3-month intervals for cuts, tears, or other damage to the rubberized material. If the raft is found to be in good condition, the $CO_2$ bottle(s) should be removed and the raft inflated with air to a pressure of 2 pounds. The air should be introduced at the fitting normally connected to the $CO_2$ bottle(s). After at least 1 hour to allow for the air within the raft to adjust itself to the ambient temperature, the pressure should be checked and adjusted, if necessary, to 2 pounds after which the raft should be left to stand for 24 hours. If, after 24 hours, the pressure is less than 1 pound, the raft should be examined for leakage by using soapy water. In order to eliminate pressure variations due to temperature differences at the time the initial and final readings are taken, the raft should be tested in a room where the temperature is fairly constant. If the pressure drop is satisfactory, the raft should be considered as being in an airworthy condition and returned to service after being fitted with correctly charged $CO_2$ bottles as determined by weighing them. It is suggested that the rafts be marked to indicate the date of inspection and that soapstone be used when folding them preparatory to insertion into the carrying case. Care should be taken to see that all of the raft's required equipment is on board and properly stowed. If the raft lanyard used to prevent the raft from floating away from the airplane is in need of replacement, a lanyard not less than 20 feet long and having a breaking strength of about 75 pounds should be used.

(ii) At 18-month intervals the above procedure should be repeated, using the $CO_2$ bottle(s) for inflation. If a single bottle is used for inflating both compartments, it should be noted whether the inflation is proceeding equally to both compartments. Occasionally the formation of "carbon dioxide snow" may occur in 1 passage of the distributing manifold and divert a larger volume of gas to 1 compartment which may burst if the mattress valve is not open to relieve the pressure. If the pressure is satisfactory, the raft should be returned to service in accordance with the procedure outlined above.

(5) *Repair of life rafts.* When leaks due to tears, abrasions, or punctures are found, repairs should be made in accordance with the recommendations of the manufacturer. Partially torn away supporting patches on the tube should be recemented so as to restore the raft to its airworthy condition. Mildewed or weak lanyards should be replaced, particularly those by which the $CO_2$ bottle is operated. This applies also to the line used to attach the raft to the airplane. All metal parts should be checked for corrosion; cleaned, or repaired if found to be defective. If leaky mattress valves have been found, they should be replaced.

(6) *Rating.* Ratings of military rafts when used in civil aircraft are shown in the following table. Ratings of the 10-, 15-, and 20-man circular rafts built for civil use are stamped on the rafts by the manufacturer.

| Type | Capacity | | | Specification |
|---|---|---|---|---|
| | Pounds buoyancy | Men | | |
| | | Military | Civil | |
| A-3 series | 1,800 | 4 | 6 | AF 94-40420. |
| E-2 series | 2,500 | 6 | 10 | AF 94-40618. |
| Mark II | 1,000 | 2 | 3 | BuAer M-3R. |
| Mark IV | 1,800 | 4 | 6 | BuAer M-3R. |
| Mark VII | 2,500 | 7 | 10 | BuAer M-3R. |

NOTE: Rafts more than 5 years old are likely to be unairworthy due to deterioration.

(e) *Parachutes.* With reasonable care, parachutes should last at least 5 years. They should not be carelessly tossed about, left in the airplanes so that they may become wet, or left in open places where they may be tampered with. They should not be placed where they may fall on oily floors or be subject to acid fumes from adjacent battery chargers. When repacking is done as required in Part 43 of the Civil Air Regulations, a careful inspection of the parachute should be made by a qualified parachute technician (rigger). If repairs or replacement of parts are necessary to maintain the airworthiness of the parachute assembly, such work should be done by the original parachute manufacturer or by qualified parachute technicians certificated in accordance with Part 25 of the Civil Air Regulations, Parachute Technician's Certificates or by agencies qualified in accordance with Part 54 of the Civil Air Regulations, Parachute Loft Certificates and Ratings.

(f) *Safety belts.* (1) The Civil Air Regulations require that when safety belts are to be installed in aircraft after July 1, 1951, such belts must conform to standards established by the Civil Aeronautics Administration. These standards are contained in Technical Standard Order TSO–C22. Safety belts eligible for installation in aircraft may be identified by the marking TSO–C22 on the belt or by a military designation number since military belts comply with the strength requirements of the TSO. Airworthy type certificated safety belts currently in aircraft may be removed for cleaning and reinstalled. However, when a type certificated safety belt is found unairworthy it must be replaced with a TSO–C22 or a new military belt.

(2) The webbing of safety belts, even when mildew proofed, is subject to deterioration due to constant use, cleaning and the effects of aging. The clamping action of the serrations of the commonly used buckle also causes a reduction in strength of the webbing and fraying occurs after long periods of usage. Fraying of belts is an indication of wear and such belts are likely to be unairworthy because they can no longer hold the minimum required tensile load. Differences of opinion as to the airworthiness of a belt can be settled by testing a questionable belt to demonstrate that it will support the required load but such testing usually costs more than a new belt and in addition affects the belt so that it is not as strong after the test as it was before. Airworthy 1-person type certificated belts should be able to withstand a tensile load of 525 pounds and TSO belts should withstand the rated tensile load indicated on the belt label. Most 1-person TSO belts are rated for 1,500 pounds. For 2-person belts the loads should be doubled.

(3) Since type certificated belts will not afford the crash protection provided by a TSO or military belt, such type certificated belts should not be repaired nor should their buckles or end fittings be reused on safety belts. If replacement of webbing or hardware of TSO or military belts is attempted, parts of identical design and material should be used. The stitch pattern should at least be identical to the original and the number of stitches per inch should be equal to the number used in the original belt. There is no objection to having a greater total length of stitching provided one line of stitches is not placed over another line. Lines of stitching should be at least three-sixteenths inch apart. A record should be kept, preferably in the log book, stating the extent to which the belt was repaired and the date. The original identification marking on the belt, conforming either to that required by TSO–C22, to a deviation from this marking, or to the military designation should be retained. Operators of a fleet of airplanes should follow the above suggestions, but keeping of records of renovations in a log book is impractical since the belts are never associated with any one particular airplane for any length of time. Therefore, in addition to retaining the original identification label and attaching it to the renovated belt, some additional simple marking should be used to indicate that the belt had been renovated. The date of renovation should also be shown. The use of the letter "R" followed by the date would be acceptable. This marking could be in the form of an indelibile ink stamping or cloth label stitched to the webbing.

(g) *Fire extinguishers.* Inspection and maintenance of fire extinguishers should be in accordance with the manufacturer's instructions attached to the extinguisher unit. In connection with carbon tetrachloride extinguishers, owners who desire to refill their own units are cautioned not to refill them with commercial carbon tetrachloride inasmuch as it invariably contains a small percentage of water which ultimately causes corrosion of the moving parts of the extinguisher mechanism. Carbon tetrachloride for refilling fire extinguishers is sold in containers identifying the contents as being intended for such usage.

§ 18.30–10 *Windshields and enclosures (CAA policies which apply to § 18.30).* These repairs are applicable to plastic windshields, enclosures, and windows in non-pressurized airplanes. For pressurized airplanes the plastic elements should be replaced or repaired only in accordance with the manufacturer's recommendations.

(a) *Types of plastics.* Two types of plastics are commonly used in transparent enclosures of aircraft. These materials are known as acrylic plastics and cellulose acetate plastics.

(1) *Replacement panels.* Replacement panels should always be of material equivalent to that originally used by the manufacturer of the aircraft. There are many types of transparent plastics on the market. Their properties vary greatly, particularly in regard to expansion characteristics, brittleness under low temperatures, resistance to discoloration when exposed to sunlight, surface checking, etc. These properties have been considered by aircraft manufacturers in selecting materials to be used in their designs and the use of substitutes having different characteristics may result in subsequent difficulties.

(b) *Installation procedures for acrylic plastics.* In installing a replacement panel, the same mounting method used by the manufacturer of the airplane should be followed. While the actual installation will vary from one type of aircraft to another, the following major principles should be considered in installing any replacement panels.

(1) Never force an acrylic plastic panel out of shape to make it fit a frame. If a replacement panel does not fit easily into the mounting, a new replacement should be obtained or the whole panel heated and reformed. When possible, a new panel should be cut and fitted at ordinary room temperature.

(2) In clamping or bolting acrylic plastic panels into their mountings, do not place the plastic under excessive compressive stress. It is easy to develop more than 1,000 pounds per square inch on the plastic by drawing up a nut and bolt good and tight. Each nut should be tightened to a firm fit then backed off one full turn.

(3) (i) In bolt installations, spacers, collars, shoulders, or stop-nuts should be used to prevent tightening the bolt excessively. Whenever such devices are used by the airplane manufacturer they should be retained in the replacement installation. It is important that the original number of bolts, complete with washers, spacers, etc., be used.

(ii) When rivets are used, adequate spacers or other satisfactory means to prevent excessive tightening of the frame to the plastic should be provided.

(4) Acrylic plastic panels should be mounted between rubber, cork, or other gaskets to make the installation waterproof, to reduce vibration, and to help to distribute compressive stresses on the plastic.

(5) Acrylic plastics expand and contract approximately three times as much as the metal channels in which they are mounted. Therefore, suitable allowance for dimensional changes with temperature should be made. Clearances of one-eighth-inch minimum should be allowed around the edges of small panels and larger clearances around the edges of large panels.

(6) In installations involving bolts or rivets, the holes through the plastic should be oversize by one-eighth-inch diameter and centered so that the plastic will not bind or crack at the edge of the holes. The use of slotted holes is also recommended.

(7) Panels should be mounted to a sufficient depth in the channel to prevent falling out when it contracts at extremely low temperatures or when the panel is flexed. When the manufacturer's original design permits, panels up to 12 inches long should be mounted to a minimum depth of 1⅛ inches.

(c) *Installation procedure for cellulose acetate plastics.* In general the methods used for installation of cellulose acetate plastics are similar to those used for acrylic plastics. The coefficient of expansion of cellulose acetate exceeds that of acrylic resins. Also, the cellulose acetate plastics are affected by moisture and will change dimensionally as they absorb water. Therefore, allowance should be made in mounting this type plastic if wide variations in temperature and humidity are to be encountered. As a general rule an allowance of about one-eighth-inch per foot of panel length should be made for expansion and three-sixteenths-inch per foot for contraction.

(d) *Repair of plastics.* Extensively damaged transparent plastic should be replaced rather than repaired whenever possible since even a carefully patched part is not the equal of a new section, either optically or structurally. At the first sign of crack development, a hole of one-eighth to three-sixteenths of an inch in diameter should be drilled at the extreme ends of the cracks as shown in figure 10-1. This serves to localize the cracks and to prevent further splitting by distributing the strain over a large area. If the cracks are small, stopping them with drilled holes will usually suffice until replacement or more permanent repair can be made. The following repairs are permissible; however, they should not be located in the line of the pilot's vision in normal flight and landing.

(1) *Surface patch.* If a surface patch is to be installed, trim away the damaged area and round all corners. A piece of plastic of sufficient size to cover the damaged area and extend at least three-fourths of an inch on each side of the crack or hole should be cut and the edges beveled as shown in figure 10-2. If the section to be repaired is curved, the patch should be fitted to the same contour by heating it in an oil bath at a temperature of 248° to 302° F. or it may be heated on a hot plate until soft. Boiling water should not be used for heating. The patch should be coated evenly with plastic solvent adhesive and placed immediately over the hole. A uniform pressure of from 5 to 10 pounds per square inch should be maintained on the patch for a minimum of 3 hours. The patch should be allowed to dry 24 to 36 hours before sanding or polishing is attempted.

(2) *Plug patch.* In using inserted patches to repair holes in plastic structures, the holes should be trimmed to a perfect circle or oval and the edges beveled slightly. The patch should be slightly thicker than the material being repaired and should have similarly beveled edges. Patches should be installed in accordance with figure 10-3. The plug is heated until soft and pressed into the hole without cement, and allowed to cool, making a perfect fit. The plug should be removed, the edges coated with adhesive and then reinserted in the hole. A firm light pressure should be maintained until the cement has set. Sand or file the edges level with the surface, buff and polish.

(e) *Cleaning and polishing transparent plastic.* (1) Plastics have many advantages over glass for aircraft use, but they lack the surface hardness of glass and care must be exercised while servicing the aircraft to avoid scratching or otherwise damaging the surface.

(2) Plastic should be cleaned by washing with plenty of water and mild soap, using a clean, soft, grit-free cloth, sponge, or bare hands. Do not use gasoline, alcohol, benzene, actone, carbon tetrachloride, fire extinguisher or de-icing fluids, lacquer thinners, or window cleaning sprays because they will soften the plastic and cause crazing. The plastic should not be rubbed with a dry cloth since this is likely to cause scratches and also build up an electrostatic charge which attracts dust particles to the surface. If after removing dirt and grease, no great amount of scratching is visible, the plastic should be finished with a good grade of commercial wax. The wax should be applied in a thin even coat and brought to a high polish by rubbing lightly with a soft cloth.

(3) If, after removing dirt and grease, the surface is found marred by scratches, hand polish or buff out the scratches. Hand-polishing or buffing should not be attempted until the surface is clean. A soft, open-type cotton or flannel buffing wheel is suggested. Minor scratches may be removed by vigorously rubbing the affected area by hand or with a soft, clean cloth dampened with a mixture of turpentine and chalk or an automobile cleanser applied with a damp cloth. Remove the cleanser and polish with a soft, dry cloth. Acrylic and cellulose acetate plastics are thermoplastic and friction created by buffing or polishing too long in one spot can generate sufficient heat to soften the surface. This will produce visual distortion and should be guarded against.

§ 18.30-11 *Hydraulic systems (CAA policies which apply to § 18.30).* Airplane hydraulic systems should be maintained, serviced, and adjusted in accordance with manufacturer's maintenance manuals and pertinent component maintenance manuals. Certain general principles of maintenance and repair which apply are outlined below.

(a) *Hydraulic lines and fittings.* All lines and fittings should be carefully inspected at regular intervals to insure airworthiness. Metal lines should be checked for leaks, loose anchorages, scratches, kinks, or other damage. Flexible hose lines should be checked for leaks, cuts, abrasions, soft spots, or other deterioration or damage. Fittings and connections should be inspected for leakage, looseness, cracks, burrs, or other damage. Defective elements should be replaced but may sometimes be repaired.

(1) *Replacement of metal lines.* When inspection shows a line to be damaged or defective, the entire line should be replaced. However, if the damaged section is localized, a repair section may be inserted. In replacing lines, always use tubing of the same size and material as the original line. Use the old tubing as a template in bending the new line, unless it is too greatly damaged, in which case a template can be made from soft iron wire. Soft aluminum tubing (2SO, 3SO, or 52SO) under one-fourth inch outside diameter may be bent by hand. For all other tubing, an acceptable tube bending, hand or power, tool should be used. Bending should be done carefully to avoid excessive flattening, kinking, or wrinkling. Minimum bend radii should conform to the values shown in table 11-1. A small amount of flattening in bends is acceptable but should not exceed an amount such that the small diameter of the flattened portion is less than 75 percent of the original outside diameter. When installing the replacement tubing it should line up correctly with the mating part and should not be forced into line by means of the coupling nuts.

(2) *Tube connections.* Most tubing connections are made using flared tube ends, and standard connection fittings: AN-818 nut and AN-819 sleeve. In forming flares, the tube ends must be cut square, filed smooth, have all burrs and sharp edges removed and be thoroughly cleaned. The tubing is then flared using the correct forming tools for the sizes of tubing and type of fitting. A double flare is used on soft aluminum tubing three-eighths inch outside diameter and under, and a single flare on all other tubing. In making the connections hydraulic fluid only should be used as a lubricant. The connection should then be tightened as overtightening will damage the tube or fitting, and may cause failure, and undertightening may cause leakage.

(3) *Repair of metal tube lines.* (i) Minor dents and scratches in tubing may be repaired. Scratches or nicks no deeper than 10 percent of the wall thickness in aluminum alloy tubing only, not in the heel of a bend, may be repaired by burnishing with hand tools. Severe die marks, seams or splits in the tube should not be repaired; such lines should be replaced. Any crack or deformity in a flare is also unacceptable and should be rejected.

(ii) A dent less than 20 percent of the tube diameter is not objectionable unless it is in the heel of a bend. Dents may be removed by drawing a bullet of proper size through the tube by means of a length of cable.

(iii) A severely damaged line may be repaired, if it is not desired to replace the entire line, by cutting out the damaged section and inserting a repair section consisting of a short section of flared tubing, flaring both ends of the undamaged tube remaining, and connecting with standard unions, sleeves, and tube nuts. If the damaged portion is short enough, the insert tubing may be omitted and the repair made with one union and two sets of connection fittings.

(4) *Replacement of flexible lines.* When replacement of flexible hose lines is necessary, use the same type, size and length hose as the replaced line. If the hose is of the swaged-end type, the entire assembly should be obtained in the correct size for replacement. If it is of the collet, or sleeve, quick-attachable-end type, the assembly should be made up in accordance with the manufacturer's directions, using the prescribed tools, so that the replacement assembly is of the same size and length as the replaced line. The hose should be installed without twisting by keeping the white line on hose straight. Use only hydraulic fluid for lubricating threads.

(ii) A hose should never be stretched tight between two fittings as this will result in overstressing and failure at the ends under pressure. The length of hose should be sufficient to provide about 5 to 8 percent slack.

(b) *Hydraulic components.* Hydraulic components such as pumps, actuating cylinders, selector valves, relief valves, etc., should be disassembled only for maintenance and overhaul in properly equipped shops by qualified personnel. Manufacturer's recommended practices and replacement parts should be used in overhauling such components. If proper servicing facilities are not available, hydraulic equipment in need of repair or overhaul should be replaced by new or overhauled parts and the removed component sent to a qualified agency for overhaul. In making adjustments to such parts as relief valves, pressure regulating valves, etc., the airplane and component manufacturer's instructions should be carefully followed. Hydraulic filter elements should be inspected at frequent intervals and replaced as necessary.

§ 18.30–12 *Electrical systems (CAA policies which apply to § 18.30)*—(a) *General.* All electric equipment, electric assemblies, and wiring installations should be frequently inspected for damage, general condition, and proper functioning to assure the continued satisfactory operation of the electric system. The adjustment, repair, overhaul, and testing of all electric equipment and systems should be accomplished in accordance with the recommendations and procedures set forth in Maintenance Instructions, or manuals published by the the Aircraft and Equipment Manufacturers.

(b) *Inspection and operating checking.* Frequent visual inspections, operating checks of all electric circuits and equipment, and replacement or repair when deficiencies are found are effective in minimizing electrical troubles and hazards in airplanes. A suggested list of items to look for during these inspections and the checks to be performed are itemized below:

Damaged or overheated equipment, connections and wiring or worn wiring insulation.
Excessive resistance at high current carrying connections, as determined by millivolt drop test.
Alinement of electrically driven equipment.
Poor electric bonding.
Cleanliness of equipment and connections.
Proper support of wiring and conduit, and satisfactory attachment to the structure.
Tightness of connections, terminals and ferrules.
Continuity of fuses, operation of circuit breakers.
Condition of electric lamps.
Clearance or insulation of exposed terminals.
Adequacy of safety wire, cotter pins, etc.
Operational check of electrically operated equipment such as motors, inverters, generators, batteries, lights, etc.
Voltage check of electric system operation with portable precision voltmeter.

(1) *Cleaning and preservation.* Frequent cleaning of electric equipment to remove dust, dirt, and grime is recommended. Fine emery cloth may be used to clean terminals and mating surfaces if they appear corroded or dirty. Crocus cloth or very fine sandpaper should be used to polish commutators or slip rings. Emery cloth should not be used on commutators since particles from the cloth may cause shorting and burning.

(i) *Batteries and battery containers.* The drain and venting provisions for the battery or battery containers should be checked frequently and if found corroded the compartment and surrounding structure should be washed with a solution of soda and water to neutralize the battery acid.

(2) *Miscellaneous check items.* Frequent checks should be made for miscellaneous irregularities such as loose terminal connections, poorly soldered or loose swaged terminals, missing safety wire, loose quick-disconnects, broken wire bundle lacing, broken or inadequate wire clamps, and insufficient clearance between exposed current-carrying parts and ground. Replacement or repair should be accomplished as a part of routine maintenance.

(c) *Major adjustments.* Major adjustments of items of equipment such as regulators, generators, contactors, control devices, inverters, and relays should be accomplished outside the airplane on the test stand or test bench where all necessary instruments and test equipment are at hand. The adjustment procedures outlined by the equipment manufacturer should be followed.

(d) *Equipment replacement.* Damaged, wornout, and defective electric equipment should be replaced with identical items or with equipment equivalent to the original in operating characteristics, mechanical strength, and the ability to withstand the environmental conditions encountered in the operation of the airplane.

(e) *Aircraft electric cable installation*—(1) *Types of electric cable.* Aircraft service imposes severe environmental conditions on electric cable. To assure satisfactory service, the cable should be of aircraft quality at least equivalent to that specified in Military Specification MIL–W–5086 (Copper) and MIL–W–7072 (Aluminum).

(2) *Size of electric cable*—(i) *Criteria for selection.* The criteria upon which the selection of electric cable size should be based, when considering an alteration, are current carrying capacity and voltage drop.

(*a*) The selected cable should not carry current continuously or intermittently in excess of the ampere values indicated by curves 1, 2, and 3 on figure 12–1.

(*b*) The voltage drop in the main power cables from the generation sources, or the battery to the bus should not exceed 2 percent (2.0%) of the regulated voltage, when the generator is carrying rated current or the battery is being discharged at the 5-minute rate.

(*c*) The voltage drop in the load circuits, between the bus and the utilization equipment, should not exceed the values shown in the following tabulation:

| Nominal system voltage | Allowable voltage drop | |
|---|---|---|
| | Continuous operation | Intermittent operation |
| 14 | 0.5 | 1 |
| 28 | 1 | 2 |
| 115 | 4 | 8 |
| 200 | 7 | 14 |

(ii) *Electric cable chart.* This chart, figure 12–1, applies to cable carrying direct current and is based on copper conductor cable manufactured in accordance with Specification MIL–W–5086, whose current ratings are given in Specification MIL–W–5088. Curves 1, 2 and 3 thereon intersect the vertical cable size lines at the maximum ampere rating for the specified conditions indicated on the chart.

(*a*) *Examples of how to use the electric cable chart—Figure 12–1*—(*1*) *Knowing the cable length and ampere load.* Determine the required cable size so as not to exceed one volt drop as follows: Select the cable length from the scale at the left and follow it horizontally across the chart to the right until it intersects the required diagonal ampere line. Then read the cable size on the nearest or preferably the nearest vertical cable size line to the right.

*Example.* Measured cable length 50 feet, continuous current 25 amperes—determine cable size. From the left scale follow horizontal line 50 chart to the right until it intersects the diagonal 25-ampere line. The 25-ampere line is slightly more than midway between the 20- and 30-ampere lines since the scale is logarithmic. The vertical cable size to the right of this intersection is numbered 8, and therefore a No. 8 cable size will be needed. Note also that the point of intersection is above curve 1, indicating that No. 8 cable wire will carry 25 amperes in conduit or bundles without overheating.

(*2*) *Knowing the cable size and ampere load.* Determine the maximum cable length so as not to exceed one volt drop as follows: Select the cable size from the scale at the bottom of the chart and follow the vertical cable size line until it intersects the required diagonal ampere line. Then read the maximum distance in feet that the cable can be run, by horizontally projecting the point of intersection to the scale at the left.

*Example.* Cable size No. 2, continuous current 150 amperes, determine maximum cable length in feet. From the bottom scale follow the No. 2 vertical cable size line until it intersects the diagonal 150-ampere line. Projecting this point horizontally to the scale at the left it is determined that 38 feet is the maximum distance that the No. 2 cable carrying 150 amperes can be run without exceeding one-volt drop. It should be noted, however, that the point of intersection falls below Curve 1 and if the cable is to be installed in a close fitting conduit or even a large bundle it would be preferable to use a No. 1 or No. 1/0 cable, depending on the known factors of the installation. Naturally the maximum distance that these larger cables can be run without exceeding one-volt drop will also be greater than that previously determined for the No. 2 cable.

(*3*) *For other than one-volt drop.*

*Examples.* Determine cable size for various voltage drops, measured cable length 100 feet, continuous current 20 amperes; also determine maximum cable lengths in feet for various voltage drops, using cable size No. 10, continuous current 20 amperes.

(iii) *Resistance.* The resistance of the current return path through the aircraft structure is always considered negligible. However, this is based on the assumption that adequate bonding of the structure or a special electric current return path has been provided which is capable of carrying the required electric current with a negligible voltage drop. The measured resistance from the ground point of a generator or the battery to the ground terminal of any electric device should not exceed 0.005 ohm.

| Voltage drop | Enter chart (feet) | Amperes | Cable size from chart | Check |
|---|---|---|---|---|
| 1 | 100 | 20 | No. 6 | VD=(0.000436) [2] (100) (20)=0.872 |
| 0.5 | $\frac{100}{0.5}=200$ | 20 | No. 4 | VD=(0.000274) [2] (100) (20)=0.548 |
| 4 | $\frac{100}{4}=25$ | 20 | No. 12 | VD=(0.00188) [2] (100) (20)=3.76 |
| 7 | $\frac{100}{7}=14$ | 20 | No. 14 [1] | VD=(0.00299) [2] (100) (20)=5.98 |

[1] It should be noted that the No. 14 cable should not be used if a considerable portion of its 100-foot length is to be confined in conduit, large bundles, or locations of high ambient temperature, as the intersection of the cable size and current lines falls below curve 1.

[2] Resistance values from table 12-1.

| Voltage drop | Wire size | Amperes | Maximum length (feet) from chart at voltage drop indicated | Check |
|---|---|---|---|---|
| 1 | No. 10 | 20 | 45 | VD=(0.0011) [1] (20) (45)=0.990 |
| 0.5 | | | (45) (0.5)=22.5 | VD=(0.0011) [1] (20) (45)=0.495 |
| 4 | | | (45) (4)=180 | VD=(0.0011) [1] (20) (45)=3.96 |
| 7 | | | (45) (7)=315 | VD=(0.0011) [1] (20) (315)=7.93 |

[1] Resistance values from table 12-1.

(iv) *Aluminum cable.* From table 12-1 and 12-2 it will be noted that the conductor resistance of aluminum cable and that of copper cable two numbers higher are similar. Accordingly, the electric cable chart, figure 12-1, can be used when it is desired to substitute aluminum cable and the proper size can be selected by remembering to reduce the copper cable size by two numbers and by referring to table 12-2. The use of aluminum cable sizes smaller than No. 6 is not recommended.

(3) *Cable terminals.* Cable terminals are attached to the ends of electric cable to facilitate connection of the cable to junction boxes, terminal strips or items of equipment. The tensile strength of the cable to terminal joint should be at least equivalent to the tensile strength of the cable itself, and its resistance should be negligible relative to the normal resistance of the cable run. Terminals are available which were specifically designed for use with the standard sizes of aircraft cable. Haphazard choice of commercial terminals may lead to overheated joints, vibration failures, and corrosion difficulties.

(i) *Solder vs. solderless terminals.* The solderless (crimp-type) terminals have largely replaced the older solder lugs for most applications. Some of the disadvantages of the soldering process are listed as follows:

(*a*) A more skilled operator is required.

(*b*) A corrosive flux may be used, and the terminal joint will rapidly deteriorate.

(*c*) Maintenance is extremely difficult.

(*d*) The cable strands are stiffened by the solder, and become more susceptible to breakage by vibration.

(*e*) The cable insulation may be charred during the soldering process.

(ii) *Solderless terminal joints.* The terminal manufacturer will normally provide a special crimping or swaging tool for joining the solderless terminal to the electric cable. Aluminum cable presents special difficulty in that each individual cable strand is insulated by an oxide coating. The oxide coating must be broken down in the crimping process and some method employed to prevent its reforming. In all cases, the terminal manufacturer's instructions should be carefully followed.

(iii) *Attachment of terminals to studs.* Electrical equipment malfunction has frequently been traced to poor terminal connections at terminal boards. Loose, dirty, or corroded contact surfaces will produce localized heating which may ignite nearby combustible materials, or overheat adjacent cable insulation to the smoking point. Heavy current-carrying connections should be available for periodic inspection to determine their condition.

(4) *Terminal strips.* Cable runs are usually joined at terminal strips. The terminal strip should be fitted with barriers to prevent terminals on adjacent studs from coming in contact with each other. The studs should be anchored against rotation and be long enough to accommodate a maximum of four terminals. When more than 4 terminals are to be connected together, 2 or more adjacent studs should be used, and a small strip-metal bus mounted across the studs. In all cases, the current should be carried by the terminal contact surfaces, and not by the stud itself.

(i) *Terminal strip stud sizes.* If the stud size is too small, it is easily sheared during servicing by applying too much torque on the nut. After a few failures of this sort, the electrician will become overcautious and not tighten the nut sufficiently, and a hazardous loose connection will result. Consequently, it is good practice to limit stud sizes to No. 10 or larger.

(ii) *Terminal strip installation.* Terminal strips should be designed or mounted in such a manner that loose metallic objects cannot fall across the terminals or studs. It is good practice to provide at least one spare stud for future circuit expansion, or in case a stud is broken.

(5) *Connector assemblies.* Connectors (plugs and receptacles) are used to facilitate maintenance when frequent disconnection is required in service. Since the cable is soldered to the connector inserts, the joints should be individually insulated and the cable bundle firmly supported to avoid damage by vibration. Connectors have been particularly vulnerable to corrosion in the past, due to condensation of moisture within the shell. Special connectors with waterproofing features have been developed, and a chemically inert water-proof jelly is sometimes packed in the connector, to combat the corrosion difficulty.

(i) *Connector assembly application.* When two or more connectors are installed adjacent to each other, the design should be such that a plug cannot be inserted in the wrong receptacle. The socket-type insert should be used on that half of the connector which is "hot" after the connector is disconnected.

(6) *Through bolts.* Through bolts are sometimes required to make feeder connections through bulkheads, fuselage skin or firewalls. Such bolts should be mounted in such manner that they are mechanically secure independent of the terminal mounting nuts. Sufficient cross-section should be provided to insure adequate conductivity against overheating, and the contact surface area should be large enough to minimize voltage drop. Particular care should be exercised to avoid dissimilar metals among the terminal mounting hardware.

(7) *Splices in electric cable.* Splicing of electric cable should be kept to a minimum, and avoided entirely in locations subjected to extreme vibrations. Soldered splices are particularly brittle and should not be used. When a mechanical (crimped or swaged) splice is used, it should be covered by insulating tubing which is supported at both ends to prevent any motion which will tend to disconnect the splice. Multiple splices in a cable bundle should be staggered along the cable run.

(8) *Wiring installation practice*—(i) *General.* Electric wiring may be installed in aircraft without special enclosing means (open wiring) or may be confined in conduit or ducts to provide additional mechanical protection. Open wiring offers the advantages of ease of installation, simple maintenance, and reduced weight. However, conduit or ducting (preferably made of an insulating fire-resistant material) should be considered for the following situations.

(*a*) To minimize the possibility of a cable fault which would result in the loss of the electrical system, or render essential electrical equipment inoperative.

(*b*) To protect the cable from detrimental substances such as hydraulic fluid or gasoline.

(*c*) To protect the cable from abrasion or damage by moving aircraft elements, such as aircraft control cables or shifting cargo.

(ii) *Open wiring installation*—(*a*) *Cable bundles.* To simplify maintenance and to minimize the damage that may result from a single fault, cable bundles should be limited as to the number of wires in the run. Shielded cable, ignition cable, and cable which is not protected by a circuit breaker or fuse should be routed separately. The bending radius should not be less than 10 times the outer diameter of the bundle, to avoid excessive stresses on the cable insulation.

(*b*) *Insulating tubing.* Soft insulating tubing (spaghetti) cannot be considered as mechanical protection against external abrasion of cable, since at best it provides only a delaying action. Conduit or ducting should be employed in such cases.

(*c*) *Clamping of cable bundles.* Clamps, preferably of non-metallic material, should be used to support the cable bundle along the run. Lacing may be used between clamps, but should not be considered as a substitute for adequate clamping. Adhesive tapes are subject to age deterioration and therefore should not be used as a clamping means.

(*d*) *Clamp installation.* Clamps should be installed in such manner that the cables do not come in contact with other parts of the aircraft when subjected to vibration. Sufficient slack should be left between the last clamp and the electrical equipment to prevent strain at the cable terminals, or to minimize adverse effects on shock-mounted equipment. Where cables pass through bulkheads or other structural members, a grommet or suitable clamping should be provided to prevent abrasion.

(*e*) *Separation from flammable fluid lines.* An arcing fault between an electric cable and a metallic flammable fluid line may puncture the line and result in a serious fire. Consequently, every effort should be made to avoid this hazard by physical separation of the cables from lines or equipment containing oil, fuel, hydraulic fluid, or alcohol. When separation is impractical, the electric cable should be placed above the flammable fluid line and securely clamped to the structure. In no case should the cable be clamped to the flammable fluid line.

(iii) *Conduit installations.* Conduit is available in metallic and non-metallic materials and in both rigid and flexible forms. Primarily its purpose is for mechanical protection of the cable within, although some radio interference shielding may be provided.

(*a*) *Size of conduit.* When selecting conduit size for a specific cable bundle application, it is common practice to allow for ease in maintenance and possible future circuit expansion by specifying the conduit inner diameter about 25 percent larger than the maximum diameter of the cable bundle. Large conduit sizes should be avoided, since simultaneous damage to many cables is possible and maintenance becomes difficult.

(*b*) *Conduit fittings.* From the abrasion standpoints, conduit is vulnerable at its ends. Suitable fittings should be applied to conduit ends, in such manner that a smooth surface comes in contact with the cable within. Conduit should be supported by clamps along the conduit run.

(*c*) *Conduit installation.* Many of the past troubles with conduit can be avoided by proper attention to the following design details:

(*1*) Conduit should not be located where operating or maintenance personnel would use it as a hand-hold or foot step.

(*2*) Drain-holes should be provided at the lowest point in a conduit run. Drilling burrs should be carefully removed.

(*3*) Conduit should be adequately supported to prevent chafing against structure, and to avoid stressing its end fittings.

(iv) *Wiring identification.* To facilitate installation and maintenance, all wiring should be indelibly marked for identification. Any consistent numbering system is considered adequate. The identification marking should be placed at each end of the cable, and also, preferably, at intervals along the length.

(f) *Junction boxes and enclosures*—(1) *Junction box construction.* Junction boxes should be made from a fire-resistant, nonabsorbent material, such as aluminum alloy or an acceptable plastic material. Where fireproofing is necessary, a stainless steel junction box is recommended. A rigid construction will prevent "oil-canning" of the box sides, which may result in internal short circuits. In all cases drain-holes should be provided.

(2) *Internal arrangement.* The junction box should be designed to permit easy access to all installed items of equipment, terminals and cable. Where marginal clearances are unavoidable, an insulating material should be interposed between current carrying parts and any grounded surface. It is not good practice to mount equipment on the covers or doors of junction boxes, since inspection of internal clearance is impossible when the door or cover is in the closed position.

(3) *Junction box installation.* It is desirable to mount junction boxes with their open side facing downward, so that loose metallic objects, such as washers or bolts, will tend to fall out of the junction box, rather than wedge between terminals.

(4) *Junction box wiring.* The original layout of the junction box should take into consideration the necessity for adequate wiring space, and possible future additions. Electric cable inside the box should be laced or clamped in such manner that terminals are not hidden, relay armatures are not fouled, and motion relative to any equipment is prevented. Entrance openings for cable should be protected against chafing by grommets or other means.

(g) *Bonding*—(1) *General.* Bonding is defined as the process of electrically connecting the various metallic parts of the airplane, to achieve one or more of the following:

(i) A low resistance ground path for electrical equipment, thereby eliminating ground wires.

(ii) A reduction in radio interference.

(iii) Less probability of lightning damage to such airplane elements as control hinges.

(iv) Prevention of the buildup of static charges between parts of the airplane, which may be a fire hazard.

(2) *Bonding jumper installations.* Bonding jumpers should be as short as practicable, and installed in such manner that the resistance of each connection does not exceed .003 ohm. Reasonable access for maintenance should be provided. The jumper should not interfere with the operation of movable aircraft elements, such as surface controls, nor should normal movement of these elements result in damage to the bonding jumper.

(i) *Bonding connections.* To assure low-resistance connections, nonconducting finishes, such as paint and anodizing films, should be carefully removed from the attachment surface under the bonding terminal.

(ii) *Corrosion prevention.* Electrolytic action may rapidly corrode a bonding connection, if suitable precautions are not taken. Aluminum alloy jumpers are recommended for most cases, except that copper jumpers are used to bond together parts made of stainless steel, cadmium plated steel, copper, brass or bronze. Where contact between dissimilar metals cannot be avoided, the choice of jumper and hardware should be such that corrosion is minimized, and the part likely to corrode would be the jumper or associated hardware. At locations where finishes were removed, a protective finish should be applied to the completed connection to prevent subsequent corrosion.

(iii) *Bonding jumper attachment.* The use of solder to attach bonding jumpers should be avoided for the same reasons outlined previously in reference to electric cable terminals. Tubular members should be bonded by means of clamps to which the jumper is attached. Proper choice of clamp material, to match the tube material, will minimize corrosion.

(3) *Ground return connections.* When bonding jumpers will carry substantial ground return current, it should be determined that the current rating of the jumper is adequate, and that a negligible voltage drop is produced.

(4) *Insulation of electrical equipment from ground.* In some cases, a unit of electrical equipment is connected into a heavy current circuit, perhaps as a control device, or relay. Such equipment should be insulated from the mounting structure, since grounding the frame of the equipment may result in a serious ground fault in the event of internal failure of the equipment. If a ground connection for a control coil must be provided, a separate small-gage wire may be used.

§ 18.30–13 *Instruments (CAA policies which apply to § 18.30)*—(a) *General*—(1) *Instrument installation and maintenance.* (i) Care should be taken with instruments to prevent their accidental damage.

(ii) When instruments do not give proper indications, they should be sent to an approved instrument overhaul and repair station or returned to the manufacturer for servicing.

(2) *Vibration insulation.* Instruments should not be subjected to excessive vibrations. When shock-insulated panels are used, the mountings should be periodically checked for condition and the panels for alinement. When necessary to replace shock mounts, units of the same characteristics should be used. Only flexible connector tubing should be used to join the ends of lines to the instruments. Care should be exercised

to insure that the instrument panel does not contact any parts of the airframe when vibrating normally.

(b) *Pitot-static system*—(1) *System components.* The conventional design of the pitot-system consists of pitot-static tubes or pitot tubes with static pressure parts and vents, lines, tubing, water drains and traps, selector valves, and various pressure actuated indicators or control units such as the altimeter, air-speed and rate of climb indicators, and automatic pilots connected to the system.

(i) *Pitot-static tube.* The tube should have its axis parallel to the longitudinal axis of the aircraft when in cruising flight configuration. All repairs and alterations on the pitot-static system should be made in conformance with the manufacturer's recommendations.

(ii) *Static pressure ports or vents.* All alterations or relocations of the static pressure ports or vents should be made in conformance with the aircraft manufacturer's engineering recommendations. (See paragraph (a) (1) of this section and subparagraph (2) of this paragraph.)

(iii) *Heater not operative.* In the types of tubes where the electric element is not replaceable, it becomes necessary to replace the tube. The voltage at the heater terminals should not be less than 85 percent of the rated system voltage.

(iv) *Clogging of pitot-static tube or static vent drains.* If water or obstructive material has entered the system, all drains should be cleaned. The drains in the pitot-static head should be probed with a fine wire to remove dirt or other obstructions. The bottom static openings act as drains for the head's static chamber and these holes should be checked at regular intervals to preclude malfunctioning of the system.

*Caution:* Make sure all instruments are disconnected during cleaning procedures.

(v) *Relocation of pitot-static tube.* If relocation of the pitot-static tube is necessary it should be done in accordance with the manufacturer's recommendations and with due consideration of the following:

(*a*) Freedom of aerodynamic disturbances caused by the aircraft.

(*b*) Location protected from accidental damage.

(*c*) Alinement with the longitudinal axis of the aircraft when in cruising flight configuration.

(2) *Pitot-static lines*—(i) *Poor drainage of lines.* If drainage is poor, check the line diameter. If this tubing diameter is less than three-eighths inch outside diameter, it should be replaced with this size tubing to overcome the difficulty, as water will not drain freely in smaller size lines.

(ii) *Replacing the lines.* If necessary to replace lines, the following installation practices should be observed:

(*a*) Attach lines to airframe at regular intervals by means of suitable clamps.

(*b*) Do not clamp lines at end fittings.

(*c*) Maintain slope of lines toward drains so that proper drainage will be effected.

(*d*) Use thread lubricant on fittings, preventing excess lubricant from entering lines.

(*e*) Check the lines for leaks.

(iii) *Leak testing static lines.* The static line openings should be connected into a common line to which a manometer or a reliable pressure gage and a suction source is connected. Apply suction equivalent to 1,000 feet altitude (1.05 inches of mercury or 14.24 inches of water) and hold. After 1 minute, the leakage should not exceed the equivalent of 150 feet of altitude (approximately 2.18 inches of water).

*Caution:* Do not apply positive pressure to the static lines. Remove all stops on static vents after tests have been completed.

(iv) *Leak testing pitot lines.* Seal drain holes, and connect pitot pressure openings to a tee to which a source of pressure and a manometer or reliable airspeed indicator is connected. Apply pressure to cause airspeed to indicate 150 miles per hour and hold it at this point (0.82 inches of mercury or 11.18 inches of water positive pressure). After 1 minute, the leakage should not exceed the equivalent of 10 miles per hour.

*Warning:* Do not apply suction to pitot lines.

(v) *Maintenance of lines.* Inspection of the lines should be made periodically. Water accumulation can be removed by opening the drain caps on valves. If the installation is not properly self-drained, disconnect the lines from the instruments and carefully "blow" the lines with clean dry air.

(c) *Magnetic direction indicator (compass)*—(1) *Correction for errors in magnetic direction indicator*—(i) *Swinging the indicator (ground).* When the magnetic direction indicator does not yield satisfactory directional indications, it can be calibrated by the "ground swinging" technique as follows:

(*a*) Remove aircraft to location free from influence of steel structures, underground pipes and cables, reinforced concrete, or other aircraft.

(*b*) Place the aircraft in level flying position.

(*c*) Remove compensating magnets from chambers or reset the fixed compensating magnets to neutral positions, whichever is applicable, before swinging.

(*d*) Check indicator for fluid level and cleanliness. If fluid is required, it should be added before compensation.

(*e*) Check the pivot friction of indicator by deflecting the card with a small magnet. The card should rotate freely in a horizontal plane.

(*f*) If radio is used in aircraft, there should be corrections noted for "Radio On" and "Radio Off" conditions.

(*g*) Aline the aircraft with the North magnetic heading and compensate with compensating magnets. Repeat for the East magnetic heading. Then place on South and West magnetic headings and remove half of indicated error by adjusting compensators. Engine(s) should be running.

(*h*) Turn the aircraft on successive 30° headings through 360°. Placard should be marked to indicate correction at each 30° heading showing "Radio On" and "Radio Off" corrections.

(ii) *Indicator cannot be properly compensated.* The pilot's indicator should have deviation of less than 10° at any heading. When this maximum is exceeded, a new location for the indicator should be considered, unless the condition causing the error can be removed permanently.

(iii) *Erratic indications of magnetic indicator.* If severe deviations are encountered, they may be due to iron or steel items being carried in the aircraft, and located too close to the magnetic direction indicator. Caution must be taken to properly locate articles of this nature away from the vicinity of the indicator.

§ 18.30-14 *Engines and fuel systems (CAA policies which apply to § 18.30)*—(a) *Engines.* In repairing or overhauling aircraft engines, all repair agencies should be guided by the recommendations and procedures set forth in the respective instruction books, manuals, or service bulletins for the installation, inspection, and maintenance of aircraft engines, published by the aircraft engine manufacturers for each type of engine. Since many details concerning the repair and overhaul of engines differ decidedly for different types and models of engines, no attempt has been made to include such details in this manual. The overhaul period for aircraft engines used in general service operations should be determined from the manufacturer's recommendations with due consideration given to the condition of each engine involved.

(1) *Magnetic, fluorescent penetrant, X-ray, supersonic, and hydrostatic inspections.* All rotating, reciprocating and other highly stressed parts of all aircraft engines should be subjected to critical inspection at the time of overhaul. This inspection should be supplemented by any of the following procedures whenever recommended in the pertinent engine manufacturer's overhaul or instruction manuals or by CAA directives:

(i) Wet or dry magnetic dust inspection of magnetic materials;

(ii) Wet or dry penetrant inspection of nonmagnetic materials;

(iii) X-ray or supersonic inspection of any material;

(iv) Hydrostatic inspection of bulky parts and assemblies, such as cylinder heads and cylinders.

A copy of the report of the findings of any of these inspections should be appended to the original repair and alteration form in the case of a major repair. Refer to § 18.30-8 (d) (1) through (6) for process details.

(2) *Rebuilt engines.* A rebuilt engine is defined as a used engine which has been completely disassembled, inspected, repaired as necessary, reassembled, tested, and approved in the same manner and to the same tolerance and limits as a new engine. Component parts of such engines may be either used parts or new parts. The used parts may be either the parts from the same engine or from other service engines, but they must con-

form to production drawing tolerances and limits to which new parts must conform. In addition, all parts, either new or used, meeting approved oversize and undersize dimensions acceptable for new engines, are also eligible.

(3) *Crankshafts.* Crankshafts should be carefully inspected for misalinement and if bent beyond the manufacturer's permissible limit for service use, should not be repaired, but should be replaced. Worn journals may be repaired by regrinding in accordance with the manufacturer's instructions. If the original fillets are altered at any time, their radii should not be reduced and their surfaces should be polished free of all tool marks. No attempt should be made to straighten crankshafts damaged in service without consulting the engine manufacturer for appropriate instructions. In no case should an attempt be made to straighten a nitrided crankshaft.

(4) *Replacement parts in certificated engines.* Only engine parts which are approved by the Civil Aeronautics Administration should be used in making replacements in certificated aircraft engines. This applies also to engine component parts such as magnetos, spark plugs, etc.

(i) Engine parts obtained from war surplus or military stocks are eligible for use providing they are found to meet the prescribed inspection limits; are otherwise in serviceable condition, and were originally acceptable under the military procurement agency's standards.

(ii) Parts for obsolete engines for which new parts are no longer obtainable from the original manufacturer or his successor manufacturer, are sometimes fabricated locally. When it becomes necessary to do this, physical tests and careful measurements of the old part may provide adequate technical information. However, this procedure is usually regarded as a major change which requires engine testing and is not recommended except as a last alternative. Oftentimes, CAA engineering data is available in Washington for obsolete engines and it may be useful in providing information for the foregong purpose.

(5) *Cylinder hold-down nuts and cap screws.* Great care is required in tightening cylinder hold-down nuts or cap screws. They must be tightened to close torque limits to prevent improper prestressing and to insure even loading on the cylinder flange. The installation of baffles, brackets, clips, and other extraneous parts under these nuts and cap screws is not considered good practice and should be discouraged. If these baffles, brackets, etc., are not properly fabricated or made of suitable material, they will cause loosening of the nuts or cap screws even though the nuts or cap screws were properly tightened and locked at installation. Either improper prestressing or loosening of any one of these nuts or cap screws will introduce the danger of progressive stud failure with the possible loss of the engine cylinder in flight. Never install parts made from aluminum alloy or other soft metals under cylinder hold-down nuts or cap screws.

(6) *Run-in time.* After an aircraft engine has been overhauled, it should be run-in in accordance with the pertinent aircraft engine manufacturer's instructions. If no special test stand, test club, and other equipment are available, the engine may be run-in on the aircraft and the aircraft should be headed into the wind during the run-in on the ground so that the maximum cooling effect will be obtained. Proper cooling during run-in cannot be overemphasized. The manufacturer's recommendations concerning engine temperatures and other criteria should be carefully observed.

(7) *Re-use of safetying devices.* Cotter pins and safety wire should never be used a second time. Flat steel-type wrist-pin retainers and thin lock washers likewise should be replaced, but special coil spring or plug-type retainers need not be replaced at overhaul if the manufacturer's recommendations permit re-use.

(8) *Self-locking nuts for aircraft engines and accessories.* Self-locking nuts may be used on aircraft engines provided the following criteria are met:

(i) Where their use is specified by the engine manufacturer in his assembly drawing, parts list, and bills of material which are approved by the Civil Aeronautics Administration.

(ii) When the nuts will not fall inside of engine should they loosen and come off.

(iii) When there is at least one full thread protruding beyond the nut.

(iv) If cotter pin or locking-wiring holes are in the bolt or stud, the edges of these holes should be well-rounded to preclude damage to the lock nut.

(v) The effectiveness of the self-locking feature should be checked and found to be satisfactory prior to its re-use.

(vi) Engine accessories should be attached to the engine by means of the types of nuts furnished with the engine. On many engines, however, self-locking nuts are furnished for such use by the engine manufacturer for all accessories except the heaviest, such as starters and generators.

(vii) On many engines, the cylinder baffles, rocker box covers, drive covers and pads, and accessory and supercharger housings, are fastened with fiber insert locknuts which are limited to a maximum temperature of 250° F. inasmuch as above this temperature the fiber will usually char and consequently lose its locking characteristic. On locations such as the exhaust-pipe attachment to the cylinder, a locknut which has good locking features at elevated temperatures will give invaluable service. In a few instances, fiber insert locknuts have been approved for use on cylinder hold-down studs. This practice is not generally recommended since especially tight stud fits to the crankcase must be provided, and extremely good cooling must prevail so that low temperatures exist at this location on the specific engines for which such use is approved.

(viii) It is necessary that all proposed applications of new types of locknuts or new applications of currently used self-locking nuts must be investigated adequately since most engines require some specially designed nuts. Such specially designed nuts are usually required for one or more of the following reasons:

(*a*) To provide heat resistance;

(*b*) To provide adequate clearance for installation and removal;

(*c*) To provide for the required degrees of tightening, or, locking ability which sometimes require a stronger, specially heat-treated material, a heavier cross-section, or a special locking means;

(*d*) To provide ample bearing area under the nut to reduce unit loading on softer metals;

(*e*) To prevent loosening of studs when nuts are removed. Information concerning approved self-locking nuts and their use on specific engines is usually found in engine manufacturer's manuals or bulletins. If the desired information is not available, it is suggested that the engine manufacturer be contacted.

(9) *Designating converted engines.* When engine type of model conversions are accomplished (see § 18.1-1 (b) (2)), the engine nameplate should be altered or replaced to include the new official model designation and any other necessary information shown on the pertinent CAA engine specification.

(i) For current engines, information concerning engine modernizing, engine model conversions, and new properly marked nameplates should be obtained from the engine manufacturer.

(ii) For military surplus engines, or old engines for which new nameplates can no longer be secured, the new model designation symbols should be marked, either in the same title block adjacent to the old symbols, or on a plain thin steel plate attached beside the existing plate by at least two of the mounting screws. For engines which were never provided with separate designation plates and have, instead, an integral stamping boss on the crankcase, the new designation symbols should be added thereto, or a stamped thin steel plate may be fabricated and attached thereto. The superseded model designations should be obliterated or enclosed with parentheses. When metal stamps are used, care should be exercised to avoid damage to the engine.

(iii) In some instances, suffix letters should be added to the engine serial number on the nameplate to designate certain alterations or conversions. Such additions should be made when the alteration or conversion is not of sufficient importance to warrant model designation changes. Examples of these letter additions are:

(*a*) Suffix letter "C" on P & W Military R-2000-7 and -11 engines denoting the plain main bearing type main crankcases as indicated on Specification 5E-5;

(*b*) Suffix letters "A," "E," "L," "M," or "P" on Warner Super Scarab Series 50 engines as indicated on Specification E-104;

(*c*) Suffix letter "D" on Continental E185 series engines denoting incorporation of a dampered crankshaft as indicated on Specification E-246.

(iv) Examples of model designation changes are:

(*a*) Pratt and Whitney R-985-AN-1 engine converted to R-985-AN-14B may be redesignated R-985-AN-(1) 14B if it is desired to preserve its former designation. Usually, though, there is no specific reason to preserve prior identities of converted engines.

(*b*) A Continental A-65-8 engine converted to an A-75 engine with flange-type crankshaft should be redesignated an A-75-8F engine. Continental Service Bulletin No. M47-16 discusses the manufacturer's recommended procedures for handling conversions of Continental engines.

(*c*) A Wright R-1820-71 engine, when installed in certificated aircraft, should be redesignated with its civil model designation 702C9GC1 and Type Certificate No. 219. Similarly, a Lycoming O-235-2 engine nameplate should be redesignated O-235-B and Type Certificate No. 229.

(*d*) An R-1830-65 engine, when converted to an R-1830-90D engine, may be designated R-1830-90D and the "65" obliterated.

(v) Some model conversions merely require the addition of the symbols M1 or M2, etc., to the existing designation, e. g., R-2000-7M1 as indicated on Specification 5E-5.

(10) *Welding in the repair of engines*—(i) *General.* In general, welding of highly stressed engine parts is not recommended. However, under the conditions given below, welding may be accomplished if it can be reasonably expected that the welded repair will not adversely affect the airworthiness of the engine:

(*a*) When the weld is externally situated and can be inspected easily;

(*b*) When the part has been cracked or broken as the result of unusual loads not encountered in normal operation;

(*c*) When a new replacement part of obsolete-type engine is not available;

(*d*) When the welder's experience and equipment employed will insure a first quality weld in the type of material to be repaired and will insure restoration of the original heat treat in heat-treated parts. Also refer to § 18.30-4 (b) for information on process details.

(ii) *Welding of minor parts.* Many minor parts not subjected to high stresses may be safely repaired by welding. Mounting lugs, cowl lugs on cylinders, covers, etc., are in this category. The welded part should be suitably stress-relieved after welding.

(11) *Metallizing.* Metallizing should not be done on any internal part of an aircraft engine except when it is proved conclusively to the Civil Aeronautics Administration that the metallized part will not adversely affect the airworthiness of the engine. Metallizing the finned surfaces of steel cylinder barrels with aluminum may be accomplished since many engines are originally manufactured in this manner.

(12) *Plating*—(i) *General.* Plating may be restored on an engine part when accomplished in accordance with the manufacturer's instructions.

(ii) *Plating of highly stressed parts.* In general, chromium plating should not be applied to highly stressed engine parts. Certain applications of this nature have been found to be satisfactory. However, the processes to be used should be approved in all details by the Civil Aeronautics Administration. Porous chromium-plated cylinder walls have been found to be satisfactory for practically all types of engines. Dense or smooth chromium plating without roughened surfaces, on the other hand, has not been found to be generally satisfactory. For cylinder bore chromium plating, CAA engineering approval of the process used is required. Information with respect to what agencies are approved for this work may be obtained from the CAA. Dense chromium plating of the crankpin and main journals of some small engine crankshafts has been found to be satisfactory except where the particular crankshaft is already marginal in strength. Refer to § 18.30-7 (b) (2) for further information on plating.

(iii) *Plating of minor parts.* Plating, including chromium plating, may be utilized to restore worn low-stressed engine parts, such as accessory drive shafts and splines, propeller shaft ends, and the seating surfaces of roller- and ball-type bearing races.

(13) *Corrosion prevention.* The application of corrosion preventive measures for temporary and dead storage, preservation, pickling, etc., should be accomplished in accordance with instructions issued by the pertinent engine manufacturer. The use of strong solutions which contain strong caustic compounds and of all solutions, polishers, cleaners, abrasives, etc., which might possibly promote corrosive action, should be avoided. Refer to § 18.30-7 for further details.

(14) *Engine accessories.* Engine accessories should be overhauled and repaired in accordance with the recommendations of the engine manufacturer and the accessory manufacturer.

(b) *Fuel systems*—(1) *Fuel tanks.* Welded or riveted fuel tanks that are made of commercially pure aluminum, 3S, 52S, or similar alloys, may be repaired by welding. Tanks made from heat-treatable aluminum alloys are generally assembled by riveting. In case it is necessary to rivet a new piece in place, the patch should be of the same material as the tank, and a sealing compound that is insoluble in gasoline should be used in the seams. If aromatic fuels are used, special sealing compounds which are resistant to aromatic fuels should be employed.

(i) *Removal of flux after welding.* It is especially important, after repair by welding, to completely remove all flux in order to avoid possible corrosion. Therefore, promptly upon completion of welding, the tank should be washed both inside and outside with liberal quantities of hot water, and drained. Next, immerse it in either 5 percent nitric or 5 percent sulfuric acid, or fill the tank with this solution (in which case also wash the outside with the same solution). Permit this acid to remain in contact with the weld about 1 hour and then rinse thoroughly with clean fresh water. The efficiency of the cleaning operation may be tested by applying some acidified 5 percent silver nitrate solution to a small quantity of the rinse water that has been used to last wash the weld. If a heavy white precipitate is formed, the cleansing has been insufficient and the washing should be repeated.

(2) *Fuel tank caps, vents, and overflow lines.* Fuel tank caps should be inspected as to the integrity of the gasket, and vents should be inspected to ascertain that they are clear. Overflow lines should be inspected to ascertain that the integrity of the material and connections are satisfactory. Care should also be taken to ascertain that the vent exit is in proper position.

(3) *Fuel lines.* Aluminum or aluminum alloy tubing should not be annealed after forming or at overhaul periods as is required practice with copper tubing. Fuel lines should be thoroughly inspected for integrity of end fittings, for bends or kinks beyond recommended bend radii, for foreign material within the lines, and for integrity of the material which could be affected by abrasion, acid, heat, or swelling in the case of rubber impregnated lines. Too sharp bends or kinks, evidence of excessive heat, abrasion, or a change in the material are causes for replacement.

(4) *Fuel strainers and sediment bowls.* The adjusting nut located at the bottom of the bowl of the fuel strainer should be positively safetied in position. This nut should be tightened only with the fingers. If leakage still occurs, do not tighten with pliers but replace the cork gasket between the glass bowl and the screen. The screens of all strainers should be periodically inspected for foreign material or rupture. Screens should only be replaced by those recommended by the manufacturer as the mesh size affects the fuel flow through them. Sediment bowls should be given frequent inspections for water or solid material.

§ 18.30-15 *Propellers (CAA policies which apply to § 18.30)*—(a) *Inspection of propellers*—(1) *General.* The propeller is easily accessible for visual inspection and should always be checked before a flight to determine that no damage has occurred. Propellers should be inspected periodically as recommended or required by maintenance manuals, service bulletins, and airworthiness directives.

(2) *Wood or composition propellers and blades.* Due to the nature of the wood itself, it is necessary that wood propellers and blades be inspected frequently to assure continued airworthiness. They should be inspected for such defects as cracks, bruises, scars, warp, evidence of glue failure and separated laminations, sections broken off, and defects in the finish. Composition blades must be handled with the same consideration as wood blades.

(i) The fixed-pitch propeller should be removed from the engine at engine overhaul periods. Whenever the propeller is removed, it should be visually inspected on the rear surface for any indication of cracks. When any indications are found, the metal hub should be disassembled from the propeller. The bolts should be inspected for wear and cracks at the head and threads and, if cracked or worn, should be replaced with new AN bolts. The propeller should be inspected for elongated bolt holes, enlarged hub bore, and checks or cracks inside of bore or anywhere on the propeller. Propellers found with any of these defects should not be used until repaired. If no defects are found, the propeller may be reinstalled on the engine. It should first be touched up with varnish at all places where the finish is worn thin, scratched, or nicked. Track and balance the propeller, and coat the hub bore and bolt holes with some moisture preventive such as asphalt varnish. In case the hub flange is integral with the crankshaft of the engine, final track should be made after the propeller is installed on the engine. In all cases where a separate metal hub is used, final balance and track should be accomplished with the hub installed in the propeller.

(ii) On new fixed-pitch propeller installations the hub bolts should always be inspected for tightness after the first flight and after the first 25 hours of flying. Thereafter, the bolts should be inspected and checked for tightness at least every 50 hours. No definite time interval can be specified, since bolt tightness is affected by changes in the wood caused by the moisture content in the air where the airplane is flown and stored. During wet weather, some moisture is apt to enter the propeller wood through the drilled holes in the hub. The wood swells but, since expansion is limited by the bolts extending between the two flanges, some of the wood fibres are crushed. Later, when the propeller dries out during dry weather or due to heat from the engine, a certain amount of propeller hub shrinkage takes place and the wood no longer completely fills the space between the two hub flanges. Accordingly, the hub bolts become loose.

(iii) In-flight tip failures may be avoided by frequent inspections of the metal cap and leading edge strip, and the surrounding areas. Inspect for such defects as looseness or slipping, separation of soldered joints, loose screws, loose rivets, breaks, cracks, eroded sections, and corrosion. Inspect for separation between metal leading edge and cap, which would indicate the cap is moving outward in the direction of centrifugal force. This condition is often accompanied by discoloration and loose rivets. Inspect tip for cracks by grasping with hand and slightly twisting about the longitudinal blade center line and by slightly bending the tip backward and forward. If leading edge and cap have separated, carefully inspect for cracks at this point. Cracks usually start at the leading edge of the blade. A fine line appearing in the fabric or plastic will indicate a crack in the wood. In all doubtful cases, have the propeller inspected by an authorized propeller repair station or factory service department.

(iv) The wood close to the metal sleeve of wood blades should be examined frequently for cracks extending outward on the blade. These cracks sometimes occur at the threaded ends of the lag screws, and may be an indication of internal cracking of the wood. Blades having such cracks should be returned to the manufacturer. Tightness of the lag screws, which attach the metal sleeve to the wood blade, should be inspected according to the manufacturer's instructions. The shank areas of composition blades next to the metal sleeve should be inspected and protected as for wood blades.

(3) *Metal propellers and blades.* Metal propellers and blades are generally susceptible to fatigue failure resulting from concentration of stresses at the bottoms of sharp nicks, cuts, and scratches. It is especially necessary, therefore, to frequently and carefully inspect them for such injuries. Propeller manufacturers have published service bulletins and instructions which prescribe the manner in which these inspections should be accomplished.

(4) *Lubrication.* Controllable pitch propellers should be carefully inspected frequently to determine if all parts are being lubricated properly. It is especially recommended that all lubrication be accomplished at the periods, and in the manner specified by the propeller manufacturer.

(b) *Repair of propellers*—(1) *General.* Propellers should be repaired in accordance with the best accepted practices and latest techniques. Manufacturer's recommendation should in all cases be followed. The Air Agency Certificate number, or name of agency making any repairs, especially on metal tipping, should be stamped or otherwise marked on the repaired propeller. It is recommended that a decalcomania giving both the repair agency's name and Air Agency Certificate number be used for this purpose. It is necessary to mark the name of the manufacturer and model designation on the repaired propeller in the event the original markings were removed during the repair or refinishing operations.

(2) *Wood or composition propellers and blades.* Wood propellers and blades requiring repair should be carefully examined to be sure that they can be restored to their original airworthy condition. Doubtful cases should be referred to the manufacturer, and the proposed repair should be referred subsequently to a representative of the Civil Aeronautics Administration for approval. Propellers damaged to the following extent are considered unairworthy, and should be scrapped immediately because repair is either impossible or uneconomical:

A crack or deep cut across the grain of the wood.

Split blades.

Separated laminations, except the outside laminations of fixed-pitch propellers.

More screw or rivet holes, including holes filled with dowels, than used to attach the metal leading edge strip and tip.

An appreciable warp.

An appreciable portion of wood missing.

A crack, cut, or damage to the metal shank or sleeve of blades.

Broken lag screws which attach the metal sleeve to the blade.

Oversize shaft hole in fixed-pitch propellers.

Cracks between the shaft hole and bolt holes.

Cracked internal laminations.

Excessively elongated bolt holes.

(i) Repairs to dents, cuts, scars, scratches, nicks, and small cracks parallel to the grain of the wood are classified under § 18.1-1 as minor repairs. Small cracks parallel to the grain should be filled with glue thoroughly worked into all portions of the cracks, dried, and then sanded smooth and flush with the surface of the propeller. This also applies to small cuts. Dents or scars which have rough surfaces or shapes that will hold a filler and will not induce failure may be filled with a mixture of glue and clean, fine, sawdust thoroughly worked and packed into the defect, dried and then sanded smooth and flush with the surface of the propeller. It is very important that all loose or foreign matter be removed from the place to be filled so that a good bond of the glue to the wood is obtained.

(ii) Major repairs as defined in § 18.1-1, include inlay work, replacement of outside lamination of fixed-pitch propellers, repair of elongated bolt holes in fixed-pitch propellers, replacement of tip fabric, repair and replacement of metal tip and leading edge strip, and replacement of all or part of plastic covering. The propeller manufacturer's instructions should be followed in all cases.

(iii) Inlays shown in figure 15-6 of this manual may be used. Inlays should be of the same wood as the propeller blade; i. e., a yellow birch propeller should be inlaid with yellow birch not with white birch, and as near the same specific gravity as possible. Repair joints should conform with figure 15-6 for taper of 10:1 from deepest point to feather edge or end of inlay. Measurements are taken along a straight line parallel to the grain or general slope of the surface on thrust and camber face. This rule applies also to the edge repairs. The grain of inlays should extend in the same direction as the grain of the propeller laminations. Inlays should be made with a fishmouth, scarf, or butt joint. The permanency of the joint is in the order named, the fishmouth being preferable. Dovetail-type inlays should not be used. The number of inlays should not exceed 1 large, 2 medium, or 4 small widely separated inlays per blade. A trailing and a leading edge inlay should not overlap more than 25 percent, as shown in figure 15-6. On blades with normal sections from the midsection to the tip, a cross-grain cut, up to 20 percent of the chord in length and one-eighth of the section thickness at the deepest point of damage may be repaired. On blades with thin sections, this depth should not exceed one-twentieth of the section thickness.

(iv) Inlays in the sides of the hubs of fixed-pitch propellers should not exceed in depth a value greater than 5 percent of the difference between the hub and bore diameters. In the portion of the blade where it fairs into the hub, allowable depths for inlays are dependent upon the general proportions. Where the width and thickness are both very large in proportion to the hub and blade, maximum inlay depths of 7½ percent of the section thickness at the center of the inlay are permissible. Where the width and thickness are excessively small, maximum inlay depths of 2½ percent of the section thickness at the center of the inlay are permissible; for propellers over

50 horsepower, cuts 2½ percent deep may be filled with glue and sawdust, while for propellers under 50 horsepower, cuts 5 percent deep may be filled with glue and sawdust.

(v) Narrow slivers up to one-eighth inch wide broken from the trailing edge at the wider portions of the blade may be repaired by sandpapering a new trailing edge, removing the least material possible, and fairing in a new trailing edge of smooth contour. Both blades should be narrowed by the same amount. Near the hub or tip an inlay should be used and should not exceed, at its greatest depth, 5 percent of the chord.

(vi) In order to replace the wood worn away at the end of the metal tipping, enough of the metal should be removed to make the minimum repair taper 10:1 each way from the deepest point. Due to the convex leading edge of the average propeller, this taper usually works out 8:1. Repairs under the metal tipping should not exceed 7½ percent of the chord for butt or scarf joints, and 10 percent for fish-mouth joints, with three-fourths inch maximum depth for any repair.

(vii) The scarfing of wood tips onto a propeller blade to replace a damaged tip is not considered an acceptable repair. The success of this type of repair is fully dependent upon the strength and quality of the glue joint. Since it is difficult to apply pressure evenly over the glue area, and since no satisfactory means are available for testing the strength of such joints, it is quite possible for defective glue joints to occur and remain undetected until failure occurs.

(viii) Whenever the glue joint of an outside lamination of fixed-pitch propellers is open, the propeller may be repaired by removing the loose lamination and gluing on a new lamination of kiln dried wood of the same kind as the original lamination. It is not usually economical to attempt to repair separations between other laminations. Outside laminations, which have been crushed at the hub due to excessive drawing up of hub bolts, may be repaired by planing and sanding one hub face smooth, removing a lamination on the other hub face and replacing it with a new lamination, thus building the hub thickness up to the original thickness. It is permissible to replace both outer laminations if necessary and feasible.

(ix) It is permissible to repair elongated bolt holes by the insertion of a steel bushing around each bolt, as illustrated in figure 15-7 method (C). The bushing should be machined with an inside diameter to fit the bolt snugly and an outside diameter approximately one-fourth inch larger than the bolt size. The bushing should be approximately one-half inch long. The face of the hub should be drilled with a hole concentric with the bolt hole and only to a sufficient depth to accommodate the bushing so that it does not protrude above the surface of the wood hub. The bushing should not be driven into the hub but should fit the hole in the hub with a clearance not exceeding .005 inch after moisture-proofing. The bushing hole should be protected from moisture by two coats of aluminum paint, varnish, glue, or other moisture-resistant coating.

(x) Small cracks, dents, scratches, and cuts in the plastic of plastic covered wood propellers and blades may be repaired by using special repair cement supplied by the manufacturer. Instructions accompany the cements. Polishes and cleaners are available for preserving the gloss finish of varnished or plastic covered propellers and blades.

(xi) Because of the nature of the material, all repairs to composition blades will be of a major nature, and damaged blades should be returned to the manufacturer for repair. However, where repairs to the metal cap and leading edge strip only are necessary, the methods and procedures discussed in the following sections may be followed.

(xii) Fabric used to strengthen the tips of wood blades should be replaced when it becomes loose or worn through. Launder the fabric (mercerized cotton airplane cloth) to remove all sizing. Cut a piece of fabric to approximate size required to cover both faces of outer portion of blade. The fabric should cover the same portion that the original fabric covered. Apply glue to the wood where the fabric is to be put on. Use a rather thick solution of the glue. Use resorcinol glue when the temperature of the workroom can be kept above 21° C. (70° F.). Put the fabric on glued surface, starting at the leading edge of the thrust face, and work toward the trailing edge. Fold the fabric around the trailing edge over the camber face, and toward the leading edge. Make a joint on the leading edge where it will be covered by the metal tipping. As the fabric is put on, smooth it out over the wood so as to prevent air bubbles or uneven glue underneath. Fabric must be perfectly flat on the blade. Trim excess fabric off with small scissors. Under no circumstances shall fabric be cut or scored with a knife. Allow the glue under the fabric to dry about 6 hours, then brush 2 coats of nitrate dope on the fabric, allowing one-half hour for drying time, and then sand the fabric lightly and brush a coat of pigmented dope over it. Lightly sand the uncovered portion of the wood and apply 2 coats of a good grade of moisture-resistant varnish, allowing 12 to 16 hours drying time between coats.

(xiii) Tipping should be replaced when it cannot be properly repaired. Cracks in the narrow necks of metal between pairs of lobes of the tipping are to be expected and are not defects. All other cracks are defects that should be repaired, or eliminated by new tipping. If the propeller does not require fabric, apply two coats of varnish to the wood to be covered by the metal tipping. If new fabric has been applied, puncture it with a pointed tool at each screw and rivet hole. Apply varnish, white lead, aluminum paint, etc., to all holes, allowing the wood to absorb as much as it can. With a soft lead pencil, draw guide centerlines on the propeller extending about 4 inches from the centers of old screw and rivet holes. This procedure is followed to insure use of the original screw and rivet holes in the propeller. New holes should not be drilled. A number of wood propeller tip failures have occurred which have been attributed to the practice of drilling new rivet and/or screw holes in the wood tips when replacing the metal tipping. To avoid continued occurrence of these failures, it is strongly recommended that the manufacturer's procedure be closely adhered to, and any procedure which involves drilling of new holes in the wood tip and plugging of old holes with dowels should be discontinued immediately.

(xiv) Obtain new tips and leading-edge strips, cut to size and formed to the approximate shape of the leading edge of the propeller. These pieces are usually supplied without holes so that the holes can be drilled in them to line up with the old screw and rivet holes in the propeller as below. If such material cut to shape is not available, the old tipping can be hammered out flat and used as a pattern to lay off a new tip. For this purpose use a piece of sheet metal of the same material and thickness as the old tip. Remove the burr from the cut edges of this piece.

(xv) Lay the cutout flat metal strip over the leading edge. Proceed to bend this metal down over the leading edge of the propeller, being careful that the metal extends an equal width on thrust and camber faces. This can be done by following the impressions of the old tipping lines. Numerous waves will occur in the metal, but these will be eliminated as the work progresses. Obtain several pieces of strong rubber tape, 4 feet long, one-half inch wide, and one-sixteenth inch thick. While forming the metal, hold it in place on the propeller by wrapping the rubber tape around the blade. Start at the tip and work inboard, being careful not to cover the pencil lines placed on the propeller, which show the location of the rivet holes. While the metal is held in place, tap the leading edge with a rawhide or rubber mallet, using moderate force to make sure the metal is seated against the wood along the nose of the leading edge. Smooth the metal by hammering it with the mallet, backing up the opposite side of the blade with a laminated hardwood bucking block having an iron weight built in the center and a piece of leather fastened to the end on which the propeller bears. The block should measure about 2 by 4 inches. Start at the end of the blade and work toward the hub, moving the bucking block so that it is always immediately under the section being hammered. Continue to do this until the metal is well shaped to the profile of the propeller. Check to see that the metal has not moved from its original position. If this has happened, remove the rubber tape, reset the metal, and rewrap the rubber tape, thus forming the metal to the leading edge.

(xvi) With a centerpunch and a hammer, proceed to locate the old screw and rivet holes, using the pencil marks on the blade as a guide. Punch the metal approximately one-fourth inch from the edge. After all holes have been located, remove the metal from the propeller. Drill screw and rivet holes in the metal with a one-eighth-inch drill. File off burrs on the inside of the metal. Run the drill through the original rivet holes in the propeller in order to clean them out. Cut or saw slots in the metal at the original positions. (Refer to old tipping metal for locations of the slots.) Place the metal leading edges on the blades they were formed to fit, and hold them in place with rubber tape. With a centerpunch as large as or slightly larger than the diameter of the screw and rivet heads, proceed to punch metal into the original countersunk holes in the wood so that the screw and rivet heads may be entered to the correct depth (not more than one-thirty-second inch below the surface of the metal). Use screws and rivets of the appropriate material. The screws should be one size larger than were originally in the propeller, and the rivets should be the solid flat, countersunk-head type. Insert screws and rivets in their respective holes. Install rivets with their heads on the thrust face of the propeller. After the rivets are tapped in place, cut off the excess length of the rivet, leaving one-eighth inch for heading. End cutters built up with solder to accurately measure this distance are very useful. When an assistant backs up the rivets with a steel bar 18 inches long and pointed to fit the rivet head, hammer the rivets either by hand or with a pneumatic hammer. Drive the screws, either by hand or with an electric screw driver.

(xvii) Cut the metal of the cap-tip on the camber face of the propeller to the shape of the propeller tip. Bevel the edges by hand with a file. Trim off flat side of metal cap so that it extends about three-sixteenths-inch all around the tip of the propeller. Form a hardwood block to the shape of thrust face of the propeller tip. Put metal tipping in place and clamp this block to the underside of the tip with a C-clamp. Turn this three-sixteenths-inch of metal up and over the camber face of the tip. Tighten and complete the lap joint. Mount the propeller blade solidly, with the thrust face up, on a stand supporting the blade at several points along its radius. With a hammer and a flatfaced tool, proceed to smooth the metal, starting at the nose of the leading edge and working toward the edge of the metal, until all wrinkles and high spots are removed. At the edge, use a caulking tool and, in the same manner, press the metal edge tightly against the wood. Turn the propeller over and repeat this operation on the camber face. Make sure that the thin tip is supported at all times when hammering. Apply solder over rivet and screwheads and over the metal seam of the tip of the propeller. Use 50–50 solder in wire form. Use muriatic acid as a flux when soldering brass. Use stainless steel soldering flux when soldering stainless steel tipping. File excess solder off and check the propeller balance while doing so. Polish the metal with a fine emery cloth or an abrasive drum driven by a flexible shaft. Vent the tipping by drilling three holes, No. 60 drill (.030), three-sixteenths inch deep in the tip end. Vent holes should be parallel to the longitudinal axis of the blade.

(xviii) After repairing a blade, it is usually necessary to refinish it. Refinishing may be classified as a minor repair. In some cases it may be necessary to completely remove the old finish. The finish, where necessary, should be renewed in accordance with the recommendations of the propeller manufacturer, or with a material which has satisfactory adhesion and high moisture resistant properties. Refinishing of plastic covered blades requires special techniques. Some manufacturers make this information available through service bulletins. Care must be exercised when revarnishing or repainting wood blades that the balance of the entire propeller is not disturbed. Coating one blade heavier than the other will produce unbalance, and cause a noticeable vibration during flight.

(xix) It is always necessary to check the balance of the propeller after any repairs or refinishing. Final balance should be accomplished on a rigid knife-edge balancing stand or on a suspension type balancer. Balancing must be done in a room free from air currents. There should be no persistent tendency to rotate from any position on the balance stand, or to tilt on the suspension balancer. Horizontal unbalance may be corrected by the application of finish or solder to the light blade. The light blade may be coated with a high grade of primer allowing for a finishing coat. After allowing each coat to dry 48 hours, the balance should be checked. Then, as may be necessary, either the required amount of finish should be removed by carefully sandpapering or an additional coat applied. The balance should be rechecked and sandpapered or additional finish applied as may be required to effect final balancing. Vertical unbalance in fixed-pitch propellers may be corrected by applying putty to the light side of the wood hub at a point on the circumference approximately 90° from the longitudinal centerline of the blades. The putty should be weighed and a brass plate weighing slightly more than the putty should be cut. The thickness of the plate should be from one-sixteenth to one-eighth inch depending on the final area, which must be sufficient for the required number of flathead attaching screws. The plate may be made to fit on the hub face or to fit the shape of the light side of the wood hub, and drilled and countersunk for the required number of screws. The plate should be attached and all of the screws tightened. After the plate is finally attached to the propeller, the screws should be secured to the plate by soldering the screw heads. The balance should be checked. All edges of the plate may be beveled to reduce its weight as necessary. The drilling of holes in the propeller and the insertion of lead or other material to assist in balancing will not be permitted.

(3 *Metal propellers and blades.* Metal propellers should never be operated with sharp edged dents, cuts, scars, scratches, nicks, or pits anywhere on the surface of a blade unless the manufacturer's instructions specifically permit it. Damaged blades with model numbers which are on the manufacturer's lists of blades that cannot be repaired should be rejected.

(i) Due to the critical effects of surface injuries and their repair on the fatigue life of steel blades, all repairs will be of a major nature. Because of the specialized tooling and equipment necessary to repair them, it is recommended that they be returned to the manufacturer for repair. Where equipment is available, the manufacturer's instructions should be followed.

(ii) For aluminum alloy propellers and blades, treatment of dents, cuts, scars, scratches, nicks, leading edge pitting, etc., may be classified as minor repairs provided their removal or treatment does not materially affect the strength, weight, or performance of the blade. These damages should be removed or otherwise treated as explained below unless contrary to manufacturer's instructions or recommendations. More than one injury is not sufficient cause alone for rejection of a blade. A reasonable number of repairs per blade may be made and not necessarily result in a dangerous condition, unless their location with respect to each other is such as to form a continuous line of repairs that would materially weaken the blade. Suitable sandpaper or fine cut files may be used for removing the necessary amount of metal. In each case, the area involved will be smoothly finished with No. 00 sandpaper or crocus cloth, and each blade from which any appreciable amount of metal has been removed will be properly balanced before it is used. Suspected cracks and all repairs should be etched as discussed in paragraph (c) (4) (i) and (ii) of this section. To avoid removal of an excess amount of metal, local etching should be accomplished at intervals during the process of removing suspected cracks. Upon completion of the repair, the entire blade should be carefully inspected by etching or anodizing. All effects of the etching process should be removed with fine emery paper. Blades identified by the manufacturer as being coldworked (shotblasted or coldrolled) may require peening after repairing. All repairing and peening on this type of blade should be accomplished in accordance with the manufacturer's instructions. However, it is not permissible in any case to peen down the edges of any injury wherein the operation will lap metal over the injury.

(iii) Nicks, scars, cuts, etc., occurring on the lading edge of aluminum alloy blades should be smoothly rounded out as shown in figure 15–2 (view B). Blades that have the leading edges pitted from normal wear in service may be reworked by removing sufficient material to eliminate the pitting. In this case, the metal should be removed by starting well back from the edge, as shown in figure 15–3, and working forward over the edge in such a way that the contour will remain substantially the same, avoiding abrupt changes in contour or blunt edges. Trailing edges of blades may be treated in substantially the same manner. On the thrust and camber faces of blades the metal around any dents, cuts, scars, scratches, nicks, longitudinal surface cracks, and pits should be removed to form shallow saucer shaped depressions as shown in figure 15–2 (view C). Care should be exercised to remove the deepest point of the injury and also remove any raised metal around the edges of the injury as shown in figure 15-2 (view A). For repaired blades the permissible reductions in width and thickness from minimum original dimensions allowed by the blade drawing and blade manufacturing specification are shown in figure 15-4 for locations on the blade from the shank to 90 percent of the blade radius. Beyond the 90-percent blade radius point, the blade width and thickness may be modified as required.

(iv) Major repairs to aluminum alloy propellers and blades include shortening due to damaged tips, repairs to deep dents, cuts, scars, nicks, etc., and straightening of bent blades (see § 18.1-3 (c)). The propeller manufacturer's instructions should be followed in all cases. Any repair on leading and trailing edges of the blades which results in a finished depression more than one-fourth-inch deep (chordwise of the blade) and 1 inch long will be a major repair, and should be submitted to a certificated repair station. Any repair on the thrust and camber faces of the blades which results in a finished depression more than one-eighth inch in depth at its deepest point, three-eighths inch in width overall, and one inch in length overall, will be a major repair, and should be submitted to a certificated repair station. When the removal or treatment of defects on the tip necessitates shortening a blade, each blade used with it should be likewise shortened. Such sets of blades should be kept together (see figure 15-5 for acceptable methods). The shortened blades should be marked to correspond with the manufacturer's system of model designation to indicate propeller diameter. If, in making the repair, it is necessary to reduce the propeller diameter below the minimum diameter limit shown on the pertinent airplane specification, the repair should be submitted to a representative of the Civil Aeronautics Administration for approval. In such cases it may be necessary to investigate the performance characteristics of the airplane with the reduced diameter propeller installed. Bent blades may be repaired only by the manufacturer or certificated repair agencies holding the appropriate ratings. The extent of a bend in face alinement should be carefully checked by means of a protractor similar to the one illustrated in figure 15-1. Only bends not exceeding 20° at 0.15-inch blade thickness to 0 degrees at 1.1-inch blade thickness may be cold-straightened. Blades with bends in excess of this amount require heat treatment.

(v) The following tolerances are those listed in the blade manufacturing specification for aluminum alloy blades and govern the width and thickness of new blades. These tolerances are to be used with the pertinent blade drawing to determine the minimum original blade dimensions to which the reductions of figure 15-4 may be applied. When repairs reduce the width or thickness of the blade below these limits, the blade should be rejected. The face alinement, or track, of the propeller should fall within the limits recommended by the manufacturer for new propellers.

| | | Manufacturing tolerance (inch) |
|---|---|---|
| Basic diameter less than 10 feet 6 inches: | | |
| Blade width | from shank to: 24-inch station | ±3/64 |
| | to tip | ±1/32 |
| Blade thickness | | ±0.025 |
| Basic diameter 10 feet 6 inches to less than 14 feet 0 inches: | | |
| Blade width | from shank to 24-inch station | ±1/16 |
| | from 30-inch station to tip | ±1/32 |
| Blade thickness | from shank to 24-inch station | ±0.030 |
| | from 30-inch station to tip | ±0.025 |
| Basic diameter 14 feet 0 inches and over: | | |
| Blade width | from shank to 30-inch station | ±3/32 |
| | from 36-inch station to tip | ±1/16 |
| Blade thickness | from shank to 30-inch station | ±0.040 |
| | from 36-inch station to tip | ±0.035 |

(vi) No repairs are permitted to the shanks (roots, or hub ends) of aluminum alloy adjustable pitch blades. The shanks must be within drawing tolerances.

(vii) (*a*) Upon completion of repairs, horizontal and vertical balance should be checked and any unbalance should be corrected as recommended by the manufacturer. A coaxial hole is drilled in the butt end of certain aluminum alloy detachable blades for the application of lead to obtain static horizontal balance. The size of this hole should not be increased by the repair agency.

(*b*) To effect vertical balance, only the manufacturer is permitted to drill and apply lead to an eccentric hole. The outside of this hole should be no closer than one-fourth inch to the nearest external blade surface. As an alternate to drilling the two holes mentioned above, the manufacturer may have drilled a single eccentric hole having a diameter and depth conforming to the eccentric hole dimensions, given in the table below, for the application of lead. The outer edge of this hole should not be closer than 1 inch to the nearest external blade surface. The ends of all balancing holes should be finished with a full sized drill having a spherical end to eliminate sharp corners. The sharp edges of all holes should be removed by a one-thirty-second-inch chamfer. The following table is included for inspectional information only as no drilling is to be done by anyone other than the manufacturer:

SIZE AND DEPTH OF BALANCING HOLES

| Shank size | Maximum concentric hole diameter | Maximum concentric hole depth | Maximum eccentric hole depth (⅜ inch maximum diameter) |
|---|---|---|---|
| | *Inch* | *Inches* | *Inches* |
| 00 | 7/16 | 2½ | 2¼ |
| 0-V2 | 19/32 | 3⅜ | 3 |
| ½ | ⅝ | 3⅝ | 3½ |
| 1 | ¾ | 4¼ | 4 |
| 1½ | 13/16 | 4⅞ | 4½ |
| 2 | ⅞ | 5½ | 5 |
| 3 | 31/32 | 6⅛ | 6 |

(4) *Steel hubs and hub parts.* Repairs to steel hubs and parts are of a major nature, and should be accomplished only on the manufacturer's recommendations. Welding of hubs, hub parts, or control parts is not permissible. Remachining is permissible only when covered by manufacturer's service bulletins.

(i) When the propeller bolt holes in a hub or crankshaft flange for fixed propellers become damaged or oversized, it is permissible to make repairs by method (A) or (B) in figure 15-7, or by use of aircraft standard bolts one-sixteenth inch larger than the original bolts. The repairs should be made in accordance with the recommendations of the propeller metal hub manufacturer who is usually the engine manufacturer. Obtain from the engine or propeller hub manufacturer, suitable flange bushings with threaded or smooth bores, as illustrated in method (A) or (B) of figure 15-7. Drill the flange and insert the bushings as recommended by the engine manufacturer. Drill the rear face of the propeller to accomodate the bushings, and protect the holes with two coats of aluminum paint or other high moisture-resistant coating. Use bolts of the same size as those originally used. Any of the following combinations may be used: Safety bolt and castellated nut, safety bolt (drilled head) and threaded bushing, or undrilled bolt and self-locking nut. Where it is desirable to use oversize bolts, obtain suitable aircraft standard bolts one-sixteenth inch larger than the original bolts. Enlarge the crankshaft propeller flange holes and the propeller hub holes sufficiently to accomodate the new bolts without more than 0.005 inch clearance. Such reboring will be permitted only once. Further repairs of bolt holes may be made in accordance with method (A) or (B) of figure 15-7.

NOTE: Method (A) or (B) is preferred over the over-size bolt method, because a propeller hub flange redrilled in accordance with this latter method will always require the redrilling of all new propellers subsequently used with the redrilled flange.

(5) *Control systems.* Components used to control the operation of certificated propellers should be inspected, repaired, assembled and tested in accordance with the manufacturer's recommended practice. It is recommended that all necessary replacement parts be those made under the control of the propeller manufacturer. It is recommended that only those repairs which are covered by manufacturer's recommendations be made.

(6) *De-icing systems.* Components used in propeller de-icing systems should be inspected, repaired, assembled, and tested in accordance with the manufacturer's recommended practice. It is recommended that all necessary replacement parts be those made under the control of the propeller manufacturer. It is recommended that only those repairs which are covered by manufacturer's recommendations be made.

(c) *Overhaul of propellers*—(1) *General.* Periodic overhaul of controllable pitch propellers is classified as a major repair in § 18.1-1, and includes the following operations:

Assembly and disassembly.
Replacement of worn parts.
Magnetic particle inspection, fluorescent penetrant inspection, anodizing, acid etching.

De-plating, and re-plating.

(2) *Hub and hub parts.* (i) Propellers submitted for overhaul should be disassembled, and all hub parts should be

cleaned in accordance with the manufacturer's recommendations. An inspection of the parts should be made to determine that the critical dimensions are within the manufacturer's specified tolerances. Particular care should be taken to check the 90° relation between shaft bore and blade socket centerline and track of the blade sockets, as these are the dimensions which are most likely to be affected by accidents Any hub which is sprung should be rejected. Worn or damaged parts should be replaced. Stress raisers such as cuts, nicks, or tool marks should be carefully stoned out or the part rejected. Splines and cone seats should be carefully inspected for signs of wear. Splines should be checked with a single key "no-go" gage made to plus 0.002 inch of the base drawing dimensions for spline land width. If the gage enters more than 20 percent of the spline area, the hub should be rejected. Cones and cone seats may show discoloration, pitting, and corrosion. Generally, corrosion and discolored spots may be removed by light lapping. Pitting is not grounds for rejection if 75 percent of the bearing area is not affected and the pitted areas are well dispersed about the cone bearing area. After cleaning, steel hubs and parts should be minutely inspected for cracks by the wet or dry magnetic particle method at every major overhaul period. It is not necessary to remove the plating or special external finish for this inspection unless so specified in the manufacturer's recommended practice. A brief statement recording the inspection and its findings should be included in the aircraft record entry. A similar entry should be made in the repair records of the repair base. In the case of an air carrier, this is considered the equivalent of the record entry. Any crack is cause for rejection.

(ii) Steel hubs which adapt fixed-pitch propellers to 0 taper crankshafts are susceptible to cracks along the keyway which often extend into the flange lightening holes. These hubs should be carefully inspected by the magnetic particle method at engine overhaul periods. Any crack is cause for rejection.

(3) *Plating for hubs and parts.* Plated hubs and parts from which the plating has been removed should be replated after they have been satisfactorily inspected. All replating must be of the same material as the original plating, and should be done in accordance with the manufacturer's recommendations. Chrome or nickel plating is not an acceptable substitute for cadmium or zinc plating. The use of zinc chromate primer on the external surfaces followed by a coating of aluminum lacquer in lieu of cadmium plating is considered acceptable where recommended by the manufacturer. However, this type of finish will require replacement more frequently than cadmium plating.

(4) *Aluminum propellers and blades.* Aluminum propellers and blades should be carefully inspected for cracks and material defects by either etching or anodizing. Etching is accomplished by immersing as much of the blade as possible in a warm 20 percent caustic soda solution and cleaning with a warm 20 percent nitric acid solution, with a warm water rinse between the caustic bath and the acid bath, and also a warm water rinse following the acid bath. All effects of the etching should be removed by polishing. The caustic and acid solutions should be maintained at a temperature of from 160° F. to 180° F. Some blades incorporate parts made of steel and other materials, and the caustic soda and the nitric acid must not be allowed to come in contact with these parts. The blade surfaces are then examined with a magnifying glass of at least three-power. A crack will appear as a distinct black line. The fluorescent penetrant method is recommended as a supplement to the caustic etch for the inspection of the shanks (roots or hub ends) of adjustable pitch blades.

(i) Suspected cracks or defects should be repeatedly locally etched until their nature is determined. With a No. 00 sandpaper, or fine crocus cloth, clean and smooth off the area containing the apparent crack. Apply a small quantity of caustic solution to the suspected area with a swab or brush. After the area is well darkened, thoroughly wipe it off with a clean (dampened) cloth. Too much water may entirely remove the solution from a crack and spoil the test. If a crack extending into the metal exists, it will appear as a dark line or mark, and by using a magnifying glass, small bubbles may be seen forming in the line or mark. Immediately upon completion of the final checks, all traces of the caustic solution will be removed by the nitric acid solution. Wash the blade thoroughly with clean (fresh) water.

(ii) The chromic acid anodizing process is superior to caustic etching for the detection of cracks and flaws and should therefore be used, whenever it is available, for general inspection of blades for material defects and for final checking of repairs performed during overhaul. The blades should be immersed in the anodizing bath as far as possible, but all parts not made of aluminum alloy must either be kept out of the chromic acid bath or be separated from the blade by nonconductive wedges or hooks. The anodizing treatment should be followed by a rinse in clear, cold, running water for 3 to 5 minutes, and the blades should then be dried as quickly as possible, preferably with an air blast. The dried blades should stand for at least 15 minutes before examination. Flaws (cold shuts or inclusions) will appear as fine black lines. Cracks will appear as brown stains caused by chromic acid bleeding out onto the surface. The blades may be sealed for improved corrosion resistance by immersing them in hot water (180° F. to 212° F.) for one-half hour. In no case should the blades be treated with hot water before the examination for cracks, since heating expands any cracks and allows the chromic acid to be washed away. A transverse (chordwise) crack or flaw of any size is cause for rejection. An excessive number of longitudinal flaws is cause for rejection. Any unusual condition or appearance revealed by caustic etching or anodizing should be referred to the manufacturer.

(5) *Assembly.* Assembly of the propeller hub and blades should be accomplished in accordance with the manufacturer's recommendations. Clevis pins, bolts, and nuts which show wear or distortion should be replaced. Cotter pins and safety wire should never be used a second time. The use of self-locking nuts is permissible only where originally used or approved by the manufacturer.

(d) *Assembly of propeller to engine*—(1) *Fixed-pitch propellers.* Loose hub bolts and bolts installed through the lightening holes in the integral hub flange of certain engine crankshafts cause the majority of the serious difficulties experienced with fixed-pitch propellers. Either of the conditions, if uncorrected, will ultimately cause the loss of the propeller.

(i) Loose hub bolts cause elongated bolt holes and damage to the hub bolts. When not corrected, the bolts break off or friction causes enough heat to affect the glue and char the wood. After successive running, checks start at the bolt holes. These checks are caused, or at least accentuated, by shrinkage of the wood due to the excessive heat generated. If allowed to progress, the propeller usually flies apart or catches fire.

(ii) On some engines equipped with a crankshaft having an integral propeller hub flange, the outer edge of the lightening holes is at the same radius as the corresponding edge of the propeller hub bolt holes. When inserting the bolts through the propeller, care must be exercised so that the bolts are inserted through the proper holes in the flange. Cases have been reported where the bolts were inserted through the larger lightening holes and, accordingly the bolt nuts bore only on the outer edges of the lightening holes. In such cases, continued running of the propeller may cause the bolt heads or nuts to slip off the flange and though the large openings in the flange, resulting in the subsequent loss of the propeller.

(iii) Both of the conditions discussed above are very easy to detect, and should be corrected immediately by a certificated mechanic or certificated repair station. In case the hub flange is integral with the crankshaft, first ascertain that the bolts are properly installed. Then make the inspection for bolt tightness in the same manner as for any other propeller hub. Use an open end wrench to determine hub bolt tightness and if the nuts can be turned, remove the cotter keys and draw up the nuts to the desired setting. Hub bolts should be tightened, preferably with a torque wrench, to the recommended values which usually range from 15 to 23 foot-pounds. If no torque wrench is available, an ordinary socket wrench may be used. This socket wrench should have a 1-foot extension lever and the wrench pulled up with the recommended force, 12 inches away from the center of the bolt which is being tightened. The tightening is best accomplished by tightening each bolt a little at a time, being sure to tighten alternate bolts which are diametrically opposite. Care should be taken not to overtighten the hub bolts, thereby damaging the wood underneath the hub flanges. The practice of overtightening bolts to draw a propeller into track should definitely be avoided. Safetying of the nuts should be accomplished by means of cotter keys of the proper size, or heavy safety wire twisted between each nut. A continuous length of single safety wire should never be used as wire failure will result in all nuts becoming unsafetied.

(e) *Alterations to propellers*—(1) *General.* All alterations to propellers should be made in accordance with the manufacturer's recommendations.

(2) *Alterations to wood detachable blades and fixed-pitch propellers.* It has been found that the service life of wood blades and propellers covered with plastic greatly exceeds the service life of those finished with varnish. It is permissible to strip the varnish from any propeller or blade and apply the plastic covering even though the propeller or blade, when new, had not been approved for this process. The nature of the process classifies it as a major alteration. Only those manufacturers and certificated repair stations who have received specific approval for the plastic covering process are eligible to reprocess in the same manner any propeller or blade. Any propeller or blade thus altered should carry some means of identification to indicate the change. It is permissible for a manufacturer to obtain approval for, and to assign new model numbers to propellers and blades of his own design and manufacture thus reprocessed. It is recommended that certificated repair stations and manufacturers reprocessing propellers and blades not of their own design and manufacture, apply some symbol to the model or serial number. This symbol or means of identification must be approved by the Administrator. It has also been found in some cases advantageous to replace the tipping fabric with a thin plastic covering. This is also classified as a major alteration, and must be performed by only those manufacturers and certificated repair stations who have received specific approval for the process.

(f) *Precautions*—(1) *General.* Many persons have been fatally injured by walking into whirling propellers. Painting a warning stripe on the propeller serves to reduce chances of such injuries. Approximately 4 inches of the propeller tips should be covered on both sides with an orange-yellow nonreflecting paint or lacquer. The drain holes in the metal tipping of wood blades should be opened up after the tips have been painted.

(2) *Wood propellers.* Wood propellers are especially susceptible to damage from improper handling. When moving an airplane, special care should be exercised to avoid bumping the propeller. The practice of pushing or pulling on a propeller blade to move an airplane should be avoided; it is extremely easy to impose forces on a blade in excess of those for which the blade is designed. It is continually necessary to ascertain that the glue joints are in good condition and that the finish on the entire propeller will protect the propeller from absorbing moisture. Two-bladed wood propellers should always be left or stored, whether on or off of an airplane, in a horizontal position to prevent unbalance from moisture absorption. A good precaution is to cover the propeller with a well fitting waterproof cover when not in use. It is very important to protect the shank section of wood blades from moisture changes to prevent swelling and subsequent loosening in the metal sleeve. In the case of varnished blades, it is advisable to occasionally apply varnish around the shank at the junction of wood and metal. In the case of the plastic covered blade, repair cement may be applied around the same joint.

(3) *Composition propellers.* In certain cases where the blade has been manufactured from laminated planks of composition material, longitudinal cracks or splitting between laminations have been observed after several hundred hours of operation. These cracks dare not progress beyond definite limits as covered by the manufacturer's service bulletin.

§ 18.30–16 *Weight and balance control (CAA policies which apply to § 18.30)*—(a) *General.* (1) The purpose of the following is to explain various items concerned with aircraft weight and balance. It covers computation of actual weight and balance, and its relation to aircraft operation within its approved limitations.

(2) The removal or addition of equipment results in changes to the center of gravity and empty weight of the aircraft, and the permissible useful load is affected accordingly. Obviously the effects of these changes should be investigated in all cases otherwise the flight characteristics of the airplane may be adversely affected.

(3) Information on which to base the record of weight and balance changes to the aircraft may be obtained from the pertinent aircraft specification, the prescribed aircraft operating limitations, and the latest approved Form ACA–337.

(4) Reference should be made to §§ 18.1–1 and 18.1–4 (a) (1), for information on specific cases wherein weight and balance checks need not be made. Since rotor wing aircraft are in general more critical with respect to control with changes in c. g. positions, the procedures and instructions in the particular model maintenance or flight manual should be followed.

(5) Terminology: The following terminology is used in the practical application of weight and balance control.

(i) *Maximum weight.* The maximum weight is the maximum authorized weight of the aircraft and its contents as listed in the specifications.

(ii) *Empty weight.* The empty weight of an aircraft includes all operating equipment that has a fixed location and is actually installed in the aircraft. It includes the weight of the airframe, powerplant, required equipment, optional and special equipment, fixed ballast, full engine coolant, hydraulic fluid, and the fuel and oil as explained in paragraph (b) (6) and (7) of this section. Additional information regarding fluids which may be contained in the aircraft systems and which must be included in the empty weight will be indicated in the pertinent aircraft specifications whenever deemed necessary.

(iii) *Useful load.* The useful load is the empty weight subtracted from the maximum weight of the aircraft. This load consists of the pilot, crew if applicable, maximum oil, fuel, passengers, and baggage unless otherwise noted.

(iv) *Weight check.* A weight check consists of checking the sum of the weights of all items of useful load against the authorized useful load (maximum weight less empty weight) of the aircraft.

(v) *Datum.* The datum is an imaginary vertical plane or line from which all horizontal measurements are taken for balance purposes with the aircraft in level flight attitude. The datum is indicated on most aircraft specifications. On some of the older aircraft where the datum is not indicated, any convenient datum may be selected. However, once the datum is located all moment arms and the location of the permissible c. g. range must be taken with reference to it. Examples of typical locations of the datum are shown in figure 16–1.

(vi) *Arm (or moment arm).* The arm is the horizontal distance in inches from the datum to the center of gravity of an item. The algebraic sign is plus (+) if measured aft of the datum and minus (−) if measured forward of the datum. Examples of plus and minus arms are shown in figure 16–2.

(vii) *Moment.* Moment is the product of a weight multiplied by its arm. The moment of an item about the datum is obtained by multiplying the weight of the item by its horizontal distance from the datum. A typical moment calculation is given in figure 16–3.

(viii) *Center of gravity.* The center of gravity is a point about which the nose-heavy and tail-heavy moments are exactly equal in magnitude. If the aircraft were suspended therefrom it would have no tendency to pitch in either direction (nose up or down). The weight of the aircraft (or any object) may be assumed to be concentrated at its center of gravity.

(ix) *Empty weight center of gravity.* The empty weight c. g. is the center of gravity of an aircraft in its empty weight condition, and is an essential part of the weight and balance record. Formulas for determining the center of gravity for tail and nose-wheel type aircraft are given in figure 16–4. Typical examples to determine the empty weight and c. g. for the tail-wheel and nose-wheel type aircraft are determined by computation in figures 16–5 and 16–6.

(x) *Empty weight center of gravity range.* The empty weight center of gravity range is determined so that when the empty weight c. g. falls within this range the specification operating c. g. limits will not be exceeded under standard specification loading arrangements. In cases where it is possible to load an airplane in a manner not covered in the aircraft specification (i. e., extra tanks, extra seats, etc.), complete calculations should be accomplished, as outlined in paragraph (c) (5) (vi) of this section.

The empty weight c. g. range, when applicable, is listed on the aircraft specifications.

(xi) *Operating center of gravity range.* The operating c. g. range is the distance between the forward and rearward center of gravity limits indicated on the pertinent aircraft specification. These limits were determined as the most forward and most rearward loaded c. g. positions at which the aircraft meets the requirements of the Civil Air Regulations. The limits are indicated on the specification in either percent of MAC or inches from the datum. The c. g. of the loaded airplane must be within these limits at all times as illustrated in figure 16–7.

(xii) *Mean aerodynamic chord (MAC).* The MAC is the mean chord of the wing. For weight and balance purposes it is used to locate the c. g. range of the aircraft. The location and dimensions of the MAC will be found in the Aircraft Specification, Flight Manual, or the Aircraft Weight and Balance Record.

(xiii) *Weighing point.* If the c. g. location is determined by weighing, it is necessary to obtain horizontal measurements between the points on the scales at which the airplane's weight is concentrated. If usual weighing practice is followed, a vertical line passing through the centerline of the axle will locate the point on the scale at which the weight is concentrated. This point is called the Weighing Point. Other structural locations, capable of supporting the aircraft, such as jack pads on the main spar, may also be used. These points should be clearly indicated in the weight and balance record when used in lieu of the usual points. Typical locations of the weighing points are shown in figure 16–8.

(xiv) *Minimum fuel.* Minimum fuel for balance purposes is one-twelfth gallon per maximum-except-takeoff horsepower (METO), and is the maximum amount of fuel which should be used in weight and balance computations when low fuel might adversely affect the most critical balance conditions. To determine the weight of fuel in pounds divide the METO horsepower by 2.

(xv) *Full oil.* Full oil is the quantity of oil shown in the aircraft specifications as oil capacity. Full oil should always be used as the quantity of oil when making the loaded weight and balance computations.

(xvi) *Tare.* Tare is the weight of chocks, blocks, stands, etc., used when weighing aircraft, and is included in the scale readings. Tare is deducted from the scale reading to obtain the actual aircraft weight.

(b) *Weighing procedure.* The following procedure should be followed when weighing an aircraft:

(1) The aircraft should be weighed inside a closed building to prevent error in scale reading due to wind.

(2) Excessive dirt, grease, moisture, etc., should be removed from the aircraft before weighing.

(3) If the center of gravity is to be determined, the aircraft should be placed in a level flight attitude.

(4) All items of equipment to be installed in the aircraft and included in the certificated empty weight should be in place for weighing. These items of equipment should be a part of the current weight and balance record. (See paragraph (c) (5) of this section.)

(5) Scales should be properly calibrated, zeroed, and used in accordance with the scale manufacturer's instructions. The scales, and suitable supports for the aircraft if necessary, are usually placed under the wheels of a land plane, the keel of a seaplane float, or the skis of a ski plane. Other structural locations capable of supporting the aircraft such as jack pads on the main spar also may be used. These points should be clearly indicated in the weight and balance data.

(6) Unless otherwise noted in the aircraft specification, the fuel system should be drained until the quantity indicator reads zero or empty with the aircraft in level flight attitude. The amount of fuel remaining in the tank, lines, and engine is termed residual fuel and it should be included in the empty weight. In special cases the aircraft may be weighed with full fuel in the fuel tanks provided a definite means of determining the exact weight of the fuel is available.

(7) Unless otherwise noted in the aircraft specification, the oil system should be completely drained with all drain cocks open. Under these conditions, the amount of oil remaining in the oil tank, lines, and engine is termed, "residual oil" and it should be included in the empty weight. When weighed with full oil, actual empty weight equals the actual recorded weight less the weight of the oil in the oil tank (oil capacity in gallons×7.5 pounds). All reports should indicate whether weights include full oil or oil drained (see figure 16–9).

(8) Brakes should not be set while taking scale reading.

(9) Tare should be noted when the aircraft is removed from the scales.

(c) *Weight and balance computations.* It is often necessary, after completing an extensive repair or alteration, to establish by computation that the authorized weight or c. g. limits as shown on the aircraft specifications are not exceeded. The following information explains the significance of algebraic signs used in balance computations, outlines the loading conditions to check, and deals with equipment changes. The aircraft specifications contain the following information relating to the subject:

C. G. range.
Empty weight c. g. range when applicable.
MAC (Mean Aerodynamic Chord).
Leveling means.
Datum.
Maximum weights.
Number of seats and arm.
Maximum baggage and arm.
Fuel capacity and arm.
Oil capacity and arm.
Equipment items and arm.

(1) *Unit weights for weight and balance purposes.*

| | |
|---|---|
| Gasoline | 6 pounds per U. S. gal. |
| Lubricating oil | 7.5 pounds per U. S. gal. |
| Crew and passengers | 170 pounds per person. |

(2) *Algebraic signs.* (i) Care should be exercised to insure retention of the proper algebraic sign (+ or −) throughout all balance computations and to always visualize the aircraft (for the sake of uniformity in these computations) with the nose to the left. In this position any arm to the left (forward) of the datum is minus and any arm to the right (rearward) of the datum is plus. Any item of weight added to the aircraft either side of the datum is a plus weight. Any weight item removed is a minus weight. When multiplying weights by arms, the answer is plus if the signs are alike and minus if the signs are unlike.

(ii) The following combinations are possible:

Items added forward of the datum—
(+) weight × (−) arm = (−) moment.
Items added to the rear of the datum—
(+) weight × (+) arm = (+) moment.
Items removed forward of the datum—
(−) weight × (−) arm = (+) moment.
Items removed rear of the datum—
(−) weight × (+) arm = (−) moment.

(iii) The total weight of the airplane is equal to the weight of the empty airplane plus the weight of the items added, minus the weight of the items removed.

(iv) The total moment is equal to the moment of the empty airplane combined with the individual moments of the items added or removed. In combining moments, plus moments are added and minus moments are subtracted.

(3) *Weight and balance extreme conditions.* The weight and balance extreme conditions represent the maximum forward and rearward c. g. positions for the aircraft. Information showing that the c. g. of the aircraft (usually in the fully loaded condition) falls between the extreme conditions should be included in the weight and balance data. The extreme conditions may be determined either by weighing or computation.

(i) *Forward weight and balance check.* When a forward weight and balance check is made, it should be established that neither the maximum weight nor the forward c. g. limit listed in the aircraft specifications are exceeded. In making this check, the following information should be obtained:

(*a*) The weight, arm, and moment of the aircraft empty.

(*b*) The maximum weights, arms, and moments of the items of useful load which are located ahead of the forward c. g. limit.

(*c*) The minimum weights, arms, and moments of the items of useful load which are located aft of the forward c. g. limit.

A typical example of the computations necessary to make this check using the above data is shown in figure 16–10.

(ii) *Rearward weight and balance check.* When a rearward weight and balance check is made, it should be established that neither the maximum weight nor the rearward c. g. limit listed in the aircraft specification are exceeded. In making this check, the following information should be obtained:

(*a*) The weight, arm, and moment of the aircraft empty.

(*b*) The maximum weights, arms, and moments of the items of useful load which are located aft of the rearward c. g. limit.

(*c*) The minimum weights, arms, and moments of the items of useful load which are located ahead of the rearward c. g. limit.

A typical example of the computation necessary to make this check using the above data is shown in figure 16–11.

(4) *Loading conditions and/or placards.* (i) If the following items have not been covered in the weight and balance extreme condition checks, or are not covered by suitable placards in the aircraft, additional computations should be made. These computations should indicate the permissible distribution of fuel, passengers, and baggage which may be carried in the aircraft at any one time without exceeding either the maximum weight or the c. g. range. The conditions to check are:

(*a*) With free fuel, determine the number of passengers and baggage permissible.

(*b*) With maximum passengers, determine the fuel and baggage permissible.

(ii) Examples of the computations for the above items are given in figures 16–12, 16–13, and 16–14, respectively. The above cases are mainly applicable to the lighter-type personal aircraft. In the case of the larger-type transport aircraft, a variety of loading conditions is possible and it is usually necessary to have changes in the loading schedule approved separately by the CAA.

(5) *Equipment list.* (i) A list of the equipment included in the certificated empty weight may be found in either the approved airplane operating manual or the weight and balance data. All required, optional, and special equipment installed in the aircraft at time of weighing and/or subsequent equipment changes should be entered in the aircraft operating limitations.

(ii) Required equipment items are items so listed in the pertinent aircraft specification.

(iii) Optional equipment items are so listed in the pertinent aircraft specification and may be installed in the aircraft at the option of the owner.

(iv) Special equipment is any item not corresponding exactly to the descriptive information in the aircraft specification. This includes such items as flares, instruments, ash trays, radios, navigation lights, carpets, etc.

(v) Required and optional equipment may be shown on the equipment list by making reference to the pertinent item number listed in the applicable specification only when they are identical to that number item with reference to description, weight, and arm given in the specification. All special equipment items should be shown by making reference to the item by name, make, model, weight, and arm. When the arm for such an item is not available, it should be obtained by actual measurement.

(vi) Equipment changes: The owner should see that a continuous record for each aircraft is kept, listing all changes affecting the weight, c. g. location, and equipment changes in order that a computed weight and c. g. location may be established at any time. An entry should be made on the equipment list indicating the items added, removed, or relocated, and the date accomplished. The identification of the repair agency should be included. Examples of items so affected are the installation of extra fuel tanks, seats, or baggage compartments. Figure 16–15 illustrates the effect on balance when equipment items are added within the acceptable c. g. limits and fore and aft of the established c. g. limits. Moment computations for typical equipment changes are given in figure 16–16 and are also included in the sample weight and balance sheet in figure 16–18.

(6) *Sample weight and balance reports.* Suggested methods of tabulating the various data and computations for determining the c. g., both in the empty weight condition and the fully loaded condition, are given in figures 16–17 and 16–18, respectively. The data presented in figure 16–17 have previously been computed in figure 16–5 and represent a suggested means of recording this information. The data presented in figure 16–18 have previously been computed in figures 16–10 and 16–11 for the extreme loading conditions, and figure 16–16 for equipment change, and represent a suggested means of recording this information.

(d) *Installation of ballast.* (1) Ballast is sometimes permanently installed for c. g. balance purposes resulting from the installation or removal of equipment times and should not be used to correct a nose-up or nose-down tendency of an aircraft. It is usually located as far aft or as far forward as possible in order to bring the c. g. position within acceptable limits with a minimum of weight increase. Permanent ballast is often in the form of lead plate wrapped around and/or bolted to the fuselage primary structure (tail-post, longerons, or bulkhead members). Permanent ballast invariably constitutes a concentrated load; accordingly, the strength of the local structure and the attachment of the ballast thereto should be investigated for the design loading conditions pertinent to the particular aircraft. Permanent ballast should be placarded: "Permanent ballast, do not remove." It is not desirable to install permanent ballast by pouring melted lead into the tail-post or longerons, due to difficulties that may be encountered in subsequent welding repair operations. It should be noted that the installation of permanent ballast results in an increase of aircraft empty weight.

(2) When disposable ballast is carried, the local strength of the compartment in which the ballast is carried, and the effect of the ballast on the aircraft balance and weight should be investigated.

(e) *Loading schedule.* (1) The loading schedule should be kept with the aircraft and usually forms a part of the airplane flight manual. It includes instructions on the proper load distribution, such as filling of fuel and oil tanks, passenger seating, restrictions of passenger movement, distribution of cargo, etc.

(2) Other means of determining safe loading conditions, such as the use of a graphical index, load adjuster, etc., are acceptable and may be used in lieu of the information in paragraph (c) (4) of this section.

(3) A separate loading condition should be computed when the aircraft is to be loaded in other than the specified conditions shown in the loading schedule.

§ 18.30–17 *Procedures and guiding comments covering typical major alterations and modifications (CAA policies which apply to § 18.30)*—(a) *The installation of an engine of a type other than that covered by a type certificate or otherwise approved by the Administrator.* (1) It is generally understood that the purpose of most changes involving the installation of an engine of a type other than that covered by the original approval is to permit full advantage to be taken of improvements in engine performance which do not involve a material increase in engine weight. This is of direct benefit to the operator of the airplane, as it increases safety of operation and/or performance by improving takeoff, climb, single-engine performance, true cruising speeds at altitude, engine reliability, and engine life between overhauls, with few (if any) changes in the aircraft structure. It should be carefully noted that these benefits will be difficult to obtain if the changes made require or involve an increase in the originally approved airplane gross weight or placard speeds. If the changes result in an increase in placard speeds, it will be necesary in any event to reinvestigate the structure for compliance with flutter prevention measures. Before making a change in engine it is always advisable for an owner to contact the manufacturer of the make of airplane involved to learn if the proposed change has ever been approved by the Administrator. If there is a record of approval, it is often a relatively simple matter to revise the airplane to conform with the manufacturer's approved data.

(2) The general procedure to be followed, when the rated power of the engine to be installed exceeds that originally used for design purposes or exceeds the rated power of the engine being replaced, is described in the following paragraphs. It consists, briefly, in substantiating the strength of the engine mount and adjacent structure for the takeoff (1 minute) power and for the local increase in weight, if any, and in limiting the engine output and indicated speeds for subsequent posting in the aircraft. The engine placard limits differentiate between the power permitted for continuous operation (maximum, except takeoff), and that which has been approved for takeoff only (takeoff, 1 minute). The following procedure applies to modifications of existing designs but the principles will also apply to new designs under consideration.

(3) To expedite handling and to reduce the usual exchange of correspondence to a minimum, the applicant for approval of the change should always supply a complete description of the proposed engine replacement. When an individual airplane is being modified it should be identified in the correspondence as to name of manufacturer, model

designation, manufacturer's serial number and identification mark. In addition, a new or revised airplane model designation should be selected to distinguish it from the original model. The current status of the engine to be used should be determined prior to the completion of any extensive changes. CAA field inspection personnel are supplied with this information and they will assist in the determination of the status of the engine in question. Copies of the approved engine specification can be obtained from CAA Office of Aviation Information, Department of Commerce, Washington 25, D. C.

(4) The data submitted should include a comparison of the weights of the original and proposed engine installations. Appendix I of the "Repair and Alteration Manual" will be found useful in rechecking the balance. The aircraft specification includes the approved center of gravity range.

(5) Changes in engine mount structure and the local effects of an increase in engine weight must, of course, be investigated. The extent of such investigation will depend largely upon the amount of increased power the applicant desires to use in takeoff (1 minute) and the remaining operations.

(6) (i) *Airspeed placard limits.* (*a*) There are some certificated airplanes in service which do not display the placard speeds specified in the current requirements. These airplane models were approved prior to the application of the 1934 edition of Aeronautics Bulletin No. 7-A in which the requirements for airspeed placards first appeared in the airplane regulations. In these cases when the rated power of the engine being installed exceeds that of the engine installation originally approved, the following airspeed limits should be displayed:

Level flight or climb: $V_L$

Glide or dive: 1.2 $V_L$ is the actual indicated high speed in level flight obtainable with the power of the engine originally used.

(*b*) If the applicant for approval wishes to raise these placard limits, there are no objections to his investigation of the case. The current requirements will serve as a guide for determining which components of the airplane and pertinent loading conditions or design criteria involve a consideration of design airspeeds. For cases in which airspeed placard limits were determined as part of the original approval, the use of an engine with rated power in excess of that originally used for design purposes will not require changes of the original airspeed placard limits. However, as previously mentioned, an attempt to increase these placard speeds will represent a revision of the basic structural design data and as such will usually require an appreciable amount of reinvestigation for purposes of determining whether the airplane structure can withstand the airloads incident to the increased performance. As a rule only the airplane manufacturer or an experienced engineer can efficiently make the necessary investigations. The Administrator does not initiate such studies.

(ii) *Engine placard limits.* (*a*) The airplanes discussed above in most instances do not display the engine placard limits specified in the current requirements. In these cases when the rated power of the engine being installed exceeds that of the engine installation being replaced the following engine operation limits should be displayed:

Maximum, except takeoff horsepower, not to exceed the output of the originally approved engine installation which is being replaced.

Takeoff (1 minute) horsepower, limited by:

Approved takeoff rating of engine.
Status of propeller used.
Strength of engine mount structure.
Fuel flow capacity.
Engine cooling requirements.

(*b*) For cases in which engine placard limits were determined as part of the original approval of the airplane, the use of an engine with rated power different from that of the engine being replaced will require the display of new placard limits corresponding with the maximum permissible output determined by the following:

Maximum, except takeoff horsepower, limited by:

Approved rating of engine.
Status of propeller used.
Strength of engine mount structure.
Fuel flow capacity tests. (There are a few supercharged installations for which the maximum, except takeoff, rating is greater than the takeoff rating. Therefore, the maximum, except takeoff power, is used in determining the fuel flow required.)
Full power longitudinal stability characteristics with rearmost center of gravity.
Engine cooling tests.
Design power used in original analysis.

Takeoff (1 minute) horsepower, limited by items listed above.

(iii) *Inspection and flight tests.* (*a*) Following receipt and approval by the Administrator of file data satisfactorily accounting for the change in engine as discussed in the foregoing paragraphs, the usual inspection and a recheck of certain flight tests will be authorized. The extent of the flight tests will depend upon the nature of the replacement with respect to the original approval.

(*b*) It will be of interest to designers to note that provision for future increases in engine power and airplane performance can easily be made in the original design by the following methods:

(*1*) Assume a power loading of 12 pounds per horsepower in determining the maneuvering load factors.

(*2*) Design the engine mount, adjacent structure, and powerplant installation for the maximum power which might possibly be used in the future.

(*3*) Assume a design level speed ($V_L$) considered high enough for all future operations. In this connection it should be noted that speed placards refer to "indicated" airspeeds and that the corresponding actual airspeed may therefore exceed the placard speed at altitudes above sea level.

(b) *The conversion of an approved type landplane or seaplane to approved skiplane status.* There are two distinct steps involved in obtaining the Administrator's aproval of an airplane equipped with skis. These are as follows:

Approval of the ski model.
Approval of the airplane equipped with approved skis.

It should be noted that the approval of a ski and the approval of a ski installation are two separate cases. The Administrator's approval of a ski for a specified static load for quantity production under a type certificate does not imply approval of the ski installed on any certificated airplane. It means only that the ski itself is satisfactory. This is true also in the case of a single set of skis where no type certificate is involved.

(1) *Approval of the ski model.* The strength of all skis must be substantiated before they may be used on certificated aircraft, whether or not the designer or manufacturer desires to obtain a type certificate for the skis.

(2) *Approval of an airplane equipped with approved skis.* Certain airplane models are already approved with certain specific approved skis installed. The owner of a certificated airplane of some such model wishing to install skis, need only install skis of the model with which airplanes of his model are approved and his airplane will be approved with the skis installed, upon the satisfactory completion of an inspection of the installation by a CAA representative. Should changes in the landing gear be necessary to accommodate the skis, the owner, of course, must make the changes in accordance with the change data approved by the Administrator. If the airplane is of a model which has not been approved with the installation of skis of the particular approved model it is desired to install, the procedure hereinafter outlined should be followed:

(i) Technical data showing any changes in the landing gear should be submitted to the Administrator for approval. This is not often necessary, as skis are usually designed to attach to the axles in place of the wheels.

(ii) Upon approval of the change data, if any, the installation must pass a satisfactory inspection by a representative of the Administrator.

(iii) During this inspection, the representative will obtain the weight of the ski installation and the weight of the wheel installation which has been replaced.

(iv) Upon completion of a satisfactory inspection, the representative will witness takeoffs and landings, and other demonstrations if deemed necessary, of the airplane equipped with skis. The characteristics of the airplane equipped with skis must be acceptable to the Administrator's representative.

(v) If the airplane inspected and tested is a standard airplane of a certain model and the skis installed are approved under a type certificate and manufactured under a production certificate or if the skis are manufactured under an approved type certificate, all airplanes of this model will be considered eligible for approval when equipped with skis of the model installed on the airplane inspected. The aircraft specification will identify the approval accordingly.

(vi) If the skis installed are not approved under an approved type certificate or were not manufactured under a production certificate, each airplane so equipped must undergo the tests above in order to be eligible for approval. The notes on the pertinent aircraft specification will list this distinction.

(c) *Increase in gross weight.* An increase in gross weight will naturally require that the structure be able to withstand greater loads in flying and landing. There is usually involved, therefore, a study of the original design data and the preparation of a partial strength analysis, preferably by the manufacturer of the airplane. Likewise, the flying characteristics will be affected, so flight tests are usually required. Increases in weight are often accompanied by changes in weight distribution, the effects of which are covered in § 18.1–2 (c). Increases in gross weight for specific industrial purposes, such as crop dusting, may be permitted, provided that the requirements of Part 8 (restricted category) of this subchapter (i. e. the Civil Air Regulations) have been complied with.

(d) *Change in weight distribution.* (1) Any change in the location of items having considerable weight or the addition of new items (equipment, etc.) may have serious effects on the flight behavior of an airplane. When any changes in weight distribution are made, it is the repair agency's responsibility to determine by computation or reweighing, whether or not the approved limits, which appear on the airplane specification in the case of later models, will be exceeded. If they are, approval cannot be granted unless the structure is substantiated for the new limits and it is shown that the new limits are in compliance with all flight requirements as proved by means of a flight test.

(2) It is of the greatest importance to realize that flight characteristics not only become worse gradually with rearward displacement of the center of gravity, but that a condition sometimes exists or will finally be reached where a small change in weight will have very large effects. For this reason, care should be taken not to install items to the rear of the rearward c. g. limit for which the aircraft was originally approved. Removal of items forward of the forward c. g. limit for which the aircraft was originally approved will have a similar effect. Increasing the weight forward of the wing will tend to disturb the balancing in flight and might make the landing conditions dangerous. Naturally, the effects of weight changes will be greater near the nose and the tail. Reasonably small changes within the portion covered by the wing are not usually serious from a balance or stability standpoint. For details regarding weight and balance procedure, see § 18.30–16.

(e) *Installation of new items.* In addition to the effects on weight and weight distribution discussed in this section there is a danger that a piece of new equipment, if improperly installed will cause local loads which might seriously damage the airplane structure. It should be remembered that in flight maneuvers and in landing, it is possible to develop inertia forces such that an item will impose a load of several times its own weight on the supporting structure. For instance, a 35-pound storage battery supported by a fuselage cross tube will have the effect of weight of an applied load of over 100 pounds on the cross tube during a hard landing. If the cross tube was not originally designed for this load, it will probably fail or bend. The greatest danger arises when such a partial failure occurs in landing, without being noticed, as the structure might then fail completely during some subsequent flight.

(f) *Alterations or modifications of control surfaces and systems.* (1) Any change in the size of control surfaces affects the loading conditions for the airplane structure and therefore requires additional strength analyses, static tests, or both. Flight tests are usually required also. One should be particularly warned against making minor changes on control surfaces, since the original design often just meets certain requirements for flutter prevention. No balancing weights should be removed or added without consulting the manufacturer and finally obtaining an Aviation Safety agent's approval. The importance of retaining the proper balance and rigidity of airplane control surfaces during repair and maintenance work cannot be underestimated. In order to preclude the occurrence of flutter in a control surface, a degree of static and/or dynamic balance is established for each model of aircraft. Failure to check and retain the original or maximum allowable degree of balance may allow serious hazards to safe flight to exist in an airplane.

(2) The development of new materials and construction techniques has made possible lighter control surfaces, for a given area, on many postwar airplanes than were used on some older airplanes. The effect of using these lighter surfaces, insofar as flutter is concerned, is to make the surface more sensitive to weight changes. Repair can cause a greater change in weight distribution, or center of gravity, than would be the case with the heavier surfaces. Since control surfaces are, in some models, only balanced to the degree necessary to obtain flutter-free operation up to the maximum speed for which the airplane is designed in the original, undamaged condition, repairs to these lighter surfaces should be carefully considered from the standpoint of how they affect the balance of the surface. This is true whether or not it has a balance weight. Therefore, any structural repairs to control surfaces should be performed with due consideration of the effect of such rework on the balance of the surface: the repair work should be done in a manner so that the original or maximum allowable static unbalance is not exceeded; or counter-balance forward of the hinge line should be added, when possible, to retain the original or maximum allowable static unbalance. When the static unbalance cannot be brought within the limits and in the manner prescribed by the manufacturer, the control surface must be discarded.

(3) Special attention is called to the indiscriminate application of extra coats of dope or paint to a control surface. In some instances, the application of extra coats of dope or paint has resulted in unsatisfactory control surface balance conditions. Proper maintenance of control surface balance conditions may require removal of dope or paint down to the base coat prior to application of new finish coatings.

(4) In line with proper maintenance for the prevention of flutter, the "water-tightness" of the original control surface should be retained. Instances of flutter have occurred due to the high unbalance of a control surface arising from trapped water or ice within the surface. Therefore, either the original "water-tightness" or water drainage provisions should be checked and retained during maintenance work.

(5) In addition to improperly balanced surfaces, improperly maintained trim tab systems can contribute greatly to the possibility of flutter occurrence. Trim tabs, in most cases, are not balanced and flutter is prevented by providing a rigid trim tab mechanism. In order to keep the weight of the main surface aft of the hinge line as light as possible, trim tabs and their actuating mechanisms are built as lightly as possible. This fact together with the vibratory nature of airflow at the tab can create a mechanism which is highly susceptible to wear and deformation. In service use, therefore, the tab rigidity may be decreased to an unsafe value.

(6) In maintaining trim tabs and their actuating mechanism, only a minor amount of wear can be tolerated, in comparison to the rest of the airplane. The maximum free-play that is acceptable is 2½% of the chord, measured at the trailing edge. For example, a tab which has a chord of four inches at one point along its span, would have a permissible free-play of 4" x 0.025 or 0.100" (total motion up and down) measured at that location on the trailing edge. Any slack in excess of this amount should be eliminated by overhauling the system.

(g) *Fairing and cowling modifications.* (1) Although changes in fairing can usually be made without impairing the airworthiness of the aircraft, it has been found that certain airplanes are very sensitive to slight changes in body lines, windshield designs, and filleting. Obviously, any change in engine cowling affects the cooling and thereby introduces possibilities of malfunctioning or failure of the engine.

(2) Low wing airplanes are usually supplied with wing-fuselage fillets which prevent tail buffeting. Any alteration of such fillets may be dangerous. The manufacturer should be consulted regarding such changes.

(h) *Appliance installations.* The aircraft and appliance manufacturer's instructions for installation of equipment should be closely followed. In particular, the recoil from flares should be provided for and, in the case of position lights, where certain angular limits are required, the light manufacturer's mounting instructions should be followed.

(i) *Batteries.* Batteries should be installed in accordance with the instructions contained in §§ 3.682 through 3.684, 4a.571, and 4b.621 of the Civil Air Regulations. It should be noted that dry batteries are not considered satisfactory for the operation of position lights.

(j) *Powerplant changes.* (1) The powerplant installation on a certificated aircraft has been thoroughly checked in accordance with rules based on a study of accident and service records covering several years of operation of all types of aircraft. These records show that many accidents are due to improper installation in small details concerning the fuel or oil system, cowling, manifolding, and items of a like nature. It is, therefore, unwise to make any changes without careful consideration.

(2) When changes appear to be necessary in the powerplant installation, the manufacturer of the aircraft should be consulted. If the manufacturer has no data concerning such a change, an Aviation Safety agent should be consulted to determine if the airworthiness of the airplane will be adversely affected by making the change.

(k) *Propeller changes.* With reference to propeller changes, the pertinent aircraft specification states the type of propeller which is approved. A large diameter propeller should not be used without investigation, because it may result in unsatisfactory ground clearance and resultant damage to the tips. Furthermore, a change to a propeller of appreciably different diameter, either larger or smaller, or different pitch, might in some cases result in unsafe performance.

APPENDIX A—FORMS

NOTE: Forms to which reference has been made throughout this part (Civil Aeronautics Manual 18) have been filed with the Federal Register Division as part of the original document.

APPENDIX B—TABLES

Tables to which reference has been made throughout this part (Civil Aeronautics Manual 18) are presented in Appendix B. These tables complement the various sections of CAM 18.30 and the numbers assigned to them have been developed and codified to each section of CAM 18.30. For instance, the first table relating to CAM 18.30-2 is numbered 2-1. This number (2-1) picks up the section number within CAM 18.30 and then by appending a dash followed by sequential numbering 1, 2, 3, etc., indicates which table within the section is being referenced. For example, table 2-1 is the first table within section 2 of CAM 18.30.

TABLE 2-1—SELECTION AND PROPERTIES OF AIRCRAFT WOOD

| 1 | 2 | 3 | 4 |
|---|---|---|---|
| Species of wood | Strength properties as compared to Spruce | Maximum permissible grain deviation (slope of grain) | Remarks |
| Spruce (Picea) sitka (P. Sitchensis) red (P. Rubra) white (P. Glauca). | 100 percent | 1:15 | Excellent for all uses. Considered as standard for this table. |
| Douglas fir (Pseudotsuga Taxifolia). | Exceeds spruce | 1:15 | May be used as substitute for spruce in same sizes or in slightly reduced sizes providing reductions are substantiated. Difficult to work with hand tools. Some tendency to split and splinter during fabrication and considerable more care in manufacture is necessary. Large solid pieces should be avoided due to inspection difficulties. Gluing satisfactory. |
| Noble fir (Abies Nobiles) | Slightly exceeds spruce except 8 percent deficient in shear. | | Satisfactory characteristics with respect to workability, warping, and splitting. May be used as direct substitute for spruce in same sizes providing shear does not become critical. Hardness somewhat less than spruce. Gluing satisfactory. |
| Western hemlock (Tsuga Heterophylla). | Slightly exceeds spruce | 1:15 | Less uniform in texture than spruce. May be used as direct substitute for spruce. Upland growth superior to lowland growth. Gluing satisfactory. |
| Pine, northern white (Pinus Strobus). | Properties between 85 percent and 96 percent those of spruce. | 1:15 | Excellent working qualities and uniform in properties but somewhat low in hardness and shock-resisting capacity. Cannot be used as substitute for spruce without increase in sizes to compensate for lesser strength. Gluing satisfactory. |
| White cedar, Port Oxford (Charaecyparis Lawsoniana). | Exceeds spruce | 1:15 | May be used as substitute for spruce in same sizes or in slightly reduced sizes providing reductions are substantiated. Easy to work with hand tools. Gluing difficult but satisfactory joints can be obtained if suitable precautions are taken. |
| Poplar, yellow (Liriodendrow Tulipifera). | Slightly less than spruce except in compression (crushing) and shear. | 1:15 | Excellent working qualities. Should not be used as a direct substitute for spruce without carefully accounting for slightly reduced strength properties. Somewhat low in shock-resisting capacity. Gluing satisfactory. |

NOTES (Table 2-1.)

1. *Defects permitted.*—(a) *Cross grain.* Suiral grain, diagonal grain, or a combination of the two is acceptable providing the grain does not diverge from the longitudinal axis of the material more than specified in column 3. A check of all four faces of the board is necessary to determine the amount of divergence. The direction of free-flowing ink will frequently assist in determining grain direction.

(b) *Wavy, curly, and interlocked grain.* Acceptable if local irregularities do not exceed limitations specified for spiral and diagonal grain.

(c) *Hard knots.* Sound hard knots up to ⅜ inch in maximum diameter acceptable providing: (1) they are not in projecting portions of I-beams, along the edges of rectangular or beveled unrouted beams or along the edges of flanges of box beams (except in lowly stressed portions); (2) they do not cause grain divergence at the edges of the board or in the flanges of a beam more than specified in column 3; and (3) they are in the center third of the beam and are not closer than 20 inches to another knot or other defect (pertains to ⅜-inch knots—smaller knots may be proportionately closer). Knots greater than ¼ inch should be used with caution.

(d) *Pin knot clusters.* Small clusters acceptable providing they produce only a small effect on grain direction.

(e) *Pitch pockets.* Acceptable in center portion of a beam providing they are at least 14 inches apart when they lie in the same growth ring and do not exceed 1½ inches length by ⅛ inch width by ⅛ inch depth and providing they are not along the projecting portions of I-beams, along the edges of rectangular or beveled unrouted beams or along the edges of the flanges of box beams.

(f) *Mineral streaks.* Acceptable providing careful inspection fails to reveal any decay.

2. *Defects not permitted*—(a) *Cross grain.* Not acceptable unless within limitations noted in 1 (a).

(b) *Wavy, curly, and interlocked grain.* Not acceptable unless within limitations noted in 1 (b).

(c) *Hard knots.* Not acceptable unless within limitations noted in 1 (c).

(d) *Pin knot clusters.* Not acceptable if they produce large effect on grain direction.

(e) *Spike knots.* These are knots running completely through the depth of a beam perpendicular to the annual rings and appear most frequently in quarter-sawed lumber. Wood containing this defect should be rejected.

(f) *Pitch pockets.* Not acceptable unless within limitations noted in 1 (e).

(g) *Mineral streaks.* Not acceptable if accompanied by decay (see 1 (f)).

(h) *Checks, shakes, and splits.* Checks are longitudinal cracks extending, in general, across the annual rings. Shakes are longitudinal cracks usually between two annual rings. Splits are longitudinal cracks induced by artificially induced stress. Wood containing these defects should be rejected.

(i) *Compression wood.* This defect is very detrimental to strength and is difficult to recognize readily. It is characterized by high specific gravity, has the appearance of an excessive growth of summer wood, and in most species shows but little contrast in color between spring wood and summer wood. In doubtful cases the material should be rejected or samples should be subjected to a toughness machine test to establish the quality of the wood. All material containing compression wood should be rejected.

(j) *Compression failures.* This defect is caused from the wood being overstressed in compression due to natural forces during the growth of the tree, felling trees on rough or irregular ground or rough handling of logs or lumber. Compression failures are characterized by a buckling of the fibers that appear as streaks on the surface of the piece substantially at right angles to the grain, and vary from pronounced failures to very fine hair lines that require close inspection to detect. Wood containing obvious failures should be rejected. In doubtful cases the wood should be rejected or further inspection in the form of microscopic examination or toughness tests made, the latter means being the more reliable.

(k) *Decay.* All stains and discolorations should be examined carefully to determine whether or not they are harmless or preliminary or advanced decay. All pieces should be free from rot, dote, red heart, purple heart, and all other forms of decay.

TABLE 2-2—COLD-SETTING SYNTHETIC-RESIN GLUES [1]

| Designation | Type | Approximate working life at 75° F. in hours |
|---|---|---|
| Amberlite PR-115 | Resorcinol | 4 |
| Bakelite BC-17613 | do | 4 |
| Bakelite BCU-1 | Room-temperature urea. | 4 |
| Bakelite BCU-5 | do | 4 |
| Bakelite BCU-12772 | do | 4 |
| Cascamite ANS | do | 4 |
| Cascamite 12 | do | 5-6 |
| Cascamite 66 | do | 4 |
| Cascamite 77 | do | 5-6 |
| Cascamite 151 | do | 1¾ |
| Cascophen RS-216 | Resorcinol | 3¾ |
| Cascophen RS-224 | do | 3-4 |
| Cascophen RS-232 | do | 3-4 |
| Casco Resin No. 5 | Room-temperature urea. | 4 |
| Casco Resin No. 5 | do | 5-6 |
| Casco Resin 135 | do | 8-9 |
| Durez 12688 | Resorcinol | 3 |
| Durite 2989 | Room-temperature urea. | 5 |
| Durite 3026 | Resorcinol | 3 |
| Kaseno 2690 | do | 3 |
| Lauxite PF90C | do | 3 |
| Lauxite 77-X | Room-temperature urea. | 4 |
| Lauxite 81-MX | do | 2-5 |
| Lauxite 224 | do | 3 |
| Le Page's Panite | Room-temperature urea. | 4 |
| Penacolite G-1124 | Resorcinol | 2-3 |
| Penacolite G-1131 | do | 2½-3 |
| Penacolite G-1215 | do | 3 |
| Perkins L-100 | Room-temperature urea. | 4 |
| Perkins D-110 | do | 5 |
| Perkins DC-246 | do | 5 |
| Perkins R-55 | Resorcinol | 2 |
| Perkins RP-60 | do | 2 |
| Phenac Resin Adhesive 703. | do | 5 |
| Plaskon 201-2 | Room-temperature urea. | 4 |
| Plaskon 250-2 | do | 4 |
| Plyophen 6000 | Resorcinol | 4 |
| Synvaren PLS | do | 2½-3½ |
| Synvarite U | Room-temperature | 4-5 |
| Synvarol WR-513 | do | 2-3 |
| Uformite 430 | do | 3-4 |
| Uformite 500 | do | 3-4 |
| Uformite CB-552 | do | 3-4 |
| Urac 180 | do | 4-5 |
| Urac Resin Adhesive 185. | do | 4½ |
| USP Resorcinol | Resorcinol | 3½-4 |
| Weldwood | Room-temperature | 3-4 |

[1] The inclusion of any glue in this table does not constitute an endorsement on the part of any government agency or assurance that it will meet applicable specifications.

TABLE 2-3—MINIMUM RECOMMENDED BEND RADII FOR AIRCRAFT PLYWOOD [1]

| Plywood thickness | | 10 percent moisture content, bent on cold mandrels | | Thoroughly soaked in hot water and bent on cold mandrels | |
|---|---|---|---|---|---|
| | | At 90° to face grain | At 0° or 45° to face grain | At 90° to face grain | At 0° or 45° to face grain |
| | |  |  |  |  |
| (1) | (2) | (3) | (4) | (5) | (6) |
| *Inch* | *No. plies* | *Inches* | *Inches* | *Inches* | *Inches* |
| 0.035 | 3 | 2.0 | 1.1 | 0.5 | 0.1 |
| .070 | 3 | 5.2 | 3.2 | 1.5 | .4 |
| .100 | 3 | 8.6 | 5.2 | 2.6 | .8 |
| .125 | 3 | 12 | 7.1 | 3.8 | 1.2 |
| .155 | 3 | 16 | 10 | 5.3 | 1.8 |
| .185 | 3 | 20 | 13 | 7.1 | 2.6 |
| .160 | 5 | 17 | 11 | 6 | 2 |
| .190 | 5 | 21 | 14 | 7 | 3 |
| .225 | 5 | 27 | 17 | 10 | 4 |
| .250 | 5 | 31 | 20 | 12 | 5 |
| .315 | 5 | 43 | 28 | 16 | 7 |
| .375 | 5 | 54 | 36 | 21 | 10 |

[1] Columns (1) and (3) may also be used for determining the maximum thickness of single laminations for curved members.

TABLE 3-1—TEXTILE FABRIC USED IN AIRCRAFT COVERING

| Materials | Specification | Minimum tensile strength new (undoped) | Minimum tearing strength new (undoped) | Minimum tensile strength deteriorated (undoped) | Thread count per inch | Use and remarks |
|---|---|---|---|---|---|---|
| Airplane cloth mercerized cotton (Grade "A"). | Society Automotive Engineers AMS 3806 (TSO-C15 references this specification). | 80 pounds per inch warp and fill. | 5 pounds warp and fill. | 56 pounds per inch. | 80 minimum, 84 maximum warp and fill. | For use on all aircraft. Required on aircraft with wing loadings greater than 9 p. s. f., and placarded never-exceed speeds greater than 160 m. p. h. |
| Do | MIL-C-5646 | do | do | do | do | Alternate to AMS 3806. |
| Airplane cloth cellulose nitrate predoped. | MIL-C-5643 | do | do | do | do | Alternate to MIL-C-5646 or AMS 3806 (undoped). Finish with cellulose nitrate dope. |
| Airplane cloth cellulose acetate butyrate, predoped. | MIL-C-5642 | do | do | do | do | Alternate to MIL-C-5646 or AMS 3806 (undoped). Finish with cellulose acetate butyrate dope. |
| Airplane cloth mercerized cotton. | Society Automotive Engineers AMS 3804 (TSO-C14 references this spec.). | 65 pounds per inch warp and fill. | 4 pounds warp and fill. | 46 pounds per inch. | 80 minimum, 94 maximum warp and fill. | For use on aircraft with wing loadings of less than 9 p. s. f., and placarded never-exceed speeds of less than 160 m. p. h. |
| Airplane cloth mercerized cotton. | Society Automotive Engineers AMS 3802 A. | 50 pounds per inch warp and fill. | 3 pounds warp and fill. | 35 pounds per inch. | 110 maximum warp and fill. | For use on gliders with wing loading of 8 p. s. f. or less, and placarded never-exceed speeds of 135 m. p. h. or less. |
| Glider fabric cotton. | A. A. F. No. 16128. | 55 pounds per inch warp and fill. | 4 pounds warp and fill. | 39 pounds per inch. | 80 minimum wrap and fill. | Alternate to AMS 3802-A. |
| Aircraft linen | British DTD540 | | | | | This material meets the minimum strength requirements of TSO-C15. |

TABLE 3-2—MISCELLANEOUS TEXTILE MATERIALS

| Materials | Specification | Yarn size | Minimum tensile strength | Yards per pound | Use and remarks |
|---|---|---|---|---|---|
| Reinforcing tape, cotton. | MIL-T-5661 | ---- | 150 pounds per one-half-inch width. | ---- | Used as reinforcing tape on fabric and under rib lacing cord. Strength of other widths approx. in proportion. |
| Lacing cord, prewaxed braided cotton. | MIL-C-5649 | ---- | 80 pounds double. | 310 minimum | Lacing fabric to structures. Unless already waxed, must be lightly waxed before using. |
| Lacing cord, special cotton. | U. S. Army No. 6-27. | 20/3/3/3 | 85 pounds double. | ---- | Do. |
| Lacing cord, braided cotton. | MIL-C-5648 | ---- | 80 pounds single. | 170 minimum | Do. |
| Lacing cord thread; linen and linen-hemp. | MIL-T-6779 | 9 ply | 59 pounds single. | 620 minimum | Do. |
|  |  | 11 ply | 70 pounds single. | 510 minimum | Do. |
| Lacing cord thread; high-tenacity cotton. | MIL-T-5660 | Ticket No. 10. | 62 pounds single. | 480 minimum | Do. |
| Machine thread cotton. | Federal V-T-276b. | 20/4 ply | 5 pounds single. | 5,000 normal | Use for all machine sewing. |
| Hand sewing thread cotton. | V-T-276b. Type III B. | 8/4 ply | 14 pounds single. | 1,650 normal | Use for all hand sewing. Use fully waxed thread. |
| Surface tape cotton (made from AN-C-121). | MIL-T-5083 | ---- | 80 lbs/in | ---- | Use over seams, leading edges, trailing edges, outer edges and ribs, pinked, scalloped or straight edges. |
| Surface tape cotton | Same as fabric used. | ---- | Same as fabric used. | ---- | Alternate to MIL-T-5083. |

TABLE 4-1—OXYACETYLENE WELDING ROD PROPERTIES

| Base material | Welding rod specification | Welding rod composition—percent |
|---|---|---|
| Plain carbon steel and low alloy steel such as SAE 4130 (not heat-treated after welding). | AAF No. 10286-D, Type II, Grade 1-G or Navy 46R4b, Class 1, Type C. | Carbon 0.06 maximum.<br>Manganese 0.25 maximum.<br>Phosphorus 0.04 maximum.<br>Sulphur 0.05 maximum.<br>Silicon[1] 0.08 maximum. |
| Plain carbon steel and alloy steel (heat-treated after welding). | AAF No. 10286-D, Type II, Grade 2-G or Navy 46R4b, Class 1, Type B. | Carbon 0.10-0.20.<br>Manganese 1.00-1.20.<br>Phosphorus 0.04 maximum.<br>Sulphur 0.05 maximum.<br>Silicon 0.20-0.30. |

[1] Silicon content not a requirement of Specification AAF No. 10286-D.

TABLE 4-2—ARC WELDING ELECTRODE PROPERTIES

| Base material | Electrode specification | Use |
|---|---|---|
| Low carbon steel and alloy steel (not heat-treated after welding). | MIL-E-6843 | DC or AC current, shallow penetration (light sections). |
| Low carbon steel and alloy steel (not heat-treated after welding). | MIL-E-6843 | DC reverse polarity, deep penetration (heavy sections). |
| Alloy steel (heat-treated after welding). | MIL-E-6843 | DC or AC current, shallow penetration (light sections). |
| Alloy steel (heat-treated after welding). | MIL-E-6843 | DC reverse polarity, deep penetration (heavy sections). |

TABLE 4-3—RECOMMENDED BEND RADII FOR 90° BEND—IN TERMS OF ALUMINUM AND ALUMINUM ALLOY SHEET THICKNESS, (t)

| Alloy and temper | Approximate thickness inch |  |  |  |  |  |
|---|---|---|---|---|---|---|
|  | 0.016<br>1/64 | 0.032<br>1/32 | 0.064<br>1/16 | 0.128<br>1/8 | 0.182<br>3/16 | 0.258<br>1/4 |
| 24S-O[1] | 0 | 0 | 0 | 0 | 0-1t | 0-1t |
| 24S-T3[1 2] | 1½t-3t | 2t-4t | 3t-5t | 4t-6t | 4t-6t | 5t-7t |
| 24S-T6[1] | 2t-4t | 3t-5t | 3t-5t | 4t-6t | 5t-7t | 6t-10t |
| 52S-O | 0 | 0 | 0 | 0 | 0-1t | 0-1t |
| 52S-H32 | 0 | 0 | 0 | 0-1t | 0-1t | ½t-1½t |
| 52S-H34 | 0 | 0 | 0-1t | ½t-1½t | 1t-2t | 1½t-3t |
| 52S-H36 | 0-1t | ½t-1½t | 1t-2t | 1½t-3t | 2t-4t | 2t-4t |
| 52S-H38 | ½t-1½t | 1t-2t | 1½t-3t | 2t-4t | 3t-5t | 4t-6t |
| 61S-O | 0 | 0 | 0 | 0 | 0-1t | 0-1t |
| 61S-T4 | 0-1t | 0-1t | 1½t-1½t | 1t-2t | 1½t-3t | 2t-4t |
| 61S-T6 | 0-1t | ½t-1½t | 1t-2t | 1½t-3t | 2t-4t | 2t-4t |
| 75S-O | 0 | 0 | 0-1t | ½t-1½t | 1t-2t | 1½t-3t |
| 75S-T6[1] | 2t-4t | 3t-5t | 3t-5t | 4t-6t | 5t-7t | 6t-10t |

[1] Alclad sheet can be bent over slightly smaller radii than the corresponding tempers of the uncoated alloy.

[2] Immediately after quenching, this alloy can be formed over appreciably smaller radii.

TABLE 4-4—NUMBER OF RIVETS REQUIRED FOR SPLICES (SINGLE-LAP JOINT) IN BARE 14S-T6, 24S-T3, 24S-T36, AND 75S-T6 SHEET, CLAD 14S-T6, 24S-T3, 24S-T36, AND 75S-T6 SHEET, 24S-T4 AND 75S-T6 PLATE, BAR, ROD, TUBE, AND EXTRUSIONS, 14S-T6 EXTRUSIONS

| Thickness "t" in inches | No. of A17S-T3 protruding head rivets required per inch of width "W" |  |  |  |  | No. of bolts |
|---|---|---|---|---|---|---|
|  | 3/32 | 1/8 | 5/32 | 3/16 | 1/4 | AN-3 |
| 0.016 | 6.5 | 4.9 | ---- | ---- | ---- | ---- |
| .020 | 6.9 | 4.9 | 3.9 | ---- | ---- | ---- |
| .025 | 8.6 | 4.9 | 3.9 | ---- | ---- | ---- |
| .032 | 11.1 | 6.2 | 3.9 | 3.3 | ---- | ---- |
| .036 | 12.5 | 7.0 | 4.5 | 3.3 | 2.4 | ---- |
| .040 | 13.8 | 7.7 | 5.0 | 3.5 | 2.4 | 3.3 |
| .051 | ---- | 9.8 | 6.4 | 4.5 | 2.5 | 3.3 |
| .064 | ---- | 12.3 | 8.1 | 5.6 | 3.1 | 3.3 |
| .081 | ---- | ---- | 10.2 | 7.1 | 3.9 | 3.3 |
| .091 | ---- | ---- | 11.4 | 7.9 | 4.4 | 3.3 |
| .102 | ---- | ---- | 12.8 | 8.9 | 4.9 | 3.4 |
| .128 | ---- | ---- | ---- | 11.2 | 6.2 | 4.2 |

NOTES:

a. For stringers in the upper surface of a wing, or in a fuselage, 80 percent of the number of rivets shown in the table may be used.

b. For intermediate frames, 60 percent of the number shown may be used.

c. For single lap sheet joints, 75 percent of the number shown may be used.

ENGINEERING NOTES: The above table was computed as follows:

1. The load per inch of width of material was calculated by assuming a strip one inch wide in tension.

2. Number of rivets required was calculated for A17ST rivets, based on a rivet allowable shear stress equal to 40 percent of the sheet allowable tensile stress, and a sheet allowable bearing stress equal to 160 percent of the sheet allowable tensile stress, using nominal hole diameters for rivets.

3. Combinations of sheet thickness and rivet size above the heavy line are critical in (i. e., will fail by) bearing on the sheet; those below are critical in shearing of the rivets.

4. The number of AN-3 bolts required below the heavy line was calculated based on a sheet allowable tensile stress of 70,000 psi and a bolt allowable single shear load of 2,126 pounds.

TABLE 4-5—NUMBER OF RIVETS REQUIRED FOR SPLICES (SINGLE-LAP JOINT) IN 17ST, 17ST ALCLAD 17SRT, AND 17SRT ALCLAD SHEET, PLATE, BAR, ROD, TUBE, AND EXTRUSIONS

| Thickness "t" in inches | Number of A17ST protruding head rivets required per inch of width "W" | | | | | Number of bolts |
|---|---|---|---|---|---|---|
| | 3/32 | 1/8 | 5/32 | 3/16 | 1/4 | AN-3 |
| 0.016 | 6.5 | 4.9 | -------- | ------- | ------- | ------- |
| .020 | 6.5 | 4.9 | 3.9 | ------- | ------- | ------- |
| .025 | 6.9 | 4.9 | 3.9 | ------- | ------- | ------- |
| .032 | 8.9 | 4.9 | 3.9 | 3.3 | ------- | ------- |
| .036 | 10.0 | 5.6 | 3.9 | 3.3 | 2.4 | ------- |
| .040 | 11.1 | 6.2 | 4.0 | 3.3 | 2.4 | ------- |
| .051 | -------- | 7.9 | 5.1 | 3.6 | 2.4 | 3.3 |
| .064 | -------- | 9.9 | 6.5 | 4.5 | 2.5 | 3.3 |
| .081 | -------- | 12.5 | 8.1 | 5.7 | 3.1 | 3.3 |
| .091 | -------- | -------- | 9.1 | 6.3 | 3.5 | 3.3 |
| .102 | -------- | -------- | 10.3 | 7.1 | 3.9 | 3.3 |
| .128 | -------- | -------- | 12.9 | 8.9 | 4.9 | 3.3 |

**NOTES:**

a. For stringers in the upper surface of a wing, or in a fuselage, 80 percent of the number of rivets shown in the table may be used.

b. For intermediate frames, 60 percent of the number shown may be used.

c. For single lap sheet joints, 75 percent of the number shown may be used:

ENGINEERING NOTES: The above table was computed as follows:

1. The load per inch of width of material was calculated by assuming a strip one inch wide in tension.

2. Number of rivets required was calculated for A17ST rivets, based on a rivet allowable shear stress equal to 50 percent of the sheet allowable tensile stress, and a sheet allowable bearing stress equal to 160 percent of the sheet allowable tensile stress, using nominal hole diameters for rivets.

3. Combinations of sheet thickness and rivet size above the heavy line are critical in (i. e., will fail by) bearing on the sheet; those below are critical in shearing of the rivets.

4. The number of AN-3 bolts required below the heavy line was calculated based on a sheet allowable tensile stress of 55,000 psi and a bolt allowable single shear load of 2,126 pounds.

TABLE 4-6—NUMBER OF RIVETS REQUIRED FOR SPLICES (SINGLE-LAP JOINT) IN 52S (ALL HARDNESS) SHEET

| Thickness "t" in inches | No. of A17S-T3 protruding head rivets required per inch of width "W" | | | | | No. of bolts |
|---|---|---|---|---|---|---|
| | 3/32 | 1/8 | 5/32 | 3/16 | 1/4 | AN-3 |
| 0.016 | 6.3 | 4.7 | ------ | ------ | ------ | -------- |
| 0.020 | 6.3 | 4.7 | 3.8 | ------ | ------ | -------- |
| 0.025 | 6.3 | 4.7 | 3.8 | ------ | ------ | -------- |
| 0.032 | 6.3 | 4.7 | 3.8 | 3.2 | ------ | -------- |
| 0.036 | 7.1 | 4.7 | 3.8 | 3.2 | 2.4 | -------- |
| 0.040 | 7.9 | 4.7 | 3.8 | 3.2 | 2.4 | -------- |
| 0.051 | 10.1 | 5.6 | 3.8 | 3.2 | 2.4 | -------- |
| 0.064 | 12.7 | 7.0 | 4.6 | 3.2 | 2.4 | -------- |
| 0.081 | ------ | 8.9 | 5.8 | 4.0 | 2.4 | 3.2 |
| 0.091 | ------ | 10.0 | 6.5 | 4.5 | 2.5 | 3.2 |
| 0.102 | ------ | 11.2 | 7.3 | 5.1 | 2.8 | 3.2 |
| 0.128 | ------ | ------ | 9.2 | 6.4 | 3.5 | 3.2 |

a. For stringers in the upper surface of a wing, or in a fuselage, 80 percent of the number of rivets shown in the table may be used.

b. For intermediate frames, 60 percent of the number shown may be used.

c. For single lap sheet joints, 75 percent of the number shown may be used.

ENGINEERING NOTES: The above table was computed as follows:

1. The load per inch of width of material was calculated by assuming a strip one inch wide in tension.

2. Number of rivets required was calculated for A17ST rivets, based on a rivet allowable shear stress equal to 70 percent of the sheet allowable tensile stress, and a sheet allowable bearing stress equal to 165 percent of the sheet allowable tensile stress, using nominal hole diameters for rivets.

3. Combinations of sheet thickness and rivet size above the heavy line are critical in (i. e., will fail by) bearing on the sheet; those below are critical in shearing of the rivets.

TABLE 5-1—AIRCRAFT CABLE

| Cable size | Minimum breaking strength, pounds | | |
|---|---|---|---|
| | Flexible | | Nonflexible 19 wire |
| | 7×7 | 7×19 | |
| | MIL-C-1511 carbon steel | MIL-C-5424 carbon steel | MIL-C-6940 carbon steel |
| 1/32 | ------------- | ------------- | 185 |
| 1/16 | 480 | 480 | 500 |
| 5/64 | ------------- | ------------- | 800 |
| 3/32 | 920 | 920 | 1,200 |
| 7/64 | ------------- | ------------- | 1,600 |
| 1/8 | 2,000 | 1,900 | 2,100 |
| 5/32 | 2,800 | 2,600 | 3,300 |
| 3/16 | 4,200 | 3,900 | 4,700 |
| 7/32 | 5,600 | 5,200 | 6,300 |
| 1/4 | 7,009 | 6,600 | 8,200 |
| 9/32 | 8,000 | 8,000 | ------------- |
| 5/16 | 9,800 | 8,200 | 12,500 |
| 11/32 | 12,500 | ------------- | ------------- |
| 3/8 | 14,400 | 12,000 | ------------- |

TABLE 5-2—TURNBUCKLE SAFETYING GUIDE[1]

| Cable size | Type of wrap | Diameter of safety wire | Material (annealed condition) |
|---|---|---|---|
| 1/16 | Single | 0.040 | Copper, brass.[2] |
| 3/32 | Single | .040 | Copper, brass.[2] |
| 1/8 | Single | .040 | Stainless steel, Monel and "K" Monel. |
| 1/8 | Double | .040 | Copper, brass.[2] |
| 1/8 | Single | .057 min | Copper, brass.[2] |
| 5/32 and greater. | Double | .040 | Stainless steel, Monel, and "K" Monel.[2] |
| 5/32 and greater. | Single | .057 min | Stainless steel, Monel, or "K" Monel.[2] |
| 5/32 and greater. | Double | .051 [3] | Copper, brass. |

NOTES:

1. The swaged and unswaged turnbuckle assemblies are covered by AN Standard Drawings.

2. Galvanized or tinned steel, or soft iron wires are also acceptable.

3. The safety wire holes in 5/32-inch diameter and larger turnbuckle terminals for swaging may be drilled sufficiently to accommodate the double 0.051-inch diameter copper or brass wires when used.

TABLE 6-1—RECOMMENDED NUT TORQUES

(Caution: These torque values are derived from oil free cadmium-plated threads)

FINE-THREAD SERIES

| Tap size | Tension-type nuts AN-365 and AN-310 | Sheer-type nuts AN-364 and AN-320 | 90,000 p. s. i. in bolts AN-365 and AN-310 nuts | (60 percent of column 4) AN-364 and AN-320 nuts |
|---|---|---|---|---|
| 8-36 | 12-15 | 7-9 | 20 | 12 |
| 10-32 | 20-25 | 12-15 | 40 | 25 |
| 1/4-28 | 50-70 | 30-40 | 100 | 60 |
| 5/16-24 | 100-140 | 60-85 | 225 | 140 |
| 3/8-24 | 160-190 | 95-110 | 390 | 240 |
| 7/16-20 | 450-500 | 270-300 | 840 | 500 |
| 1/2-20 | 480-690 | 290-410 | 1100 | 660 |
| 9/16-18 | 800-1000 | 480-600 | 1600 | 960 |
| 5/8-18 | 1100-1300 | 600-780 | 2400 | 1400 |
| 3/4-16 | 2300-2500 | 1300-1500 | 5000 | 3000 |
| 7/8-14 | 2500-3000 | 1500-1800 | 7000 | 4200 |
| 1-14 | 3700-5500 | 2200-3300 [1] | 10000 | 6000 |
| 1 1/8-12 | 5000-7000 | 3000-4200 [1] | 15000 | 9000 |
| 1 1/4-12 | 9000-11000 | 5400-6600 [1] | 25000 | 15000 |

COARSE-THREAD SERIES

| | | | | |
|---|---|---|---|---|
| 8-32 | 12-15 | 7-9 | 20 | 12 |
| 10-24 | 20-25 | 12-15 | 35 | 21 |
| 1/4-20 | 40-50 | 25-30 | 75 | 45 |
| 5/16-18 | 80-90 | 48-55 | 160 | 100 |
| 3/8-16 | 160-185 | 95-100 | 275 | 170 |
| 7/16-14 | 235-255 | 140-155 | 475 | 280 |
| 1/2-13 | 400-480 | 240-290 | 880 | 520 |
| 9/16-12 | 500-700 | 300-420 | 1100 | 650 |
| 5/8-11 | 700-900 | 420-540 | 1500 | 900 |
| 3/4-10 | 1150-1600 | 700-950 | 2500 | 1500 |
| 7/8-9 | 2200-3000 | 1300-1800 | 4600 | 2700 |

[1] Estimated corresponding values.

NOTE: The above torque loads may be used for all cadmium plated steel nuts of the fine or coarse thread series which have approximately equal number of threads and equal face bearing areas.

TABLE 8-1—NUMERICAL SYSTEM FOR STEEL IDENTIFICATION

| *Type of steel* | *Numerals and digits* |
|---|---|
| Carbon steels | 1xxx |
| Plain carbon steels | 10xx |
| Free cutting steels | 11xx |
| Manganese steels (manganese 1.60 to 1.90 percent) | 13xx |
| Nickel steels | 2xxx |
| 3.50 percent nickel | 23xx |
| 5.00 percent nickel | 25xx |
| Nickel chromium steels | 3xxx |
| 0.70 percent nickel, 0.70 percent chromium | 30xx |
| 1.25 percent nickel, 0.60 percent chromium | 31xx |
| 1.75 percent nickel, 1.00 percent chromium | 32xx |
| 3.50 percent nickel, 1.50 percent chromium | 33xx |
| Corrosion and heat resisting | 30xxx |
| Molybdenum steels | 40xx |
| Chromium molybdenum steels | 41xx |
| Nickel chromium molydenum steels | 43xx |
| Nickel molybdenum steels | |
| 1.75 percent nickel, 0.25 percent molybdenum | 46xx |
| 3.50 percent nickel, 0.25 percent molybdenum | 48xx |
| Chromium steels | 5xxx |
| Low chromium | 51xx |
| Medium chromium | 52xxx |
| Corrision and heat resisting | 51xxx |
| Chromium vanadium steels | 6xxx |
| 1.00 percent chromium | 61xx |
| National emergency steels | 8xxx |
| Silicon manganese steels | 9xxx |
| 2.00 percent silicon | 92xx |

TABLE 8-2—HARDNESS VALUES FOR STEEL

| Rockwell hardness | | Vickers diamond pyramid hardness [1] | Brinell hardness [2] | | Tensile strength, 1,000 lb. per sq. in. |
|---|---|---|---|---|---|
| C-150 kg. load diamond | B-100 kg. load 1/16 ball | | Tungsten carbide ball | Steel ball | |
| 53 | ---- | 573 | 554 | --- | 283 |
| 52 | ---- | 556 | 538 | --- | 273 |
| 51 | ---- | 539 | 523 | 500 | 264 |
| 50 | ---- | 523 | 508 | 488 | 256 |
| 49 | ---- | 508 | 494 | 476 | 246 |
| 48 | ---- | 493 | 479 | 464 | 237 |
| 47 | ---- | 479 | 465 | 453 | 231 |
| 46 | ---- | 465 | 452 | 442 | 221 |
| 45 | ---- | 452 | 440 | 430 | 215 |
| 44 | ---- | 440 | 427 | 419 | 208 |
| 43 | ---- | 428 | 415 | 408 | 201 |
| 42 | ---- | 417 | 405 | 398 | 194 |
| 41 | ---- | 406 | 394 | 387 | 188 |
| 40 | ---- | 396 | 385 | 377 | 181 |
| 39 | ---- | 386 | 375 | 367 | 176 |
| 38 | ---- | 376 | 365 | 357 | 170 |
| 37 | ---- | 367 | 356 | 347 | 165 |
| 36 | -------- | 357 | 346 | 337 | 160 |
| 35 | -------- | 348 | 337 | 327 | 155 |
| 34 | -------- | 339 | 329 | 318 | 150 |
| 33 | -------- | 330 | 319 | 309 | 147 |
| 32 | -------- | 321 | 310 | 301 | 142 |
| 31 | -------- | 312 | 302 | 294 | 139 |
| 30 | -------- | 304 | 293 | 286 | 136 |
| 29 | -------- | 296 | 286 | 279 | 132 |
| 28 | -------- | 288 | 278 | 272 | 129 |
| 27 | -------- | 281 | 271 | 265 | 126 |
| 26 | -------- | 274 | 264 | 259 | 123 |
| 25 | -------- | 267 | 258 | 253 | 120 |
| 24 | -------- | 261 | 252 | 247 | 118 |
| 23 | -------- | 255 | 246 | 241 | 115 |
| 22 | 100.2 | 250 | 241 | 235 | 112 |
| 21 | 99.5 | 245 | 236 | 230 | 110 |
| 20 | 98.9 | 240 | 231 | 225 | 107 |
| 19[3] | 98.1 | 235 | 226 | 220 | 104 |
| 18 | 97.5 | 231 | 222 | 215 | 103 |
| 17 | 96.9 | 227 | 218 | 210 | 102 |
| 16 | 96.2 | 223 | 214 | 206 | 100 |
| 15 | 95.5 | 219 | 210 | 201 | 99 |
| 14 | 94.9 | 215 | 206 | 197 | 97 |
| 13 | 94.1 | 211 | 202 | 193 | 95 |
| 12 | 93.4 | 207 | 199 | 190 | 93 |
| 11 | 92.6 | 203 | 195 | 186 | 91 |
| 10 | 91.8 | 199 | 191 | 183 | 90 |
| 9 | 91.2 | 196 | 187 | 180 | 89 |
| 8 | 90.3 | 192 | 184 | 177 | 88 |
| 7 | 89.7 | 189 | 180 | 174 | 87 |
| 6 | 89 | 186 | 177 | 171 | 85 |
| 5 | 88.3 | 183 | 174 | 168 | 84 |
| 4 | 87.5 | 179 | 171 | 165 | 83 |
| 3 | 87 | 177 | 169 | 162 | 82 |
| 2 | 86 | 173 | 165 | 160 | 81 |
| 1 | 85.5 | 171 | 163 | 158 | 80 |
| 0 | 84.5 | 167 | 159 | 154 | 78 |
| ---- | 83.2 | 162 | 153 | 150 | 76 |
| ---- | 82 | 157 | 148 | 145 | 74 |
| ---- | 80.5 | 153 | 144 | 140 | 72 |
| ---- | 79 | 149 | 140 | 136 | 70 |
| ---- | 77.5 | 143 | 134 | 131 | 68 |
| ---- | 76 | 139 | 130 | 127 | 66 |
| ---- | 74 | 135 | 126 | 122 | 64 |
| ---- | 72 | 129 | 120 | 117 | 62 |
| ---- | 70 | 125 | 116 | 113 | 60 |
| ---- | 68 | 120 | 111 | 108 | 58 |
| ---- | 66 | 116 | 107 | 104 | 56 |
| ---- | 64 | 112 | 104 | 100 | 54 |
| ---- | 61 | 108 | 100 | 96 | 52 |
| ---- | 58 | 104 | 95 | 92 | 50 |
| ---- | 55 | 99 | 91 | 87 | 48 |
| ---- | 51 | 95 | 86 | 83 | 46 |
| ---- | 47 | 91 | 83 | 79 | 44 |
| ---- | 44 | 88 | 80 | 76 | 42 |
| ---- | 39 | 84 | 76 | 72 | 40 |
| ---- | 35 | 80 | 72 | 68 | 38 |
| ---- | 30 | 76 | 67 | 64 | 36 |
| ---- | 24 | 72 | 64 | 60 | 34 |
| ---- | 20 | 69 | 61 | 57 | 32 |
| ---- | 11 | 65 | 57 | 53 | 30 |
| ---- | 0 | 62 | 54 | 50 | 28 |

[1] Vickers hardness values obtained with following loads:

| | *Kilograms* |
|---|---|
| 918 to 171, inclusive | 50 |
| 167 to 95, inclusive | 30 |
| 91 to 62, inclusive | 10 |

[2] Brinell hardness values obtained with 3,000 kg. load except tungsten carbide ball values 159 to 86, inclusive, obtained with 1,500 kg. load and from 83 to 54, inclusive, with 500 kg. load.

[3] Rockwell C values below 20 are not recommended for correlation; however, these values are sufficiently accurate to indicate the trend of relationship.

TABLE 8-3—HARDNESS VALUES FOR ALUMINUM ALLOYS

| Material commercial designation | Hardness temper | Brinell hardness No. |
|---|---|---|
| 2S (pure aluminum) | O | 23 |
| | H | 44 |
| 3S | O | 28 |
| | H | 55 |
| 14S, forging | T | 125 |
| 17S | O | 45 |
| | T | 100 |
| | RT | 110 |
| 24S | O | 42 |
| | T | 105 |
| | RT | 116 |
| 25S, forging | O | 80 |
| | W | 100 |
| | T | 90 |
| A51S, forging | T | 90 |
| 52S | O | 45 |
| | H | 85 |
| 61S | O | 30 |
| | T | 95 |

TEMPER CODE

O—Annealed condition.
H—Maximum commercial degree of work hardening.
T—Fully heat-treated.
RT—Heat-treated and cold worked.
W—Quenched but not completely aged. W temper applies only to alloys requiring artificial aging to attain T condition.

TABLE 11-1—TUBE DATA

| Tube O. D. (inches) | Wrench torque range for tightening tube nuts (inch pounds) | | Minimum bend radii (inches) | |
|---|---|---|---|---|
| | Alum. alloy 2S½H, 52SO | Steel | Alum. alloy 2S½H, 52SO | Steel |
| 1/8 | ------- | ------- | 3/8 | ----- |
| 3/16 | ------- | 30-70 | 7/16 | 21/32 |
| 1/4 | 40-65 | 50-90 | 9/16 | 7/8 |
| 5/16 | 60-80 | 70-120 | 3/4 | 1 1/8 |
| 3/8 | 75-125 | 90-150 | 1 5/16 | 1 5/16 |
| 1/2 | 150-250 | 155-250 | 1 1/4 | 1 3/4 |
| 5/8 | 200-350 | 300-400 | 1 1/2 | 2 3/16 |
| 3/4 | 300-500 | 430-575 | 1 3/4 | 2 5/8 |
| 1 | 500-700 | 550-750 | 3 | 3 1/2 |
| 1 1/4 | 600-900 | ------- | 3 3/4 | 4 3/8 |
| 1 1/2 | 600-900 | ------- | 5 | 5 1/4 |
| 1 3/4 | ------- | ------- | 7 | 6 1/8 |
| 2 | ------- | ------- | 8 | 7 |

TABLE 12-1—COPPER ELECTRIC CABLE CURRENT CARRYING CAPACITY

| Cable size—Specification MIL-W-5086 | Single cable in free air—maximum amperes | Cable in conduit or bundled—maximum amperes | Maximum resistance—ohms/1,000 feet (20° C.) | Nominal conductor area—circular mils. | Finished cable weight—pounds per 1,000 feet |
|---|---|---|---|---|---|
| AN-20 | 11 | 7.5 | 10.25 | 1,119 | 5.6 |
| AN-18 | 16 | 10 | 6.44 | 1,779 | 8.4 |
| AN-16 | 22 | 13 | 4.76 | 2,409 | 10.8 |
| AN-14 | 32 | 17 | 2.99 | 3,830 | 17.1 |
| AN-12 | 41 | 23 | 1.88 | 6,088 | 25.0 |
| AN-10 | 55 | 33 | 1.10 | 10,443 | 42.7 |
| AN-8 | 73 | 46 | .70 | 16,864 | 69.2 |
| AN-6 | 101 | 60 | .436 | 26,813 | 102.7 |
| AN-4 | 135 | 80 | .274 | 42,613 | 162.5 |
| AN-2 | 181 | 100 | .179 | 66,832 | 247.6 |
| AN-1 | 211 | 125 | .146 | 81,807 | ------------ |
| AN-0 | 245 | 150 | .114 | 104,118 | 382 |
| AN-00 | 283 | 175 | .090 | 133,665 | 482 |
| AN-000 | 328 | 200 | .072 | 167,332 | 620 |
| AN-0000 | 380 | 225 | .057 | 211,954 | 770 |

TABLE 12-2—ALUMINUM ELECTRIC CABLE CURRENT CARRYING CAPACITY

| Cable size—Specification MIL-W-7072 | Single cable in free air—maximum amperes | Cable in conduit or bundled—maximum amperes | Maximum resistance—ohms/1,000 feet (20° C.) | Nominal conductor area—circular mils. | Finished cable weight—pounds per 1,000 feet |
|---|---|---|---|---|---|
| AL-6 | 83 | 50 | 0.641 | 28,280 | ------------ |
| AL-4 | 108 | 66 | .427 | 42,420 | ------------ |
| AL-2 | 152 | 90 | .268 | 67,872 | ------------ |
| AL-0 | 202 | 123 | .169 | 107,464 | 166 |
| AL-00 | 235 | 145 | .133 | 138,168 | 204 |
| AL-000 | 266 | 162 | .109 | 168,872 | 250 |
| AL-0000 | 303 | 190 | .085 | 214,928 | 303 |

### APPENDIX C—FIGURES

NOTE: Figures to which reference has been made throughout this part appear in Appendix C. The numbering system used in relation to tables, as explained in Appendix B, applies to the figures in this appendix. For example, figure 2-1 is the first figure within § 18.30-2 (a).

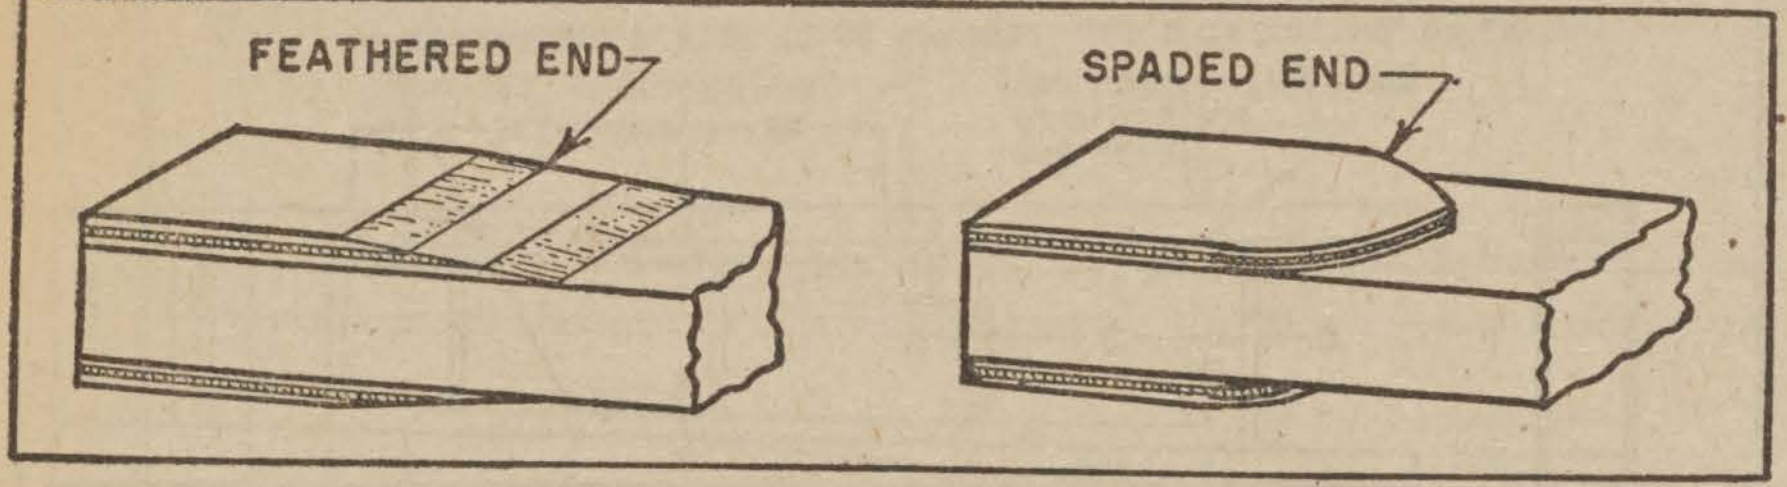

FIGURE 2-1—Tapering of face plates.

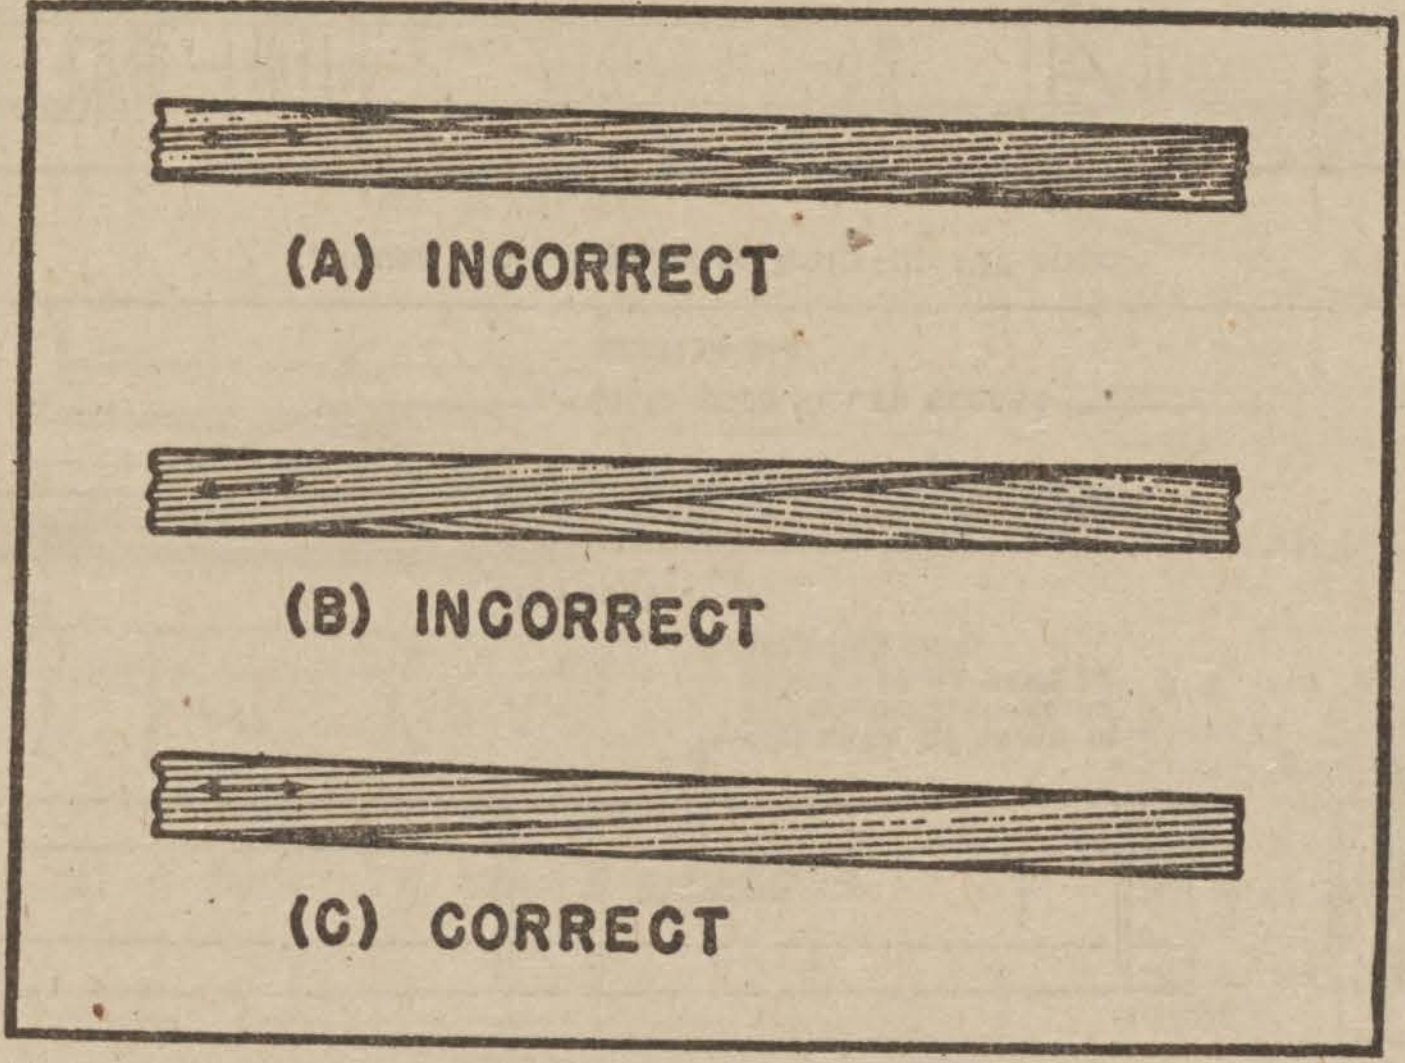

FIGURE 2-2—Consideration of grain direction when making scarf joints.

No grain deviation steeper than 1 in 15 should be present in an outer eighth of the depth of the spar. In an adjacent eighth deviations involving steeper slopes, such as a wave in a few growth layers, are unlikely to be harmful. Local grain slope deviations in excess of those specified may be permitted in spar flanges only in the inner one-fourth of the flange depth.

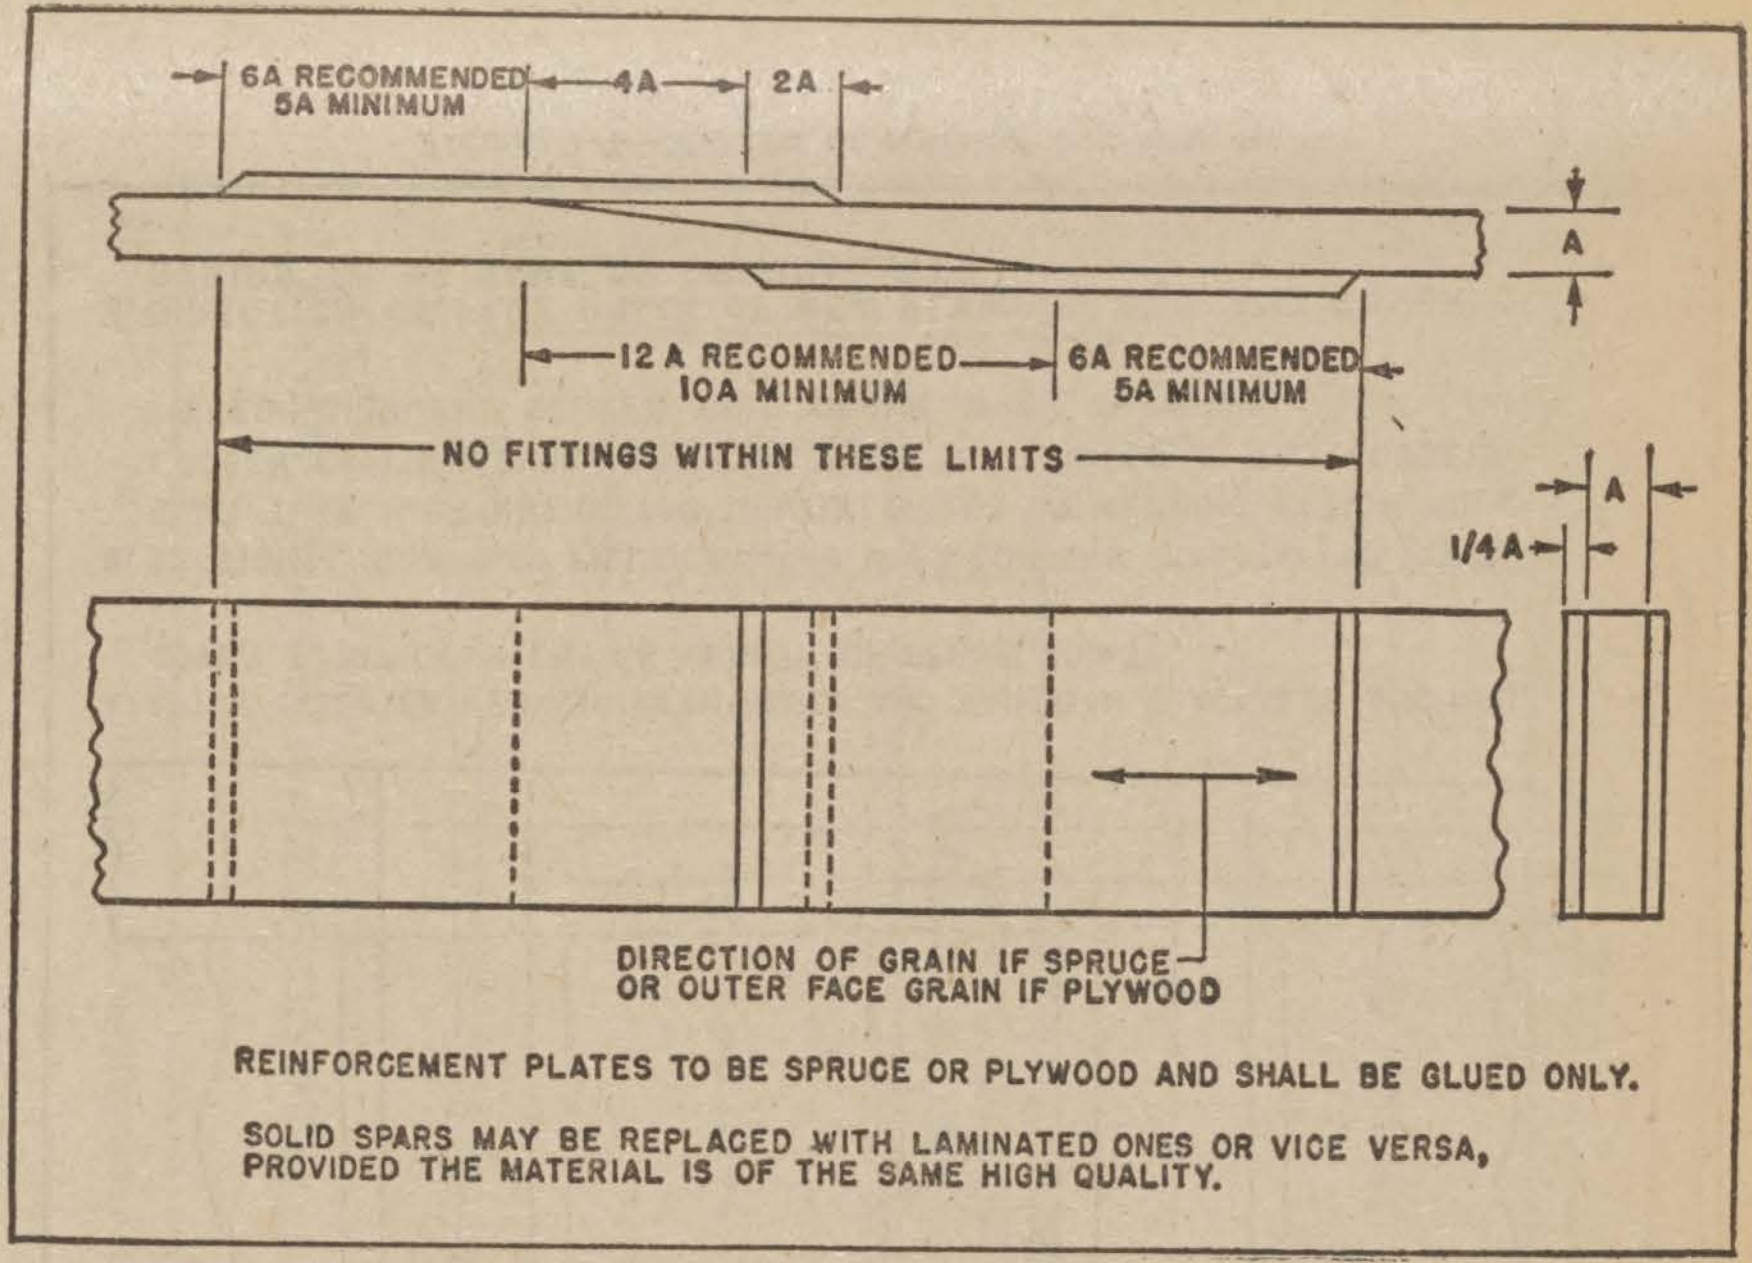
6A RECOMMENDED
5A MINIMUM
4A
2A
A
12 A RECOMMENDED
10A MINIMUM
6A RECOMMENDED
5A MINIMUM
NO FITTINGS WITHIN THESE LIMITS
A
1/4A
DIRECTION OF GRAIN IF SPRUCE OR OUTER FACE GRAIN IF PLYWOOD

REINFORCEMENT PLATES TO BE SPRUCE OR PLYWOOD AND SHALL BE GLUED ONLY.

SOLID SPARS MAY BE REPLACED WITH LAMINATED ONES OR VICE VERSA, PROVIDED THE MATERIAL IS OF THE SAME HIGH QUALITY.

FIGURE 2-3—Method of splicing solid or laminated rectangular spars.

IF SPLICE IS MADE WHERE ROUTING IS FEATHERED TO FULL WIDTH OF SPAR, TAPERED PLATES CONFORMING TO THE CONTOUR OF THE ROUTING, SHOULD FIRST BE ADDED. OTHERWISE THE SPLICE IS THE SAME AS SHOWN.

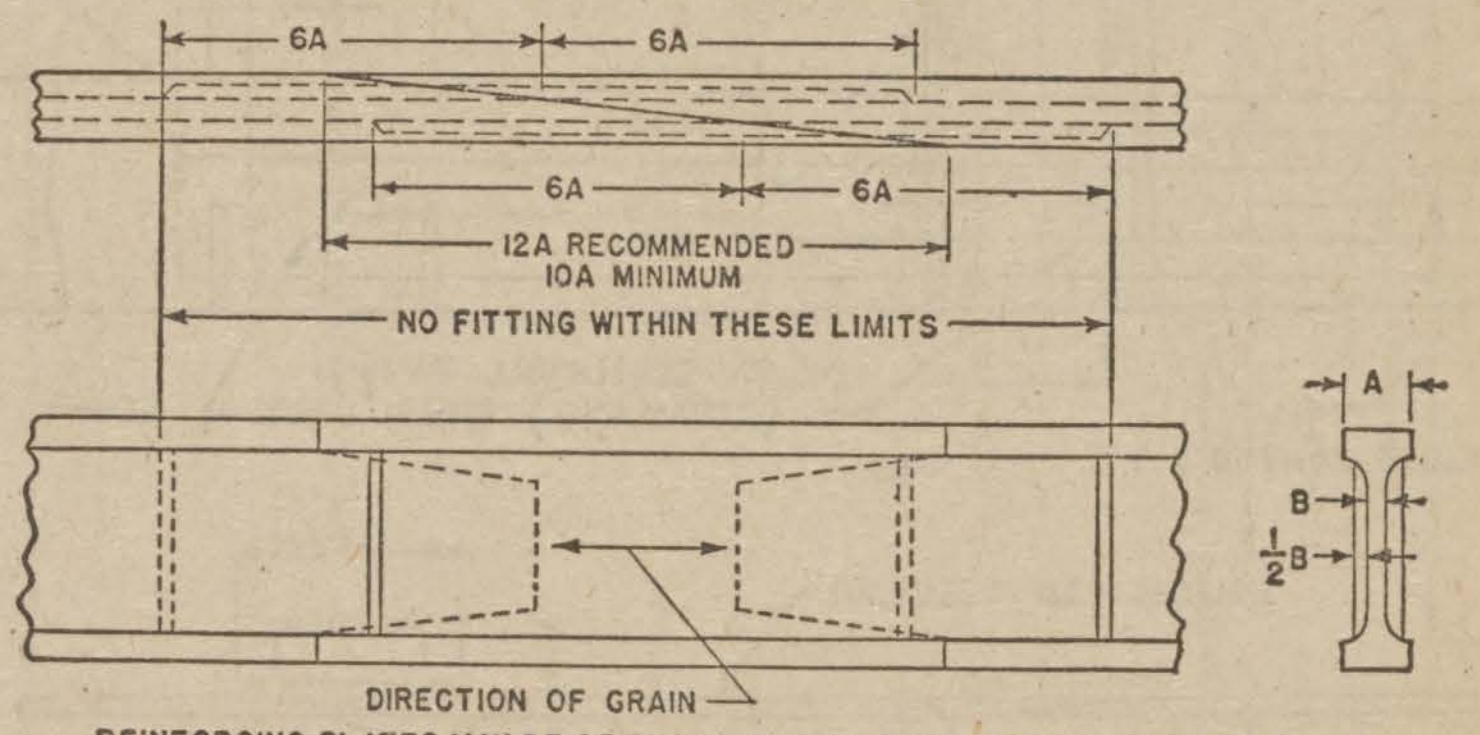

REINFORCING PLATES MAY BE OF PLYWOOD, THE SAME MATERIAL AS THE SPAR, OR MATERIAL OF EQUAL OR HIGHER QUALITY, AND SHALL BE GLUED ONLY.

FIGURE 2-4—Method of splicing solid "I" spars.

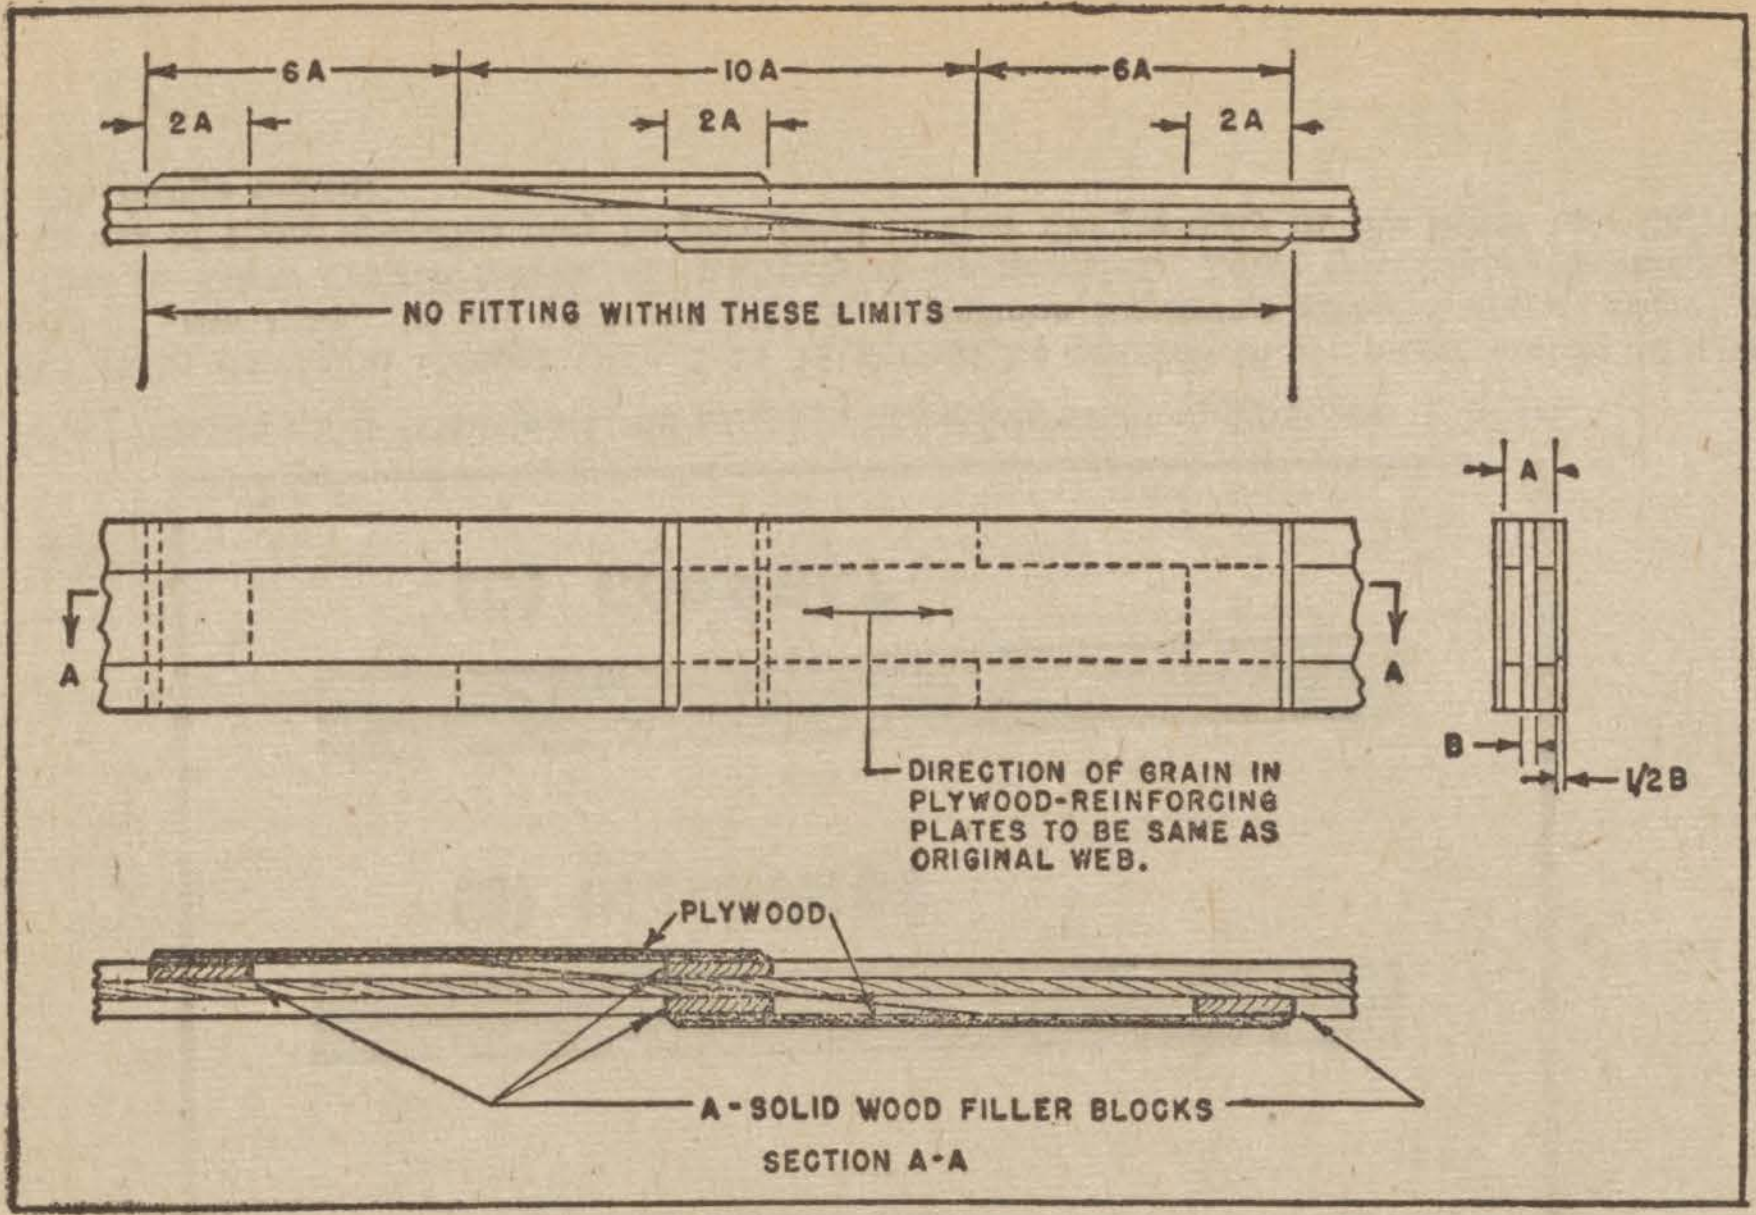
6A
10A
6A
2A
2A
2A
NO FITTING WITHIN THESE LIMITS
A
A
A
B
1/2B
DIRECTION OF GRAIN IN PLYWOOD-REINFORCING PLATES TO BE SAME AS ORIGINAL WEB.
PLYWOOD
A-SOLID WOOD FILLER BLOCKS
SECTION A-A

FIGURE 2-5—Repairs to built-up "I" spar.

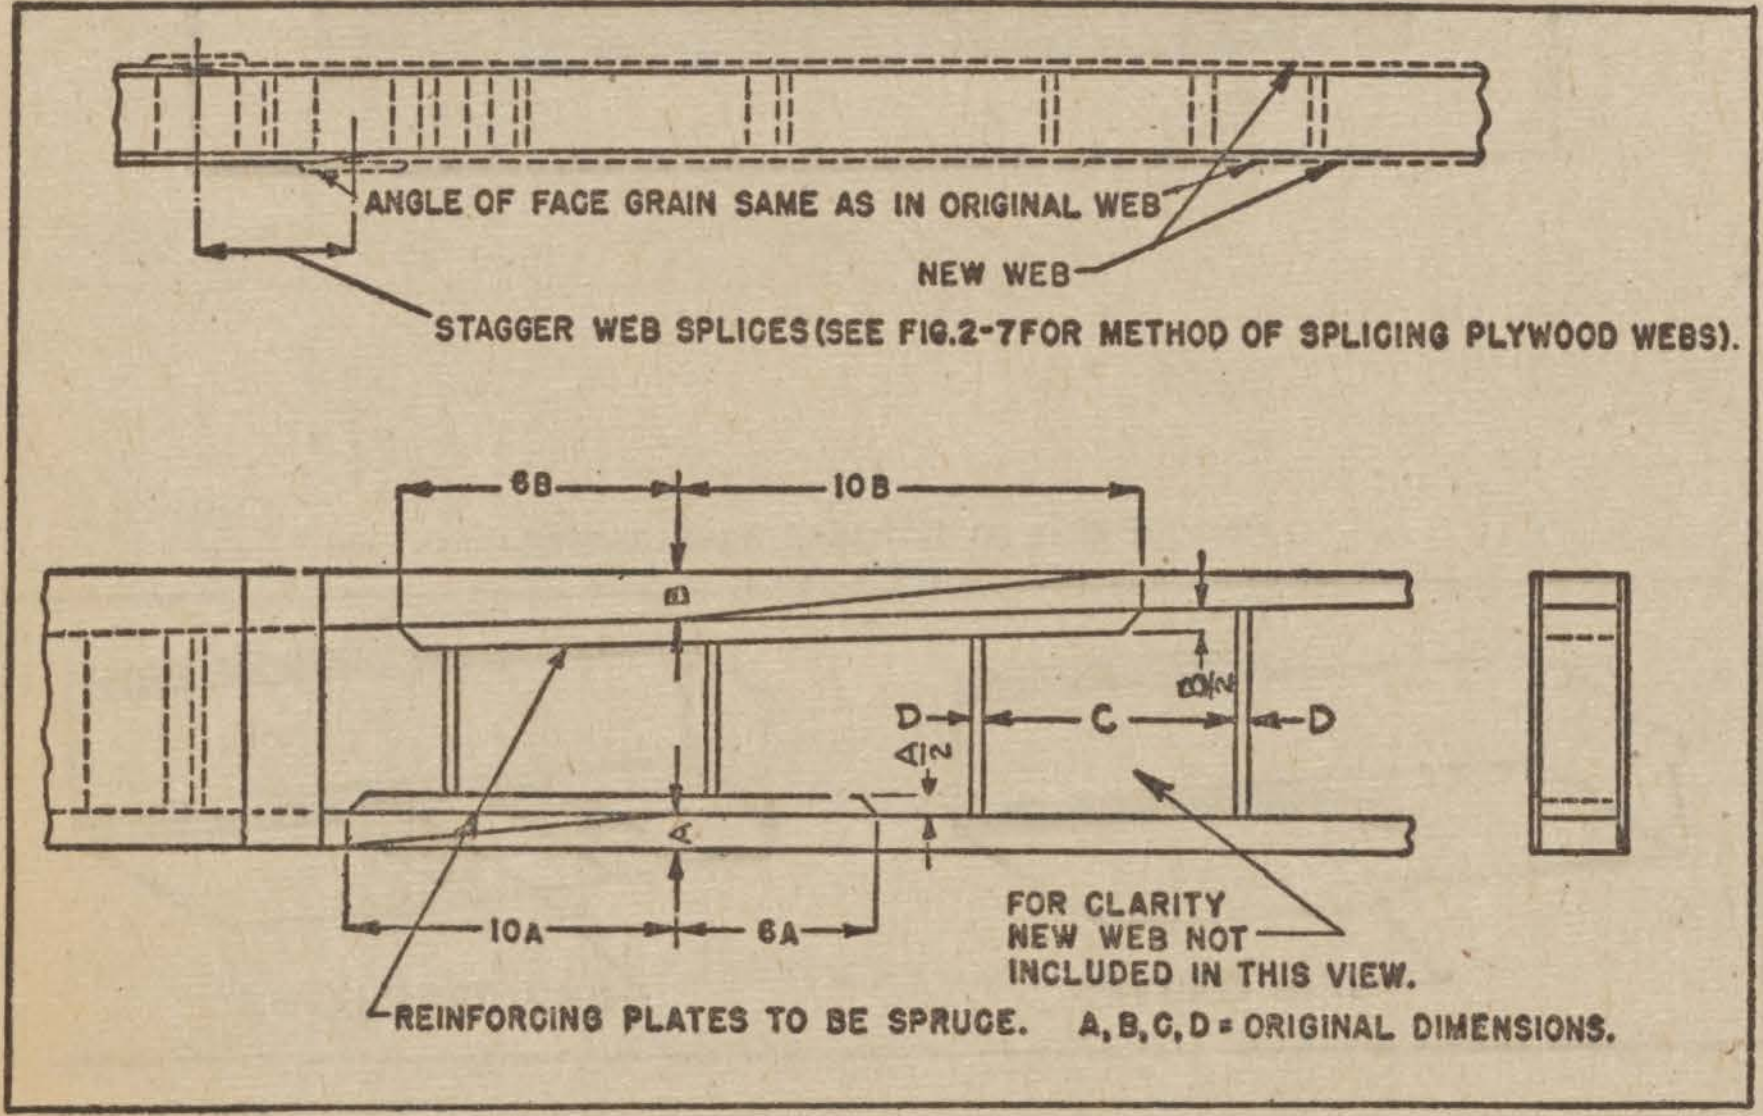
ANGLE OF FACE GRAIN SAME AS IN ORIGINAL WEB
NEW WEB
STAGGER WEB SPLICES (SEE FIG.2-7 FOR METHOD OF SPLICING PLYWOOD WEBS).
6B
10B
B
D
C
D
B/2
A/2
A
10A
6A
FOR CLARITY NEW WEB NOT INCLUDED IN THIS VIEW.
REINFORCING PLATES TO BE SPRUCE. A, B, C, D = ORIGINAL DIMENSIONS.

FIGURE 2-6—Method of splicing box-spar flanges (plate method).

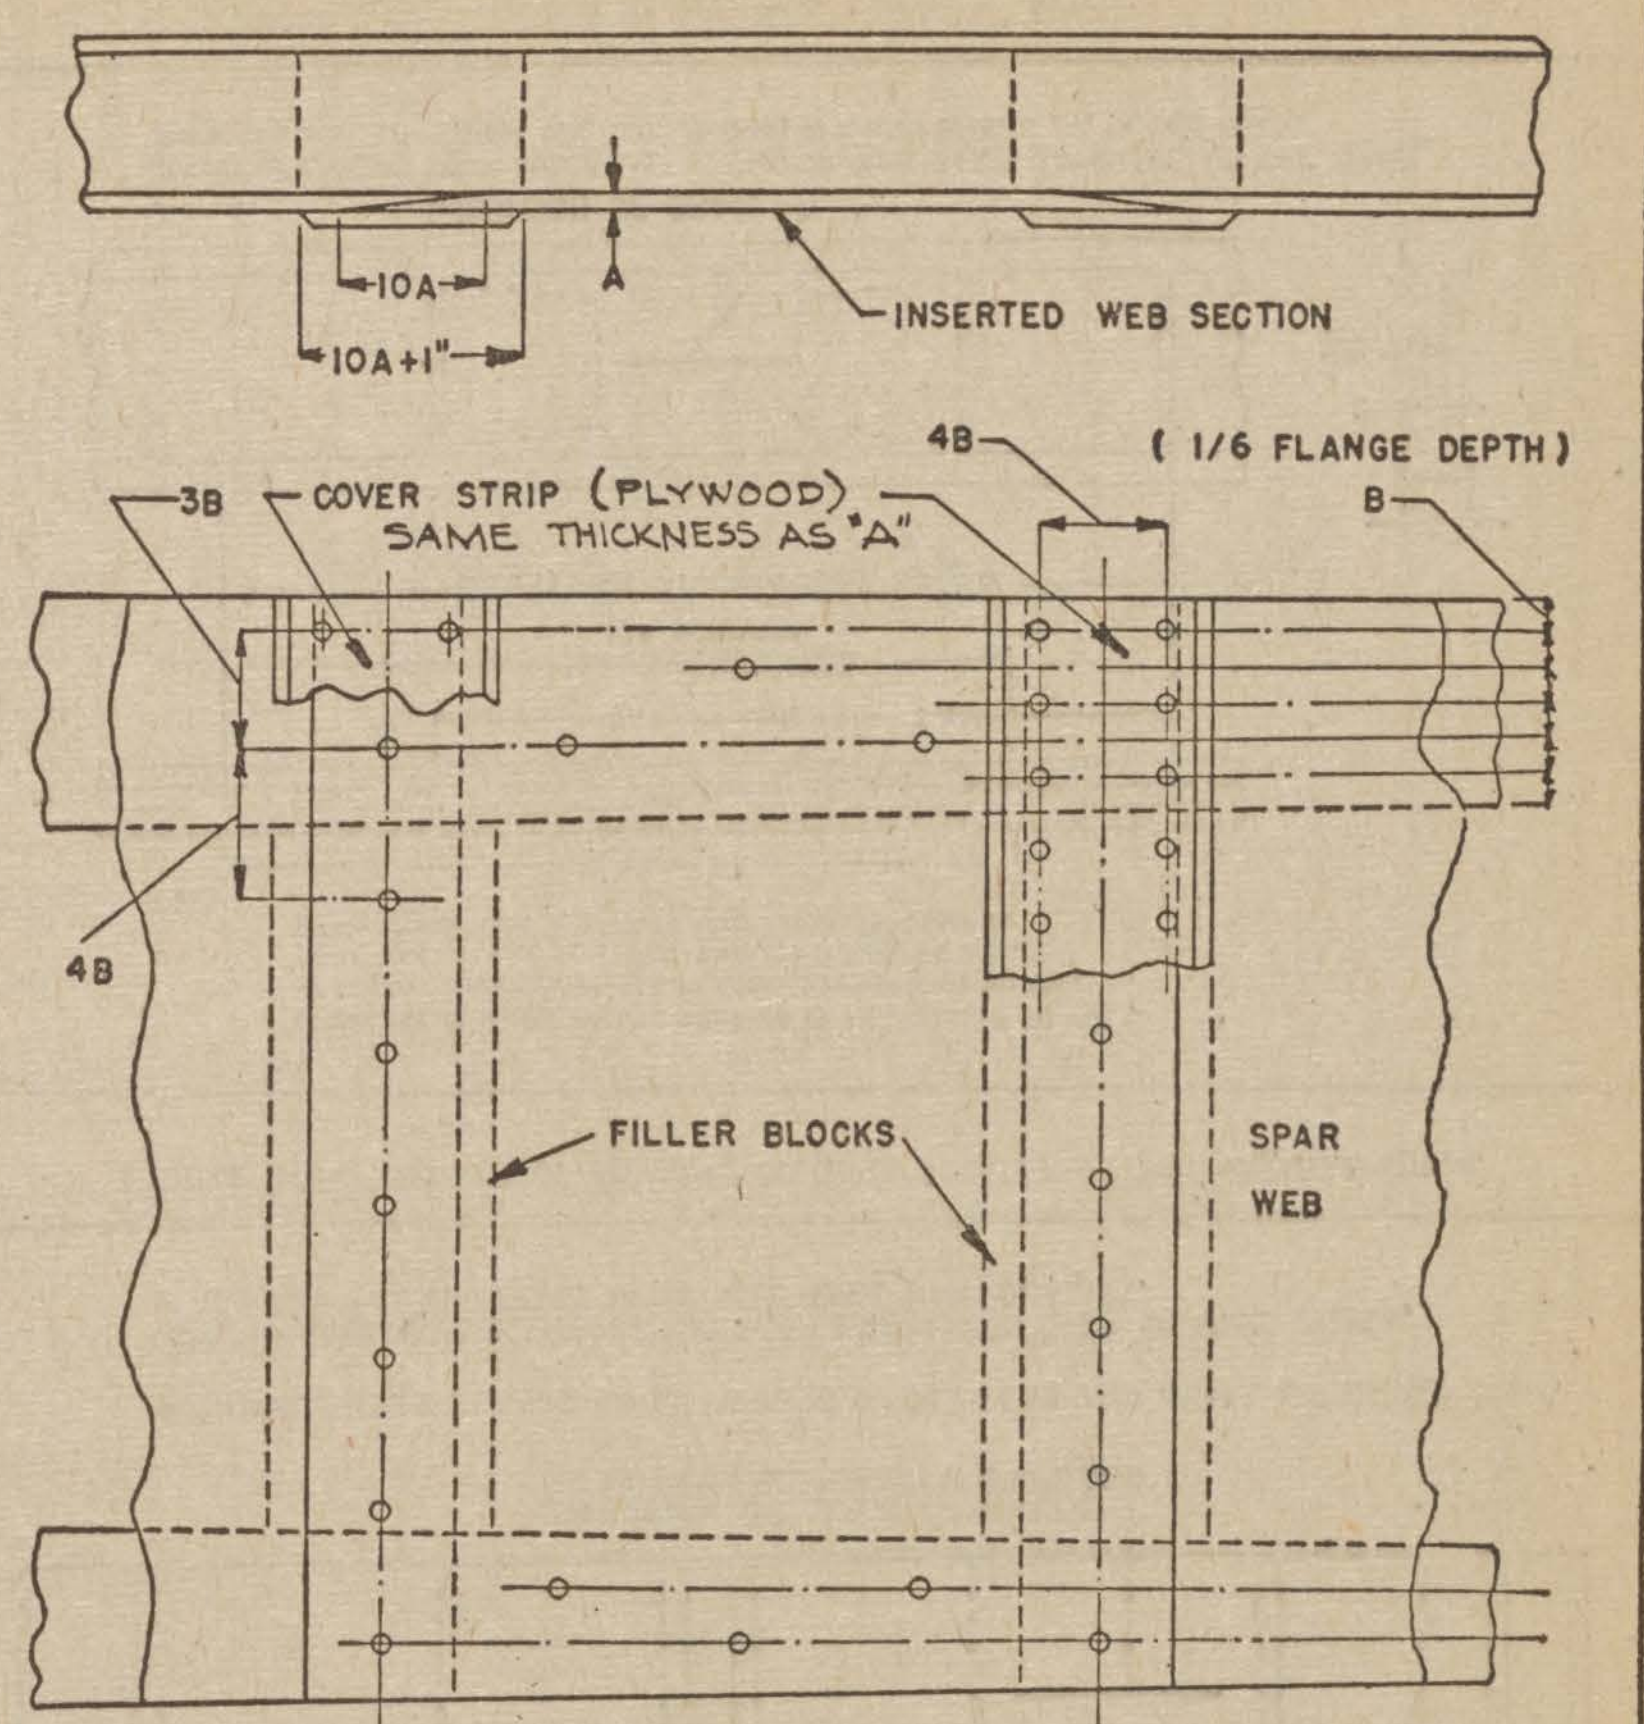

1. AFTER INSERTED WEB HAS BEEN GLUED AND NAILED IN PLACE, GLUE AND NAIL COVER STRIP OVER ENTIRE LENGTH OF SPLICE JOINTS.

2. SECTIONAL SHAPE OF FILLER BLOCKS MUST CONFORM EXACTLY TO TAPER OF SPAR. THEY MUST NOT BE TOO TIGHTLY FITTED OR WEDGING ACTION WILL LOOSEN EXISTING GLUE JOINTS OF WEBS TO FLANGES. IF TOO LOOSELY FITTED, CRUSHING OF WEB WILL OCCUR WHEN CLAMPING.

3. DIRECTION OF FACE GRAIN OF NEW PLYWOOD WEB AND COVER STRIPS TO BE SAME AS ORIGINAL WEB.

FIGURE 2-7—Method of splicing box-spar webs.

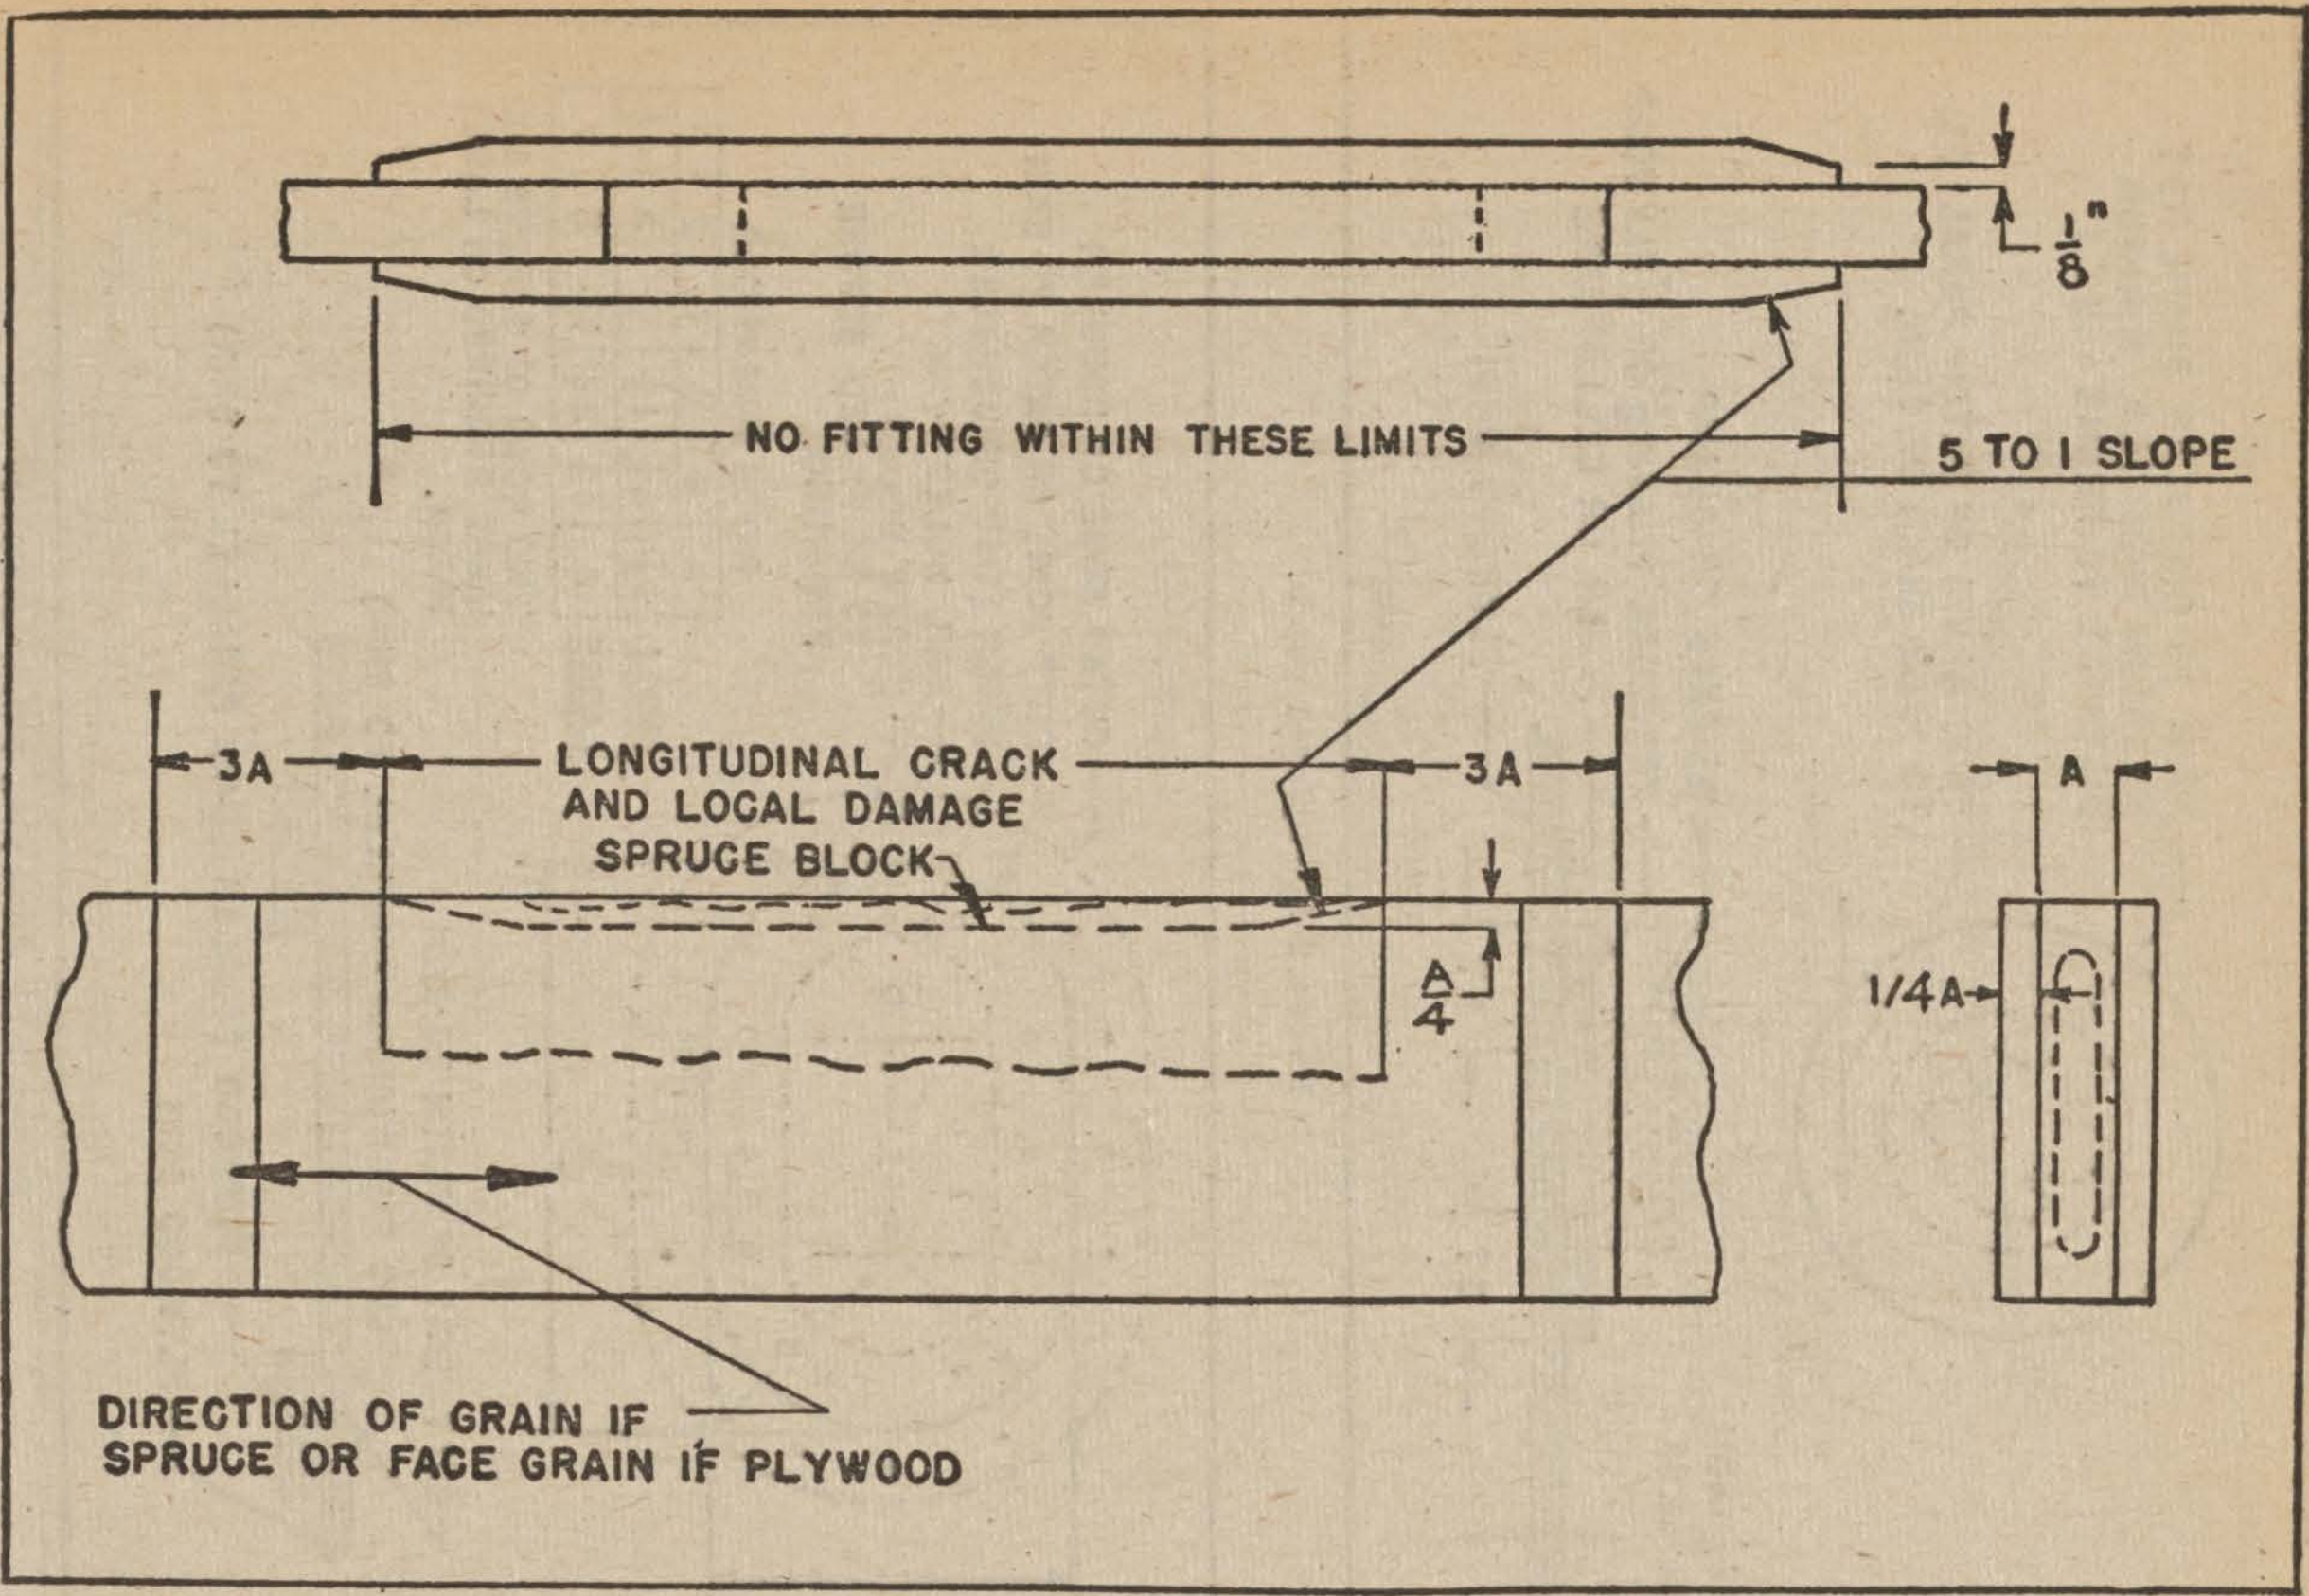

FIGURE 2-8—Method of reinforcing a longitudinal crack and/or local damage in a solid or internally routed spar.

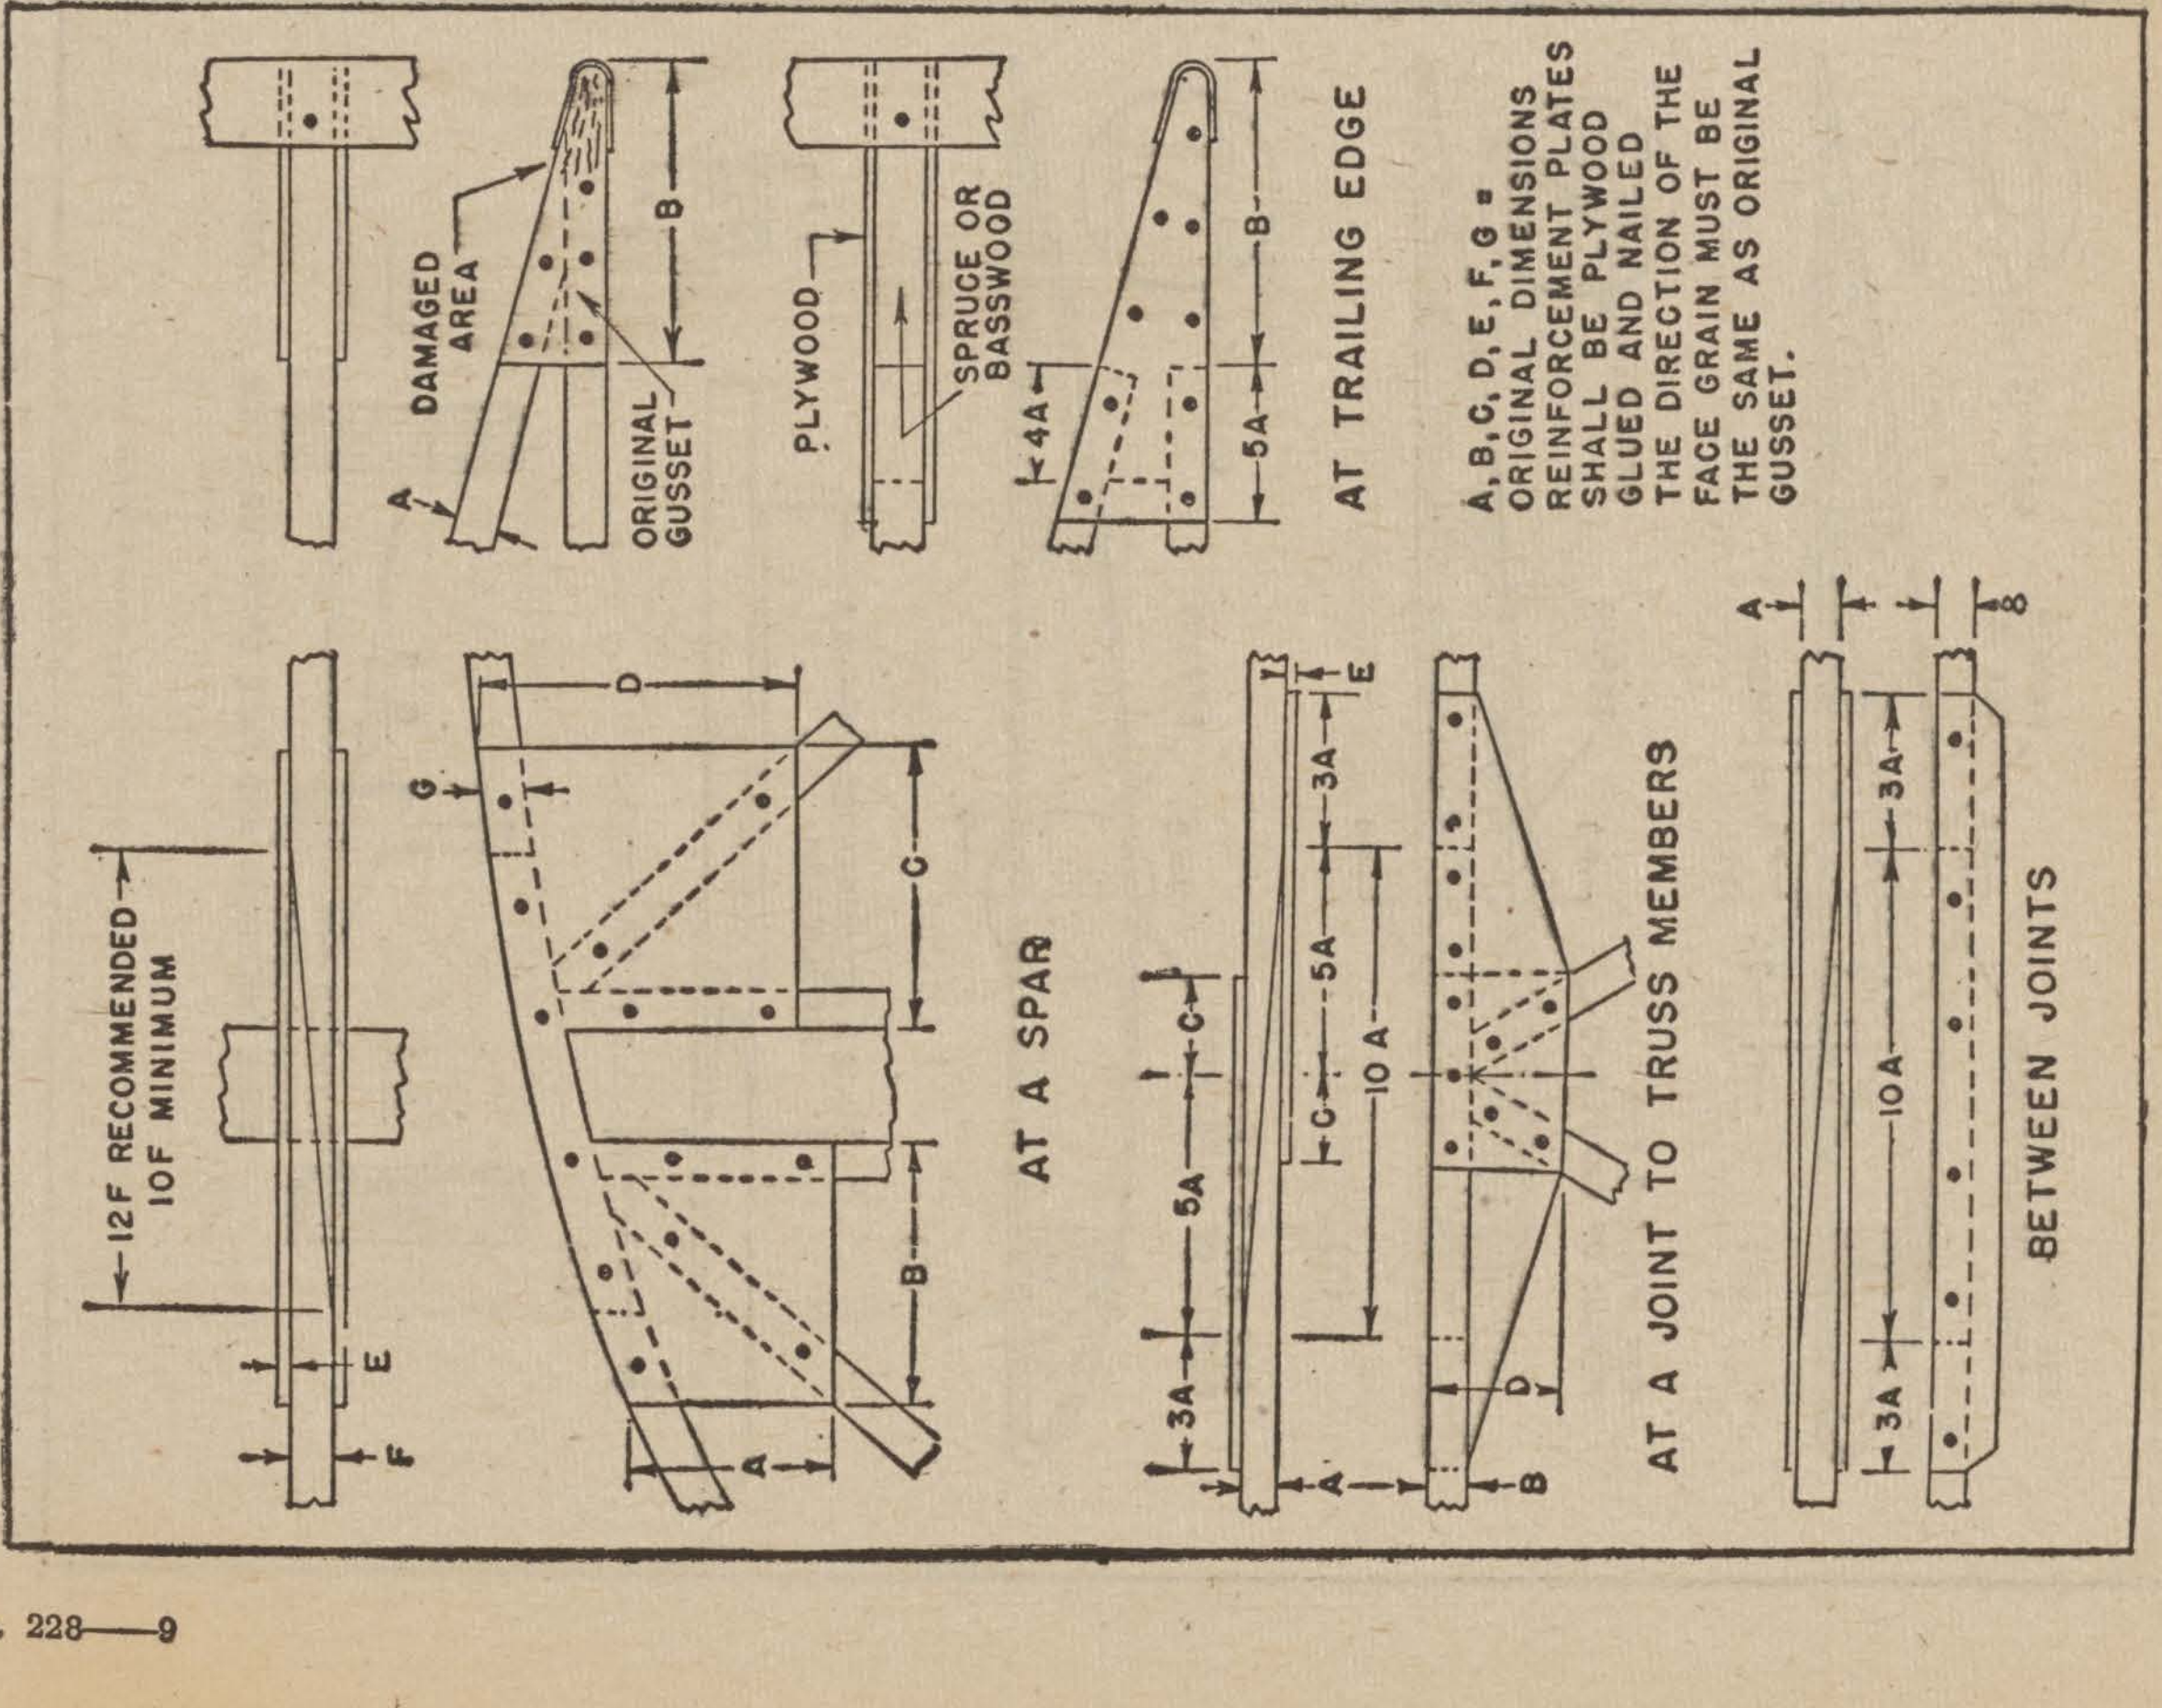

A, B, C, D, E, F, G = ORIGINAL DIMENSIONS REINFORCEMENT PLATES SHALL BE PLYWOOD GLUED AND NAILED THE DIRECTION OF THE FACE GRAIN MUST BE THE SAME AS ORIGINAL GUSSET.

FIGURE 2-9—Repair of wood ribs.

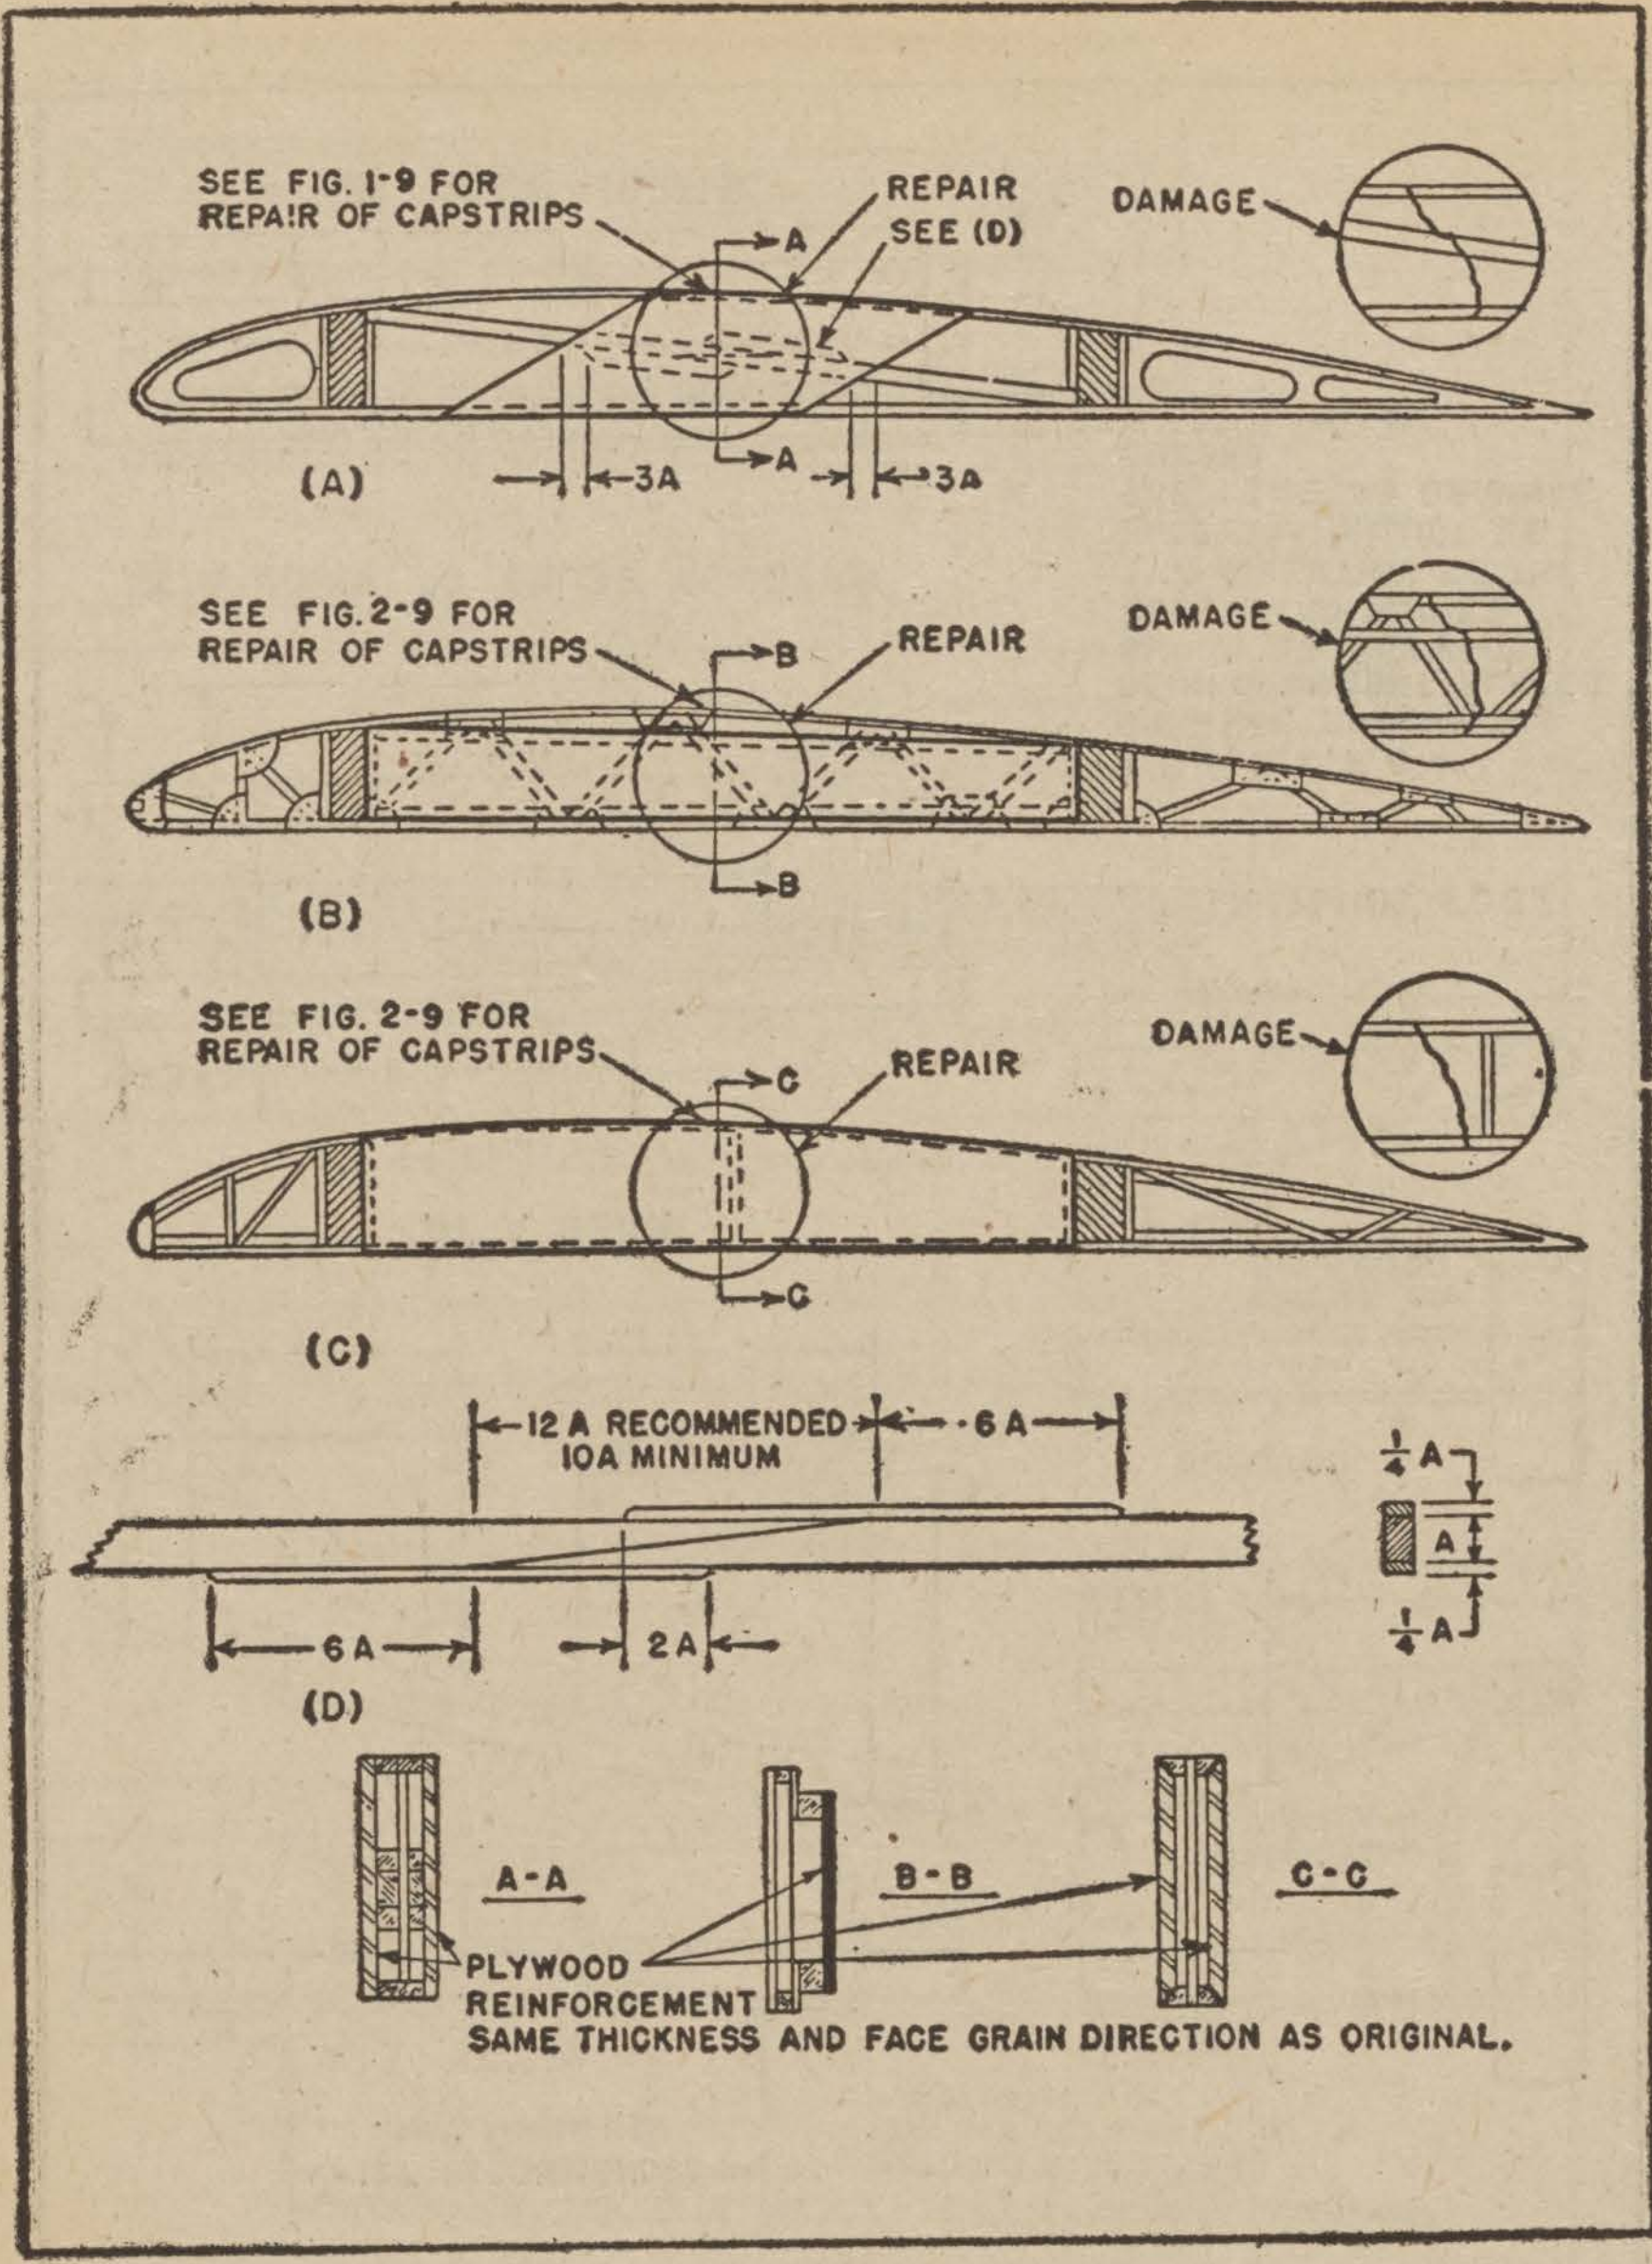
SEE FIG. 1-9 FOR REPAIR OF CAPSTRIPS
REPAIR SEE (D)
DAMAGE
A
3A
3A
(A)
SEE FIG. 2-9 FOR REPAIR OF CAPSTRIPS
REPAIR
DAMAGE
B
(B)
SEE FIG. 2-9 FOR REPAIR OF CAPSTRIPS
REPAIR
DAMAGE
C
(C)
12 A RECOMMENDED 10A MINIMUM
6 A
6 A
2 A
1/4 A
A
1/4 A
(D)
A-A
B-B
C-C
PLYWOOD REINFORCEMENT
SAME THICKNESS AND FACE GRAIN DIRECTION AS ORIGINAL.

FIGURE 2-10—Typical wing compression rib repairs.

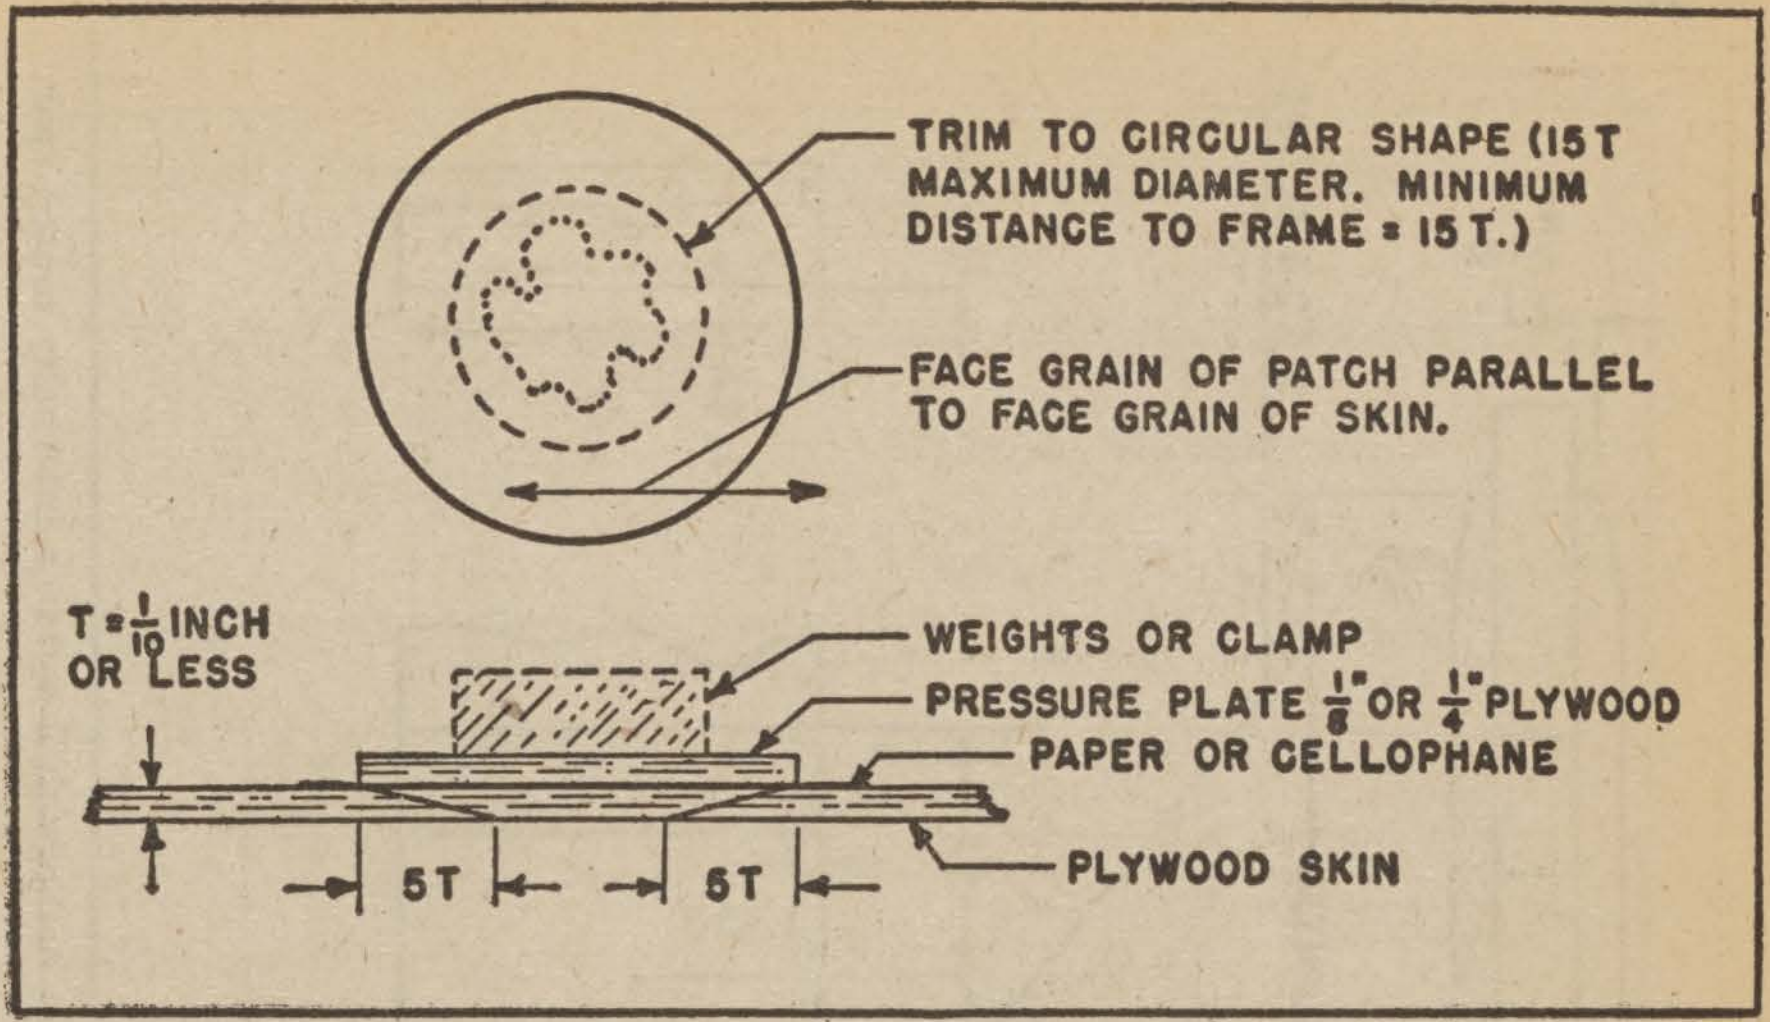
TRIM TO CIRCULAR SHAPE (15T MAXIMUM DIAMETER. MINIMUM DISTANCE TO FRAME = 15T.)
FACE GRAIN OF PATCH PARALLEL TO FACE GRAIN OF SKIN.
T = 1/10 INCH OR LESS
WEIGHTS OR CLAMP
PRESSURE PLATE 1/8" OR 1/4" PLYWOOD
PAPER OR CELLOPHANE
PLYWOOD SKIN
5T
5T

FIGURE 2-11—Splayed patch.

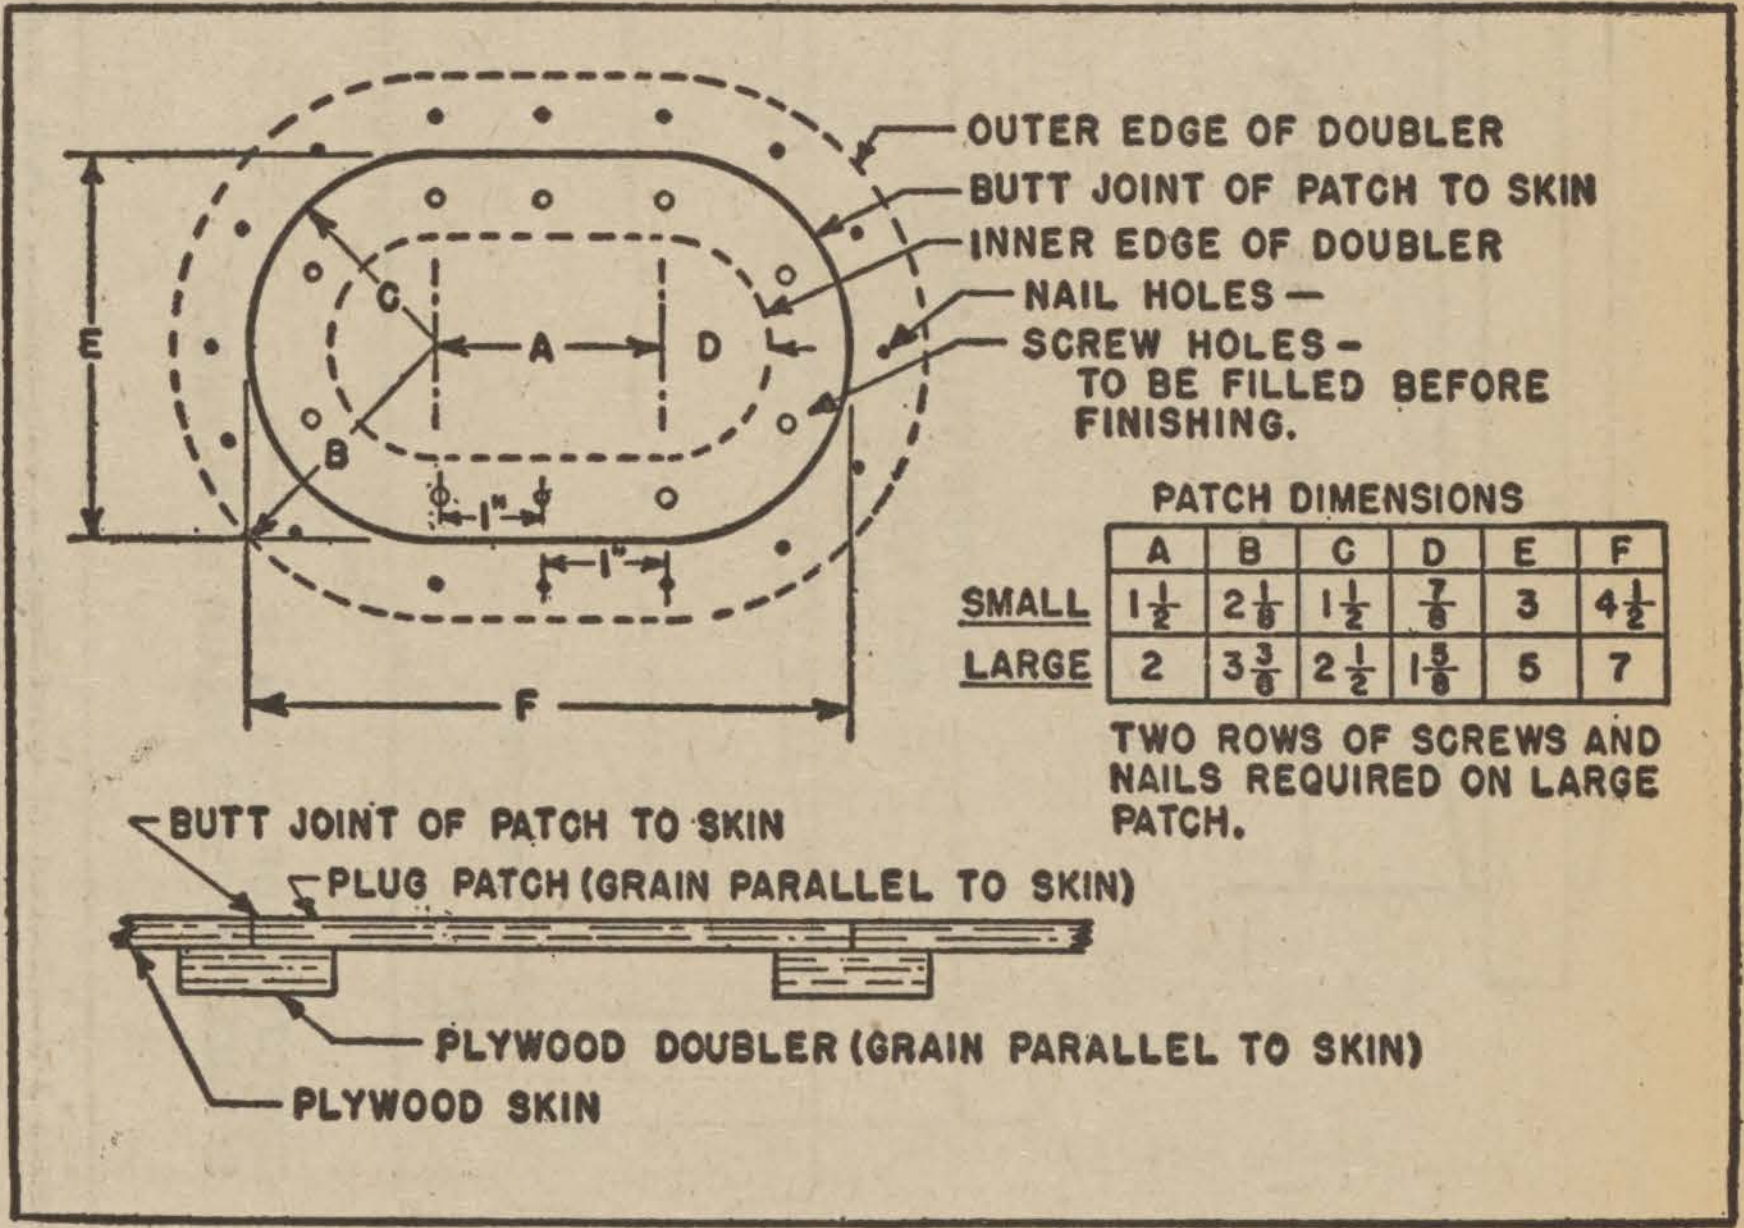
OUTER EDGE OF DOUBLER
BUTT JOINT OF PATCH TO SKIN
INNER EDGE OF DOUBLER
NAIL HOLES—
SCREW HOLES— TO BE FILLED BEFORE FINISHING.
A
B
C
D
E
F
1"
1"
BUTT JOINT OF PATCH TO SKIN
PLUG PATCH (GRAIN PARALLEL TO SKIN)
PLYWOOD DOUBLER (GRAIN PARALLEL TO SKIN)
PLYWOOD SKIN

PATCH DIMENSIONS

|  | A | B | C | D | E | F |
|---|---|---|---|---|---|---|
| SMALL | 1½ | 2⅛ | 1½ | ⅞ | 3 | 4½ |
| LARGE | 2 | 3⅜ | 2½ | 1⅝ | 5 | 7 |

TWO ROWS OF SCREWS AND NAILS REQUIRED ON LARGE PATCH.

FIGURE 2-12—Oval plug patch assembly.

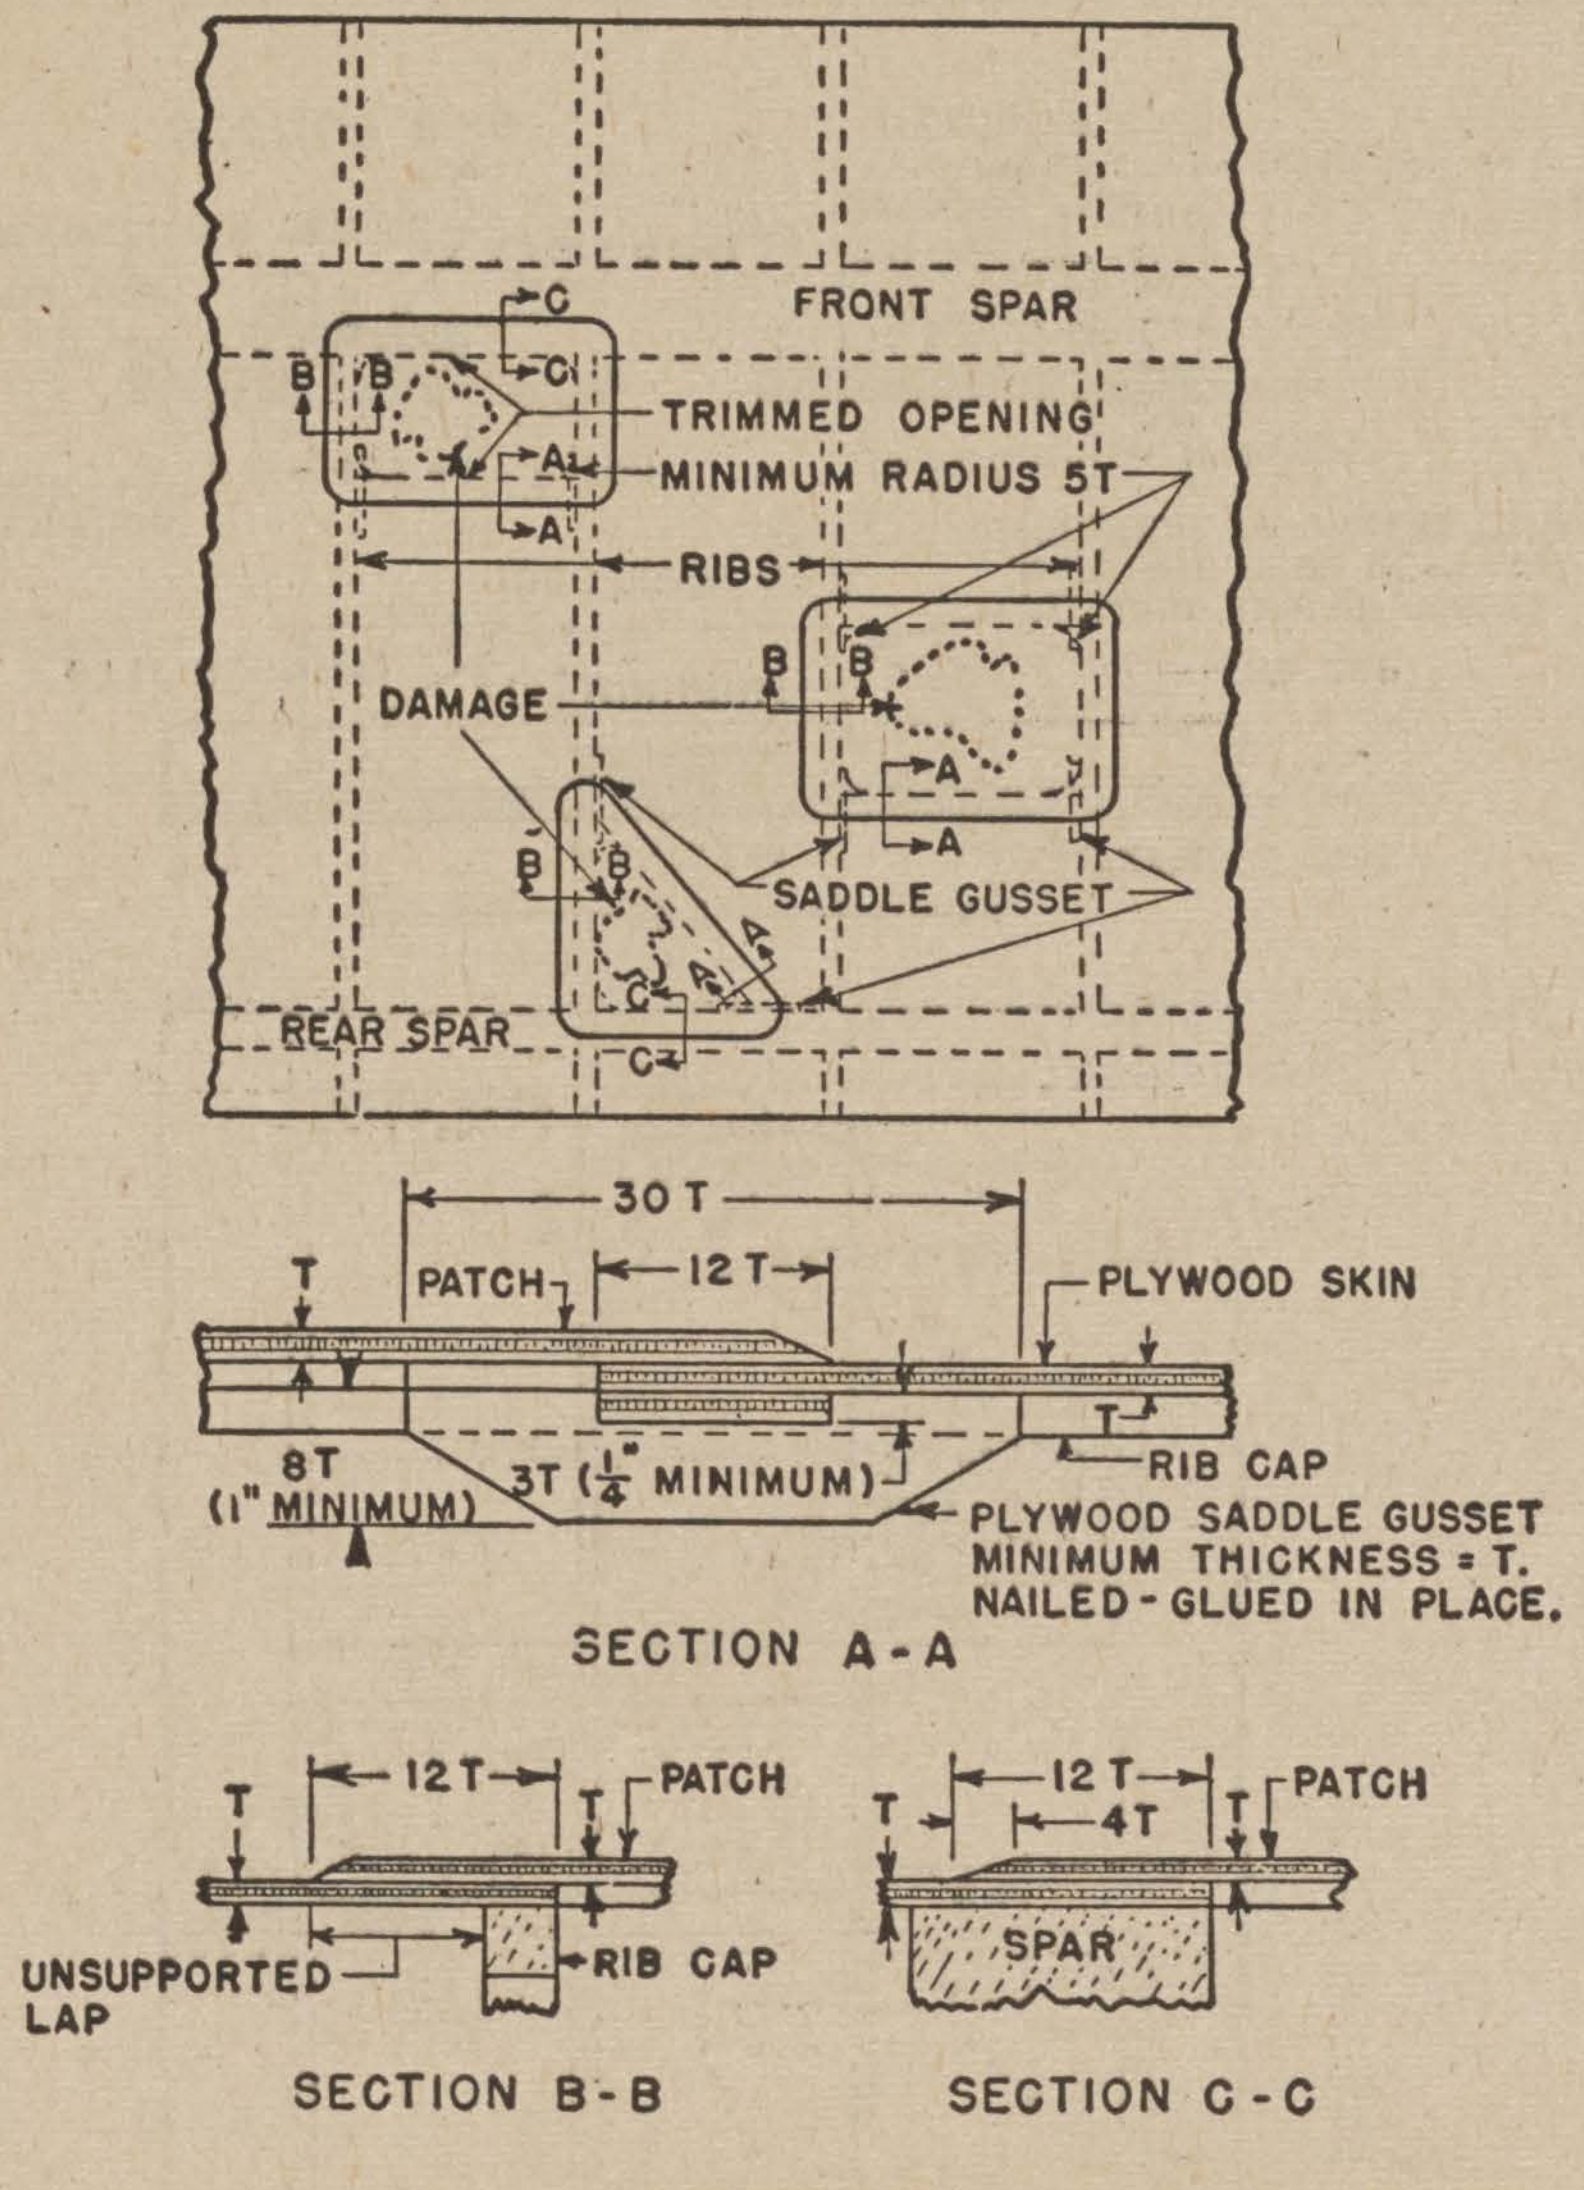

Figure 2-13—Surface patches.

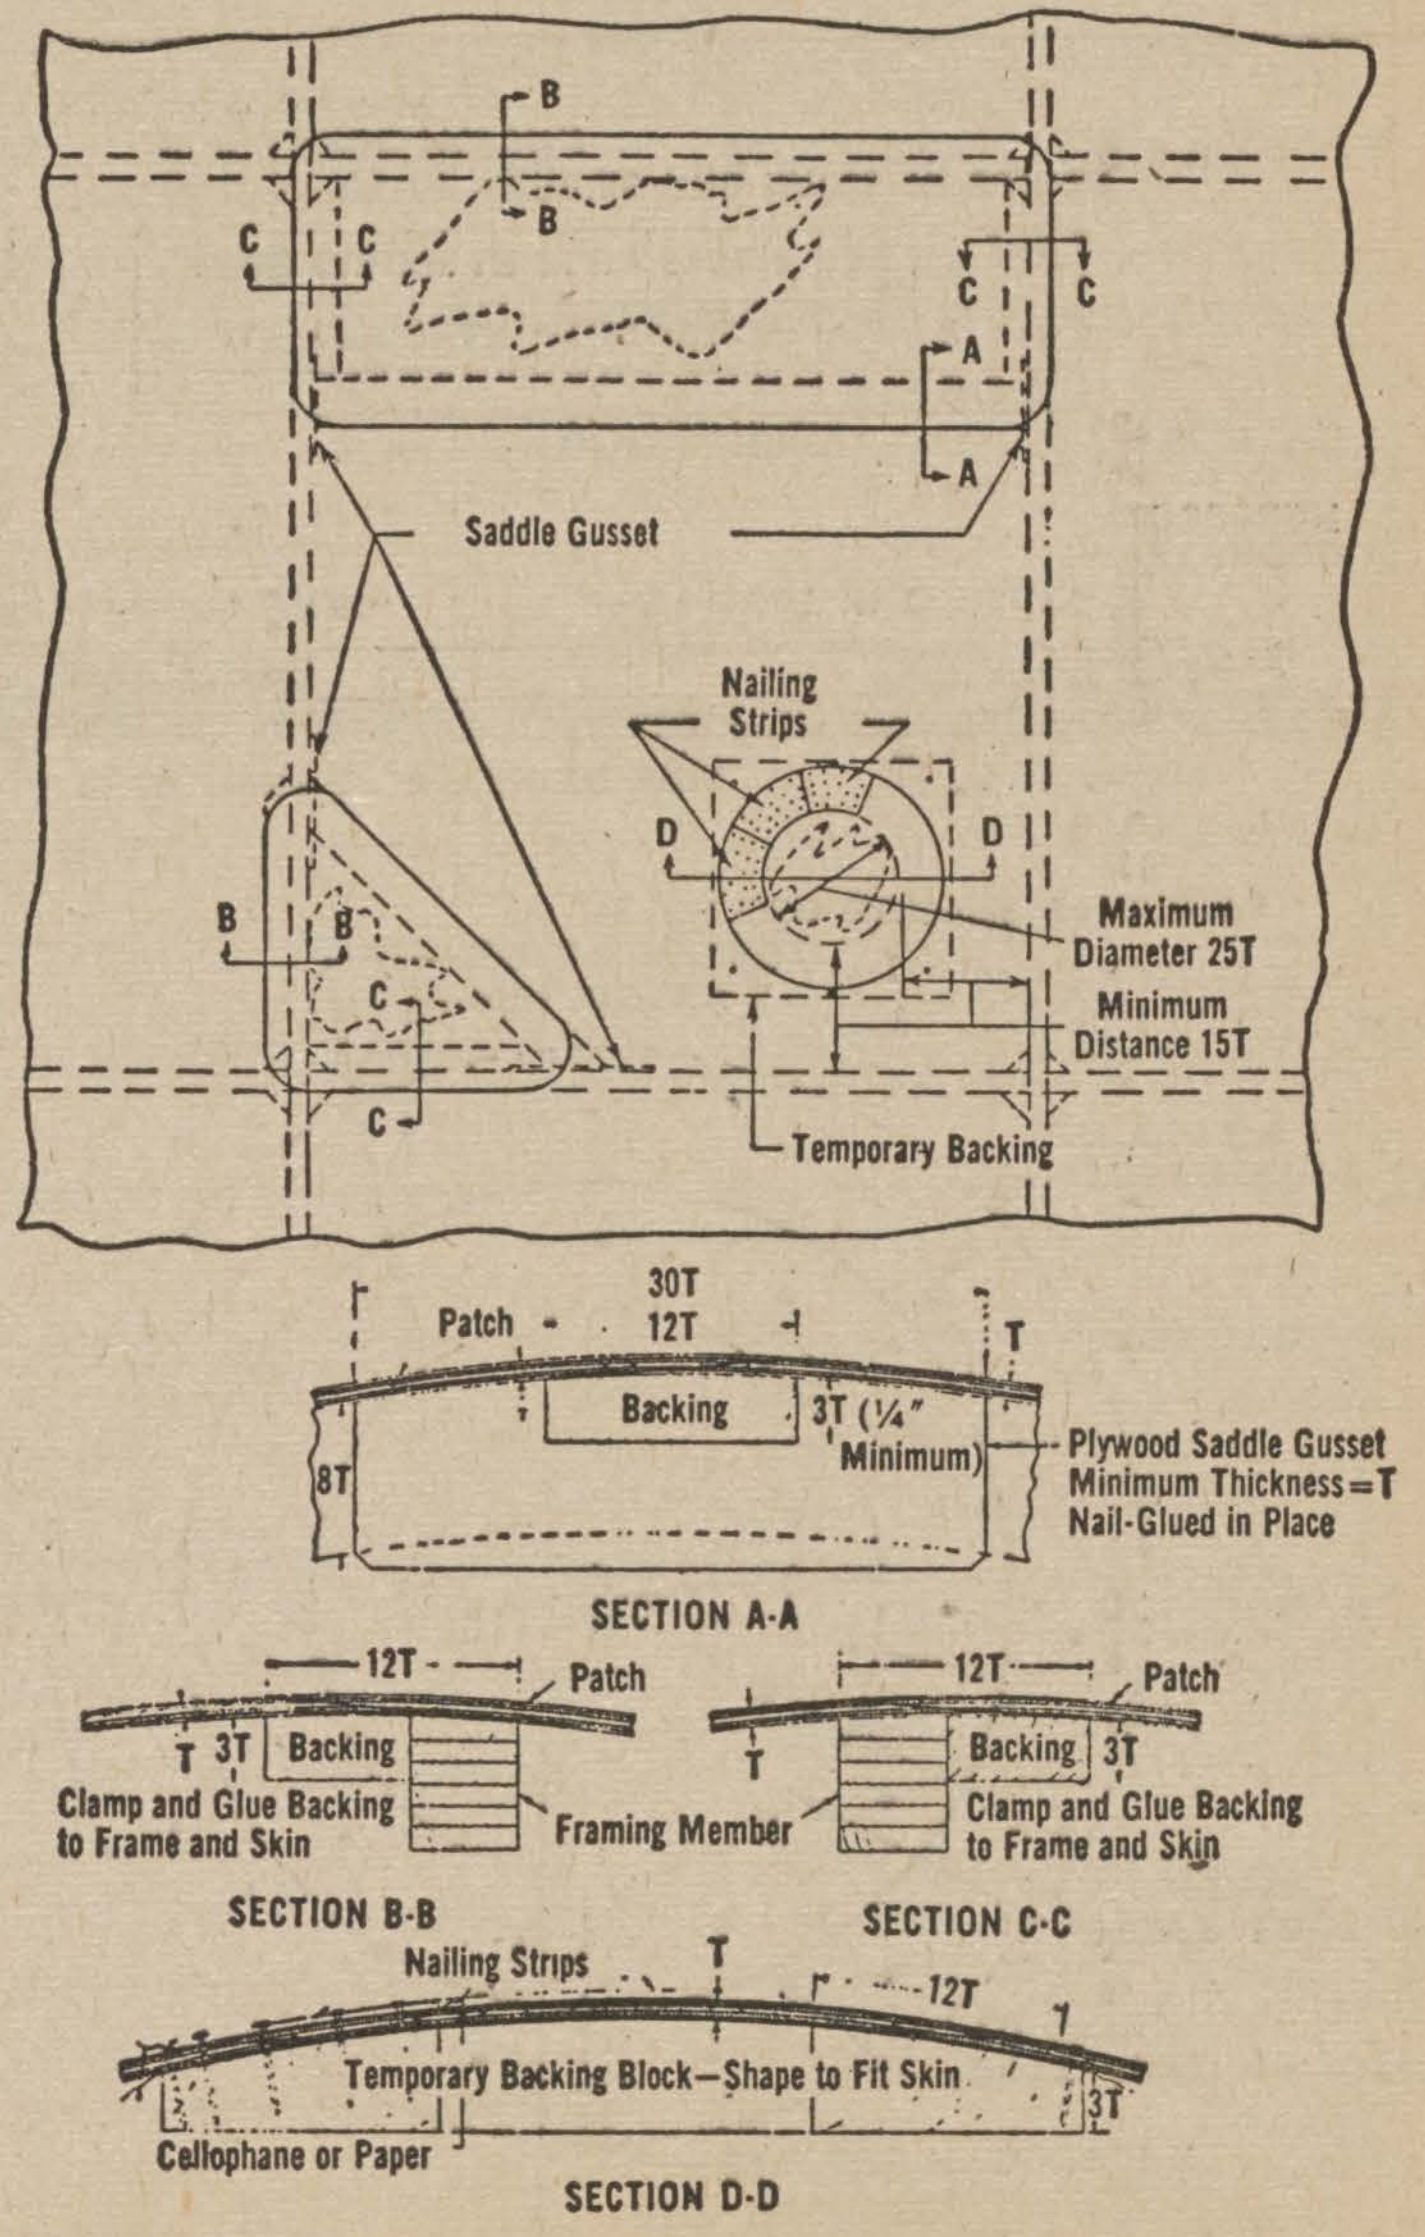

Figure 2-14—Scarf patches—back of skin accessible.

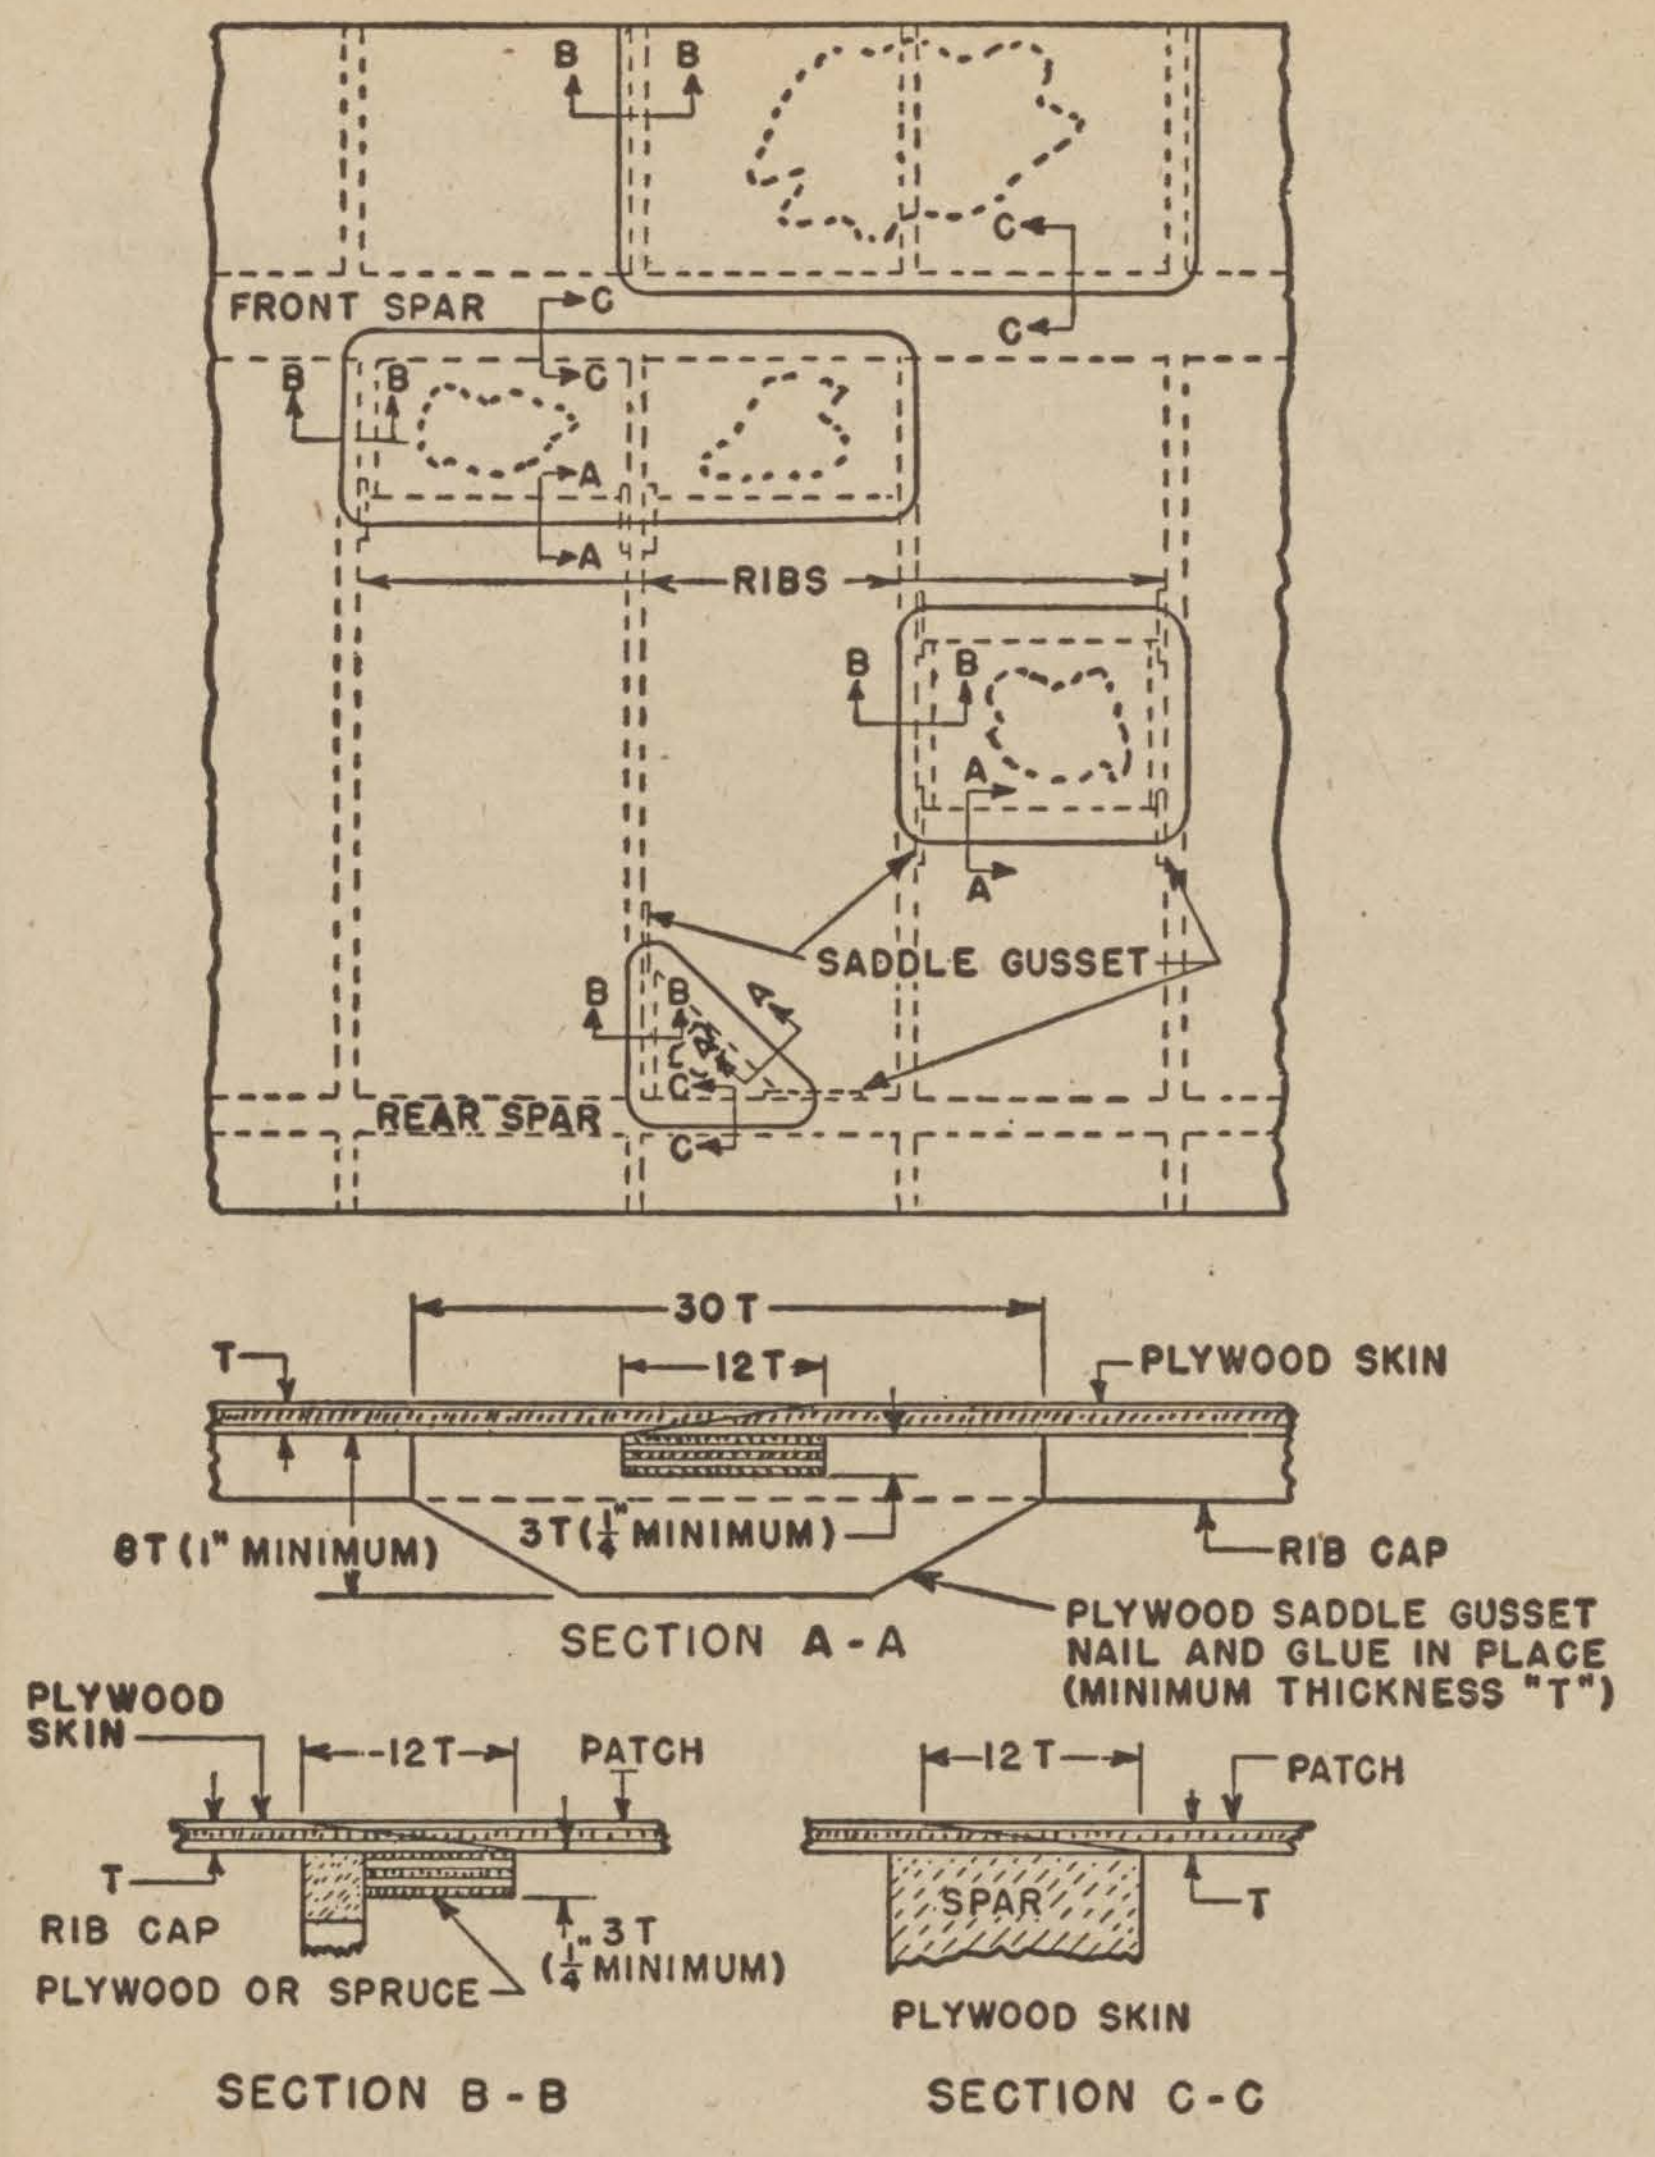

FIGURE 2-15—Scarf patches—Back of skin not accessible.

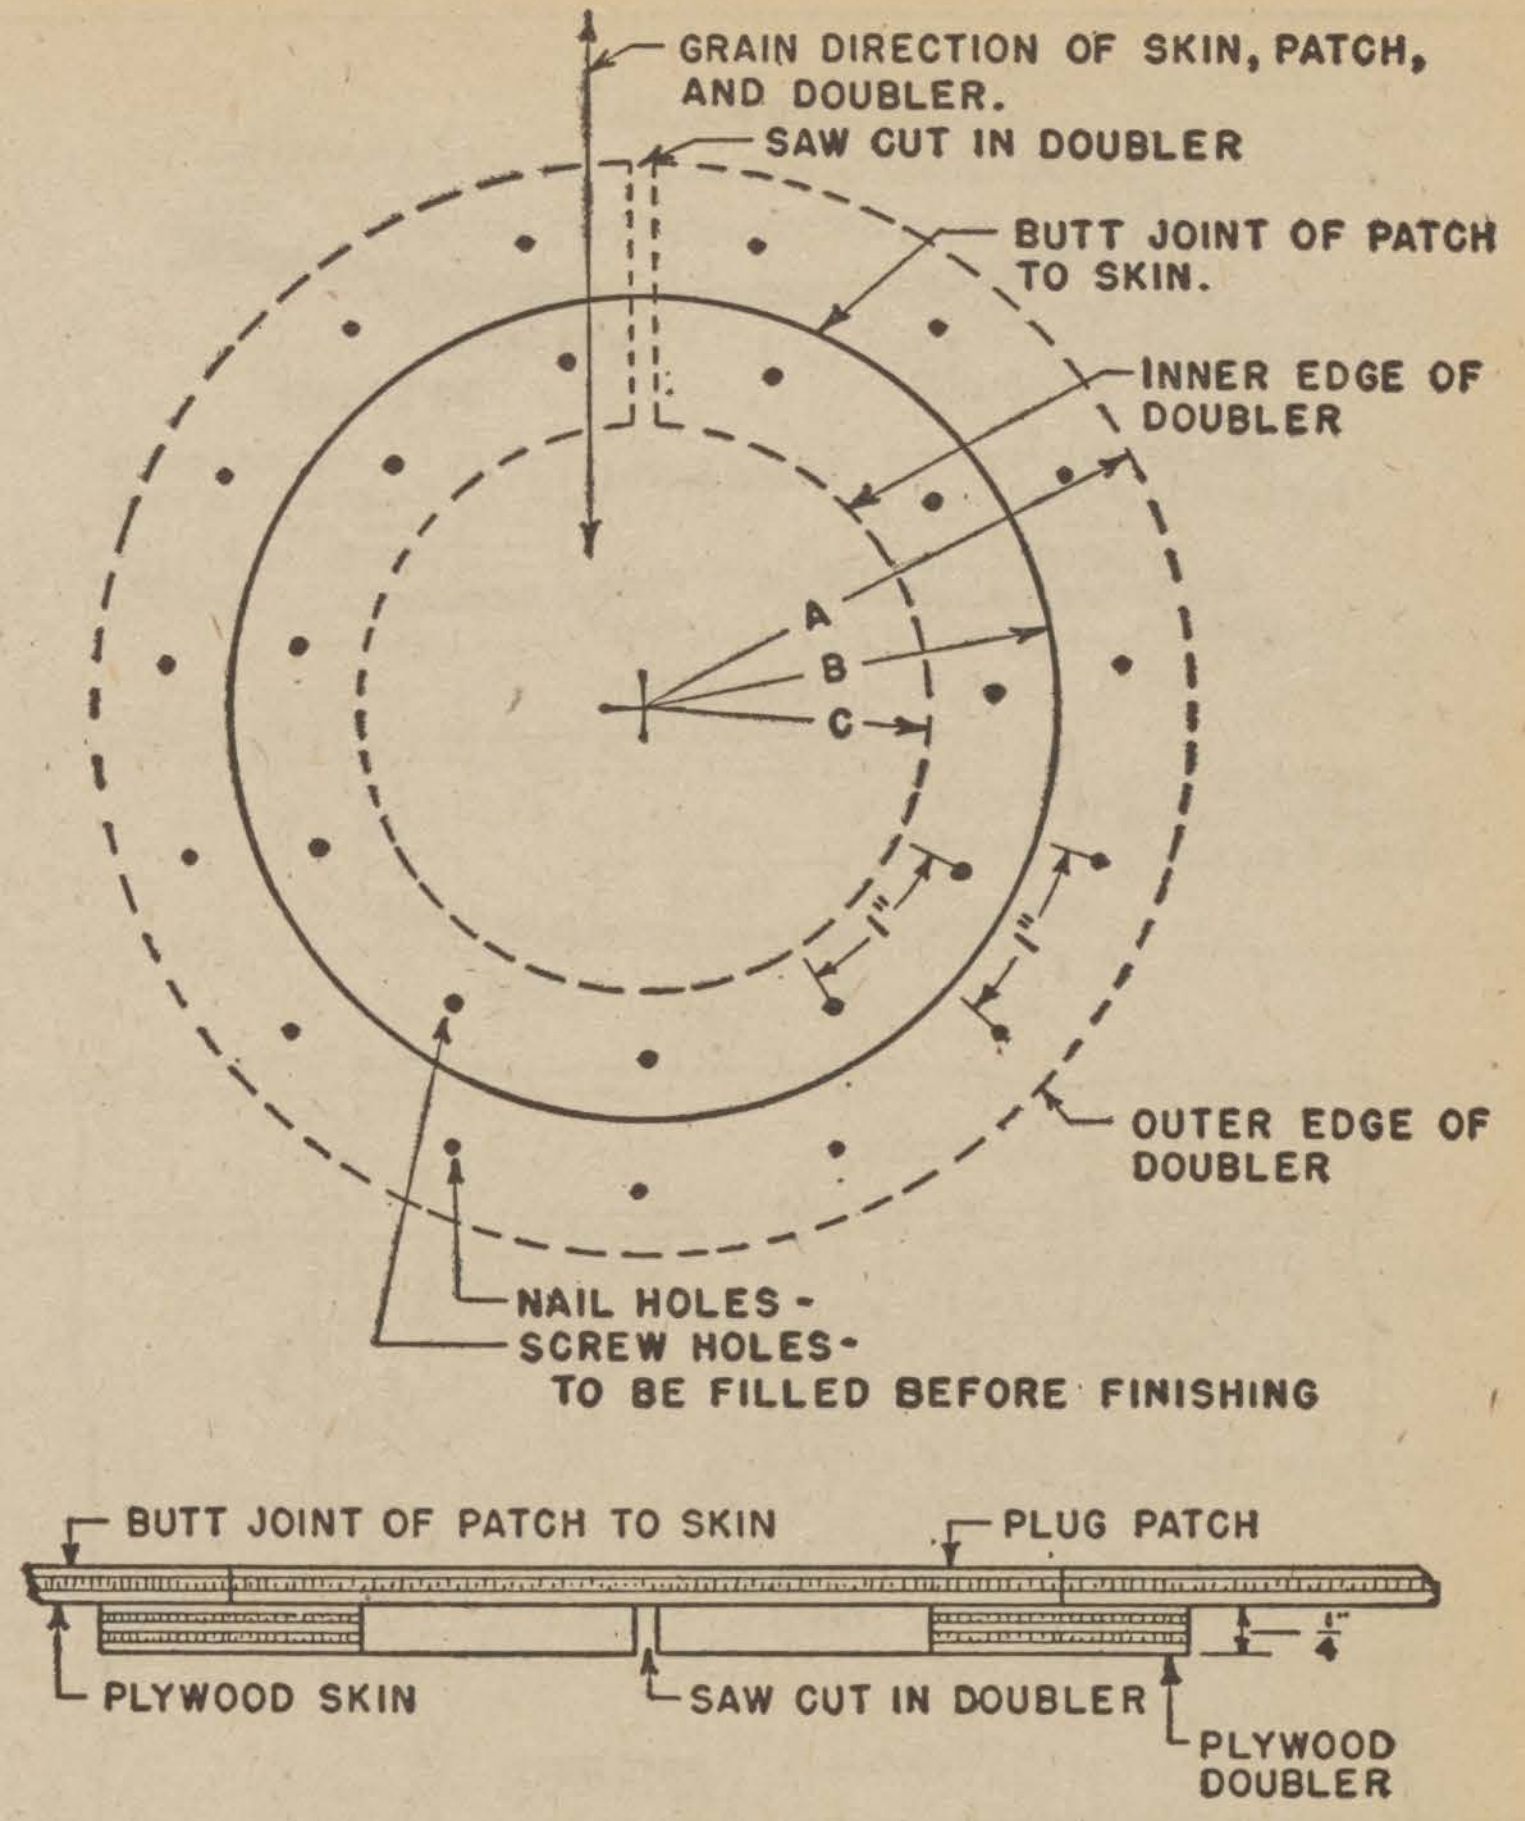

DIMENSIONS

| | A | B | C |
|---|---|---|---|
| SMALL CIRCULAR PLUG PATCH | $2\frac{5}{8}$ | 2 | $1\frac{3}{8}$ |
| LARGE CIRCULAR PLUG PATCH | $3\frac{7}{8}$ | 3 | $2\frac{1}{8}$ |

(TWO ROWS OF SCREWS AND NAILS REQUIRED FOR LARGE PATCH.)

FIGURE 2-16—Round plug-patch assembly.

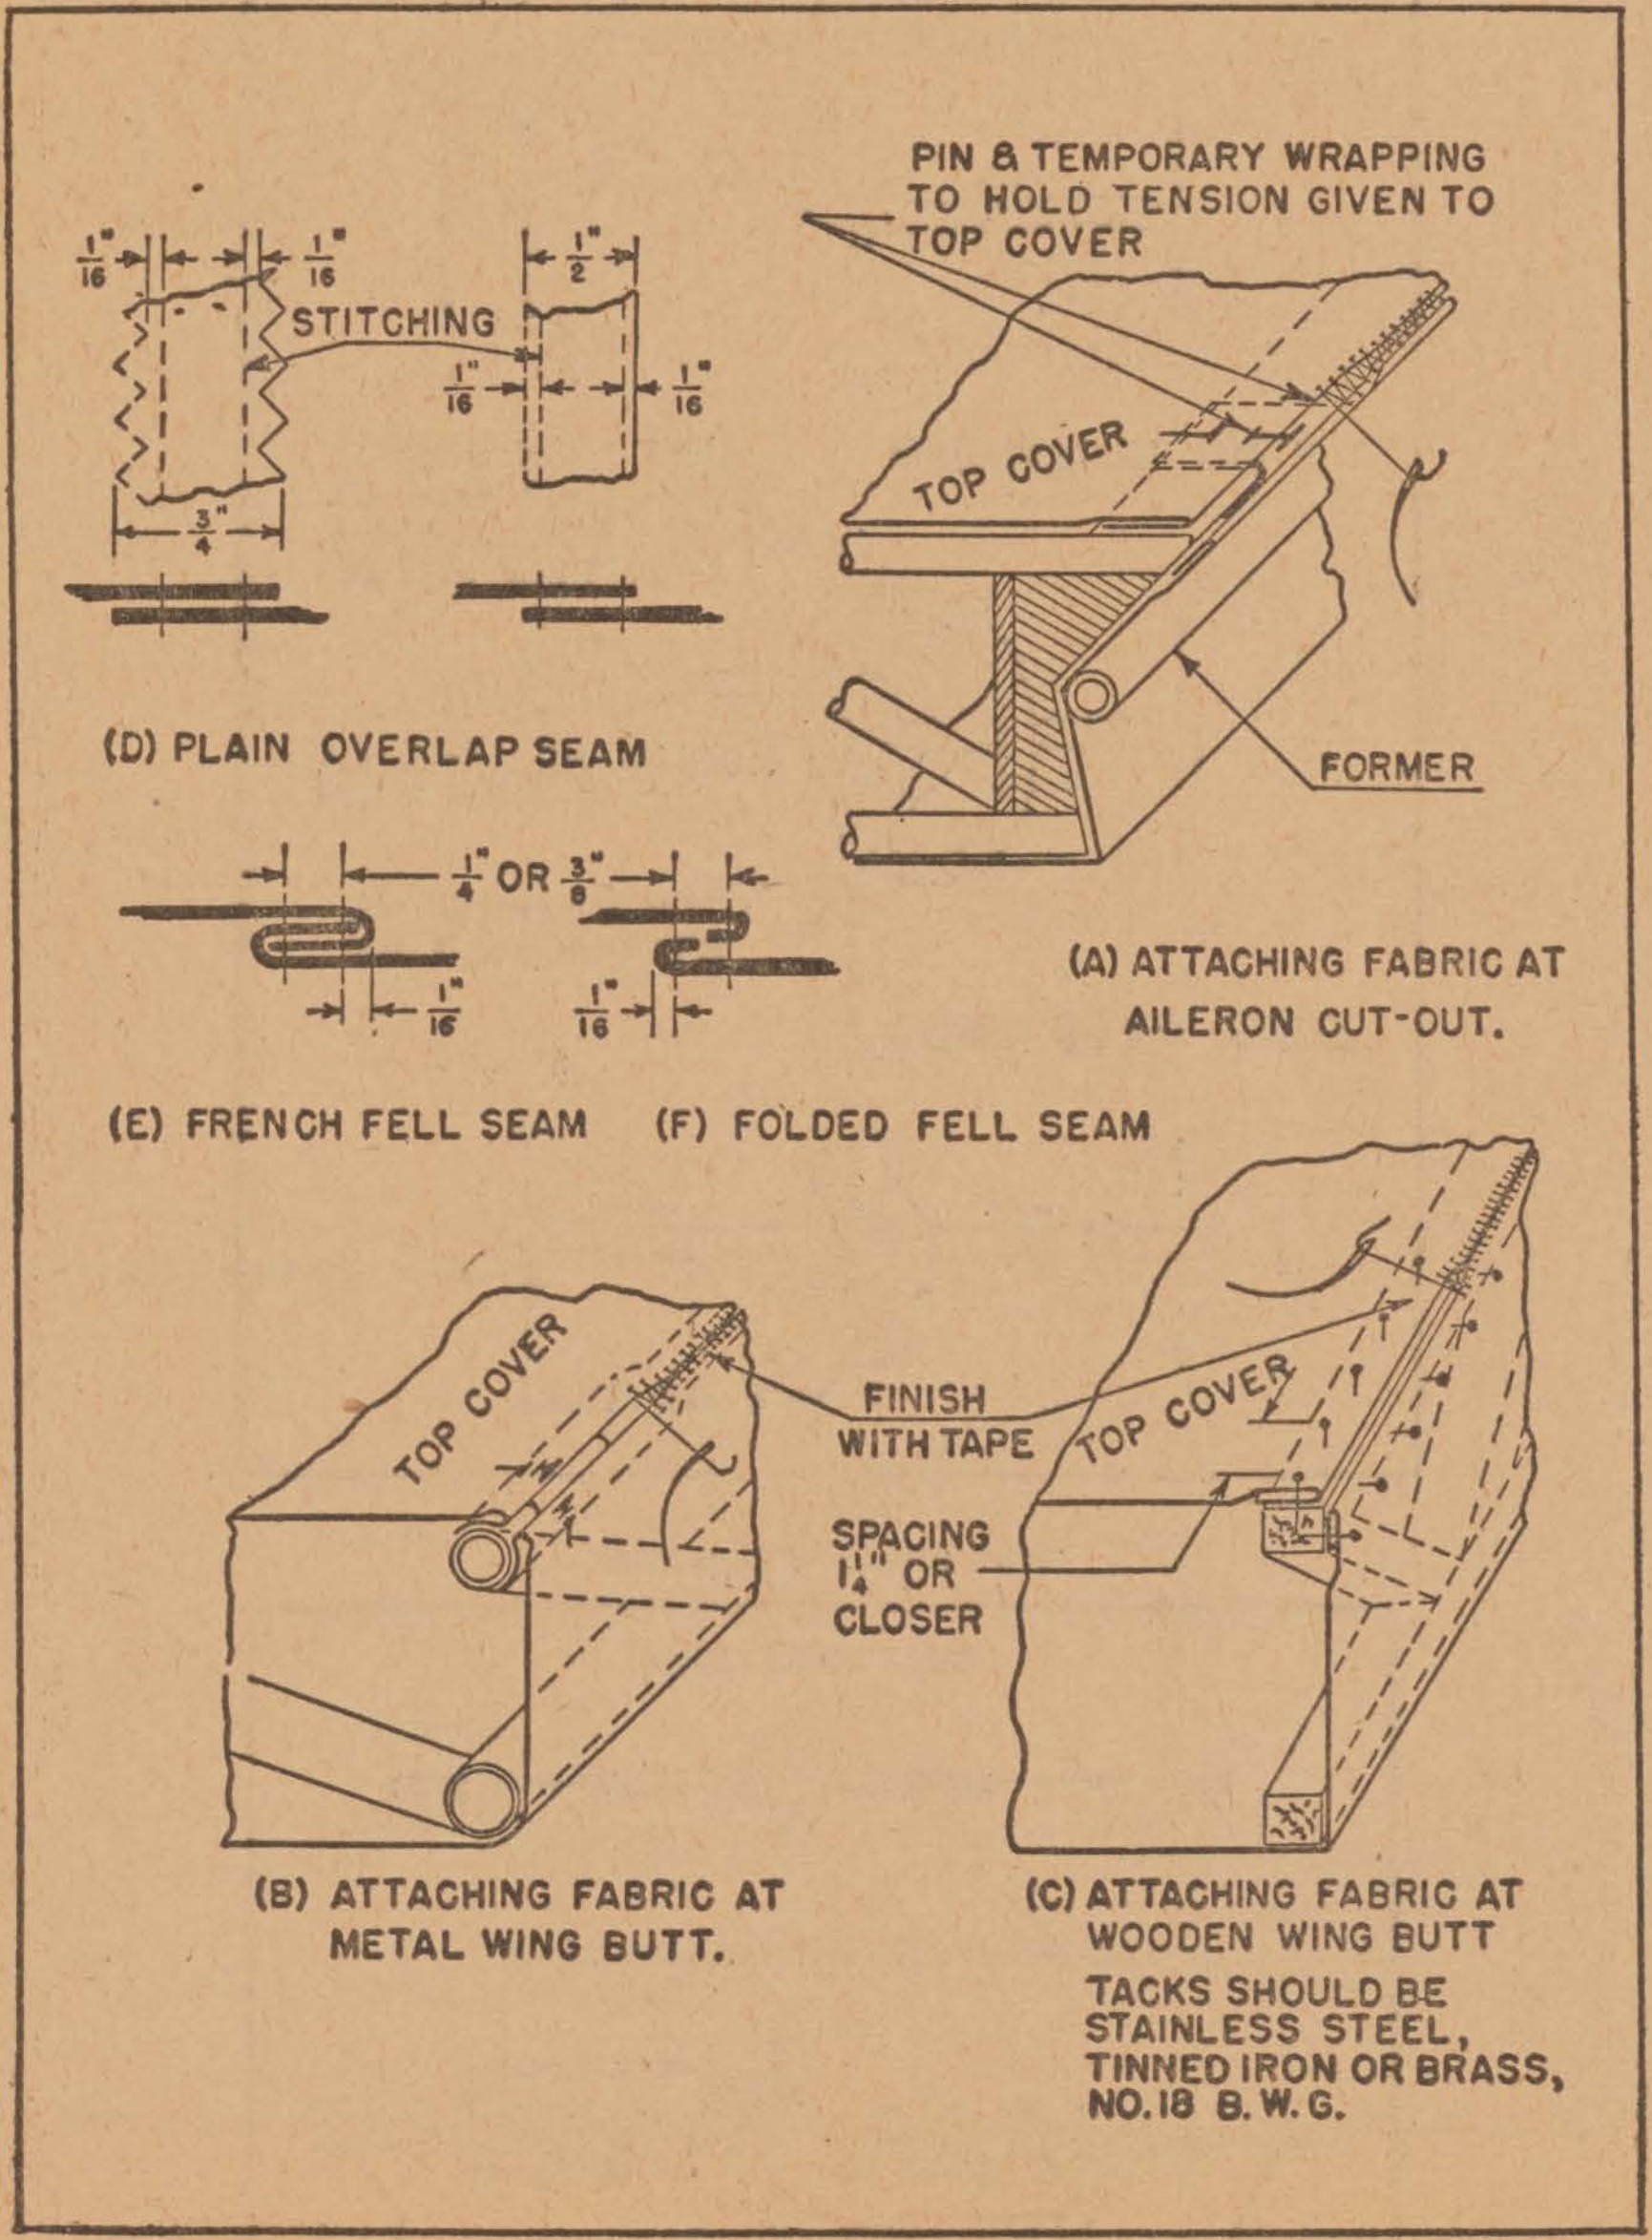
PIN & TEMPORARY WRAPPING TO HOLD TENSION GIVEN TO TOP COVER
TOP COVER
FORMER
(A) ATTACHING FABRIC AT AILERON CUT-OUT.
1/16"
1/16"
STITCHING
1/2"
1/16"
1/16"
3/4"
(D) PLAIN OVERLAP SEAM
1/4" OR 3/8"
1/16"
1/16"
(E) FRENCH FELL SEAM
(F) FOLDED FELL SEAM
TOP COVER
FINISH WITH TAPE
TOP COVER
SPACING 1 1/4" OR CLOSER
(B) ATTACHING FABRIC AT METAL WING BUTT.
(C) ATTACHING FABRIC AT WOODEN WING BUTT
TACKS SHOULD BE STAINLESS STEEL, TINNED IRON OR BRASS, NO. 18 B.W.G.

FIGURE 3-1—Typical methods of attaching fabric.

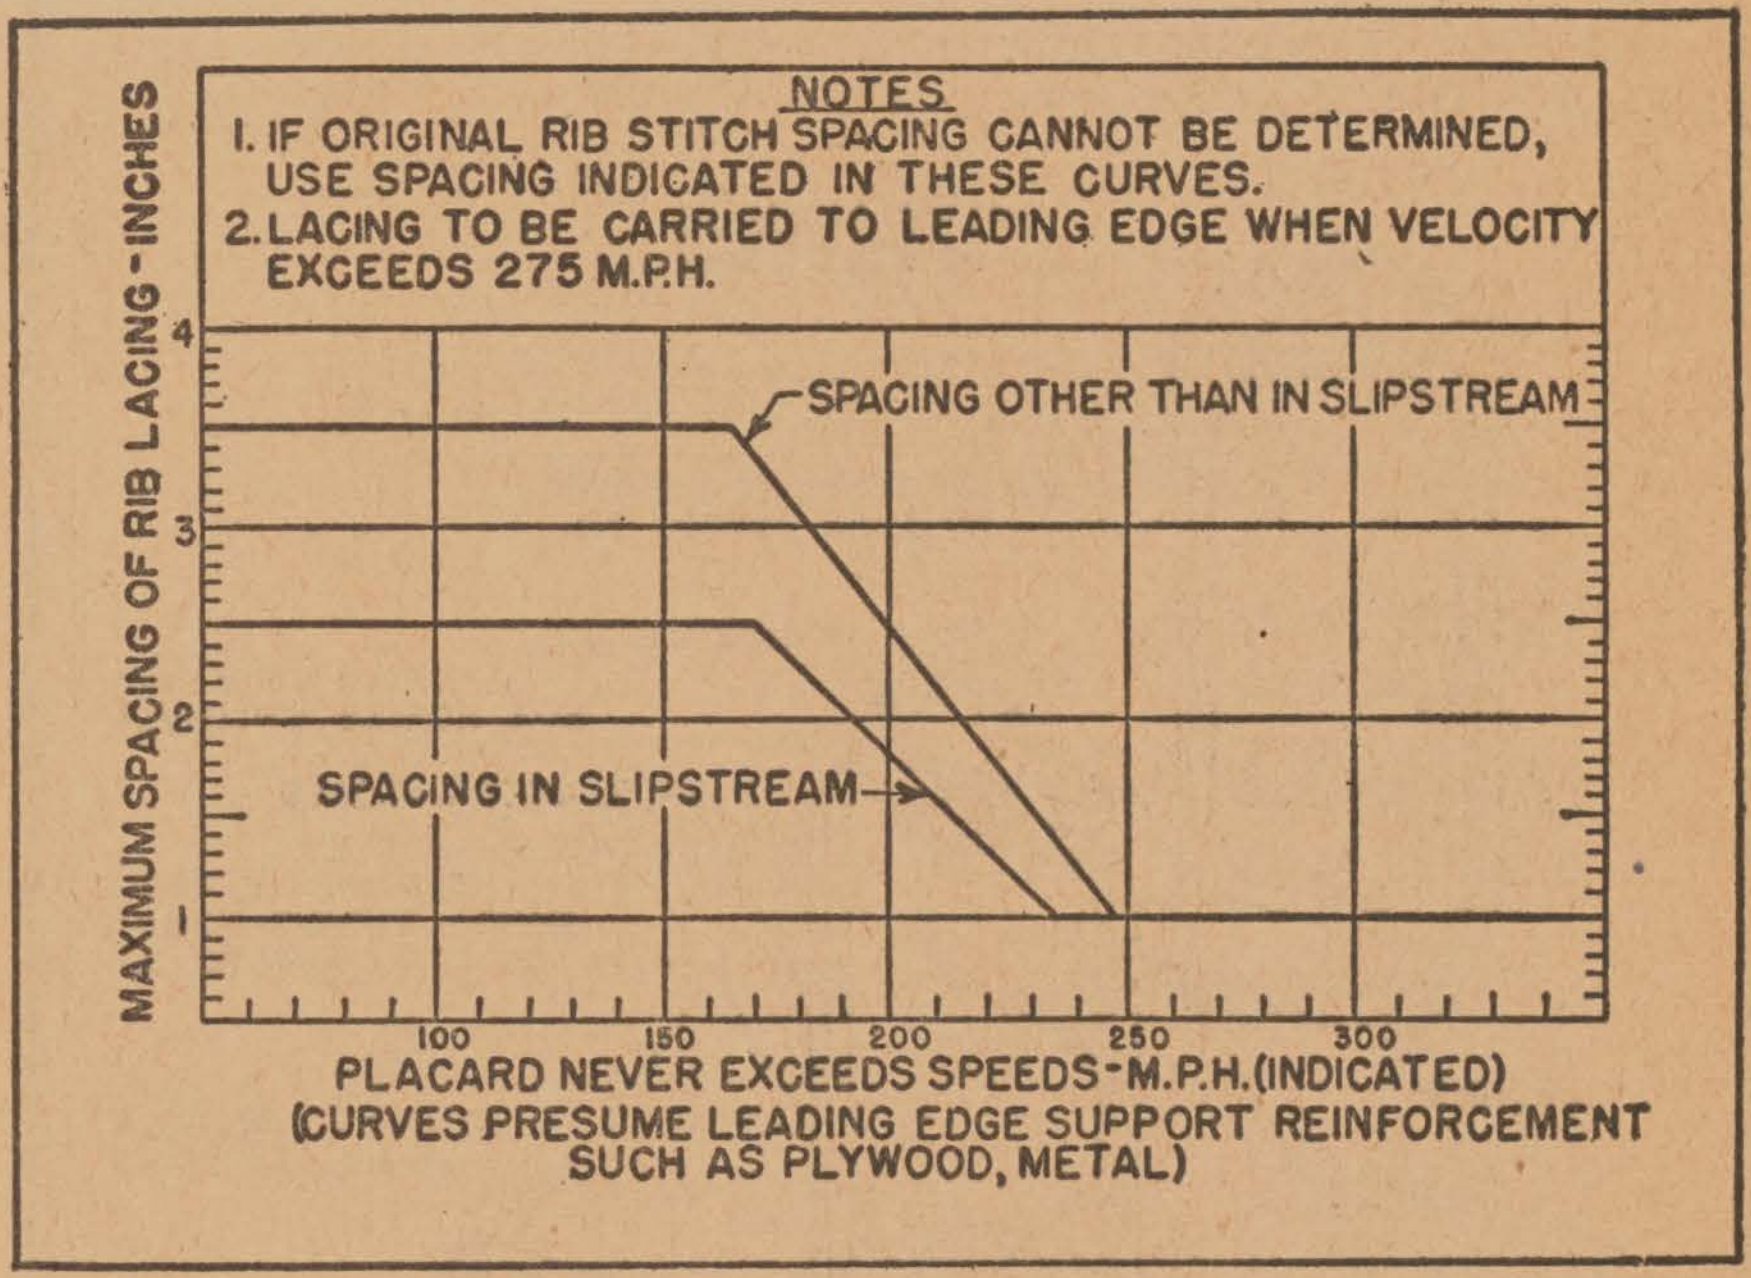

FIGURE 3-2—Fabric attachment spacing.

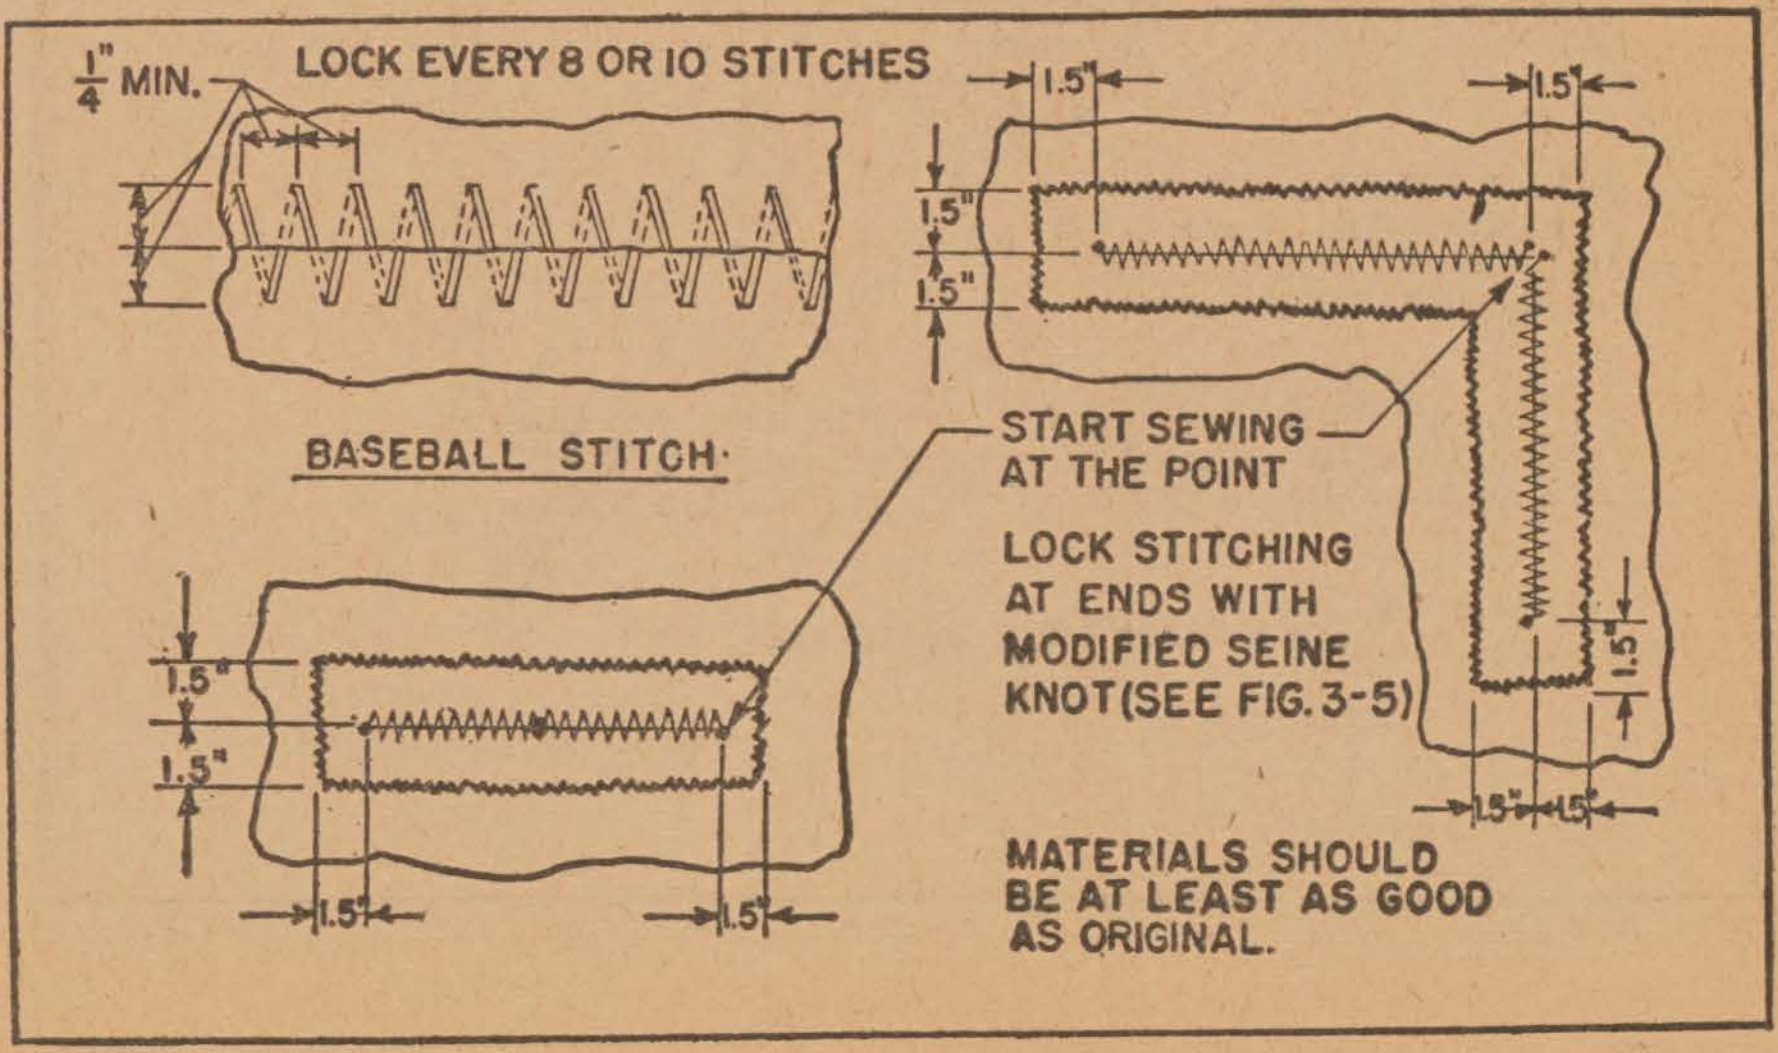
1/4" MIN.
LOCK EVERY 8 OR 10 STITCHES
BASEBALL STITCH
1.5"
1.5"
1.5"
1.5"
1.5"
1.5"
1.5"
1.5"
1.5"
1.5"
1.5"
START SEWING AT THE POINT
LOCK STITCHING AT ENDS WITH MODIFIED SEINE KNOT (SEE FIG. 3-5)
MATERIALS SHOULD BE AT LEAST AS GOOD AS ORIGINAL.

FIGURE 3-3—Repair of tears in fabric.

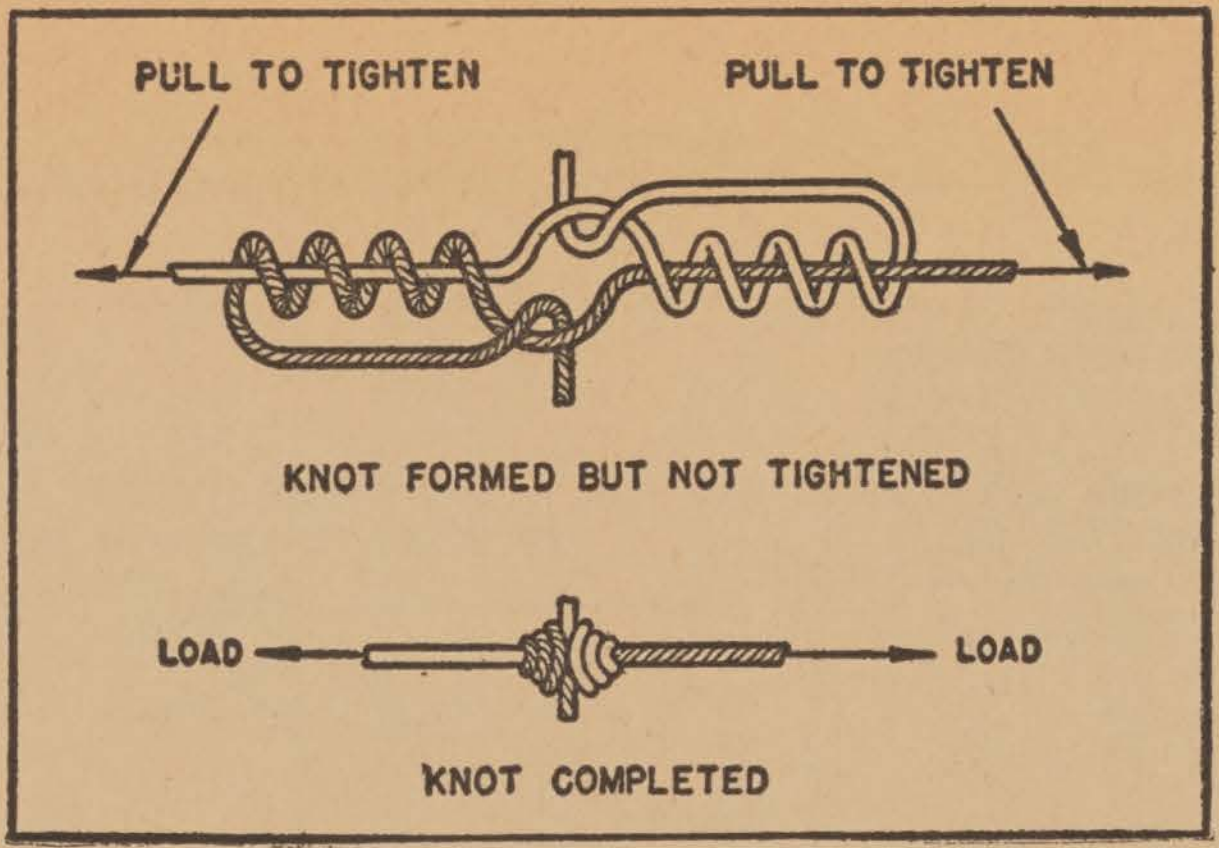

FIGURE 3-4—Splice knot.

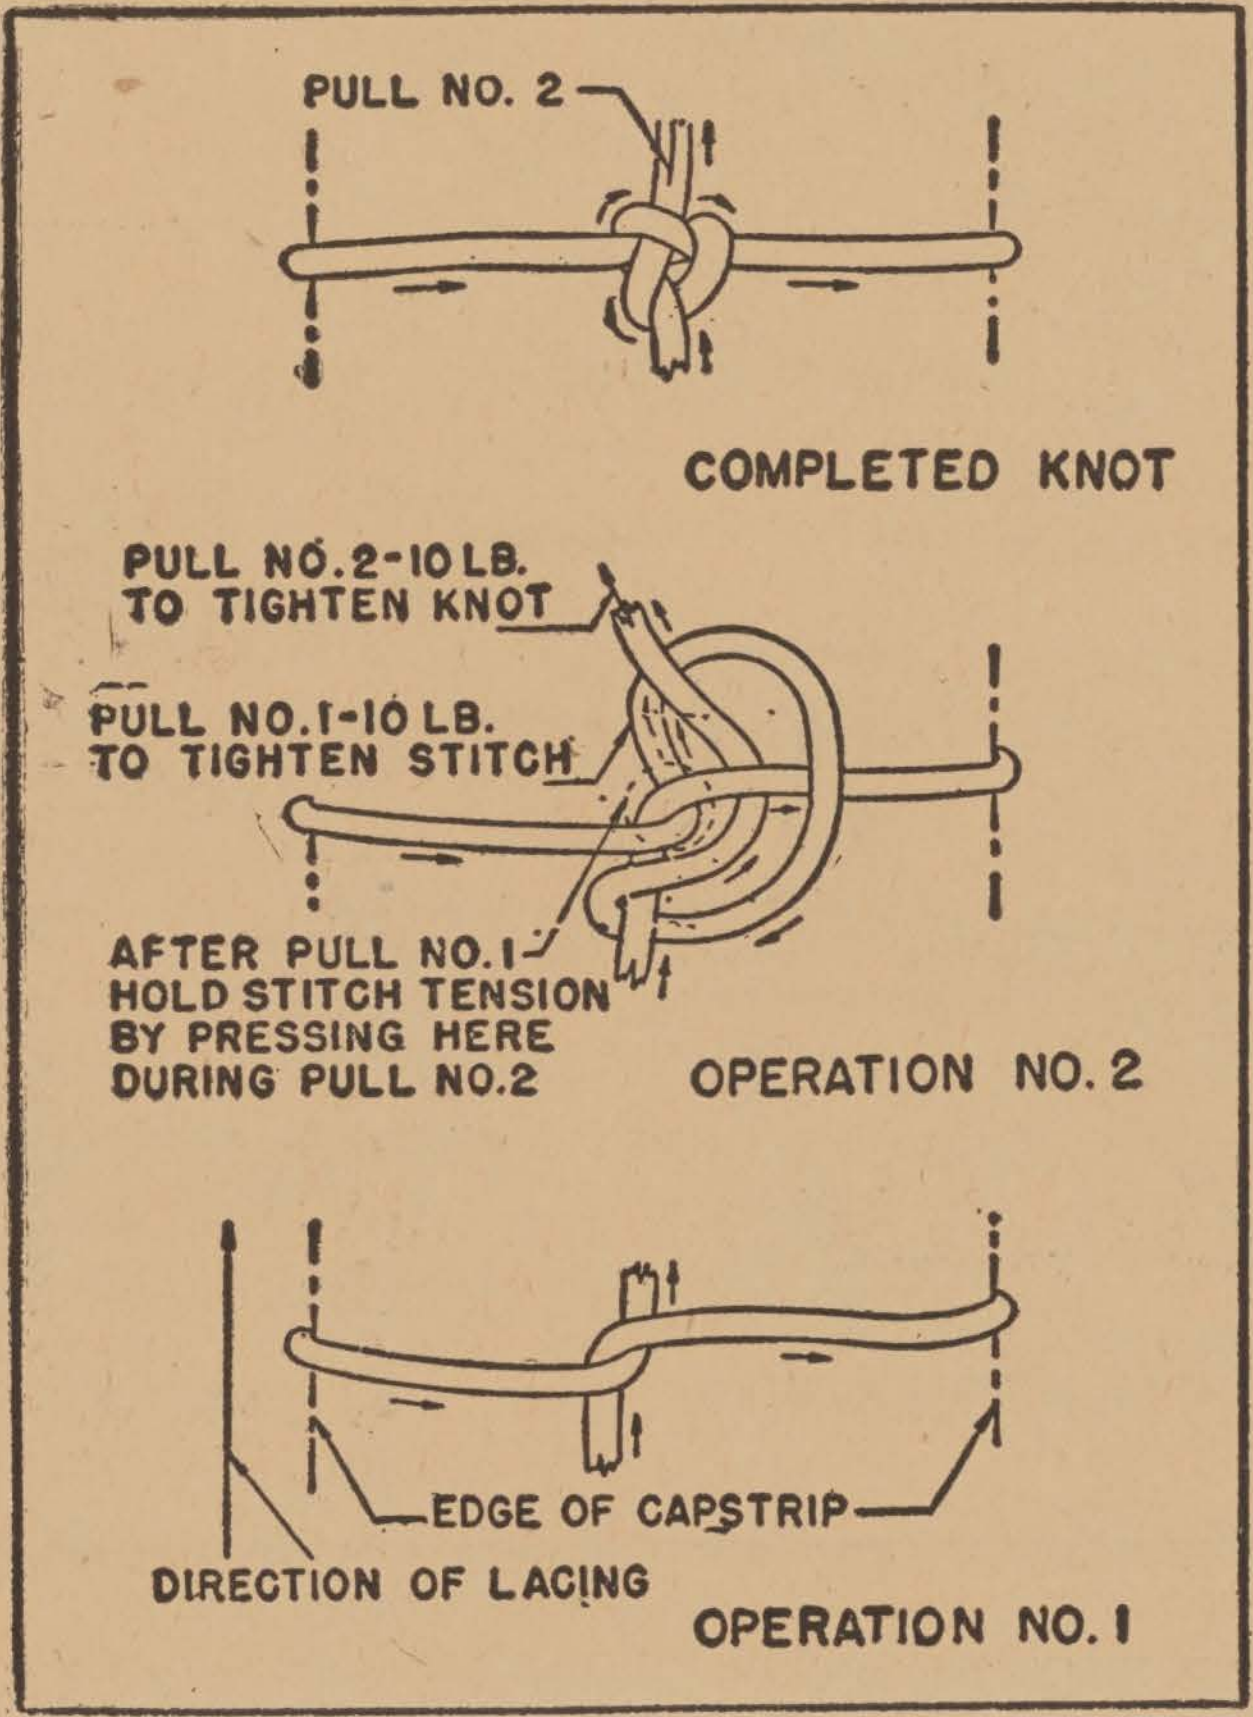
PULL NO. 2
COMPLETED KNOT
PULL NO.2-10 LB. TO TIGHTEN KNOT
PULL NO.1-10 LB. TO TIGHTEN STITCH
AFTER PULL NO.1 HOLD STITCH TENSION BY PRESSING HERE DURING PULL NO.2
OPERATION NO. 2
EDGE OF CAPSTRIP
DIRECTION OF LACING
OPERATION NO. 1

FIGURE 3-5—Standard knot for rib lacing (modified seine knot).

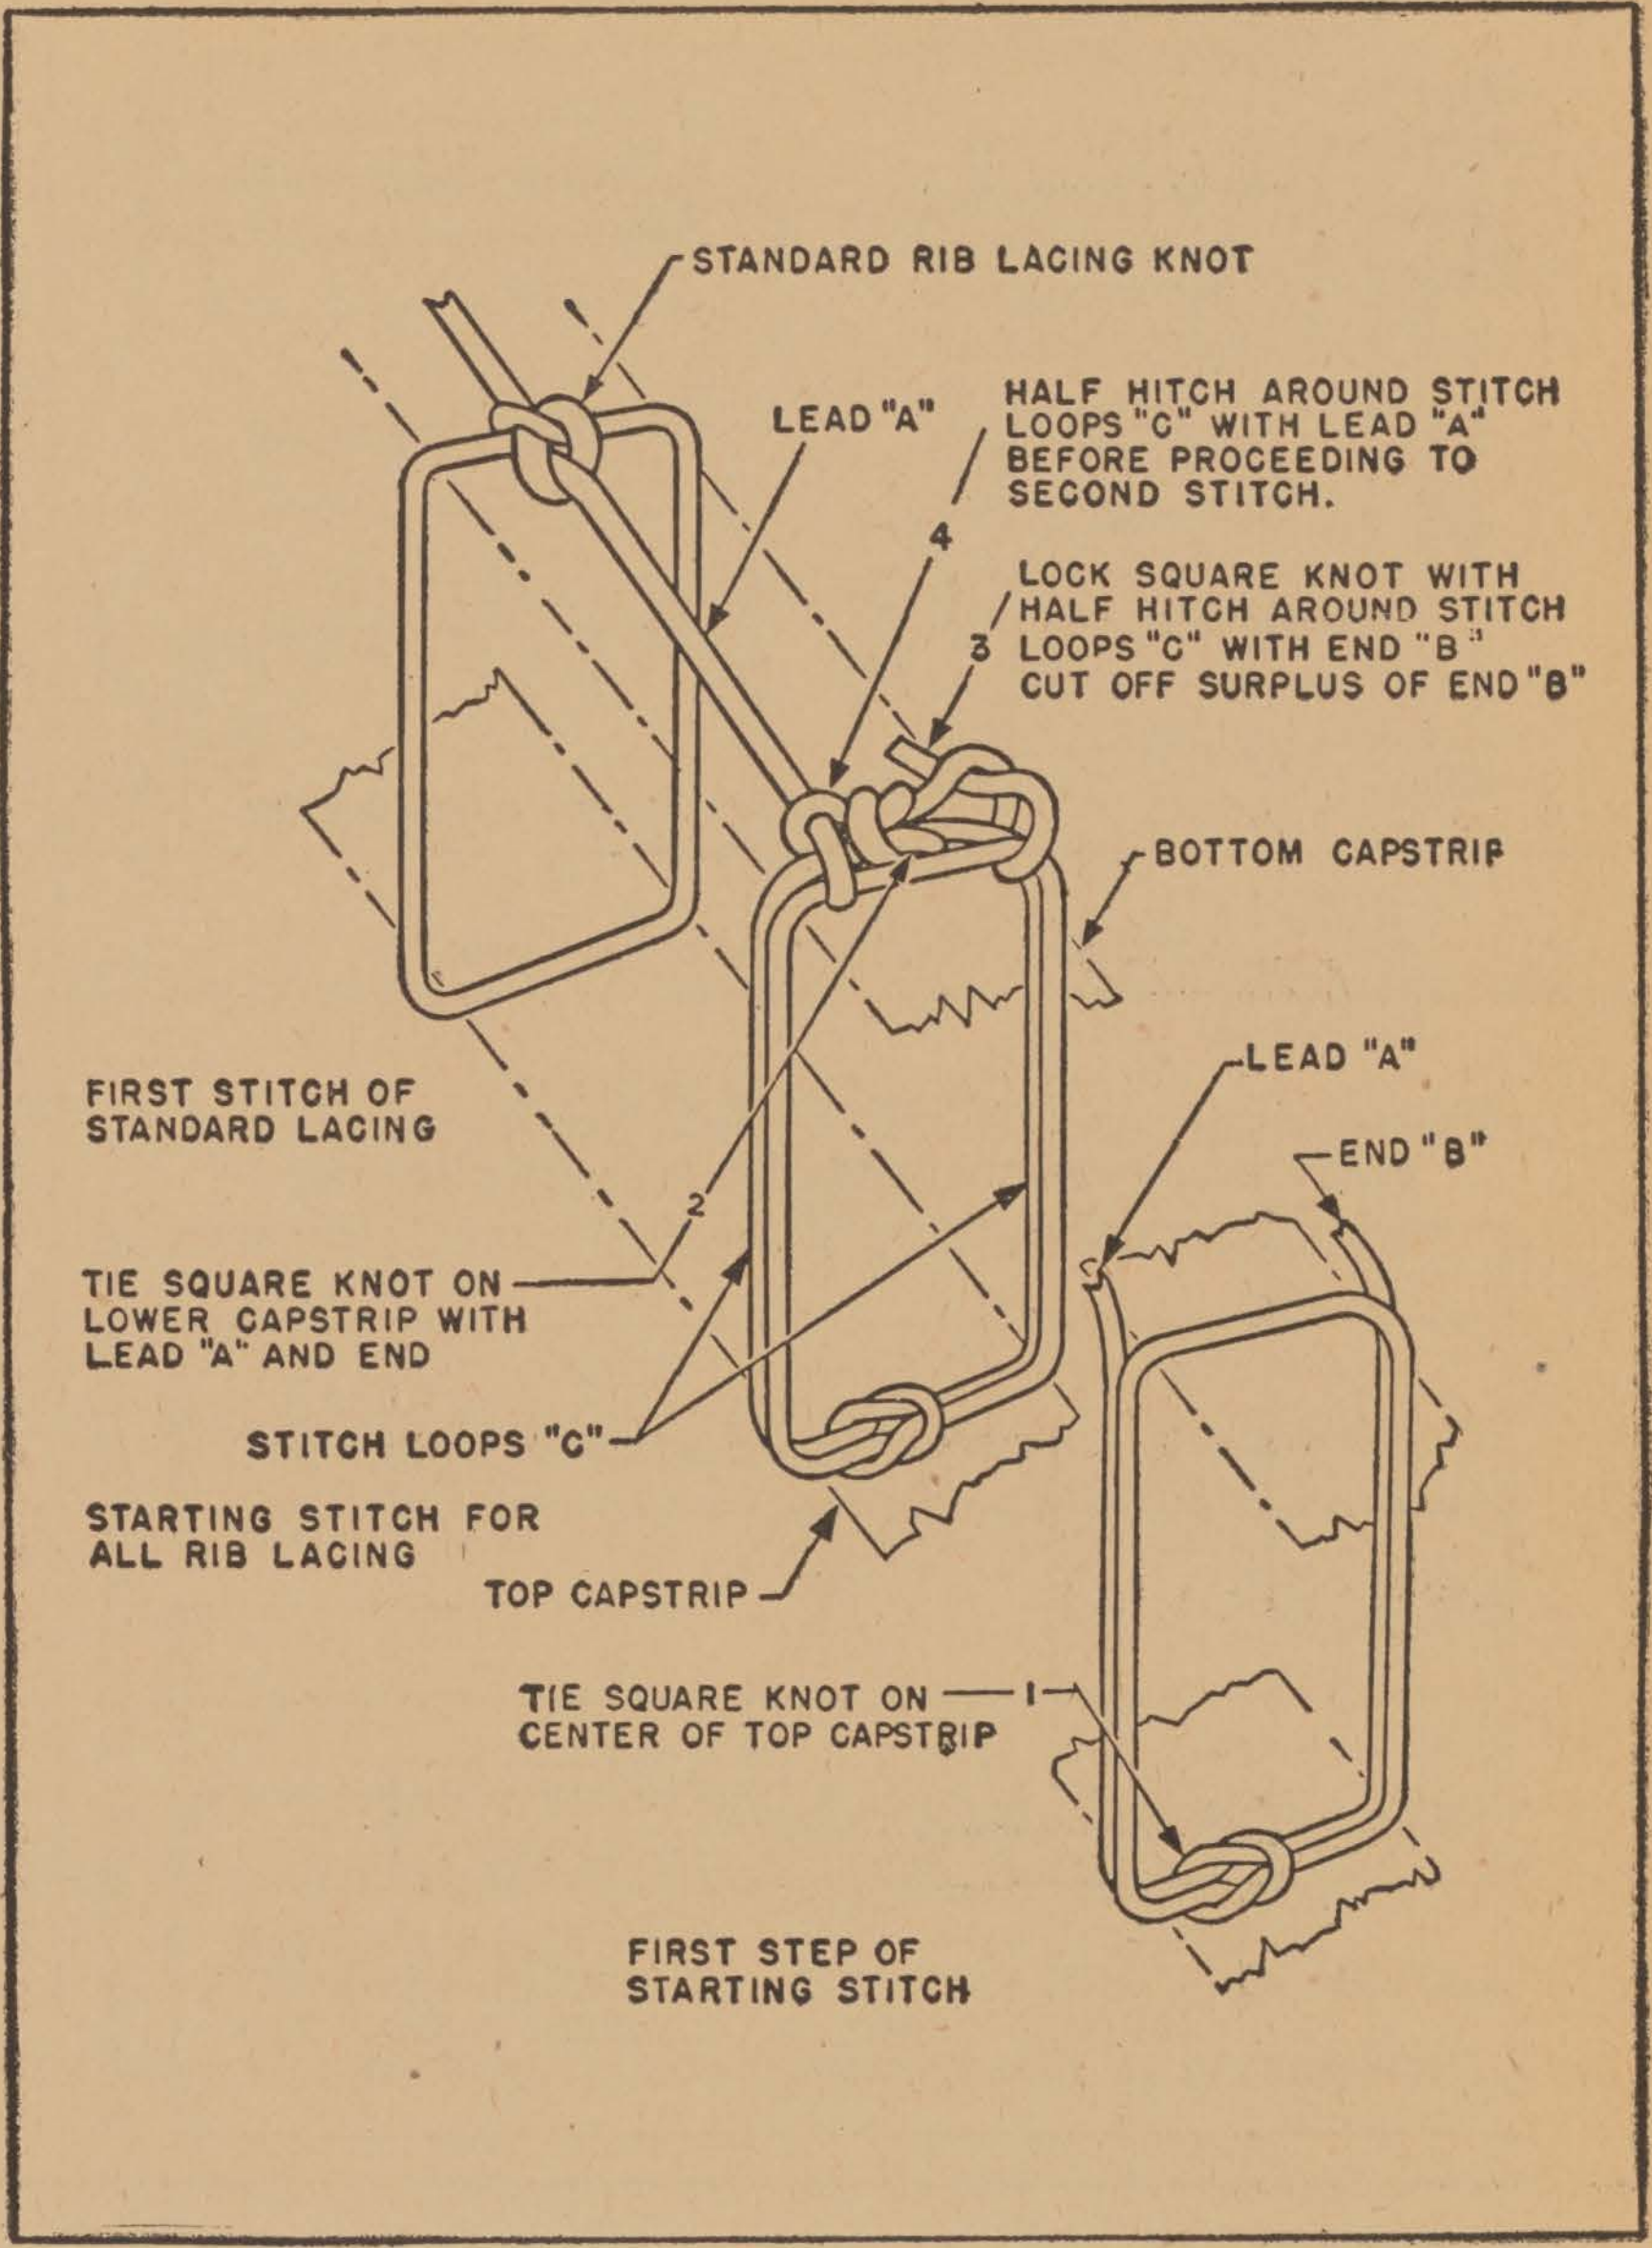
STANDARD RIB LACING KNOT
LEAD "A"
HALF HITCH AROUND STITCH LOOPS "C" WITH LEAD "A" BEFORE PROCEEDING TO SECOND STITCH.
4
LOCK SQUARE KNOT WITH HALF HITCH AROUND STITCH LOOPS "C" WITH END "B" CUT OFF SURPLUS OF END "B"
3
BOTTOM CAPSTRIP
FIRST STITCH OF STANDARD LACING
LEAD "A"
END "B"
2
TIE SQUARE KNOT ON LOWER CAPSTRIP WITH LEAD "A" AND END
STITCH LOOPS "C"
STARTING STITCH FOR ALL RIB LACING
TOP CAPSTRIP
TIE SQUARE KNOT ON CENTER OF TOP CAPSTRIP
1
FIRST STEP OF STARTING STITCH

FIGURE 3-6—Starting stitch for rib stitching.

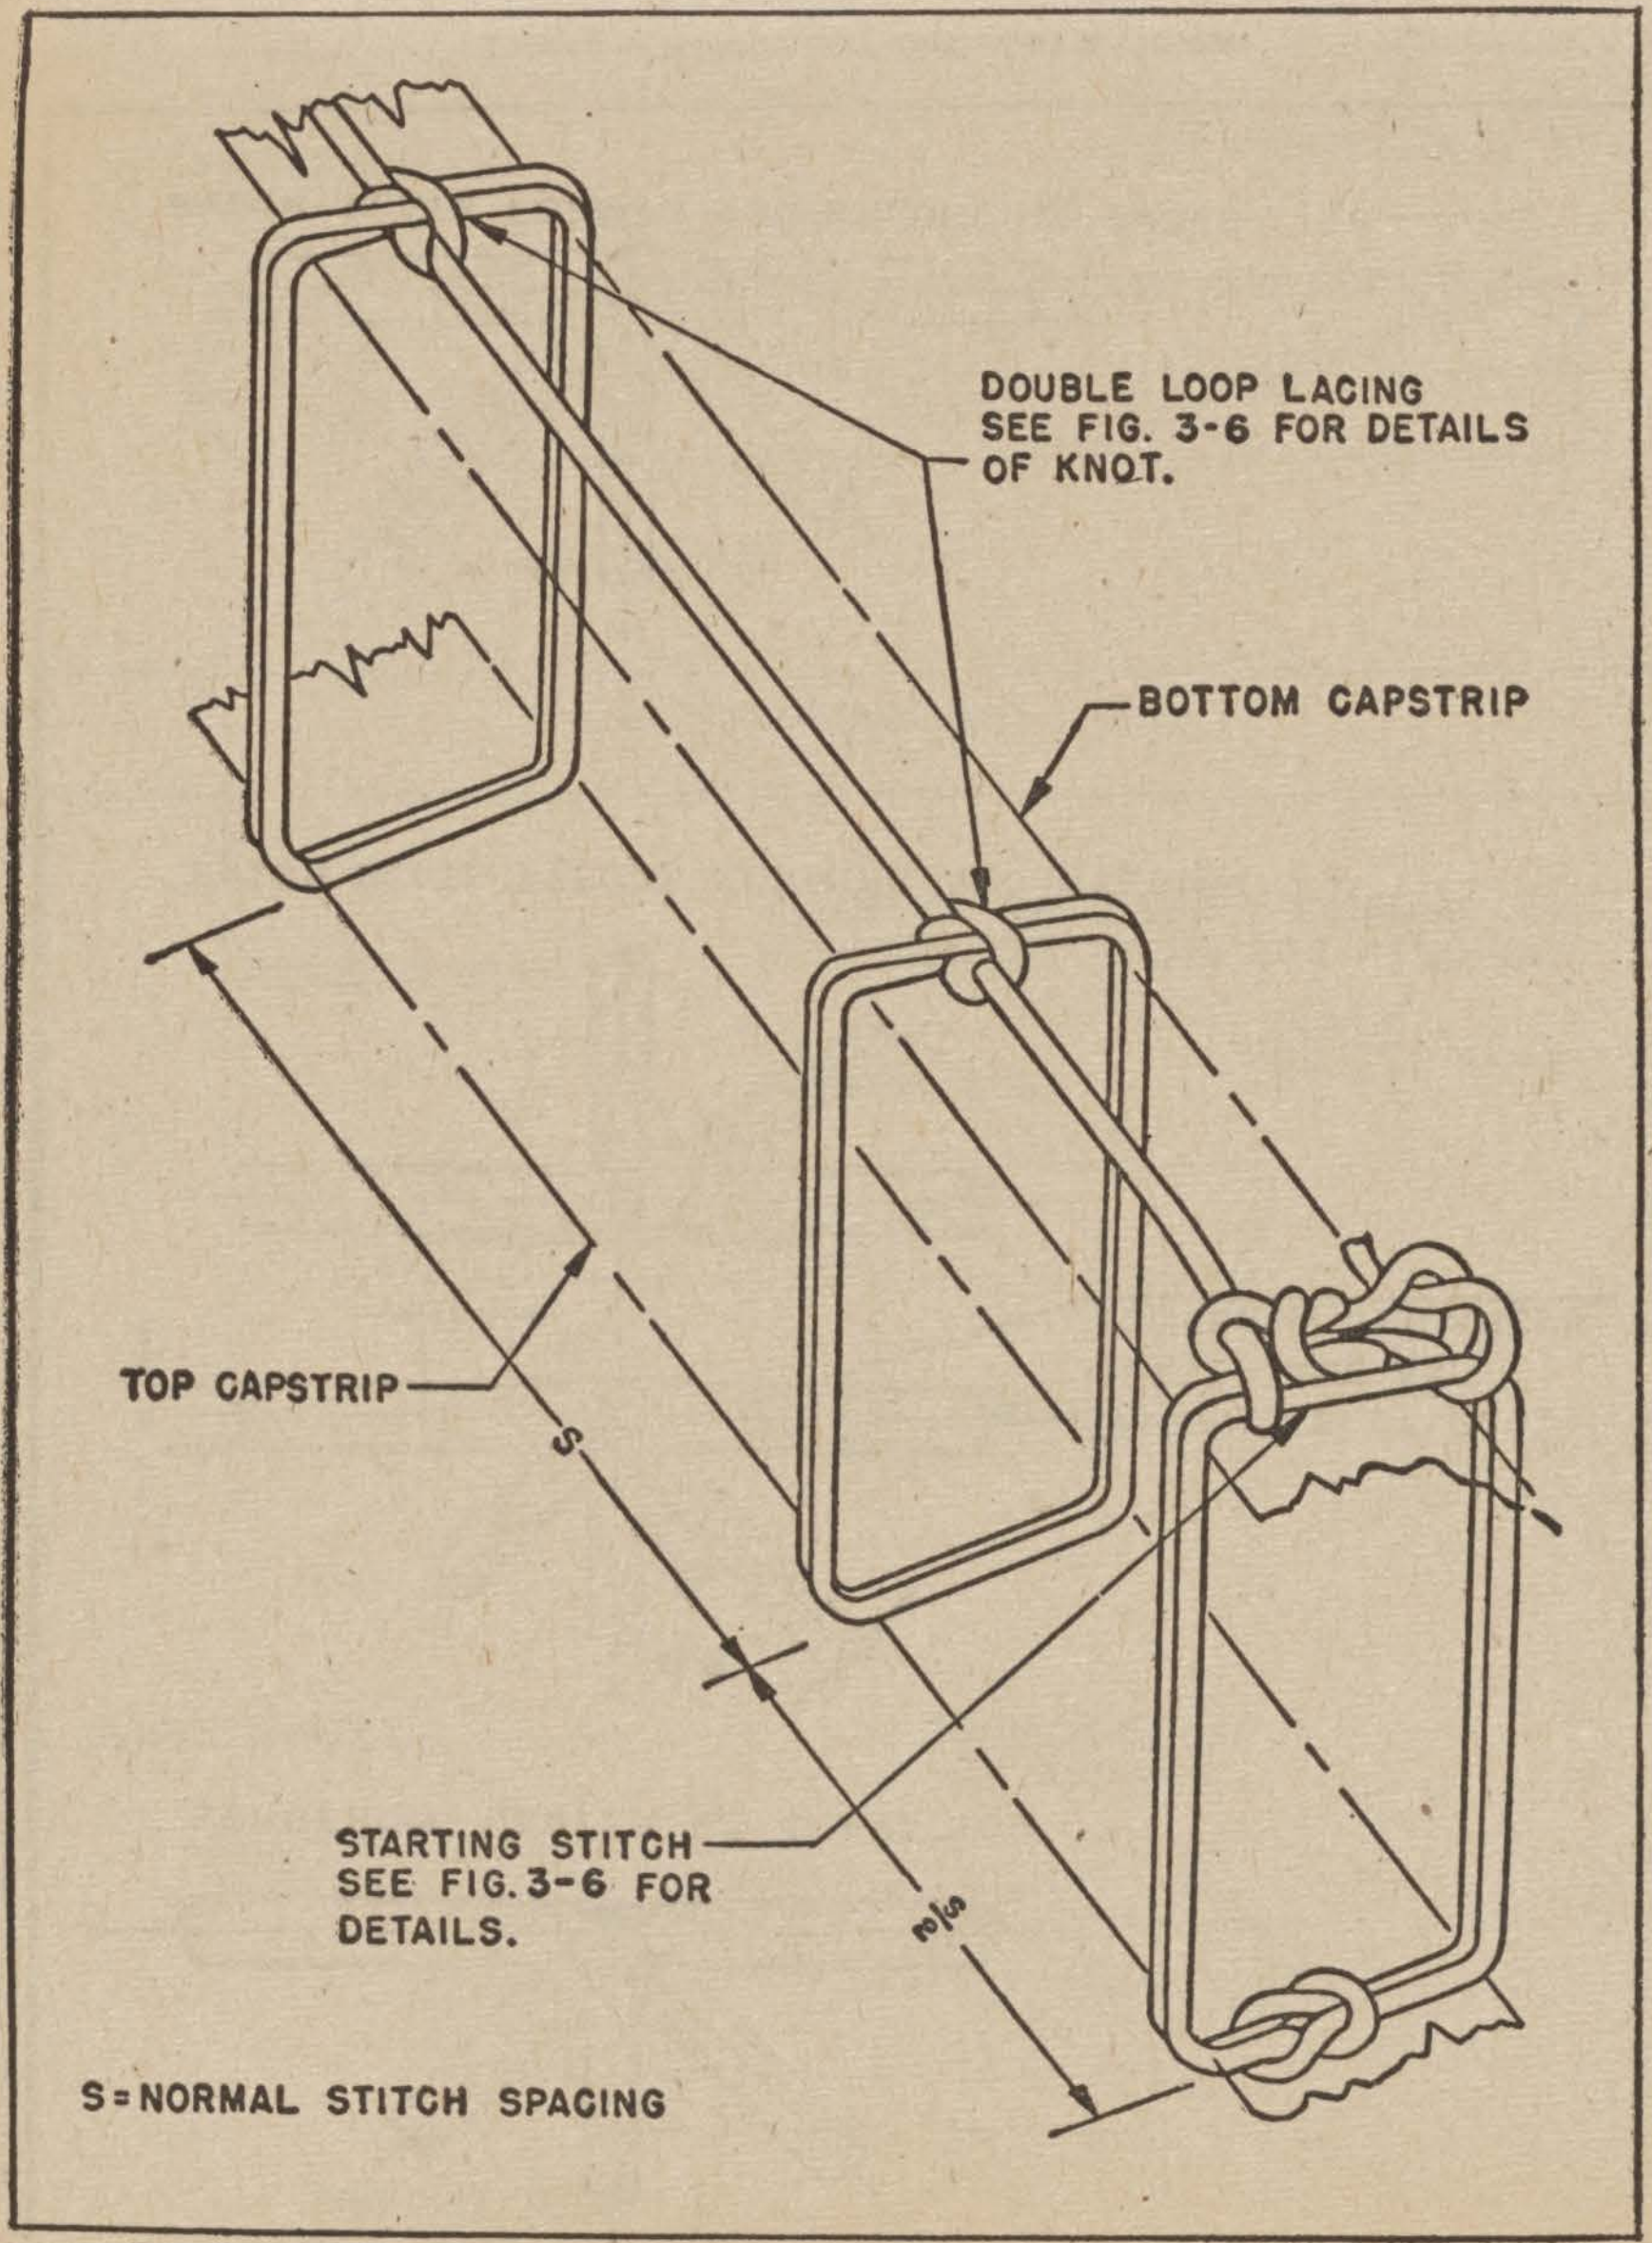

FIGURE 3-7—Standard double loop lacing.

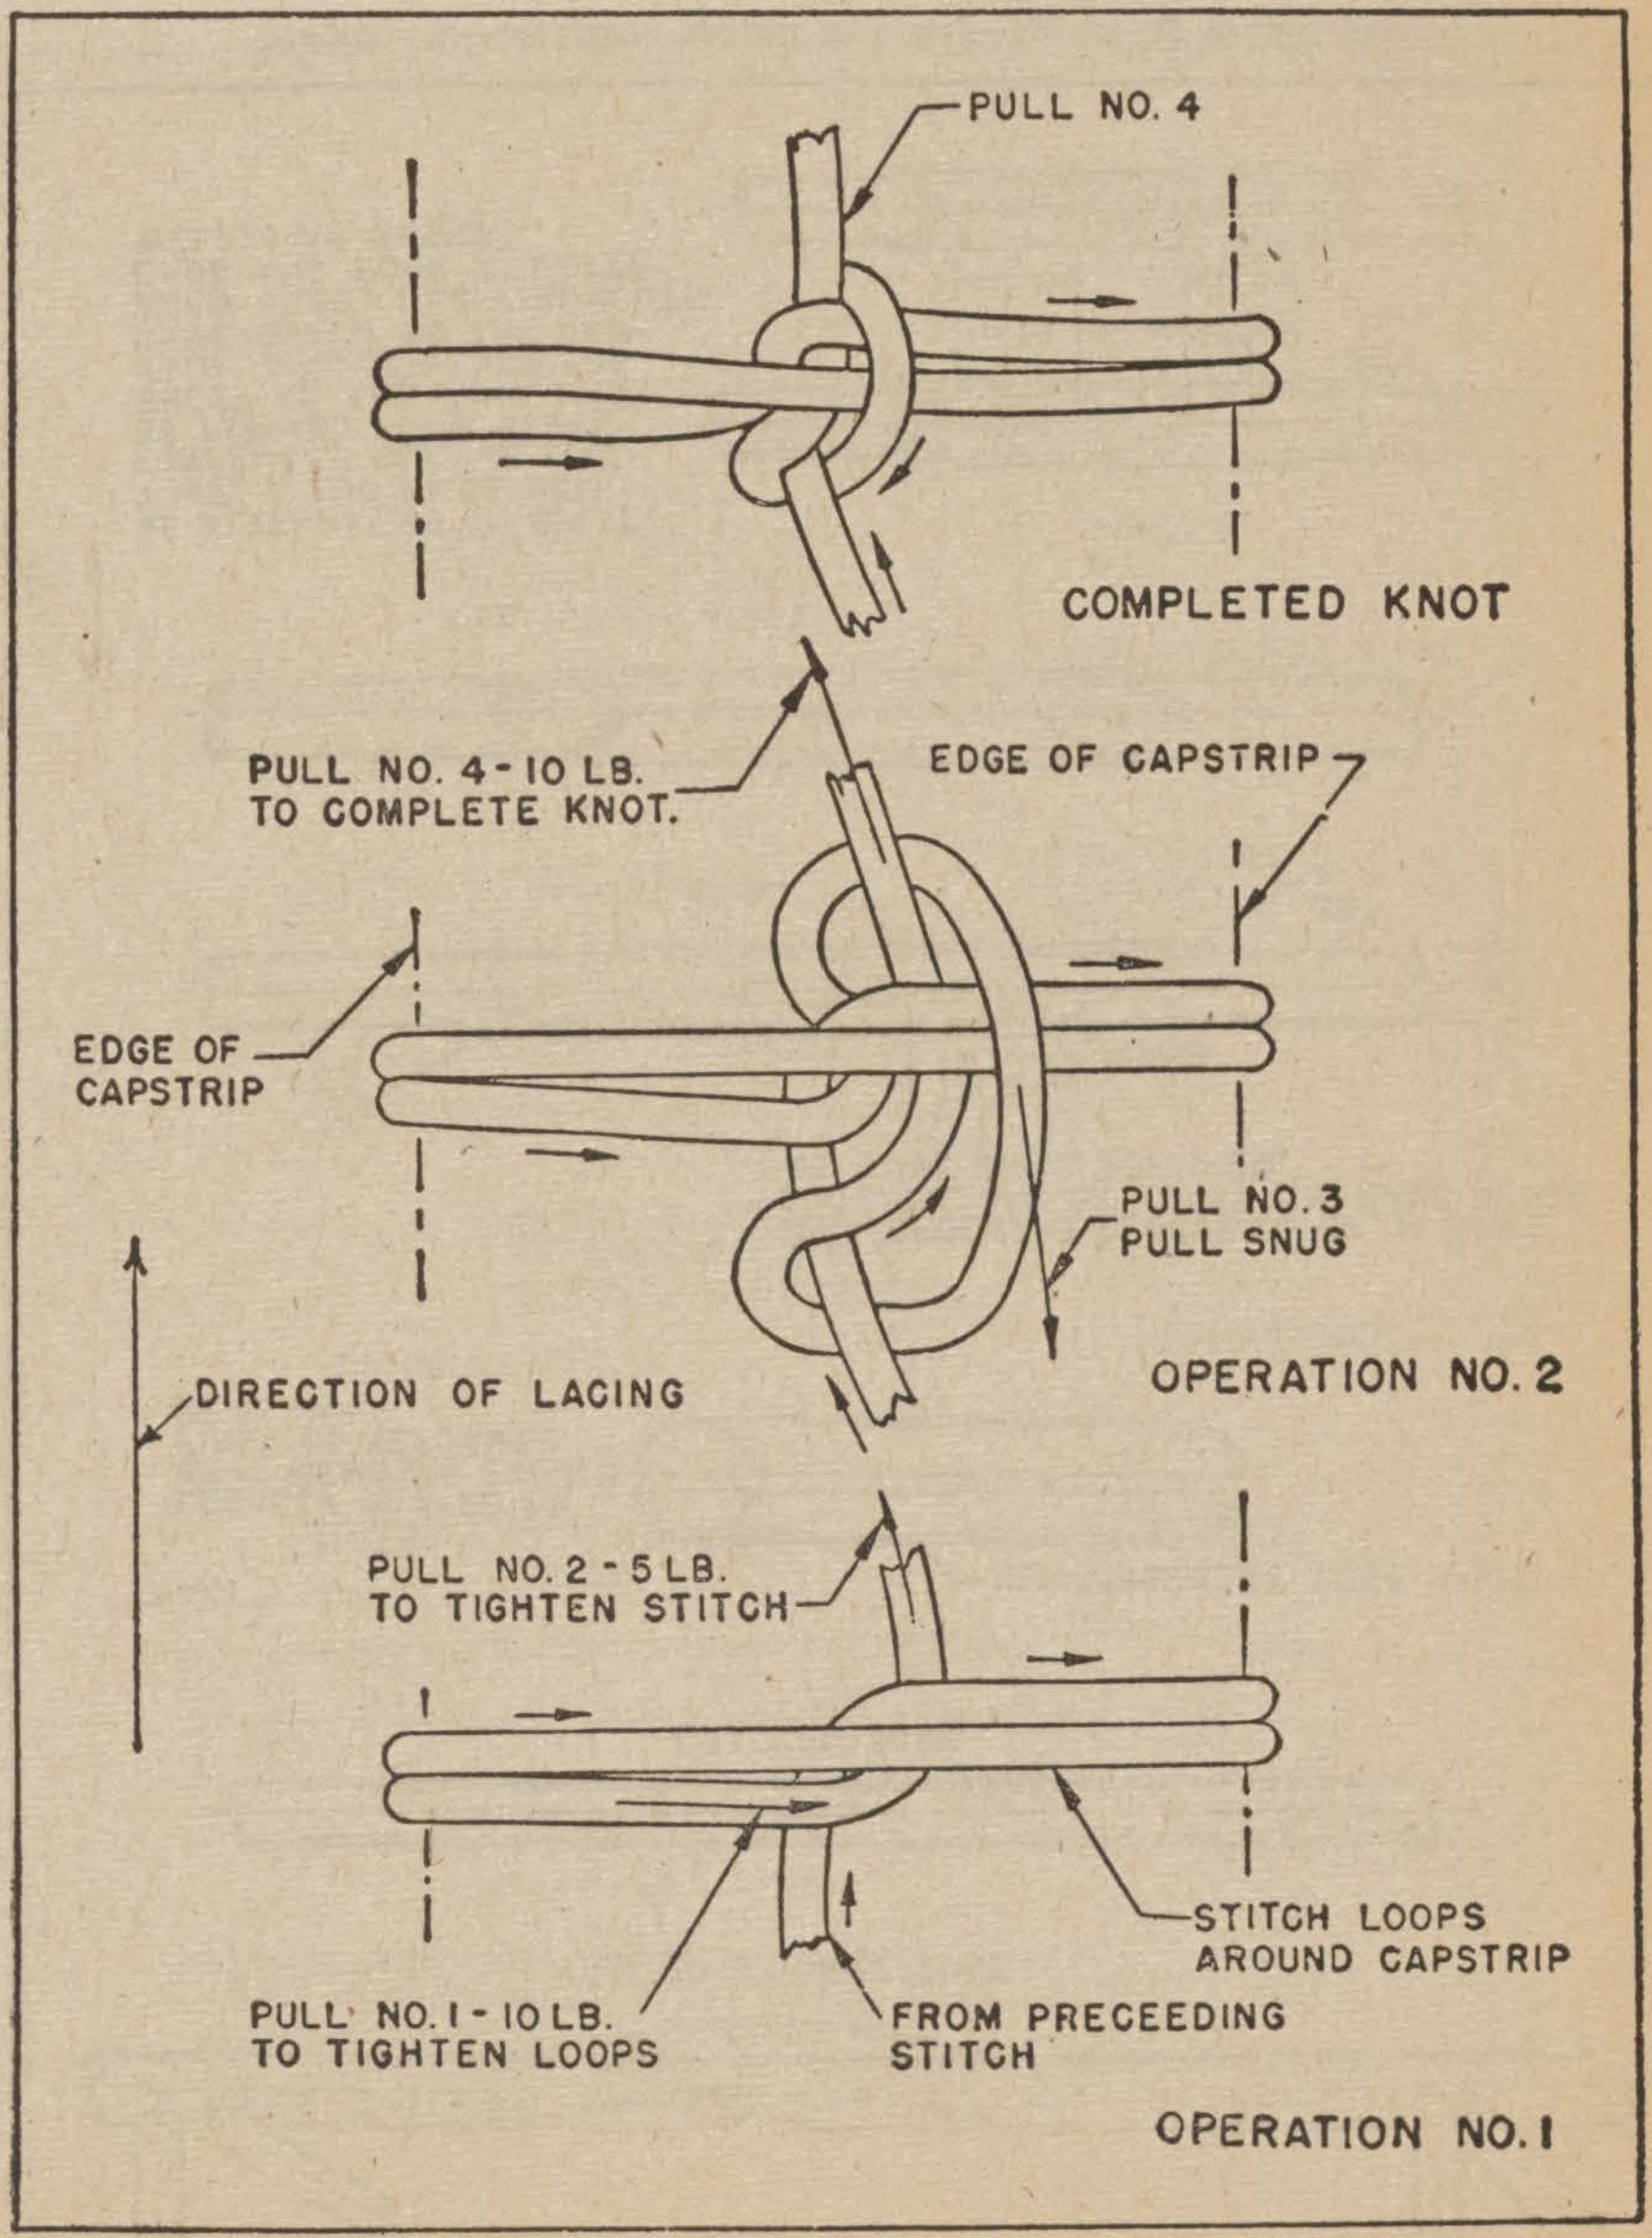

FIGURE 3-8—Standard knot for double loop lacing.

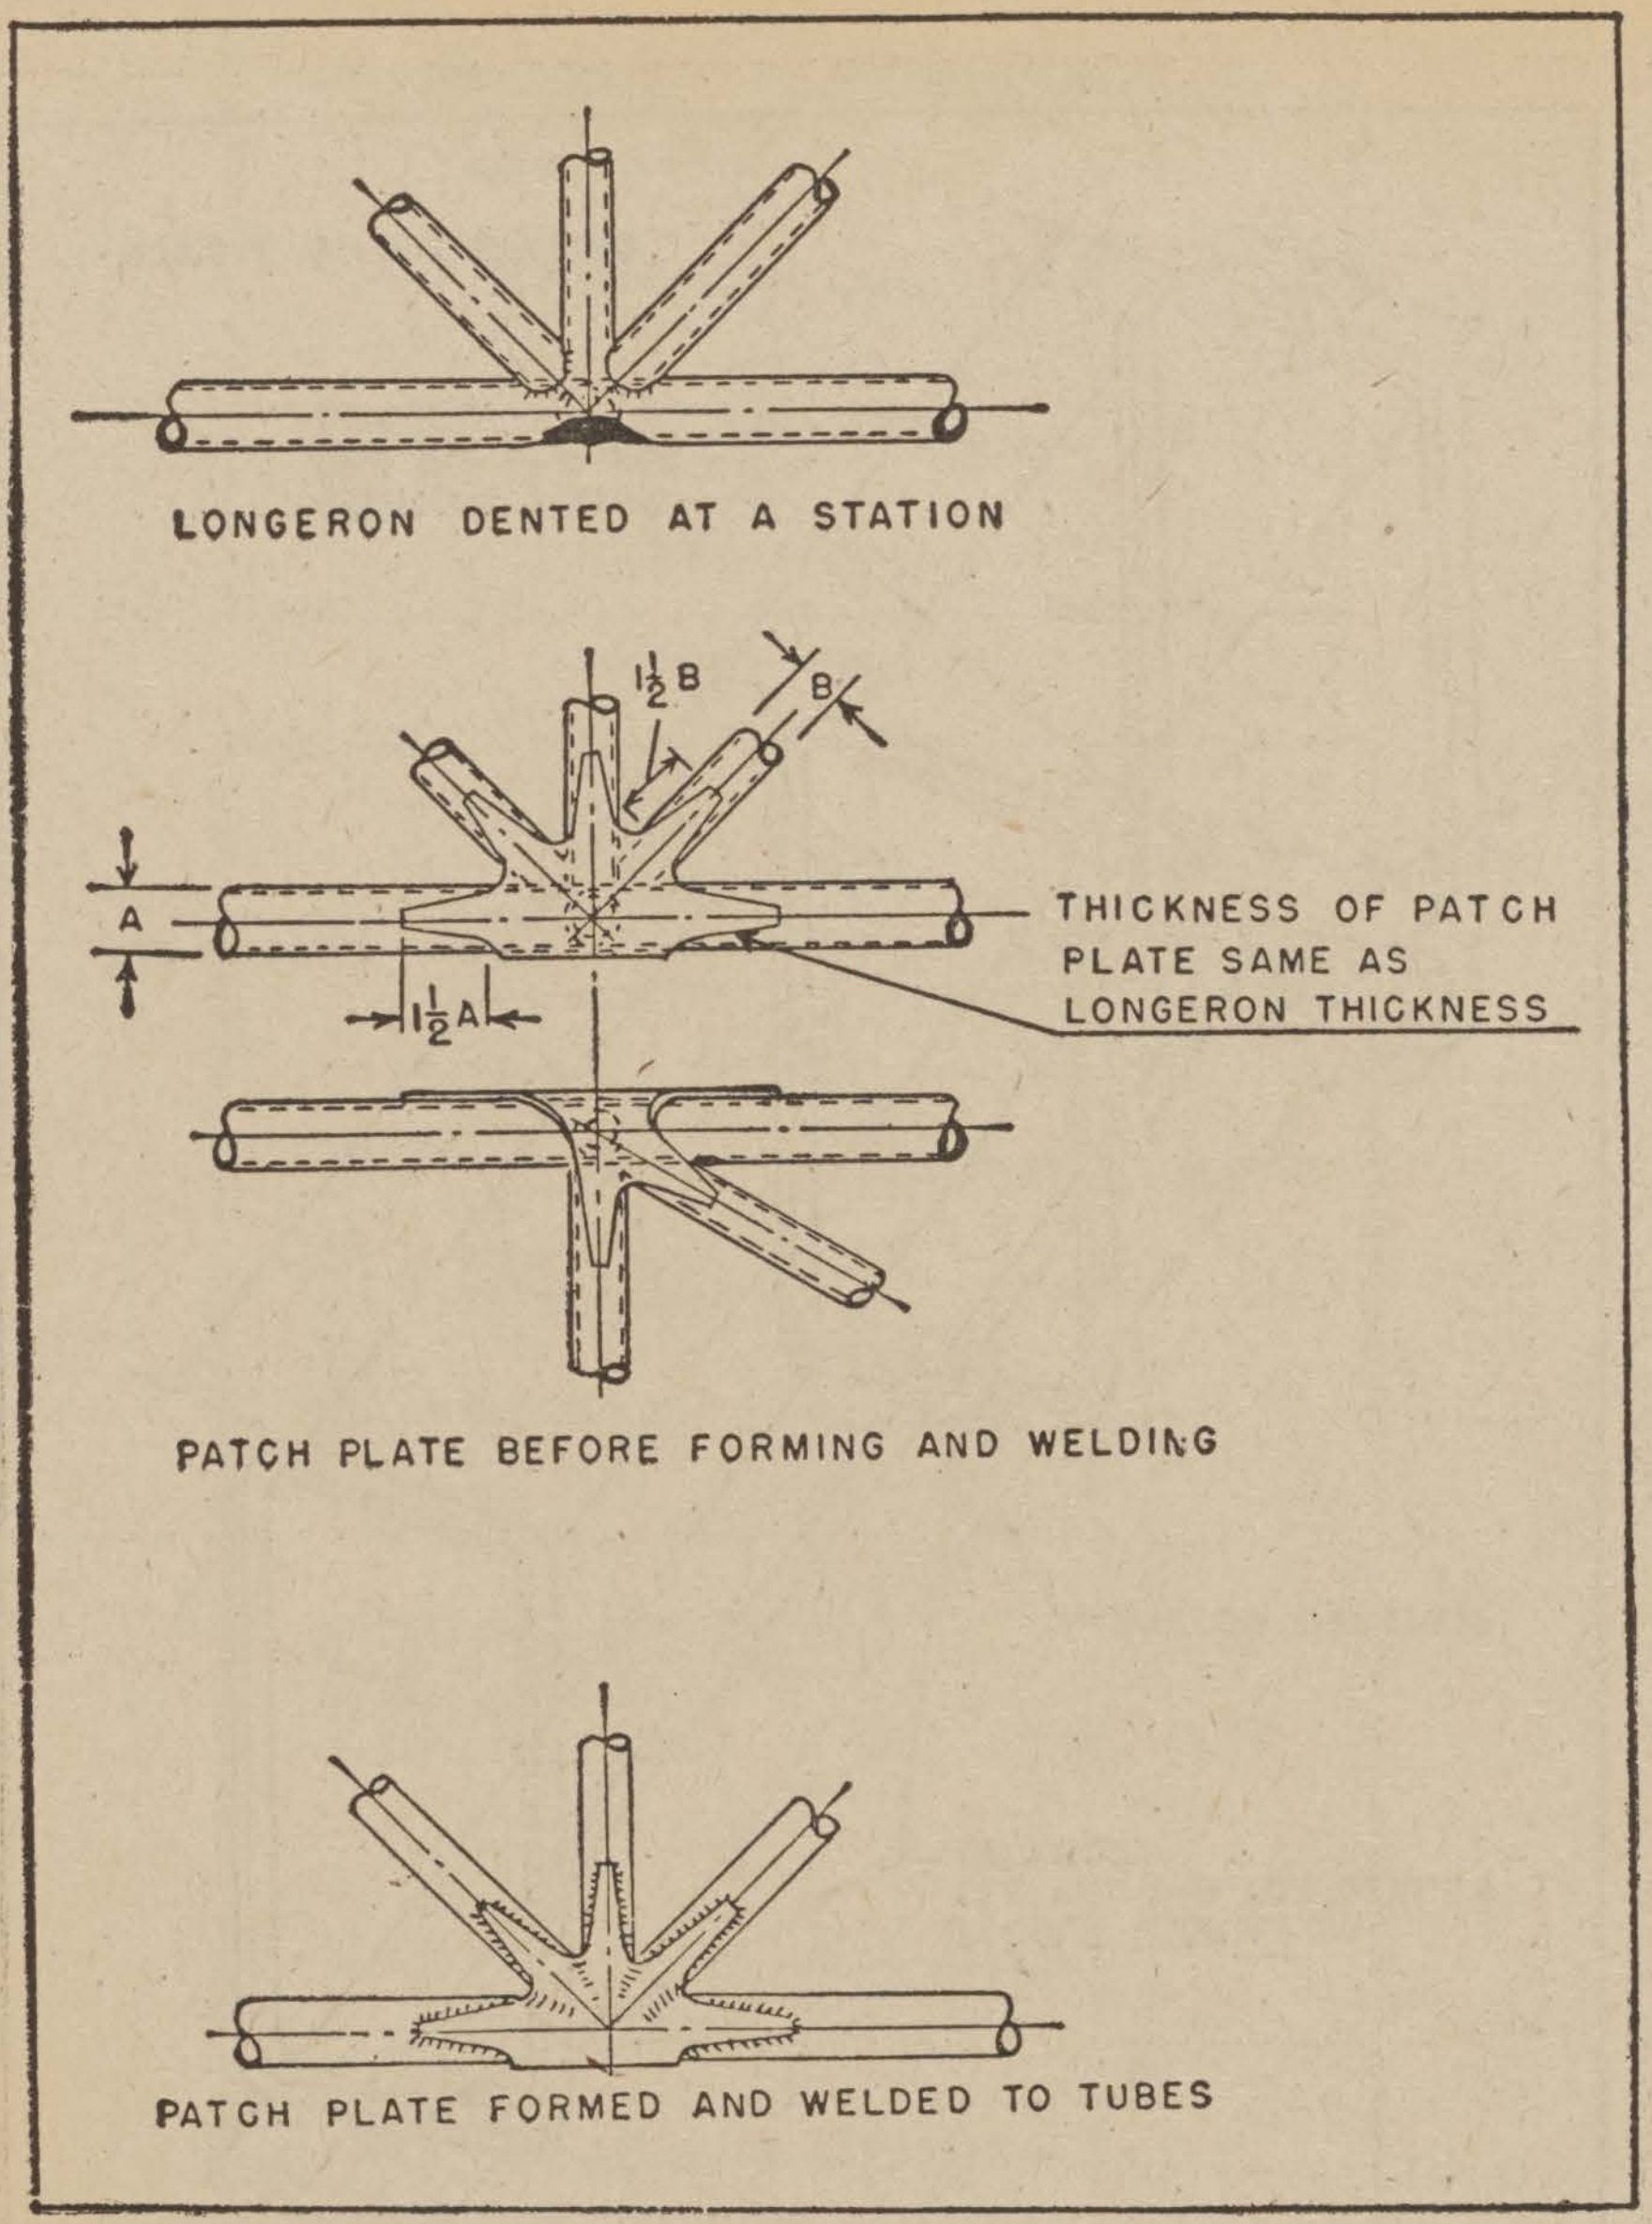
LONGERON DENTED AT A STATION
1½ B
B
A
1½ A
THICKNESS OF PATCH PLATE SAME AS LONGERON THICKNESS
PATCH PLATE BEFORE FORMING AND WELDING
PATCH PLATE FORMED AND WELDED TO TUBES

FIGURE 4-1—Members dented at a cluster.

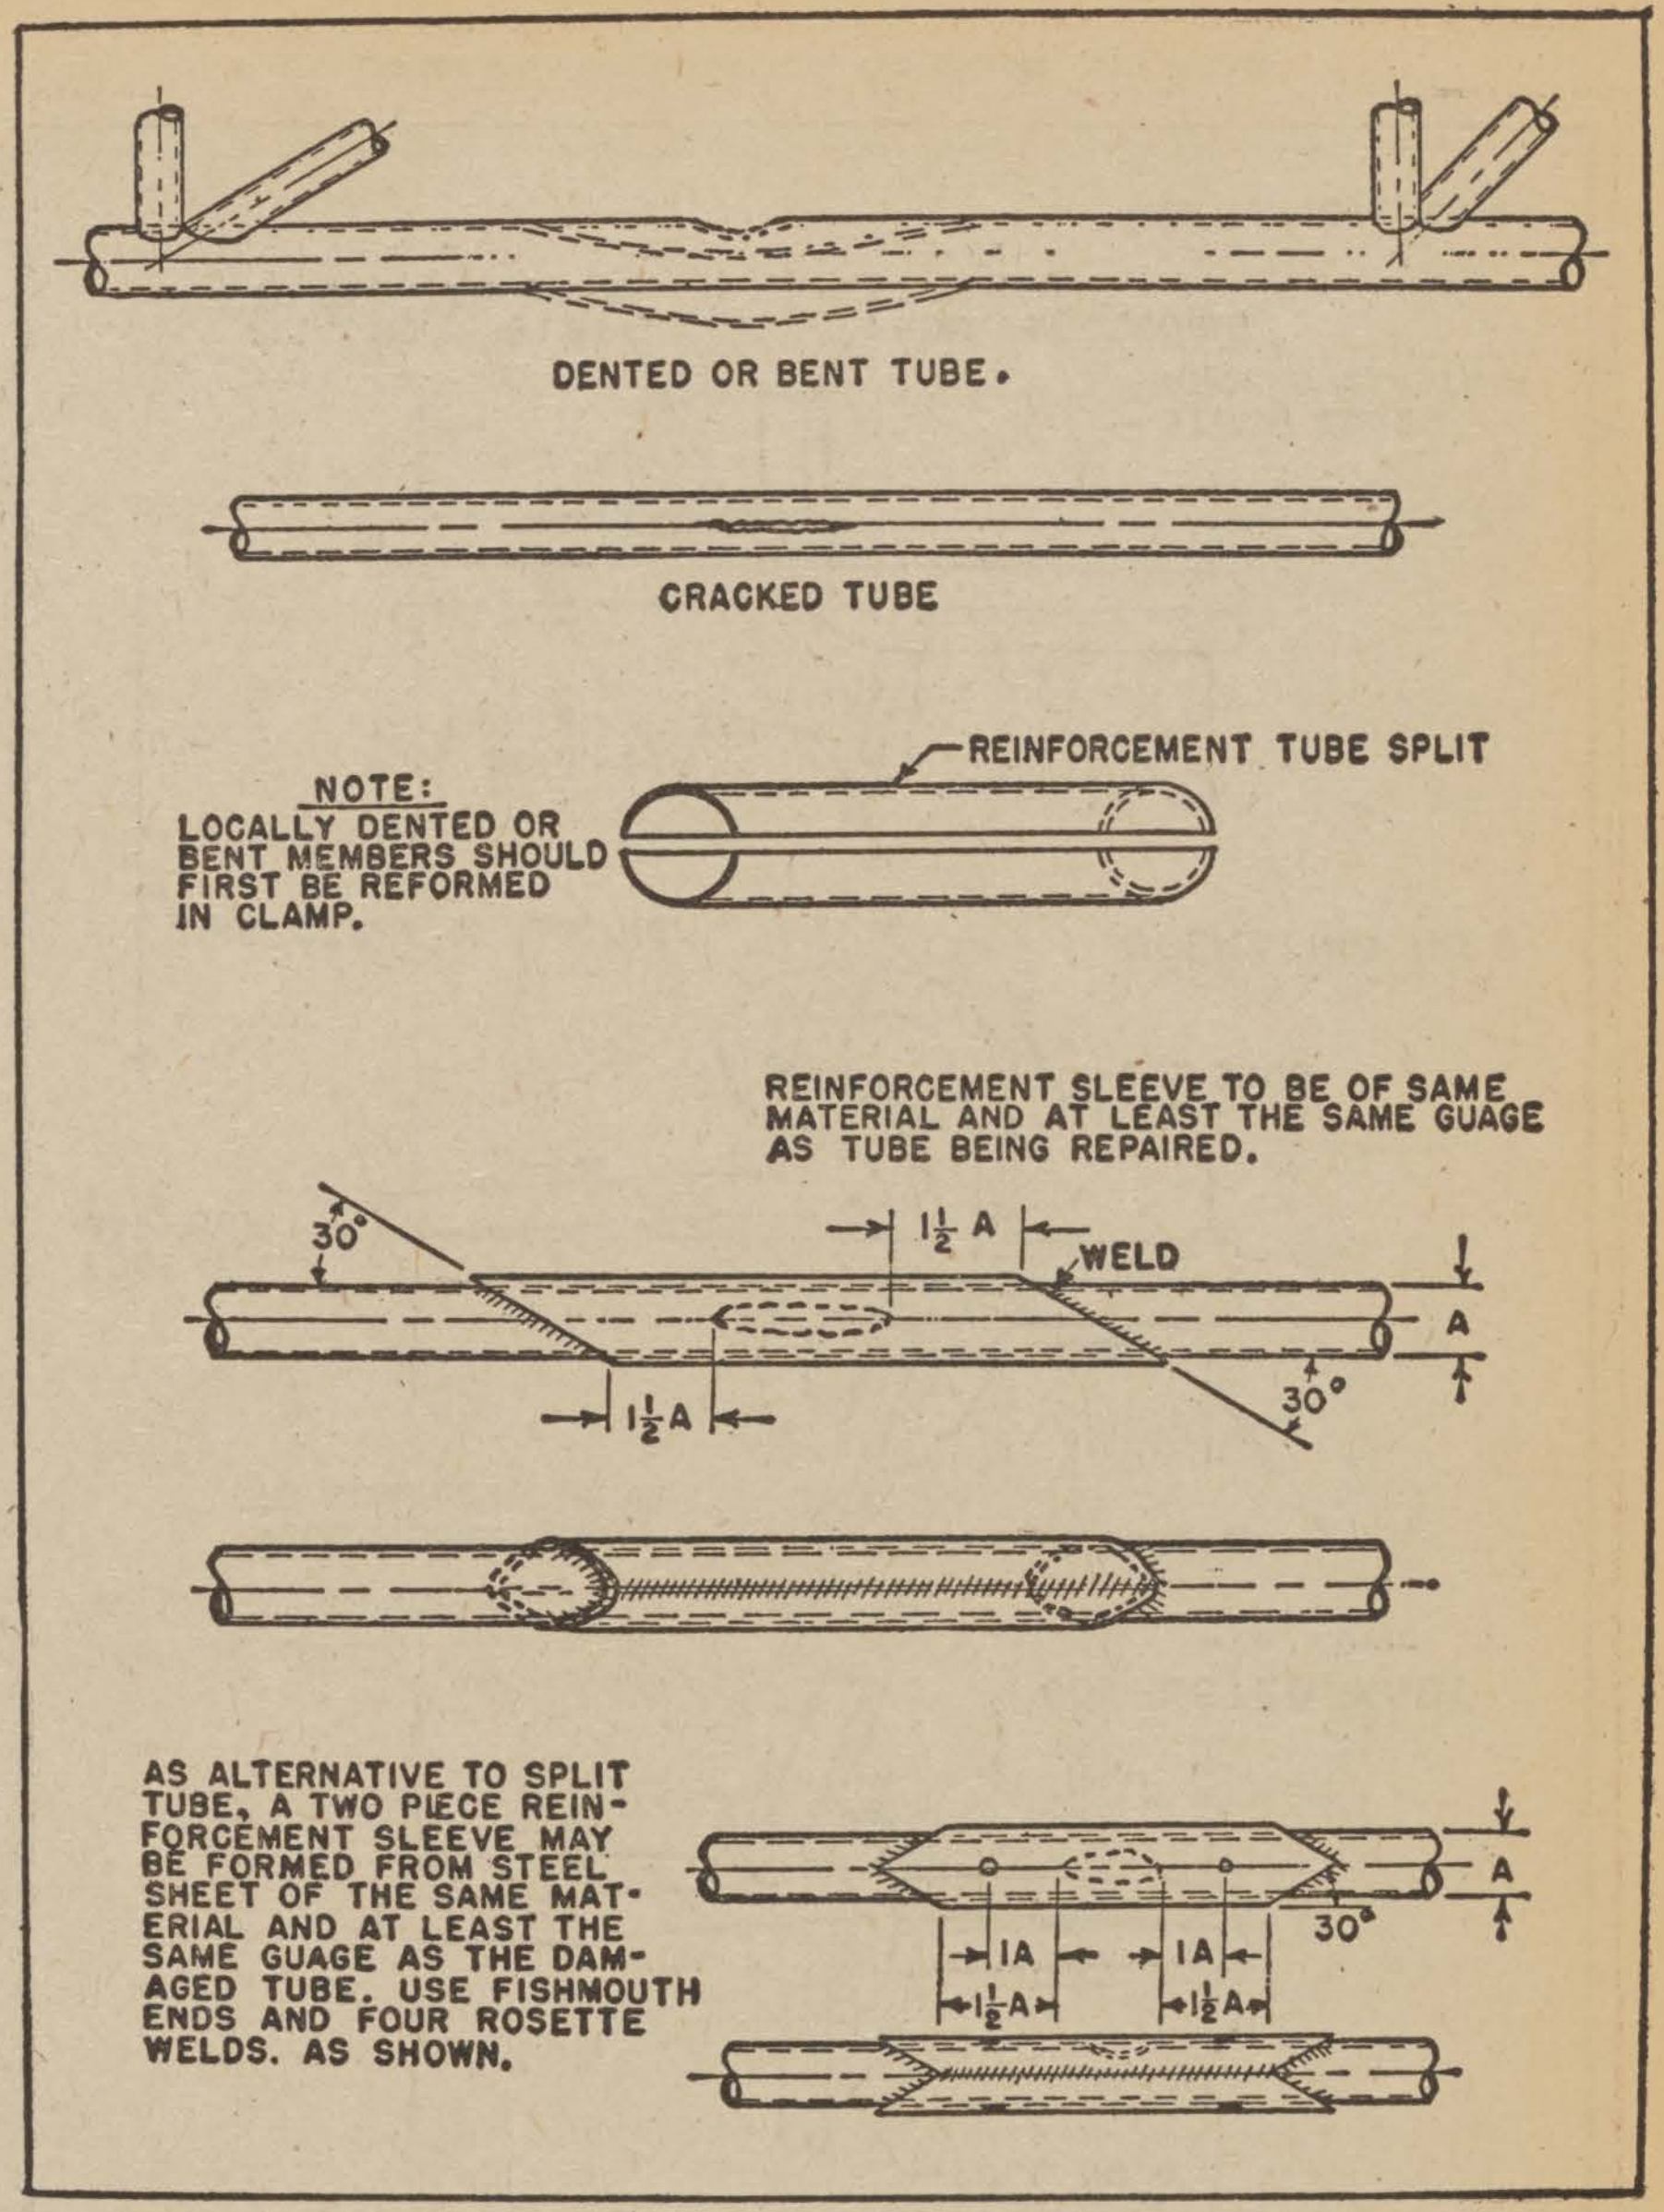
DENTED OR BENT TUBE.
CRACKED TUBE
REINFORCEMENT TUBE SPLIT
NOTE: LOCALLY DENTED OR BENT MEMBERS SHOULD FIRST BE REFORMED IN CLAMP.
REINFORCEMENT SLEEVE TO BE OF SAME MATERIAL AND AT LEAST THE SAME GUAGE AS TUBE BEING REPAIRED.
30°
1½ A
WELD
A
30°
1½ A
AS ALTERNATIVE TO SPLIT TUBE, A TWO PIECE REINFORCEMENT SLEEVE MAY BE FORMED FROM STEEL SHEET OF THE SAME MATERIAL AND AT LEAST THE SAME GUAGE AS THE DAMAGED TUBE. USE FISHMOUTH ENDS AND FOUR ROSETTE WELDS. AS SHOWN.
A
30°
1A
1A
1½ A
1½ A

FIGURE 4-2—Members dented in a bay—repair by welded sleeve.

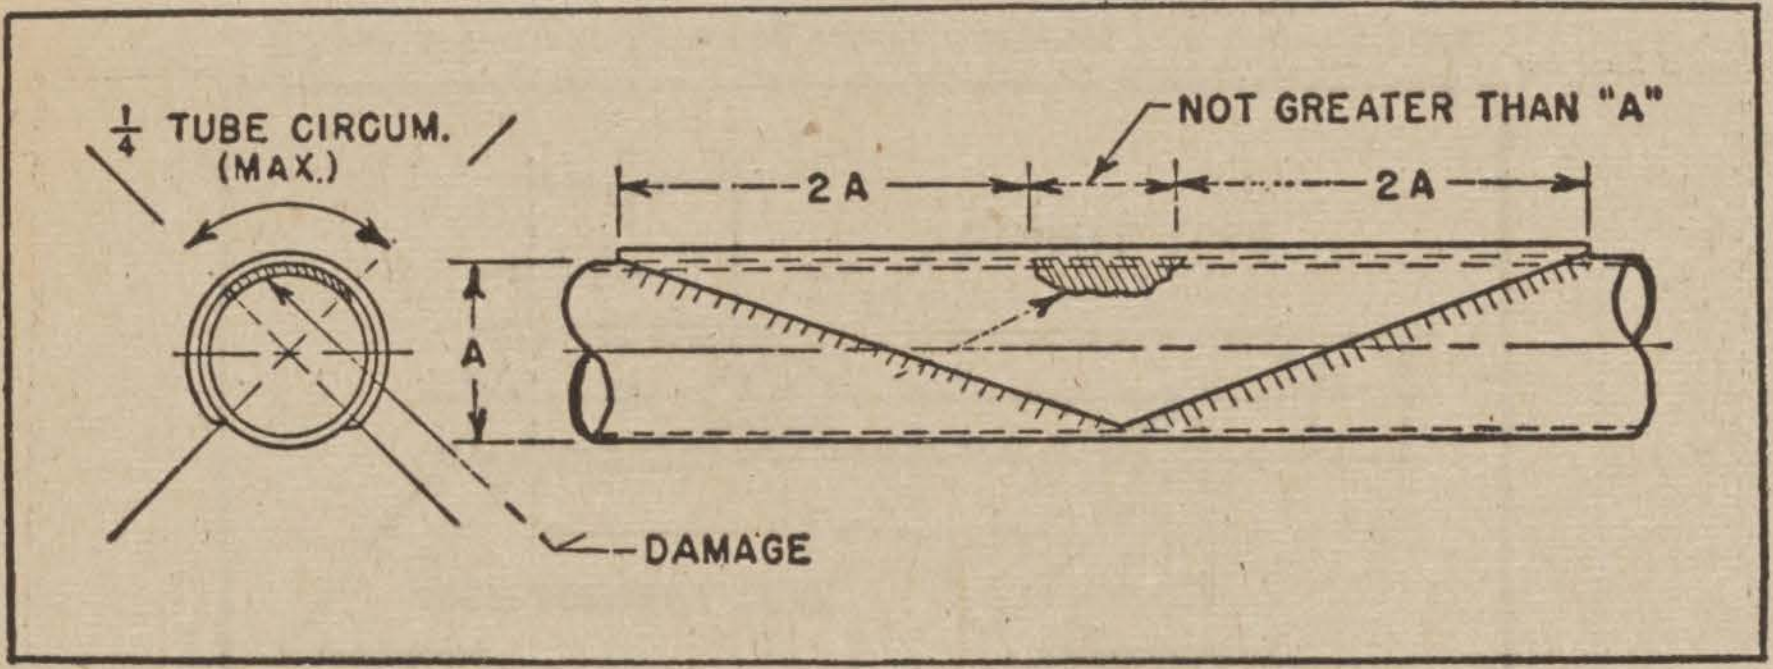

FIGURE 4-3—Welded patch repair.

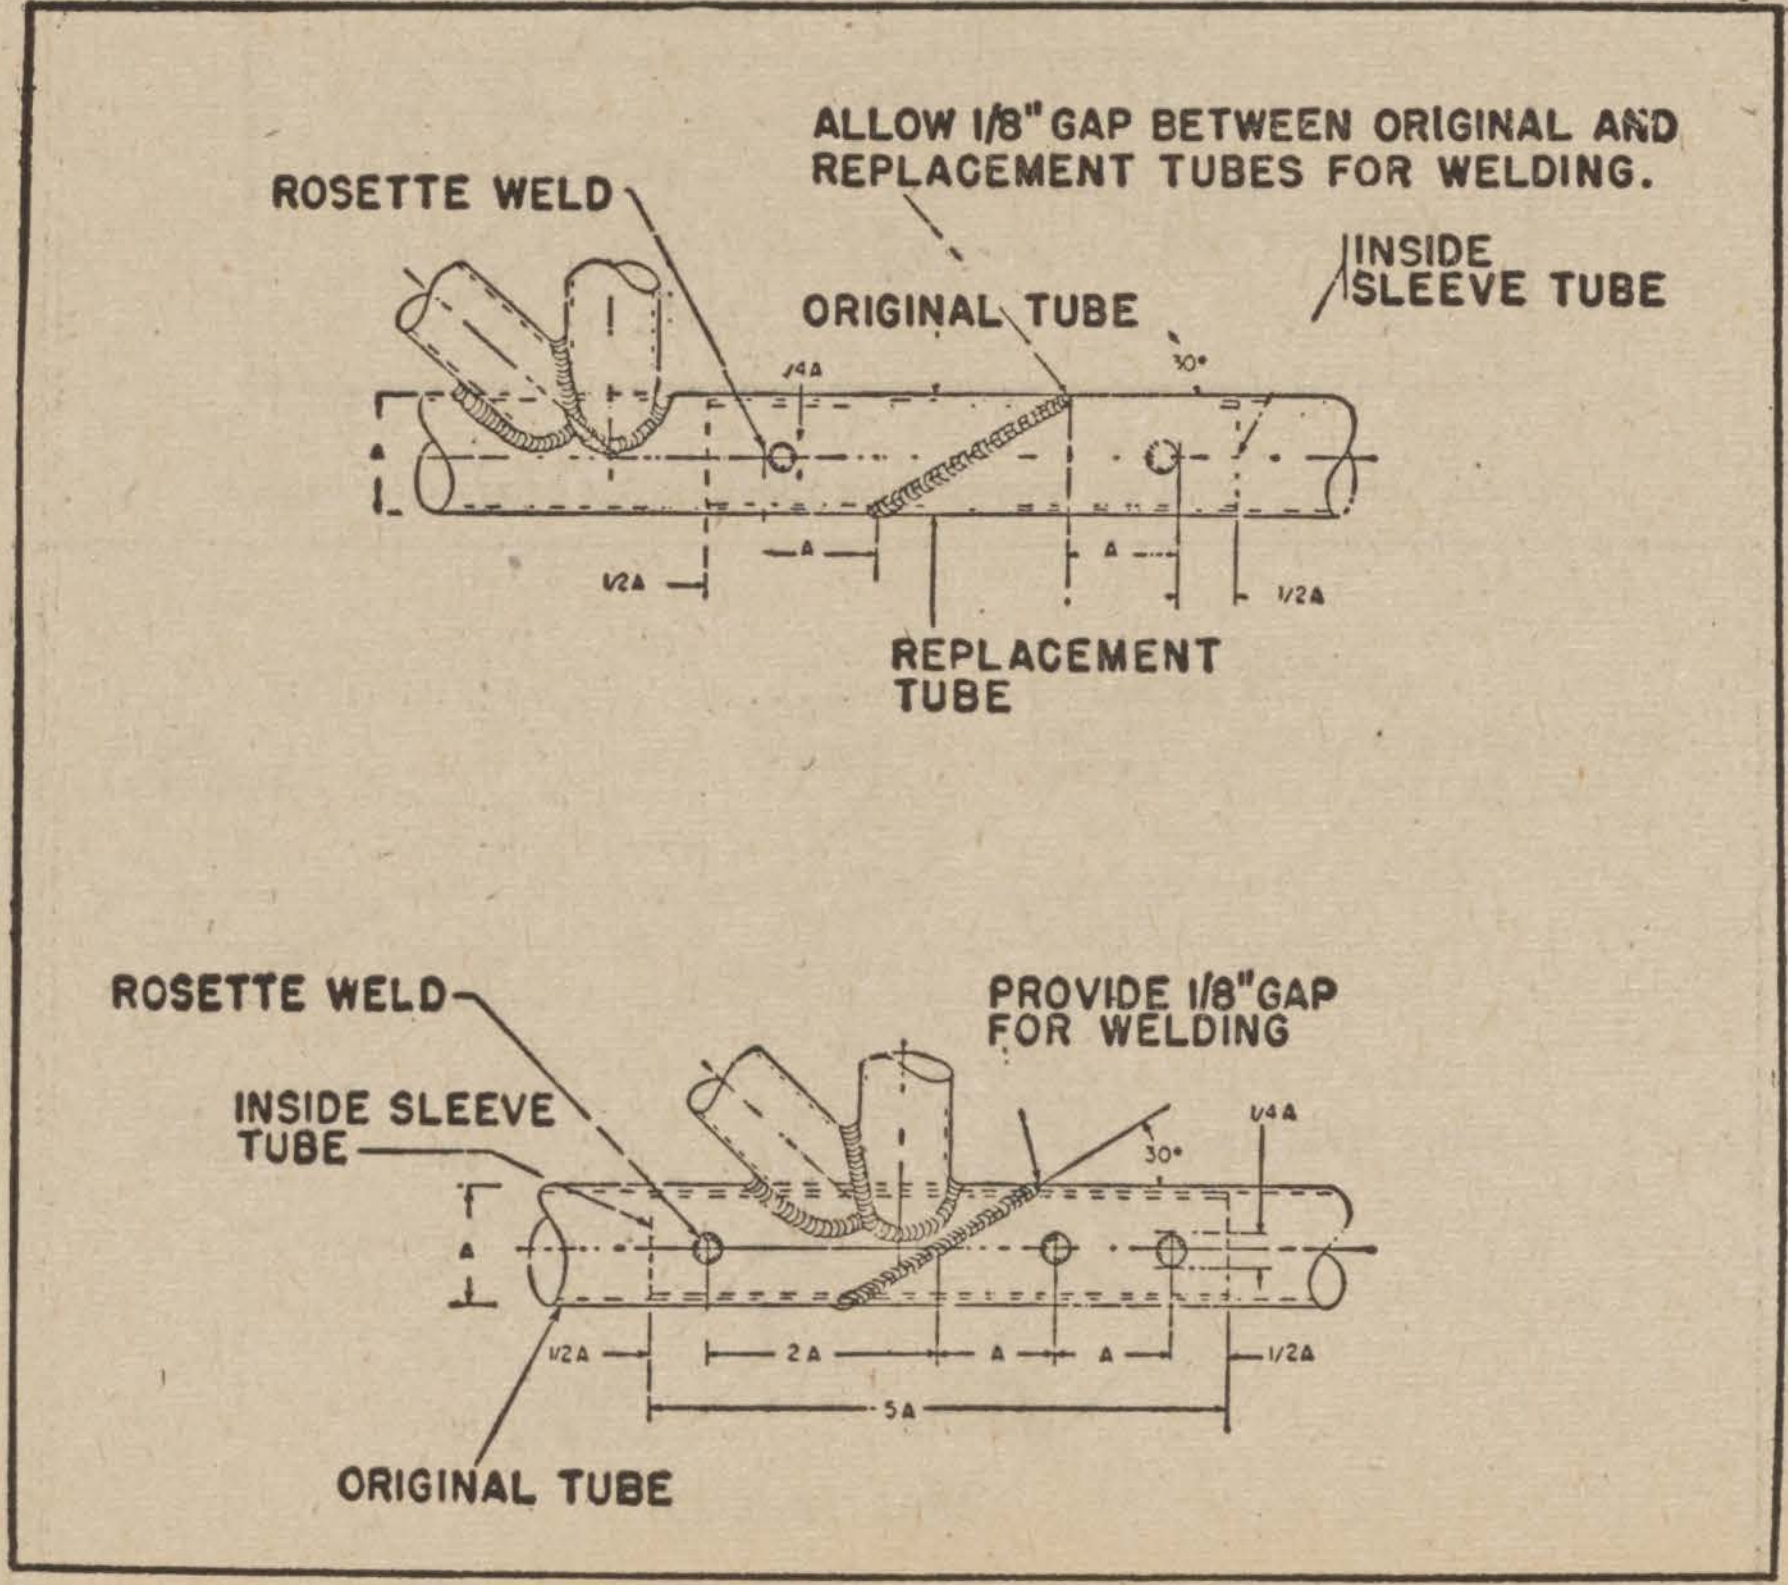

FIGURE ~~4-4~~—Splicing by inner sleeve method.

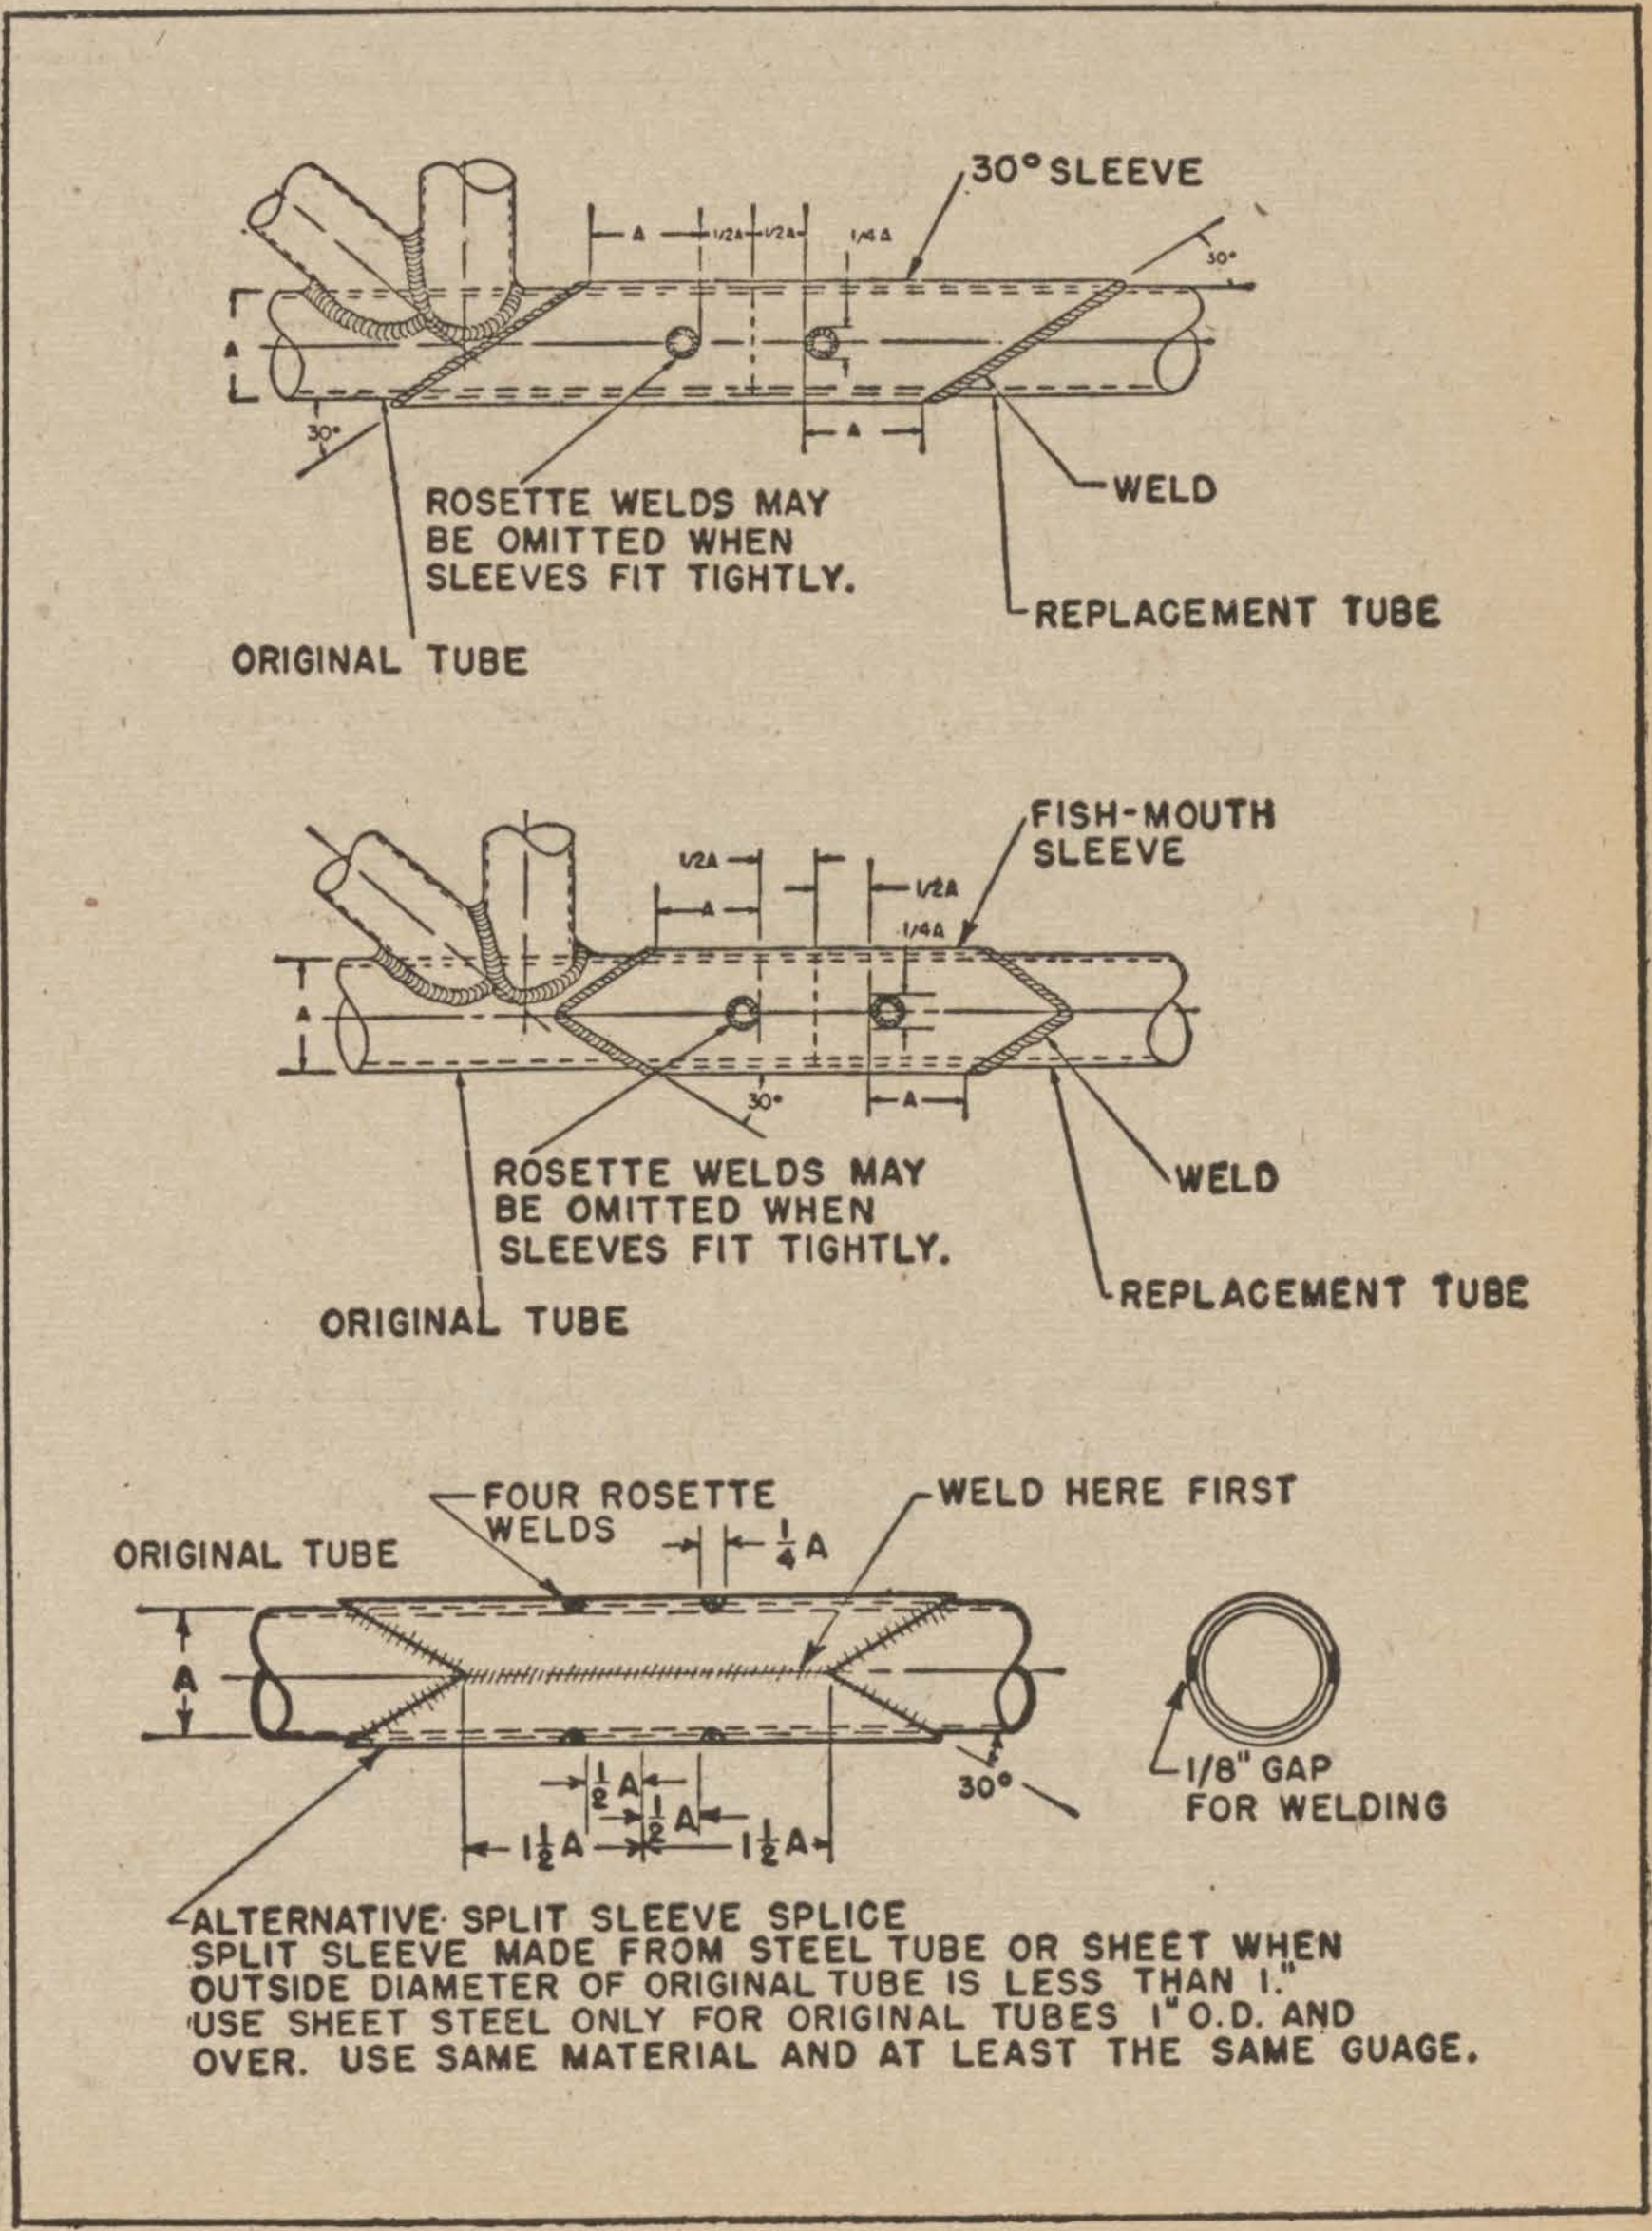

ALTERNATIVE SPLIT SLEEVE SPLICE
SPLIT SLEEVE MADE FROM STEEL TUBE OR SHEET WHEN OUTSIDE DIAMETER OF ORIGINAL TUBE IS LESS THAN 1."
USE SHEET STEEL ONLY FOR ORIGINAL TUBES 1" O.D. AND OVER. USE SAME MATERIAL AND AT LEAST THE SAME GUAGE.

FIGURE 4-5—Splicing by outer sleeve method—replacement by welded outside sleeve.

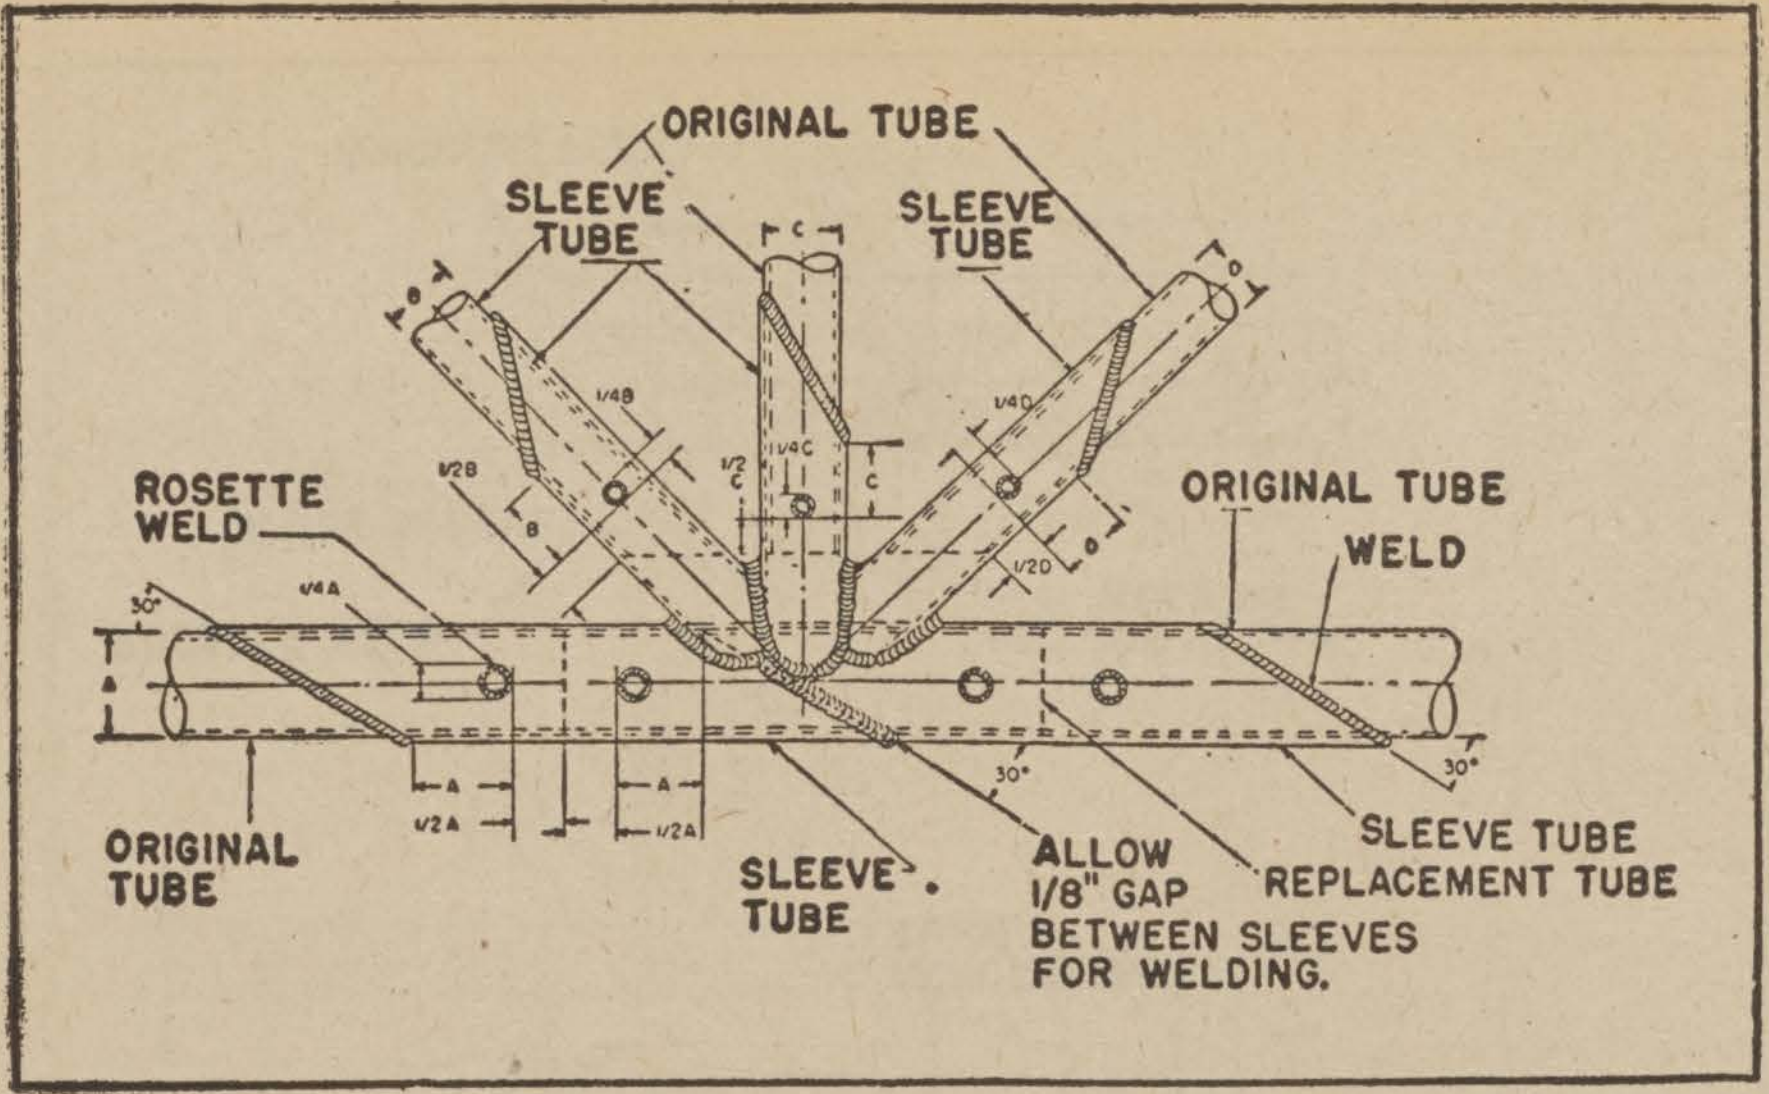

FIGURE 4-6—Tube replacement at a station by welded outer sleeves.

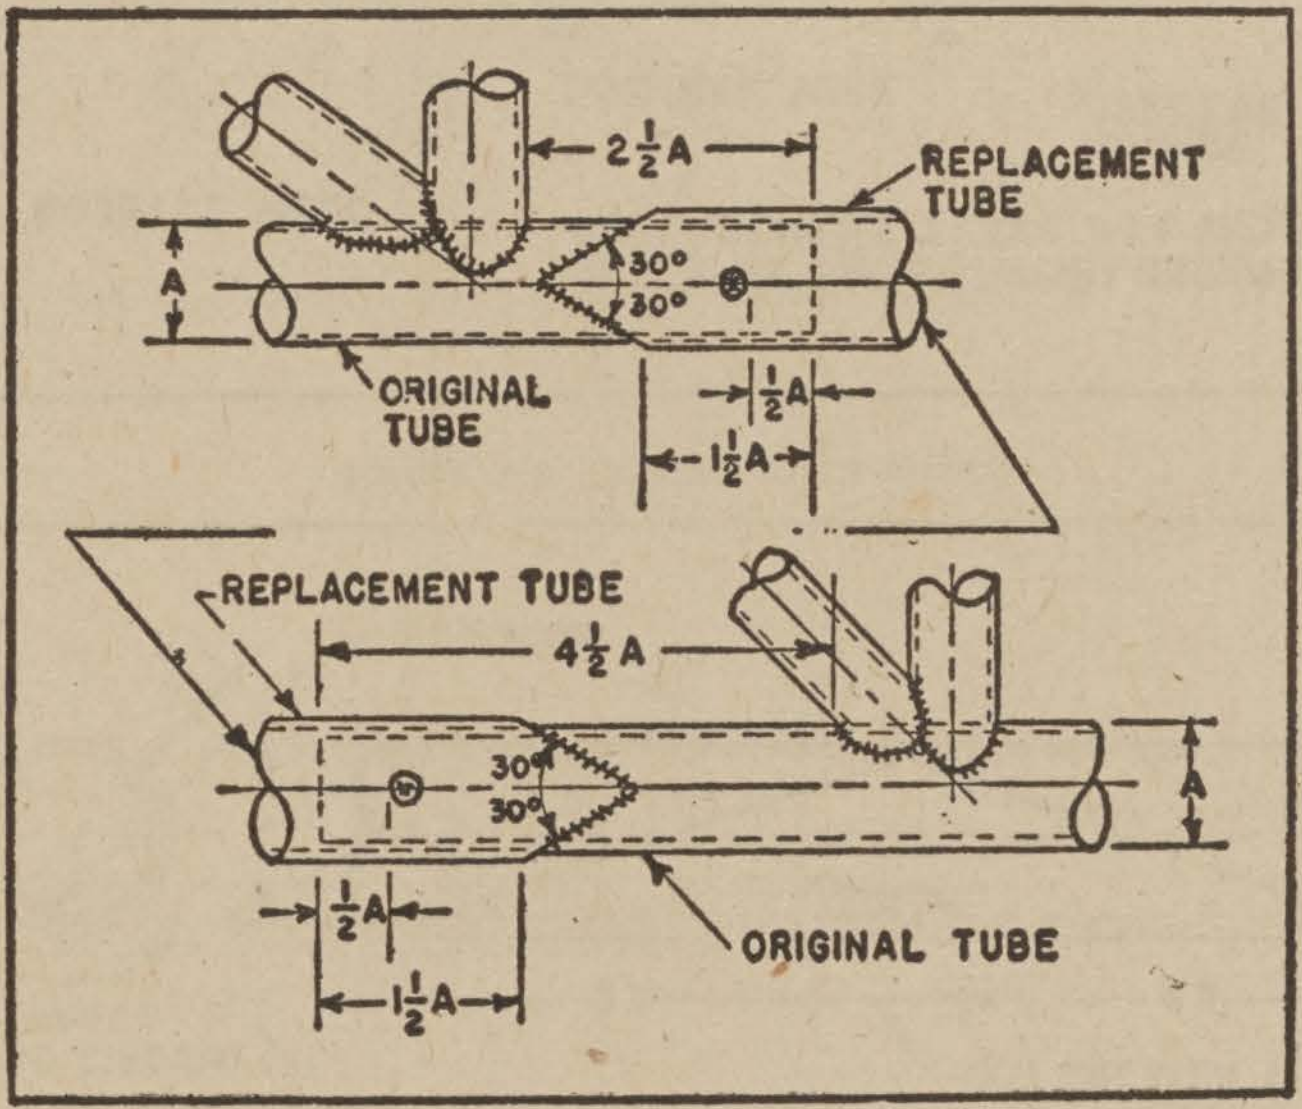

FIGURE 4-7—Splicing using larger diameter replacement tube.

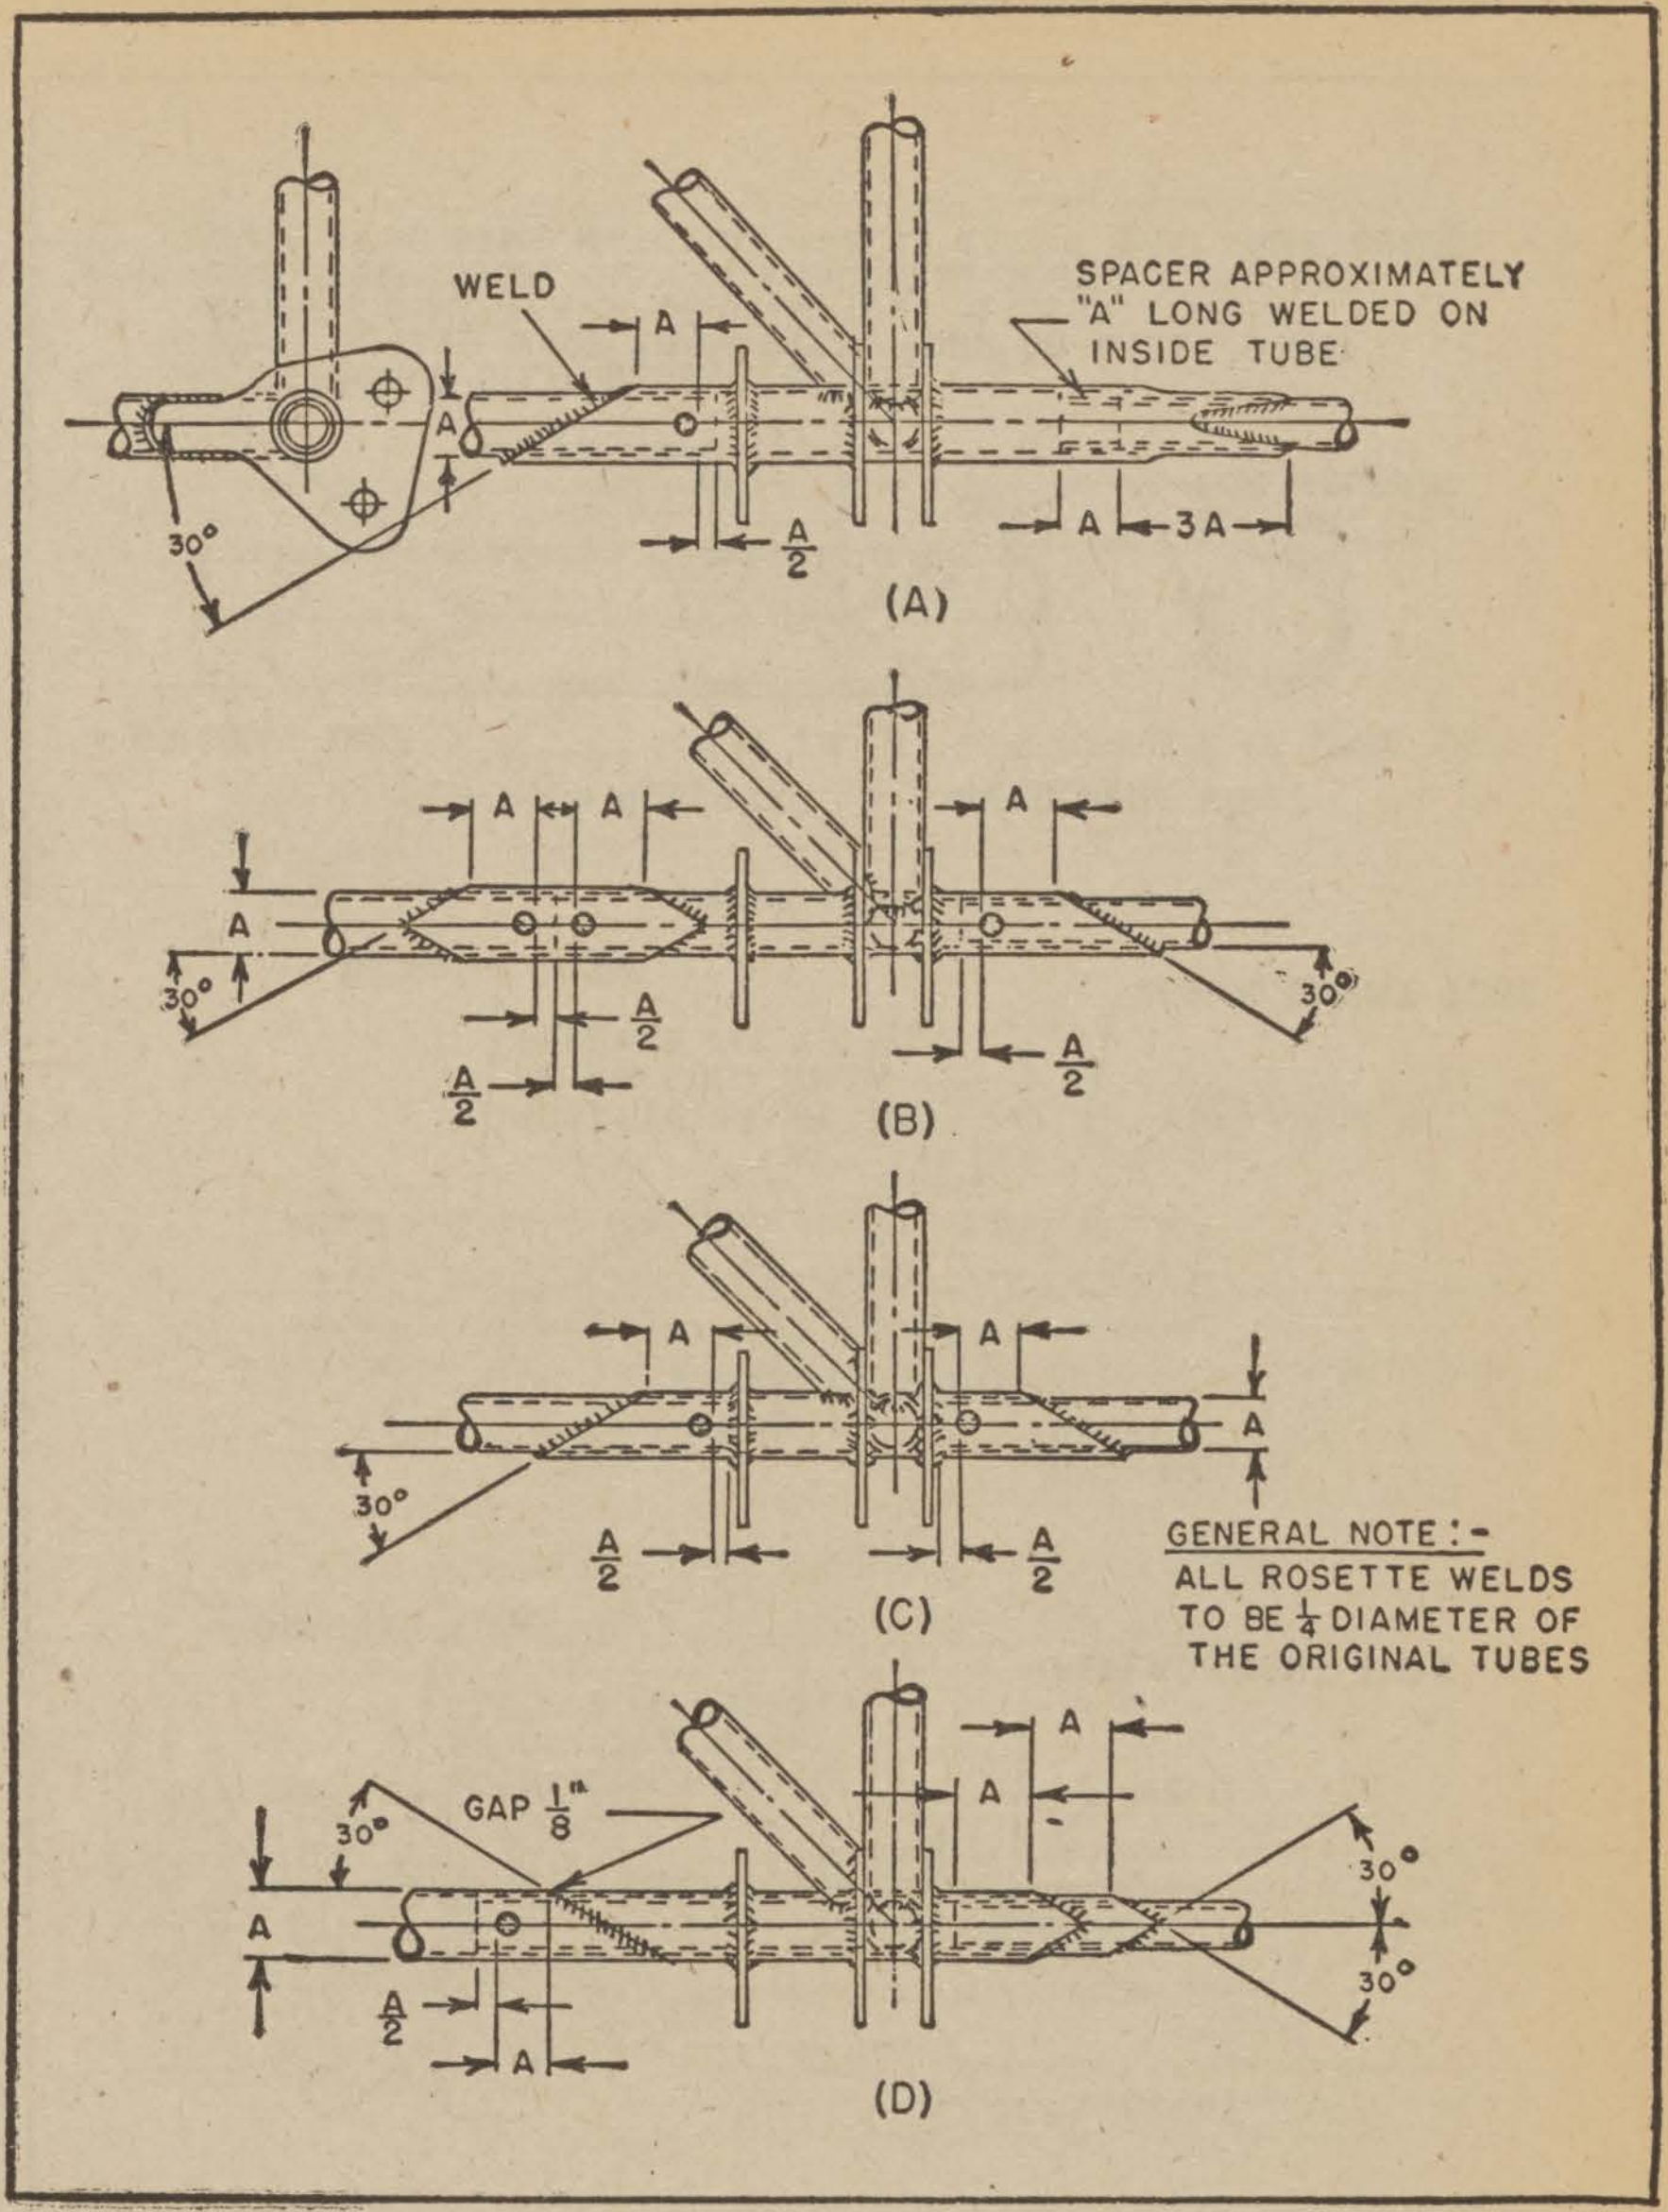

FIGURE 4-8—Repairs at built-in fuselage fittings.

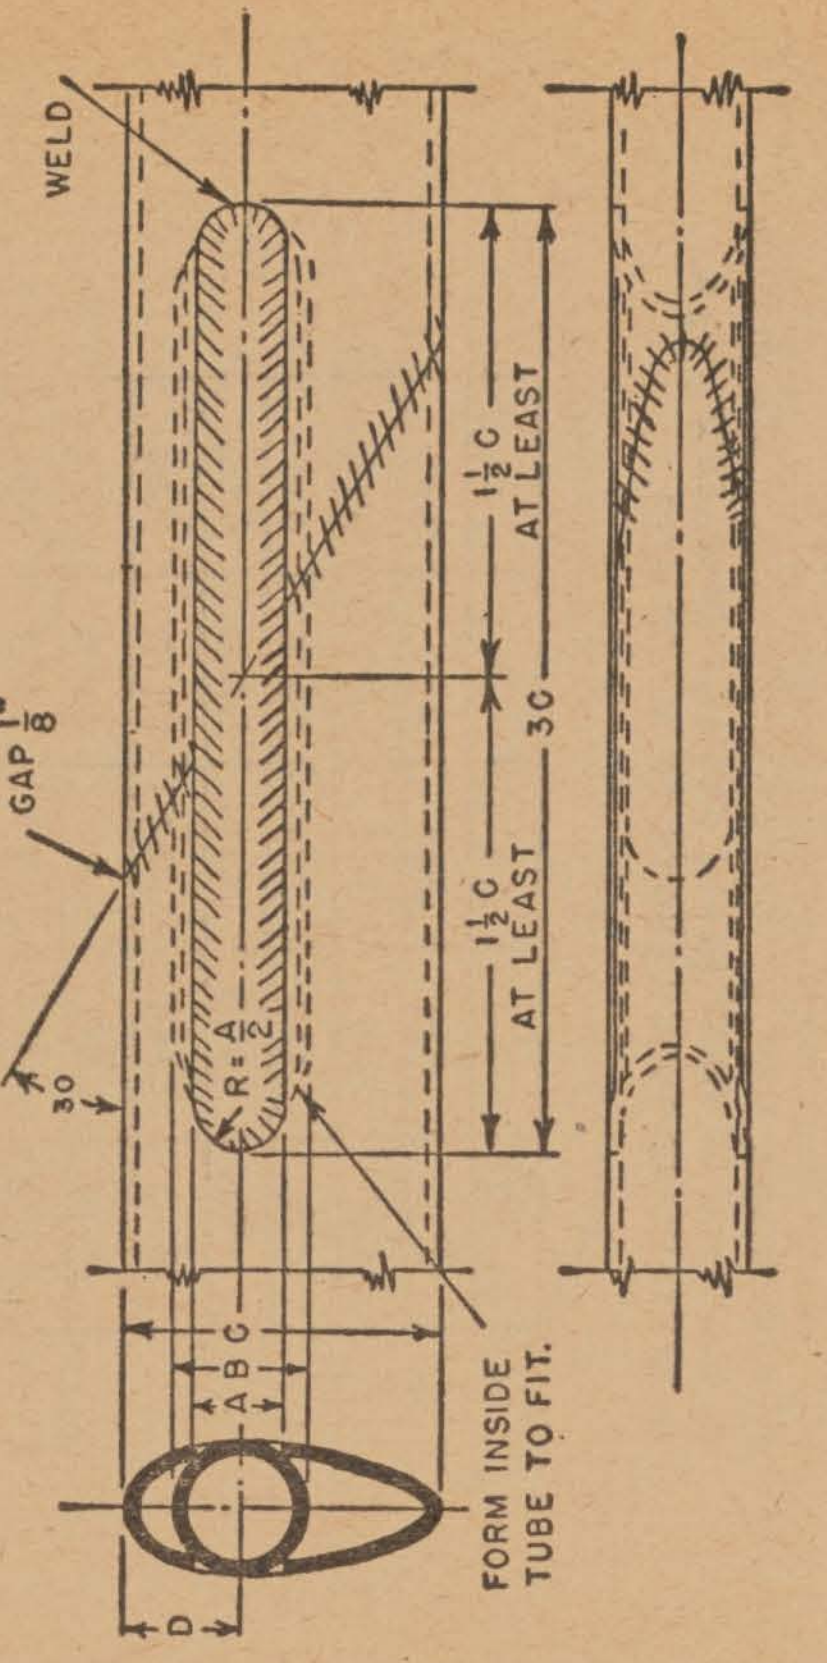

A - SLOT WIDTH (ORIGINAL TUBE)
B - OUTSIDE DIAMETER (INSERT TUBE)
C - STREAMLINE TUBE LENGTH OF MAJOR AXIS

| S.L. SIZE | A | B | C | D |
|---|---|---|---|---|
| 1" | 3/8" | 9/16" | 1.340" | .496" |
| 1-1/4 | 3/8 | 11/16 | 1.670 | .619 |
| 1-1/2 | 1/2 | 7/8 | 2.005 | .743 |
| 1-3/4 | 1/2 | 1 | 2.339 | .867 |
| 2 | 1/2 | 1-1/8 | 2.670 | 991 |
| 2-1/4 | 1/2 | 1-1/4 | 3.008 | 1.115 |
| 2-1/2 | 1/2 | 1-3/8 | 3.342 | 1.239 |

ROUND INSERT TUBE (B) SHOULD BE AT LEAST OF SAME MATERIAL AND ONE GAUGE THICKER THAN ORIGINAL STREAMLINE TUBE (C).

FIGURE 4-9—Streamline tube splice using round tube (applicable to landing gears).

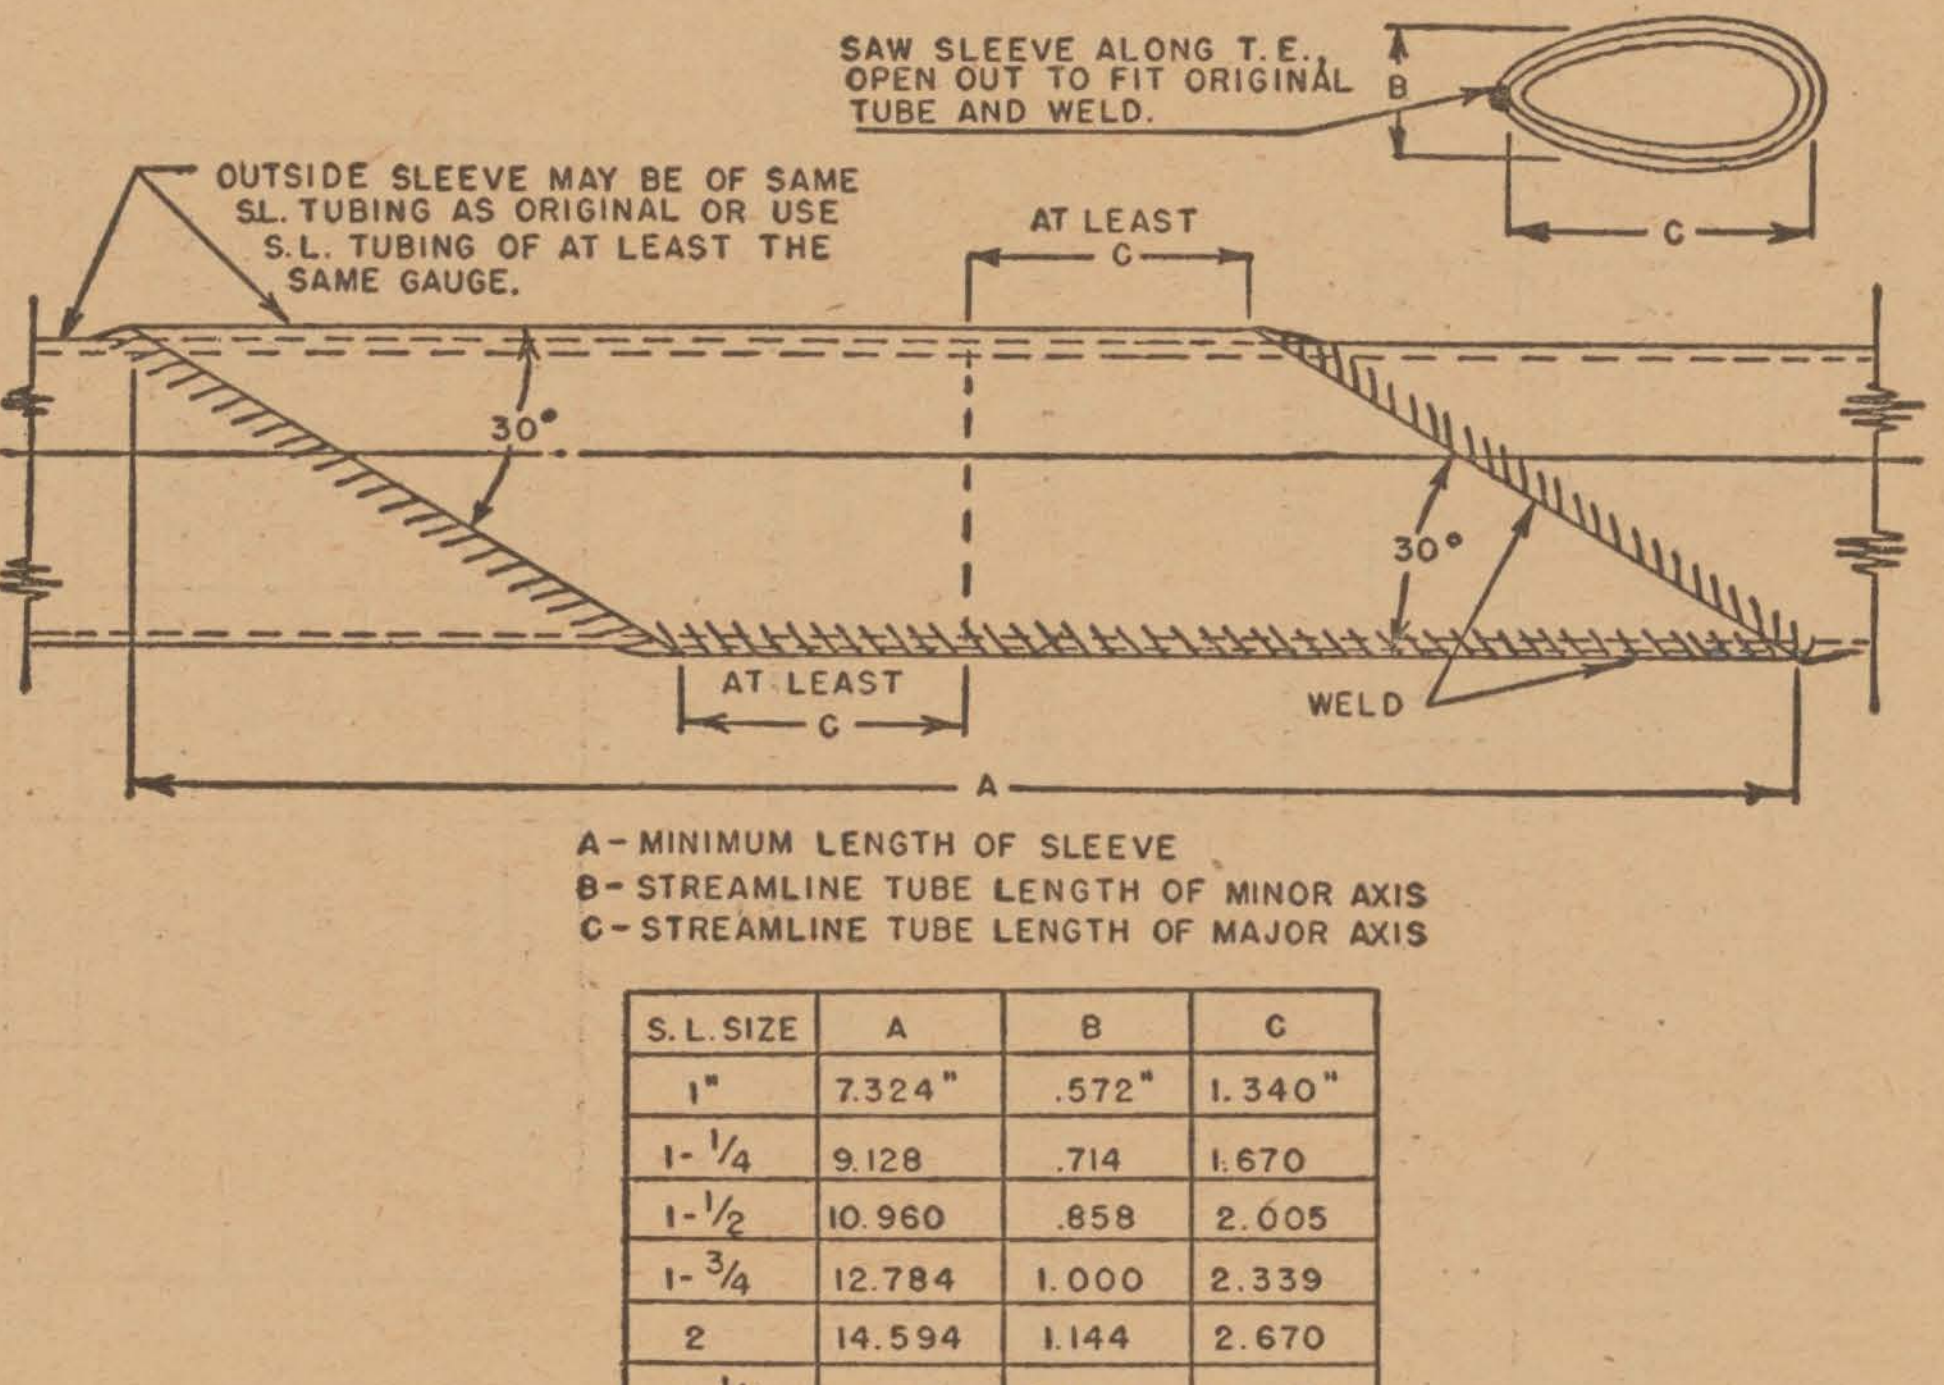
SAW SLEEVE ALONG T.E., OPEN OUT TO FIT ORIGINAL TUBE AND WELD.
B
C
OUTSIDE SLEEVE MAY BE OF SAME S.L. TUBING AS ORIGINAL OR USE S.L. TUBING OF AT LEAST THE SAME GAUGE.
AT LEAST C
30°
30°
AT LEAST C
WELD
A

A - MINIMUM LENGTH OF SLEEVE
B - STREAMLINE TUBE LENGTH OF MINOR AXIS
C - STREAMLINE TUBE LENGTH OF MAJOR AXIS

| S. L. SIZE | A | B | C |
|---|---|---|---|
| 1" | 7.324" | .572" | 1.340" |
| 1-1/4 | 9.128 | .714 | 1.670 |
| 1-1/2 | 10.960 | .858 | 2.005 |
| 1-3/4 | 12.784 | 1.000 | 2.339 |
| 2 | 14.594 | 1.144 | 2.670 |
| 2-1/4 | 16.442 | 1.286 | 3.008 |
| 2-1/2 | 18.268 | 1.430 | 3.342 |

FIGURE 4-10—Streamline tube splice using split sleeve (applic able to wing and tail surface brace struts and other members).

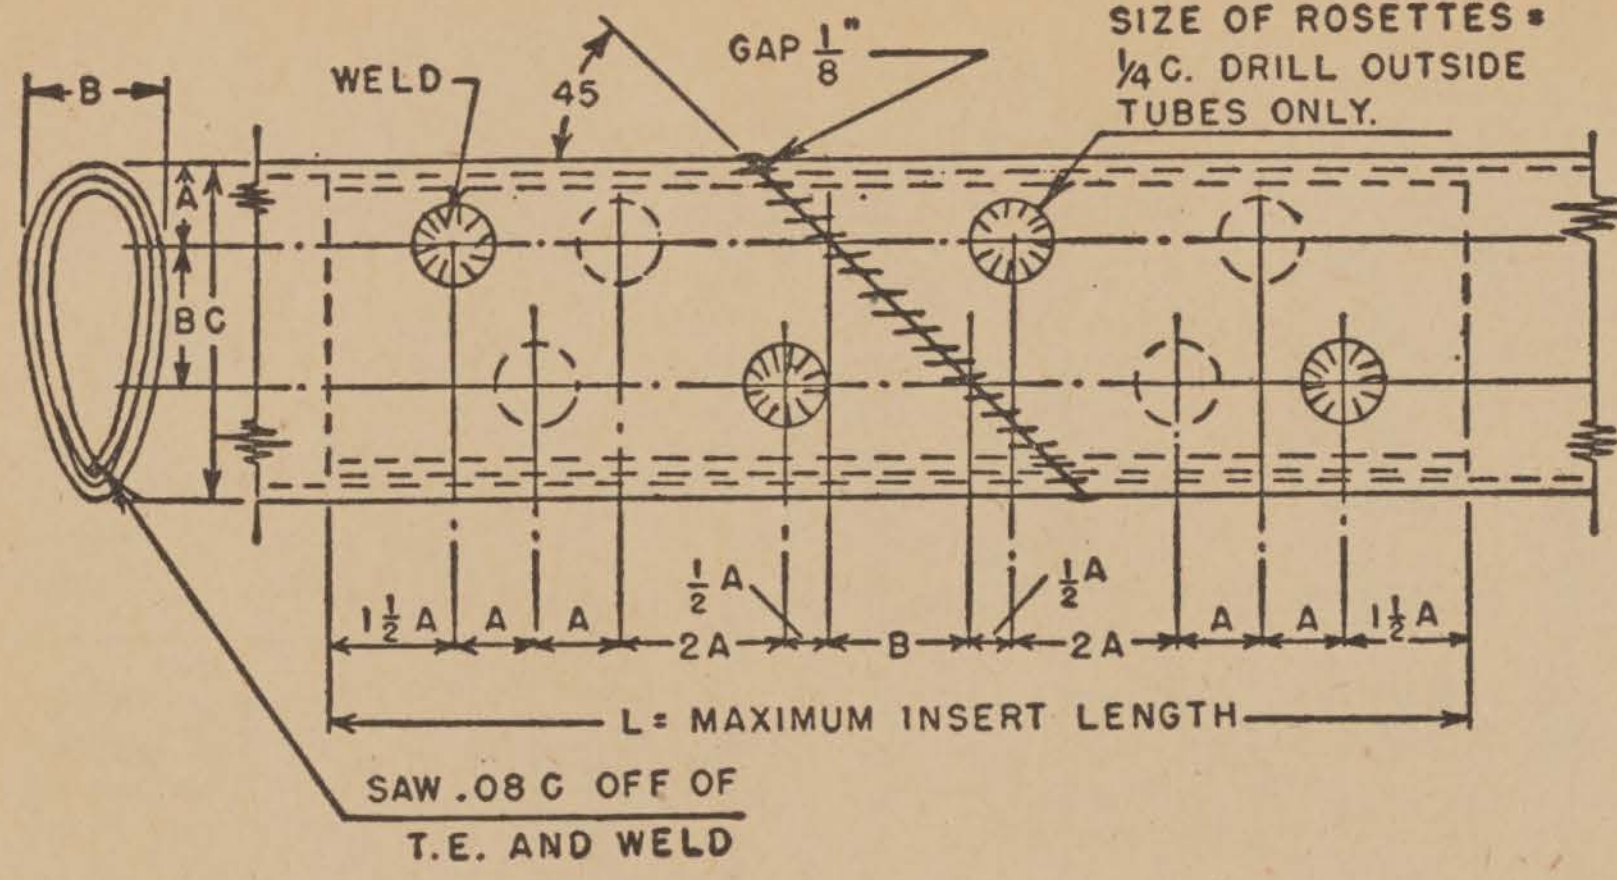
B
A
BC
WELD
45
GAP 1/8"
SIZE OF ROSETTES = 1/4 C. DRILL OUTSIDE TUBES ONLY.
1½ A
A
A
½ A
2 A
B
½ A
2 A
A
A
1½ A
L = MAXIMUM INSERT LENGTH
SAW .08 C OFF OF T.E. AND WELD

INSERT TUBE IS OF SAME STREAMLINE TUBING AS ORIGINAL.

A IS $\frac{2}{3}$ B

B IS MINOR AXIS LENGTH OF ORIGINAL STREAMLINE TUBE

C IS MAJOR AXIS LENGTH OF ORIGINAL STREAMLINE TUBE

| S. L. SIZE | A | B | C | L |
|---|---|---|---|---|
| 1" | .382 | .572 | 1.340 | 5.16 |
| 1 1/4 | .476 | .714 | 1.670 | 6.43 |
| 1 1/2 | .572 | .858 | 2.005 | 7.72 |
| 1 3/4 | .667 | 1.000 | 2.339 | 9.00 |
| 2 | .763 | 1.144 | 2.670 | 10.30 |
| 2 1/4 | .858 | 1.286 | 3.008 | 11.58 |
| 2 1/2 | .954 | 1.430 | 3.342 | 12.88 |

FIGURE 4-11—Streamline tube splice using split insert (applicable to landing gears).

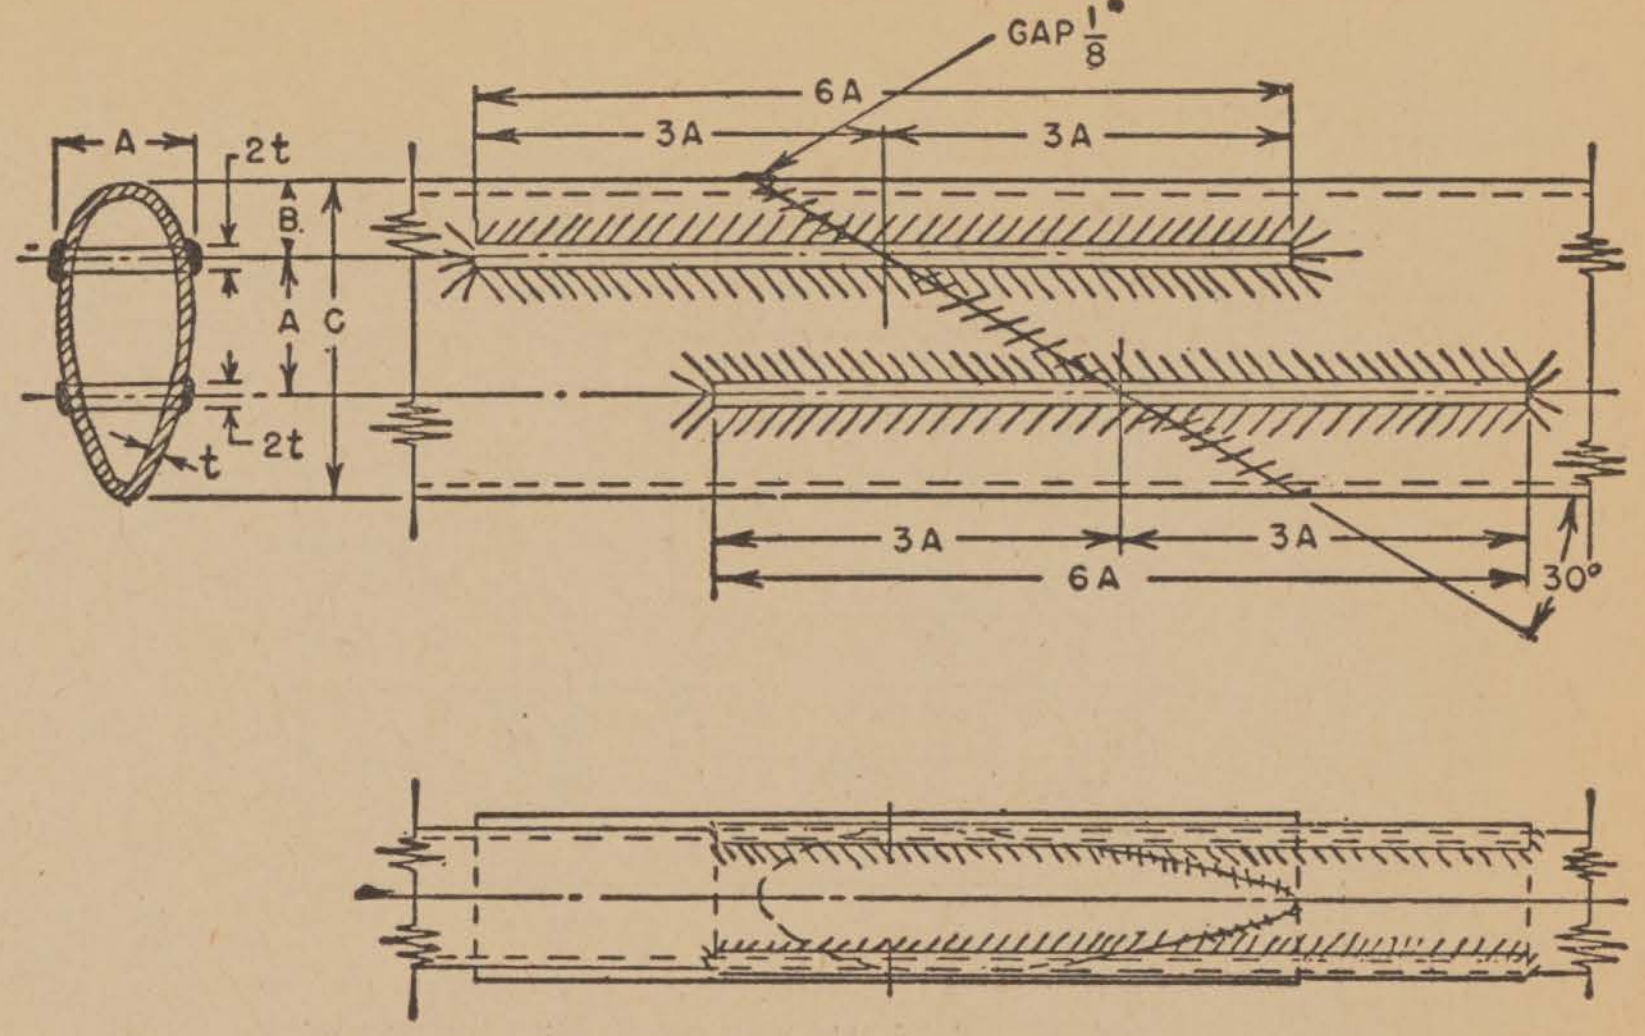

A- STREAMLINE TUBE LENGTH OF MINOR AXIS, PLATE WIDTHS.
B- DISTANCE OF FIRST PLATE FROM LEADING EDGE, 2/3 A.
C- STREAMLINE TUBE LENGTH OF MAJOR AXIS.

| S.L. SIZE | A | B | C | 6A |
|---|---|---|---|---|
| 1" | .572 | .382 | 1.340 | 3.43 |
| 1-1/4 | .714 | .476 | 1.670 | 4.28 |
| 1-1/2 | .858 | .572 | 2.005 | 5.15 |
| 1-3/4 | 1.000 | .667 | 2.339 | 6.00 |
| 2 | 1.144 | .762 | 2.670 | 6.86 |
| 2-1/4 | 1.286 | .858 | 3.008 | 7.72 |
| 2-1/2 | 1.430 | .954 | 3.342 | 8.58 |

FIGURE 4-12—Streamline tube splice using plates (applicable to landing gears).

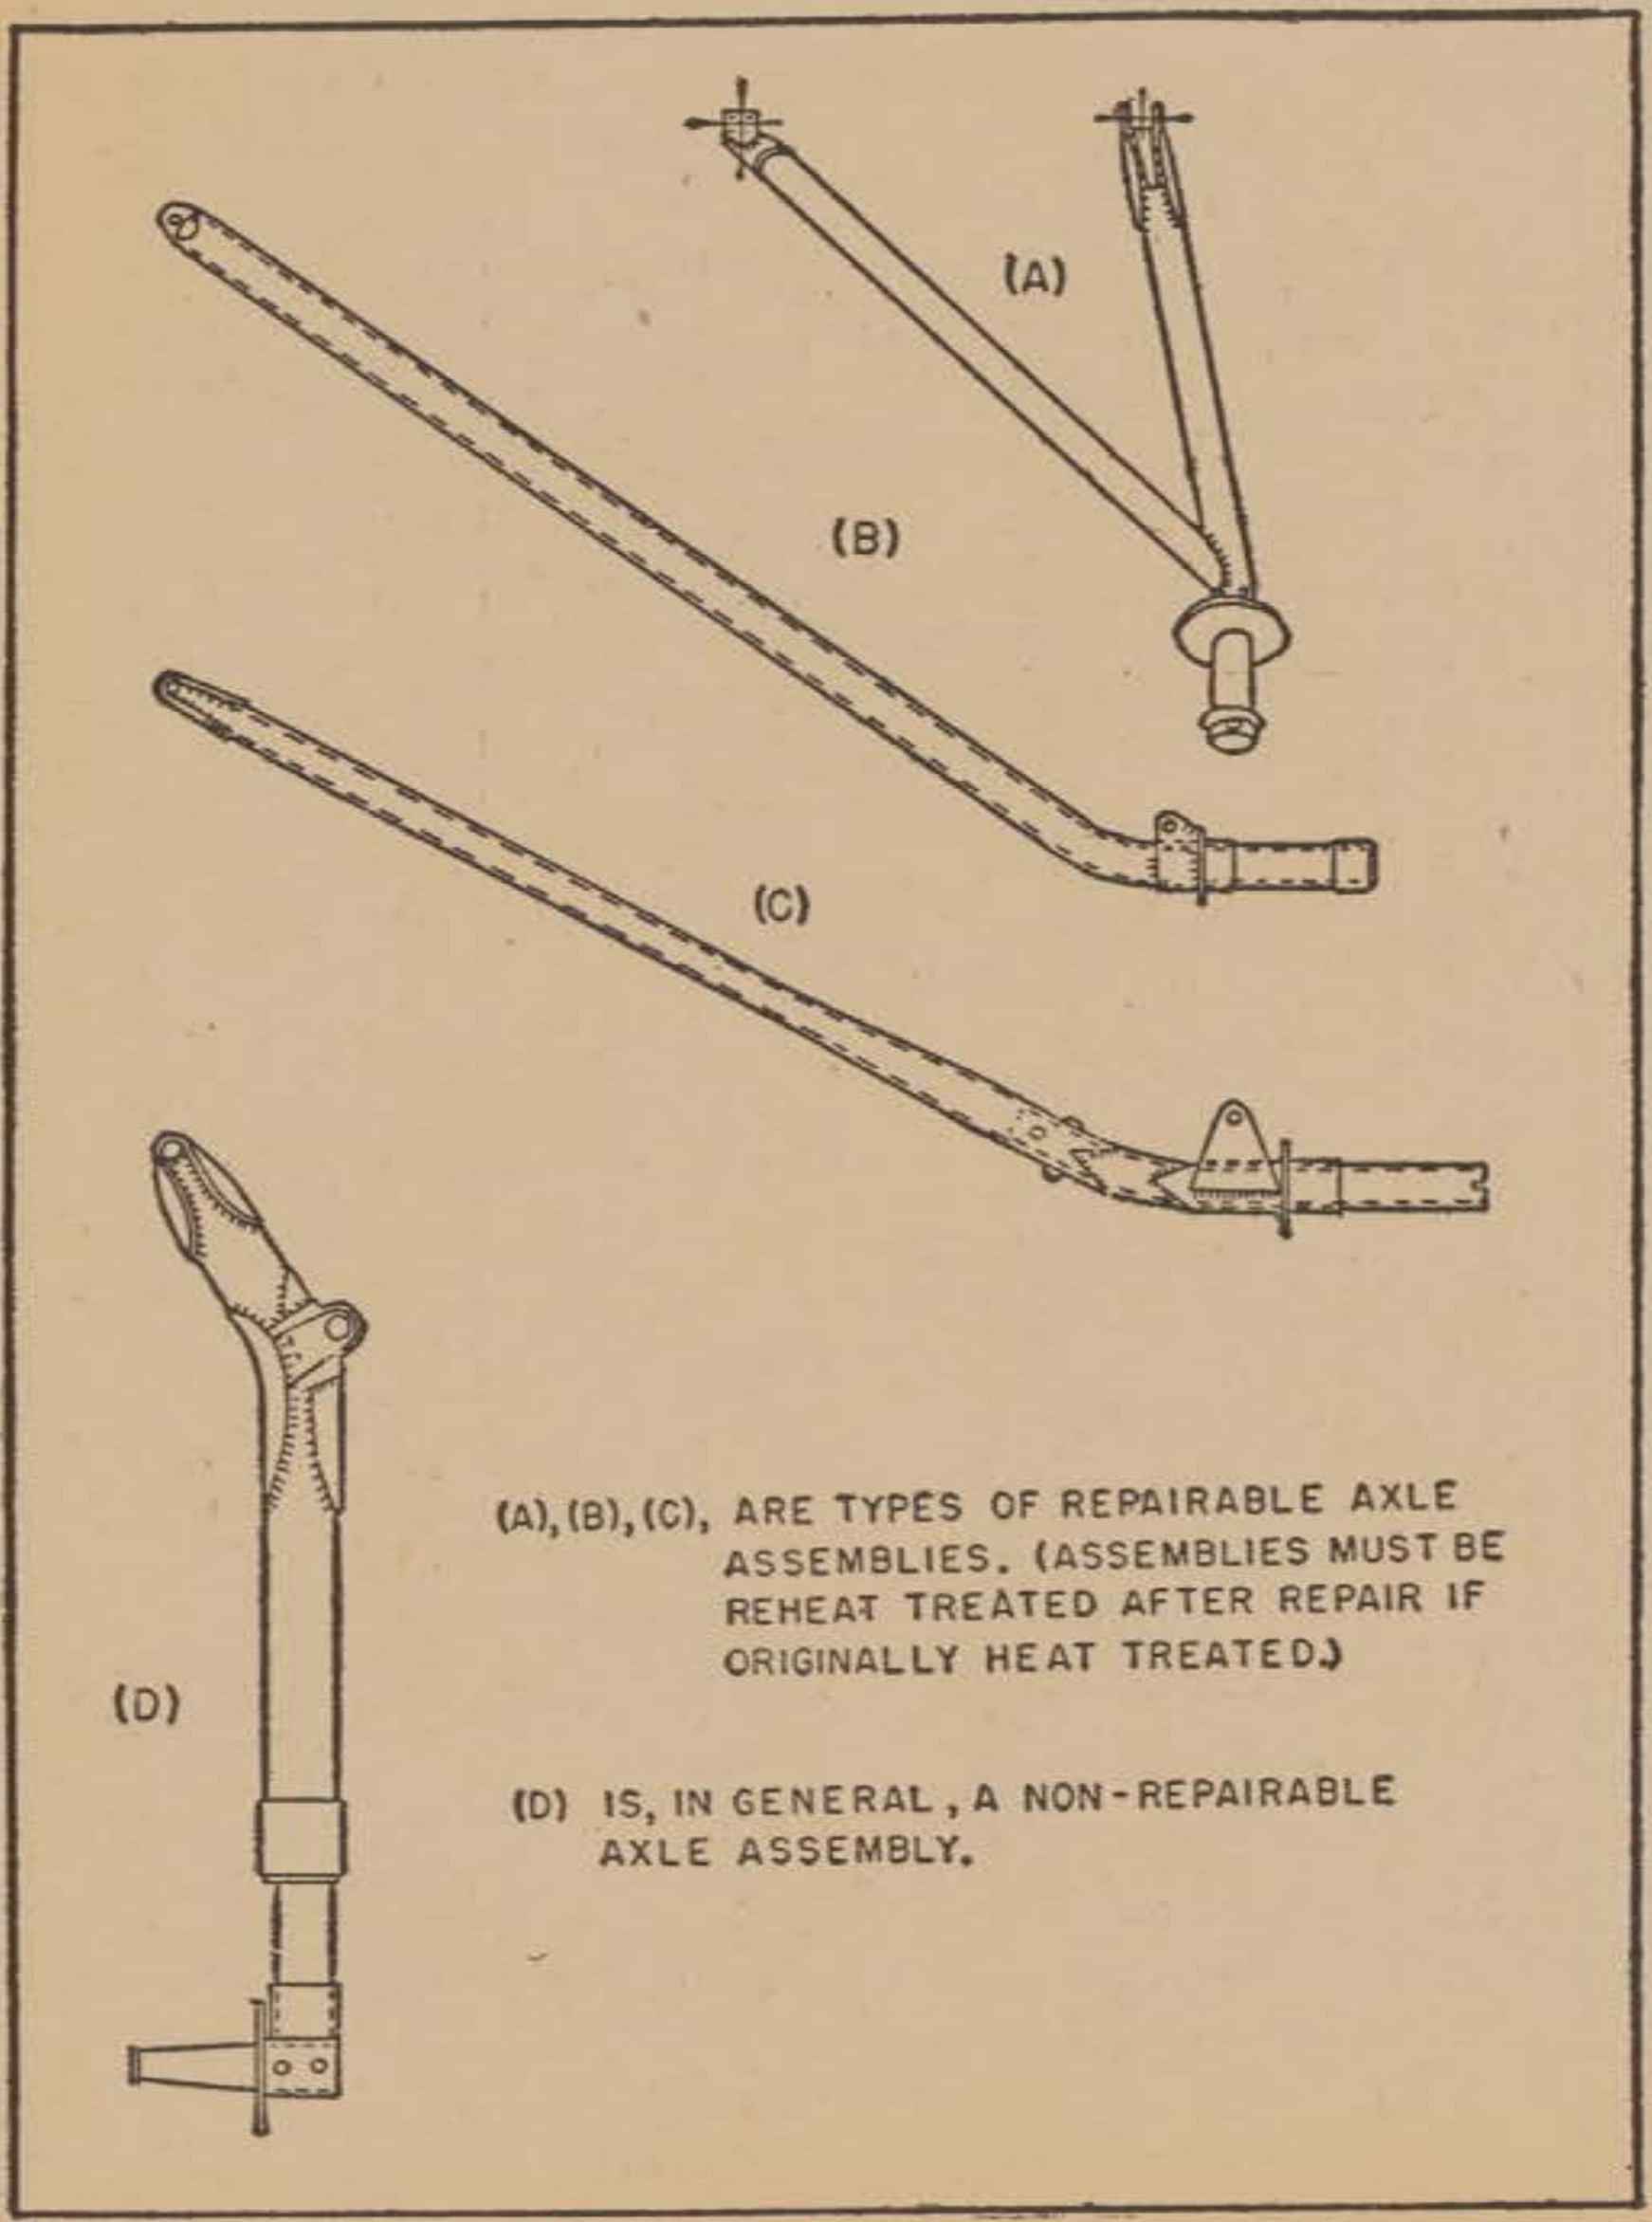
(A)
(B)
(C)
(D)
(A), (B), (C), ARE TYPES OF REPAIRABLE AXLE ASSEMBLIES. (ASSEMBLIES MUST BE REHEAT TREATED AFTER REPAIR IF ORIGINALLY HEAT TREATED.)
(D) IS, IN GENERAL, A NON-REPAIRABLE AXLE ASSEMBLY.

FIGURE 4-13—Representative types of repairable and non-repairable axle assemblies.

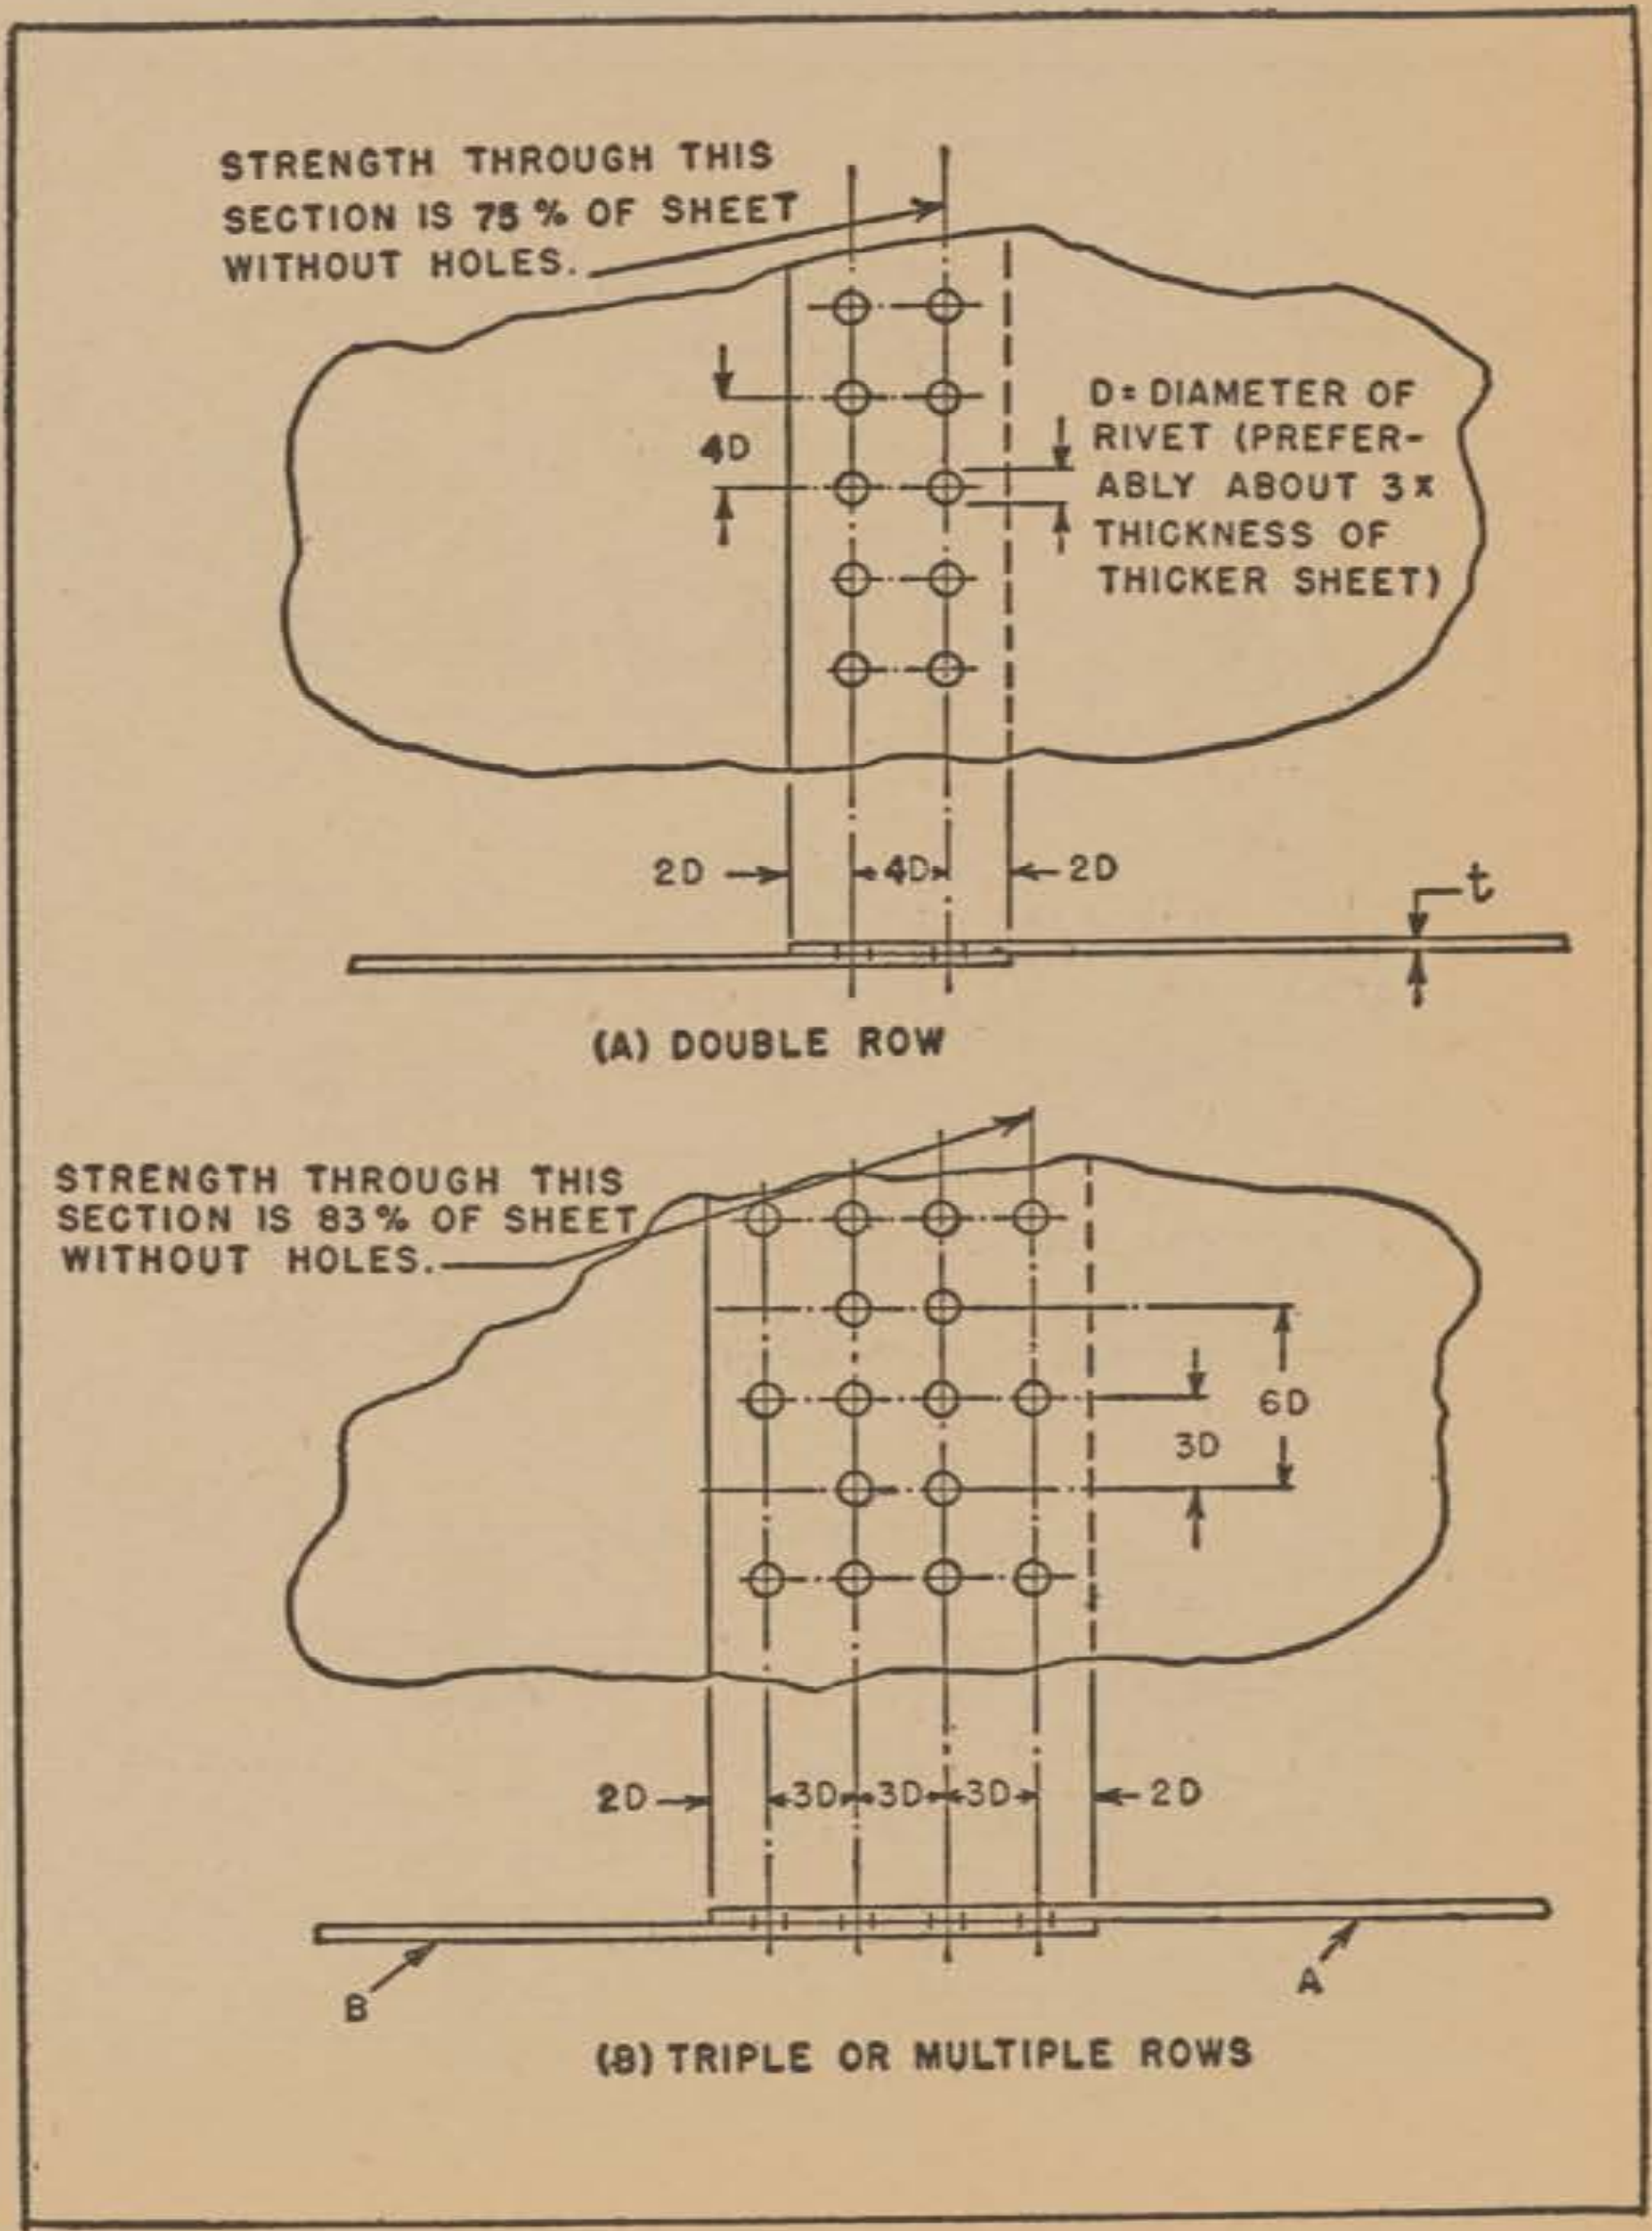
STRENGTH THROUGH THIS SECTION IS 75 % OF SHEET WITHOUT HOLES.
D = DIAMETER OF RIVET (PREFERABLY ABOUT 3 x THICKNESS OF THICKER SHEET)
4D
2D
4D
2D
t
(A) DOUBLE ROW
STRENGTH THROUGH THIS SECTION IS 83 % OF SHEET WITHOUT HOLES.
6D
3D
2D
3D
3D
3D
2D
B
A
(B) TRIPLE OR MULTIPLE ROWS

FIGURE 4-14—Rivet hole spacing and edge distance for single-lap sheet splices.

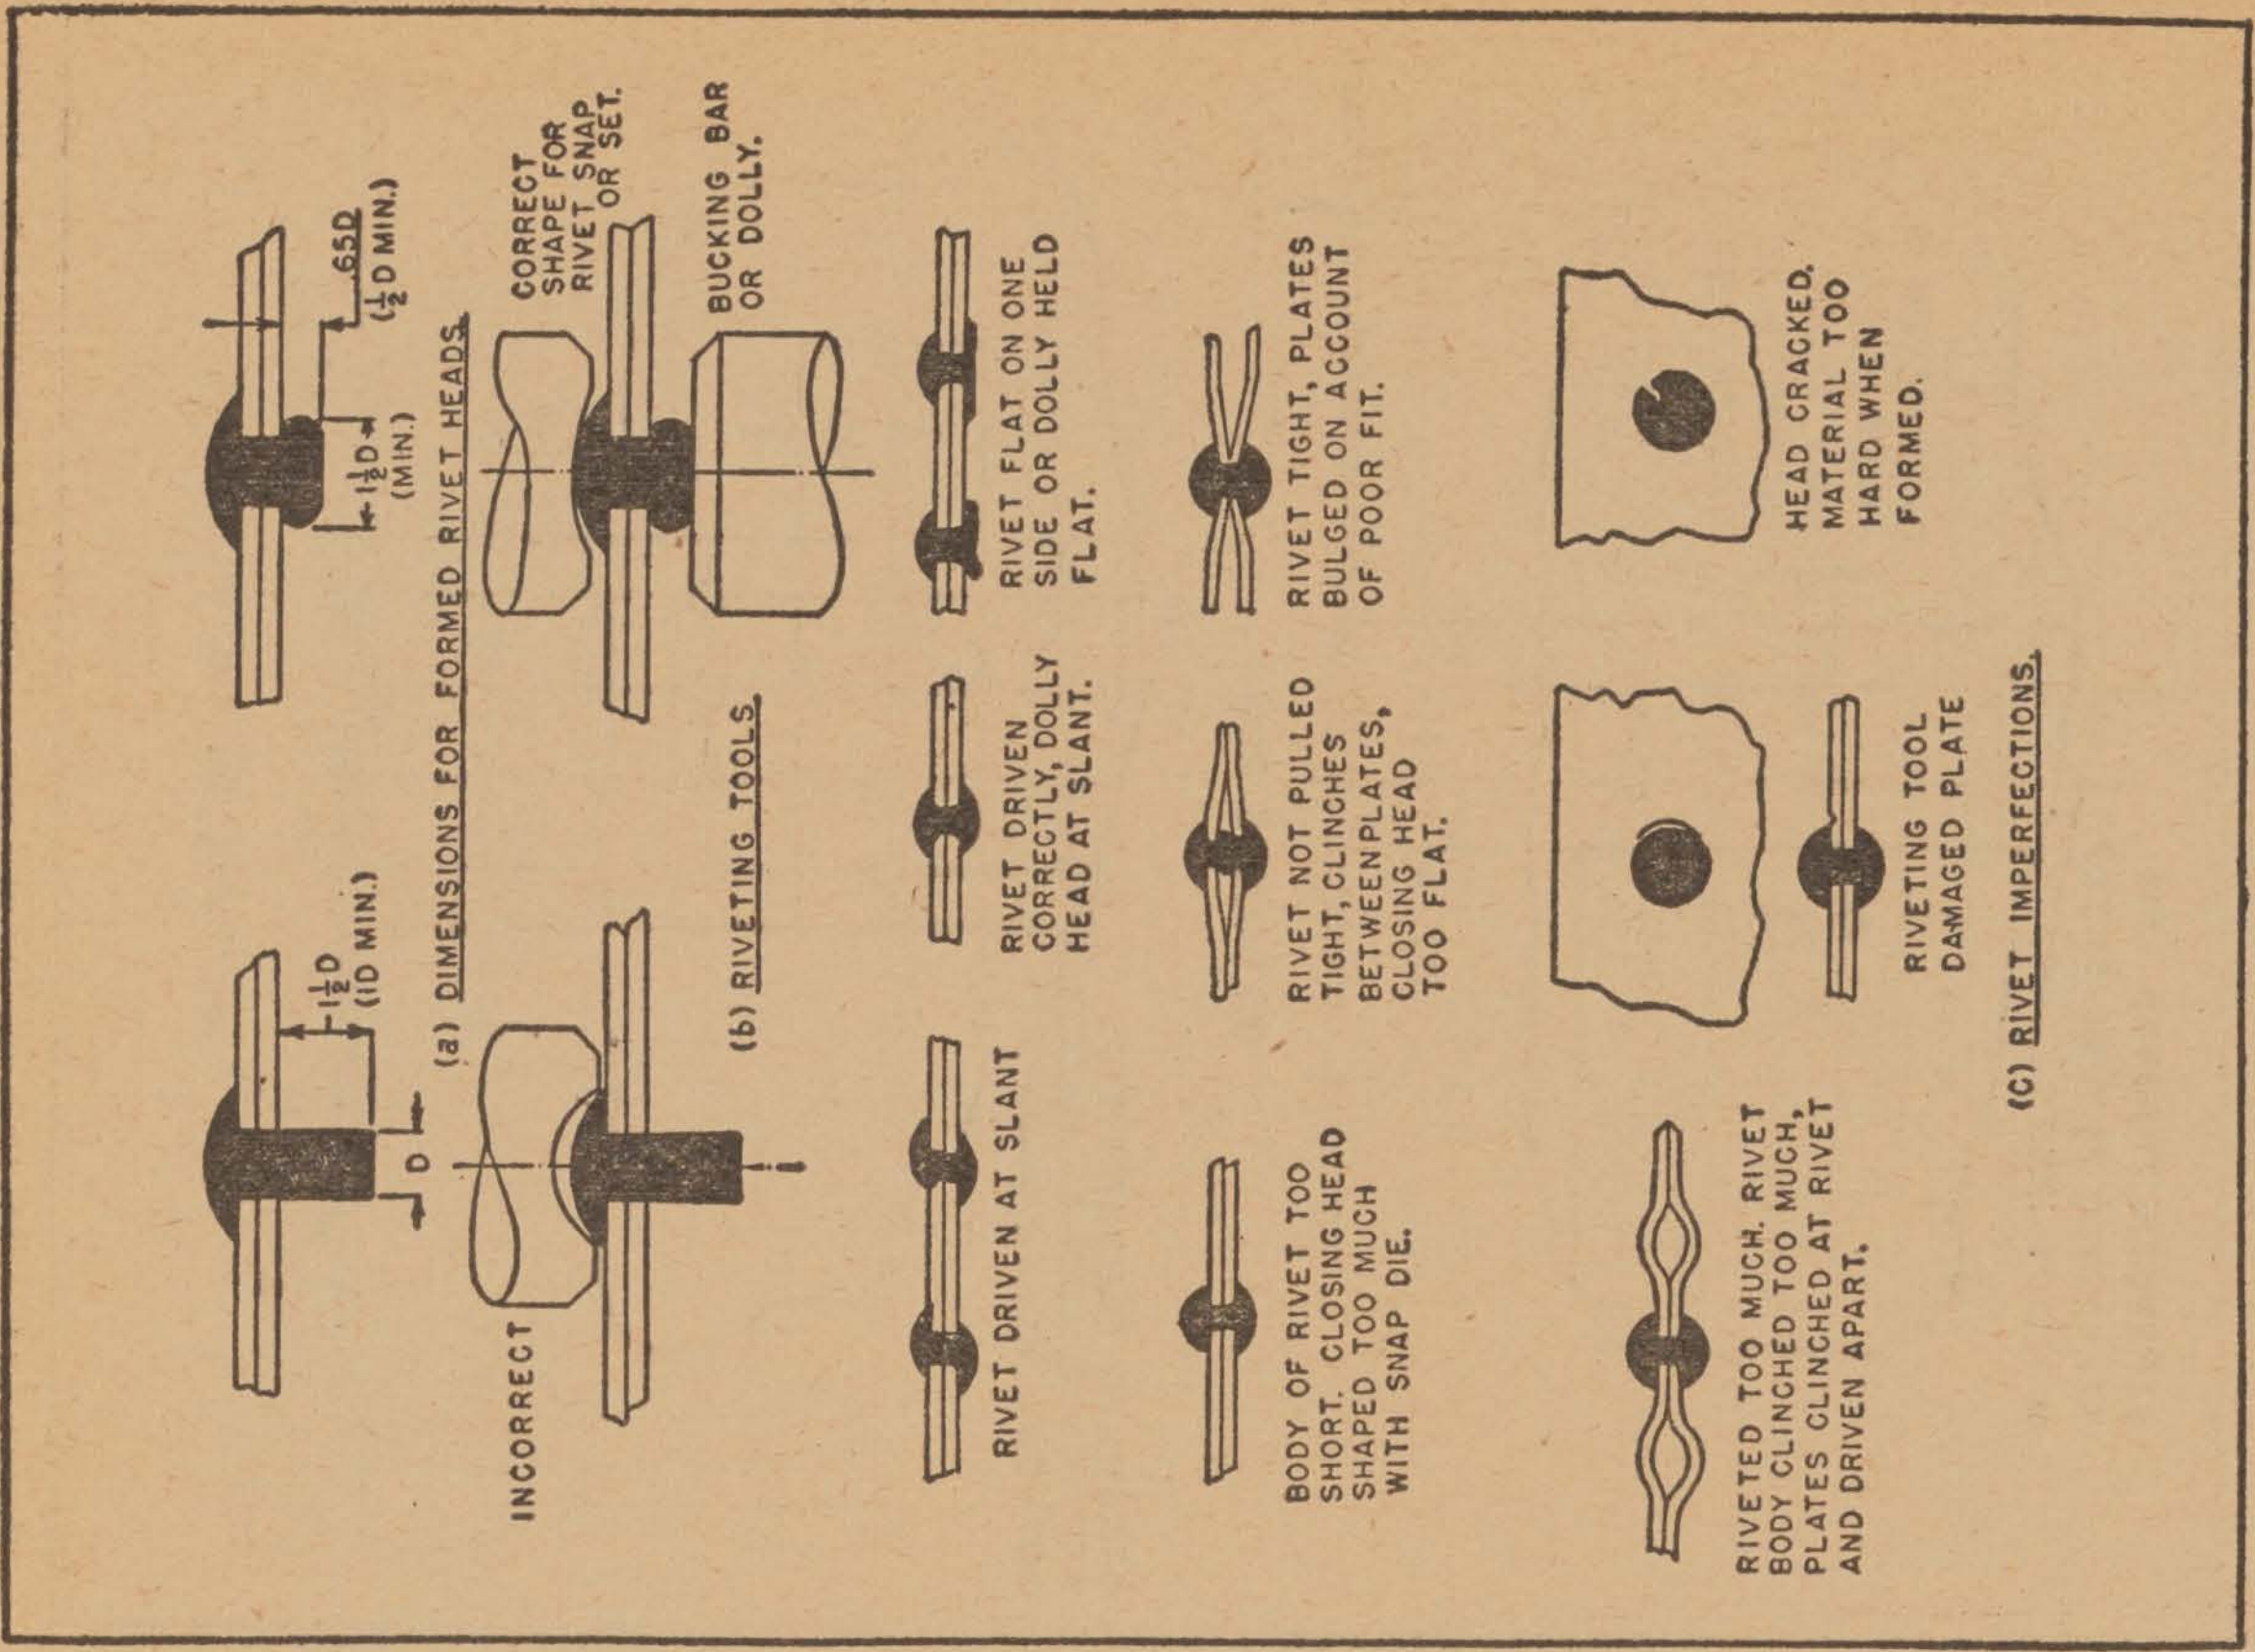
D
$1\frac{1}{2}$D (1D MIN.)
$1\frac{1}{2}$D (MIN.)
.65D ($\frac{1}{2}$D MIN.)
(a) DIMENSIONS FOR FORMED RIVET HEADS.
INCORRECT
CORRECT SHAPE FOR RIVET SNAP OR SET.
BUCKING BAR OR DOLLY.
(b) RIVETING TOOLS.
RIVET DRIVEN AT SLANT
RIVET DRIVEN CORRECTLY, DOLLY HEAD AT SLANT.
RIVET FLAT ON ONE SIDE OR DOLLY HELD FLAT.
BODY OF RIVET TOO SHORT. CLOSING HEAD SHAPED TOO MUCH WITH SNAP DIE.
RIVET NOT PULLED TIGHT, CLINCHES BETWEEN PLATES, CLOSING HEAD TOO FLAT.
RIVET TIGHT, PLATES BULGED ON ACCOUNT OF POOR FIT.
RIVETED TOO MUCH. RIVET BODY CLINCHED TOO MUCH, PLATES CLINCHED AT RIVET AND DRIVEN APART.
RIVETING TOOL DAMAGED PLATE
HEAD CRACKED. MATERIAL TOO HARD WHEN FORMED.
(C) RIVET IMPERFECTIONS.

FIGURE 4-15—Riveting practice and rivet imperfections.

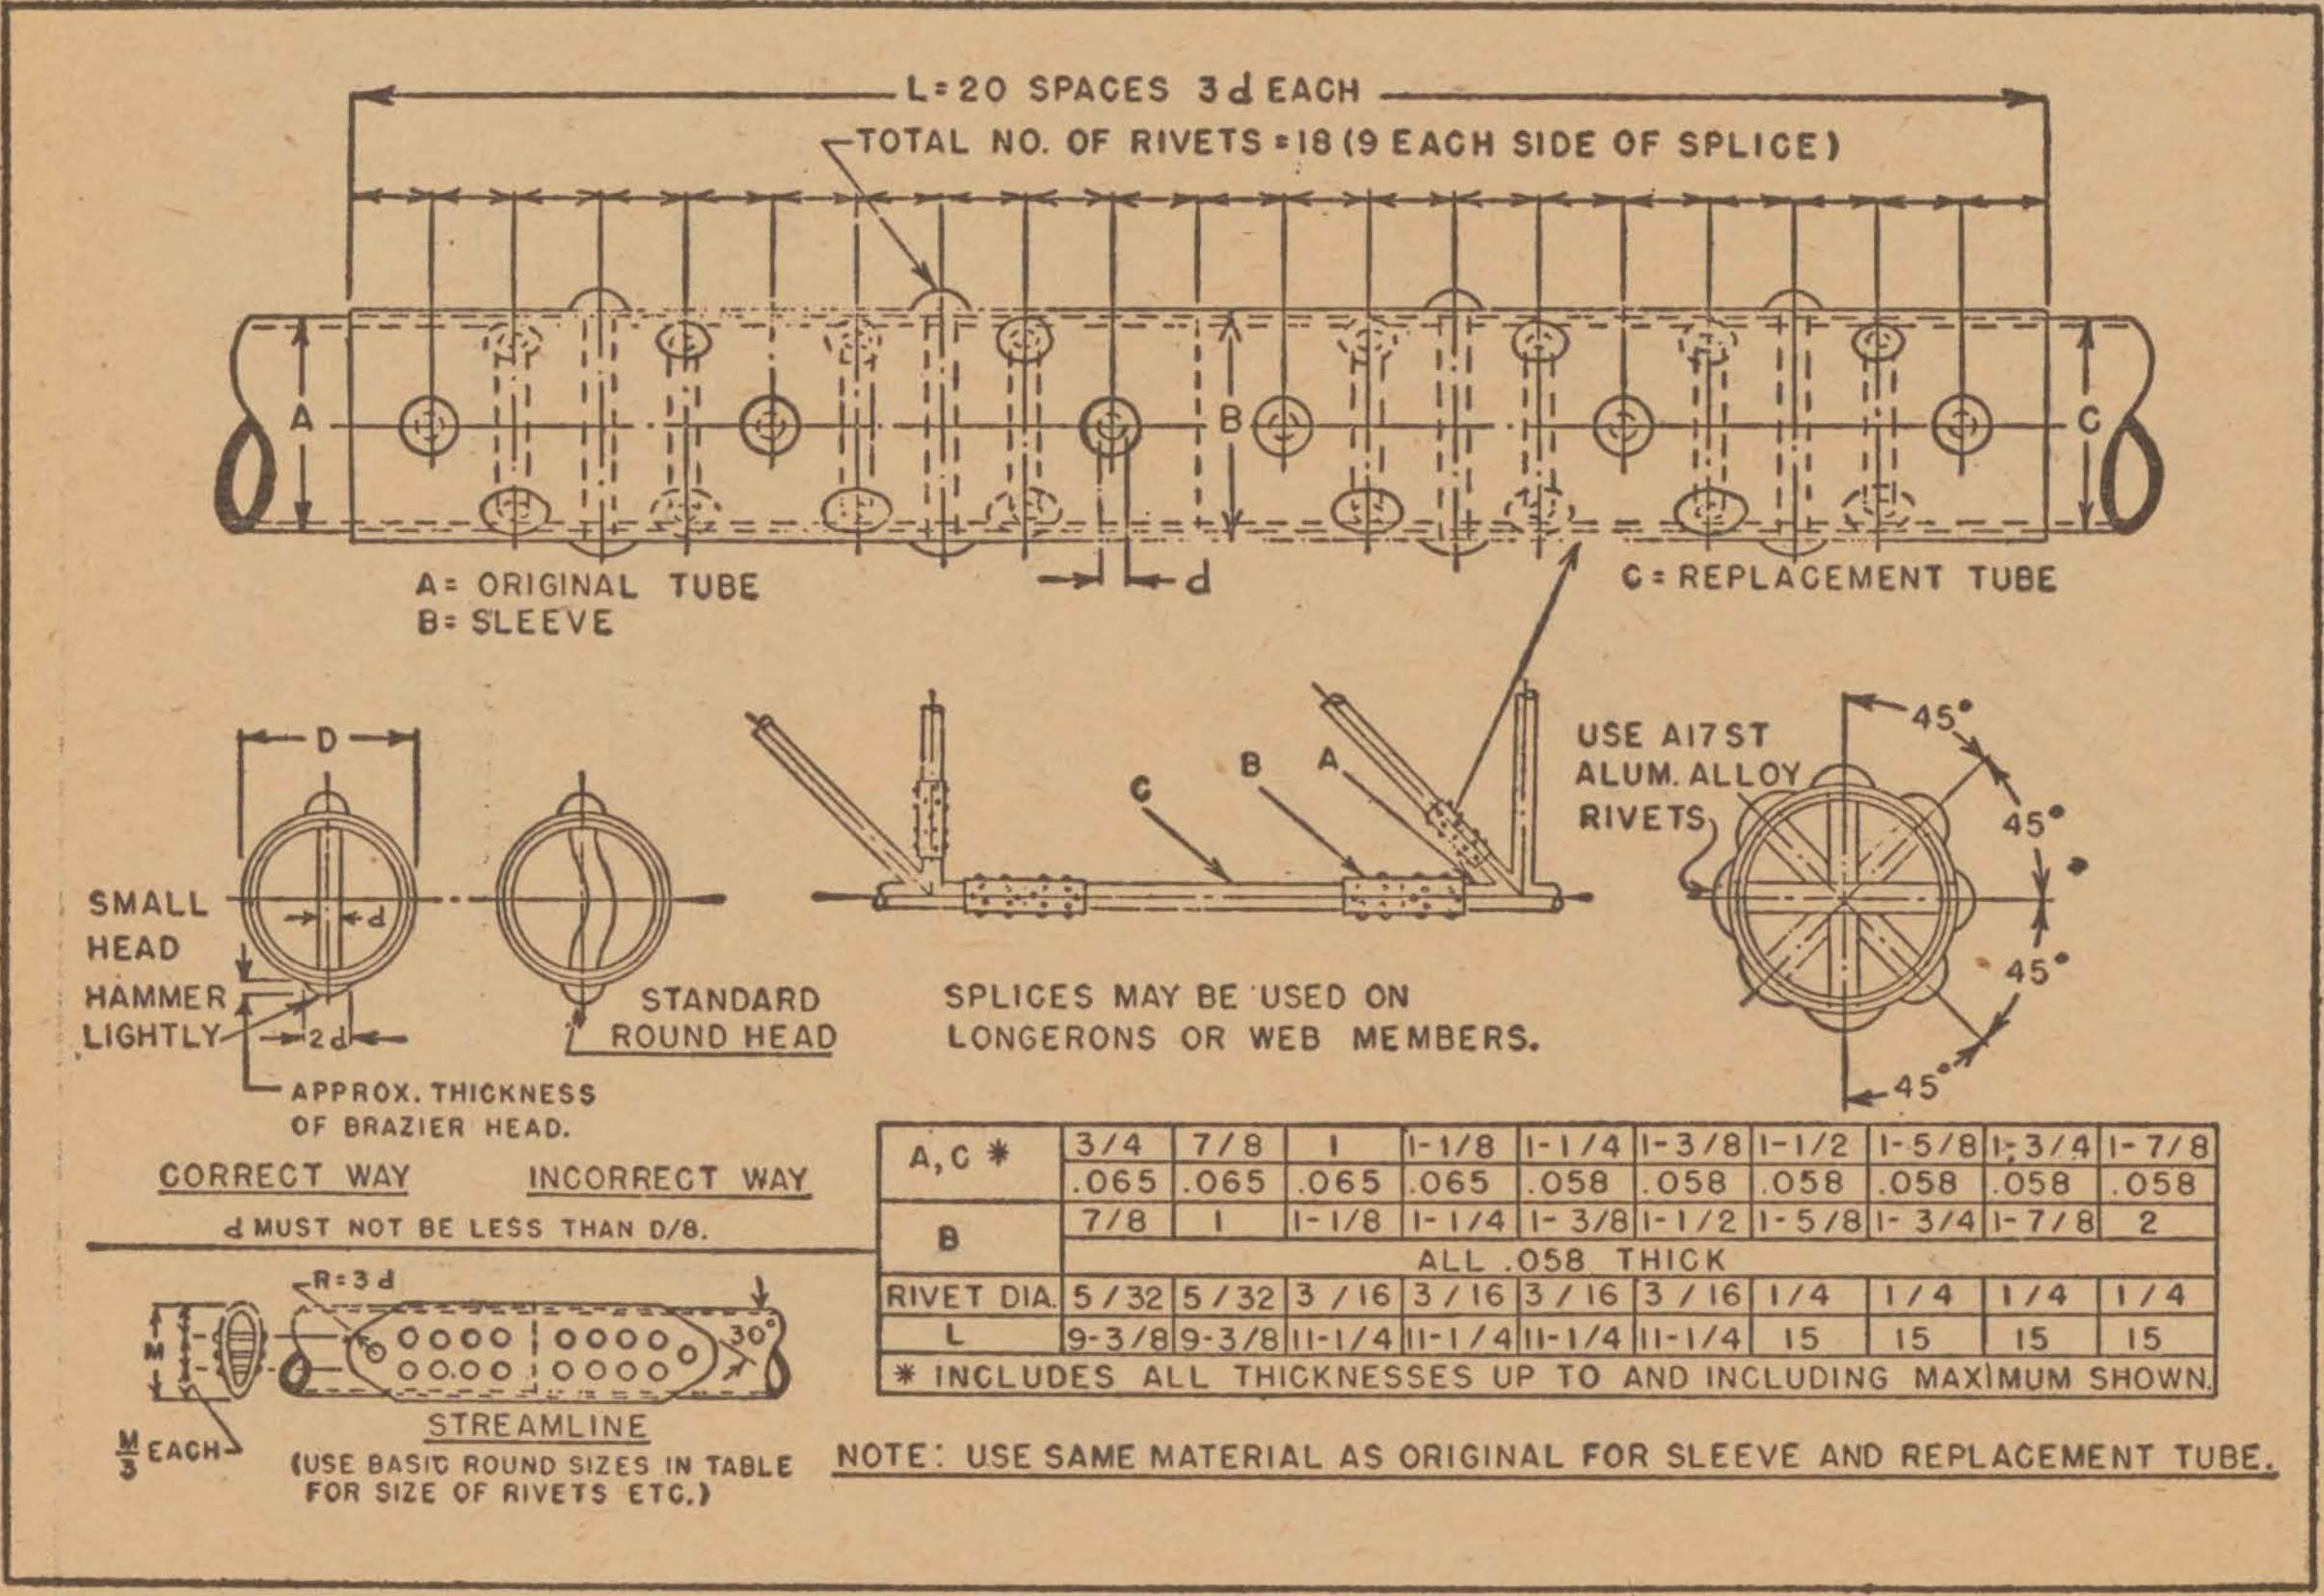
L=20 SPACES 3d EACH
TOTAL NO. OF RIVETS=18 (9 EACH SIDE OF SPLICE)
A
B
C
d
A= ORIGINAL TUBE
B= SLEEVE
C= REPLACEMENT TUBE
D
d
SMALL HEAD
HAMMER LIGHTLY
2d
APPROX. THICKNESS OF BRAZIER HEAD.
STANDARD ROUND HEAD
CORRECT WAY
INCORRECT WAY
d MUST NOT BE LESS THAN D/8.
C
B
A
SPLICES MAY BE USED ON LONGERONS OR WEB MEMBERS.
USE A17ST ALUM. ALLOY RIVETS
45°
45°
45°
45°
R=3d
30°
M
$\frac{M}{3}$ EACH
STREAMLINE
(USE BASIC ROUND SIZES IN TABLE FOR SIZE OF RIVETS ETC.)

| | | | | | | | | | | |
|---|---|---|---|---|---|---|---|---|---|---|
| A, C * | 3/4 | 7/8 | 1 | 1-1/8 | 1-1/4 | 1-3/8 | 1-1/2 | 1-5/8 | 1-3/4 | 1-7/8 |
| | .065 | .065 | .065 | .065 | .058 | .058 | .058 | .058 | .058 | .058 |
| B | 7/8 | 1 | 1-1/8 | 1-1/4 | 1-3/8 | 1-1/2 | 1-5/8 | 1-3/4 | 1-7/8 | 2 |
| | ALL .058 THICK | | | | | | | | | |
| RIVET DIA. | 5/32 | 5/32 | 3/16 | 3/16 | 3/16 | 3/16 | 1/4 | 1/4 | 1/4 | 1/4 |
| L | 9-3/8 | 9-3/8 | 11-1/4 | 11-1/4 | 11-1/4 | 11-1/4 | 15 | 15 | 15 | 15 |
| * INCLUDES ALL THICKNESSES UP TO AND INCLUDING MAXIMUM SHOWN. | | | | | | | | | | |

NOTE: USE SAME MATERIAL AS ORIGINAL FOR SLEEVE AND REPLACEMENT TUBE.

FIGURE 4-16—Typical repair method for tubular members of aluminum alloy.

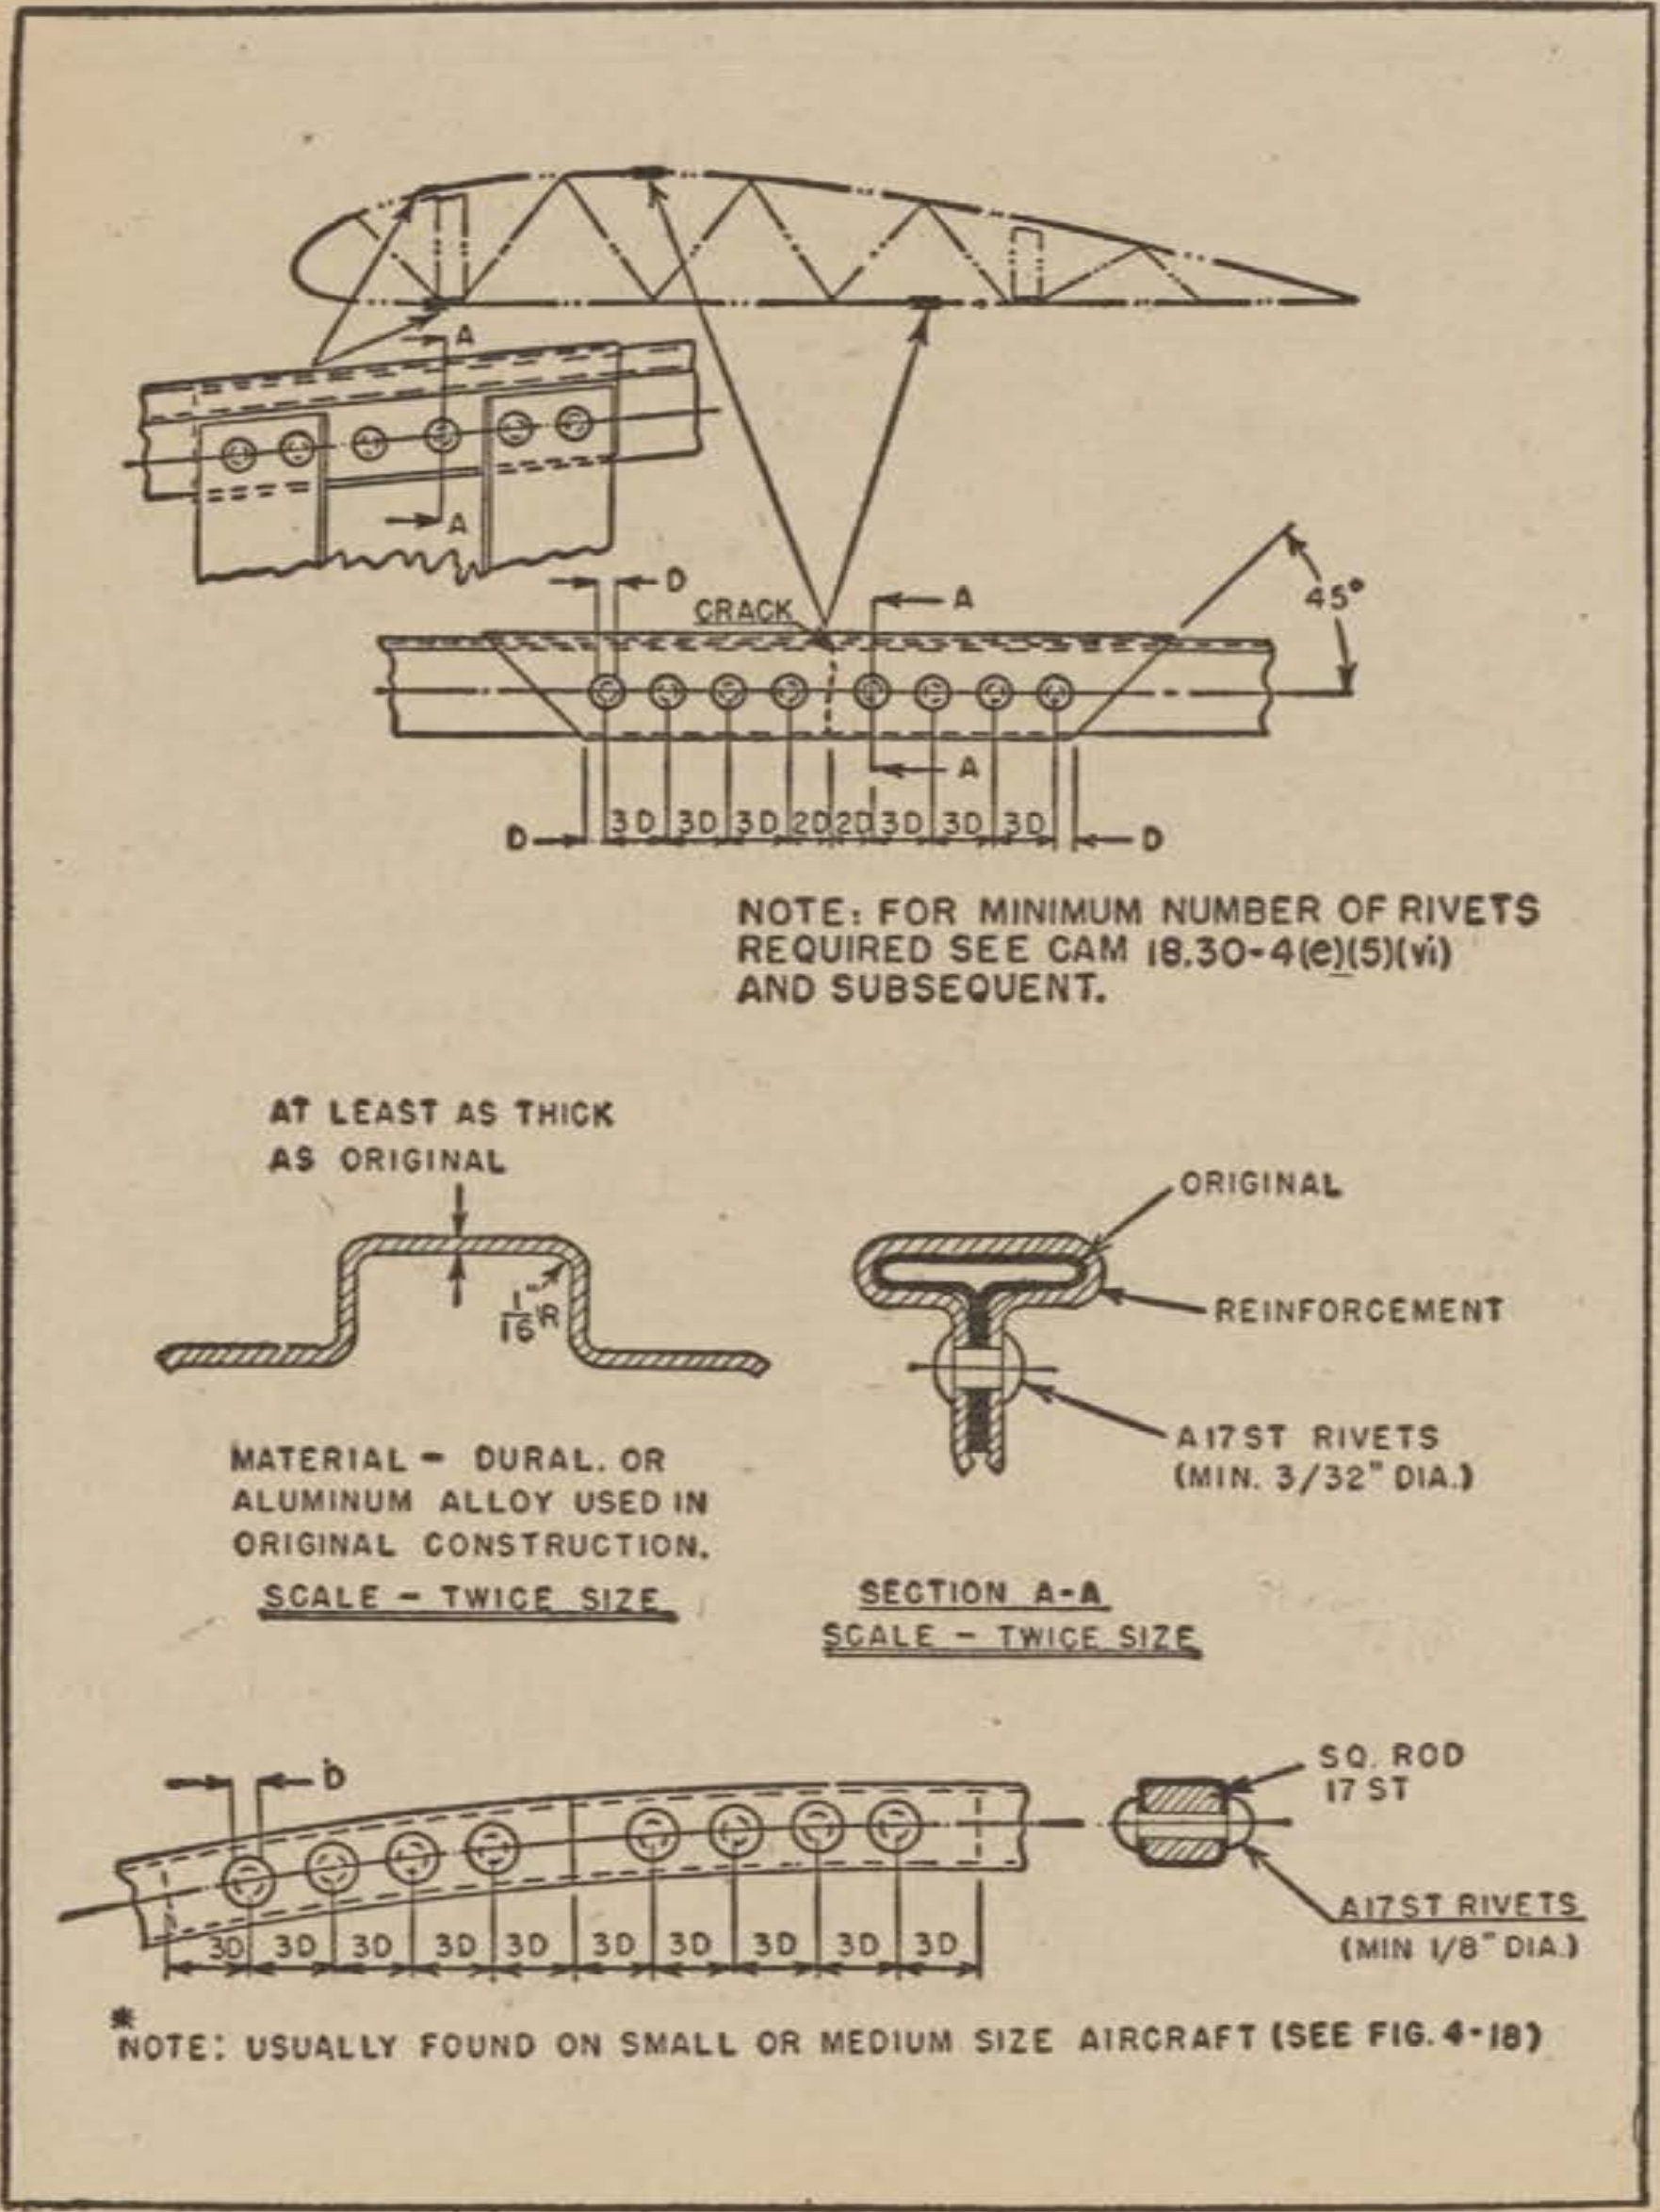
A
A
D
CRACK
A
45°
A
D
3D 3D 3D 2D 2D 3D 3D 3D
D
NOTE: FOR MINIMUM NUMBER OF RIVETS REQUIRED SEE CAM 18.30-4(e)(5)(vi) AND SUBSEQUENT.
AT LEAST AS THICK AS ORIGINAL
1/16" R
MATERIAL - DURAL. OR ALUMINUM ALLOY USED IN ORIGINAL CONSTRUCTION.
SCALE - TWICE SIZE
ORIGINAL
REINFORCEMENT
A17ST RIVETS (MIN. 3/32" DIA.)
SECTION A-A
SCALE - TWICE SIZE
b
SQ. ROD 17 ST
A17ST RIVETS (MIN 1/8" DIA.)
3D 3D 3D 3D 3D 3D 3D 3D 3D 3D
* NOTE: USUALLY FOUND ON SMALL OR MEDIUM SIZE AIRCRAFT (SEE FIG. 4-18)

FIGURE 4-17—Typical repair for buckled or cracked formed metal wing rib capstrips.

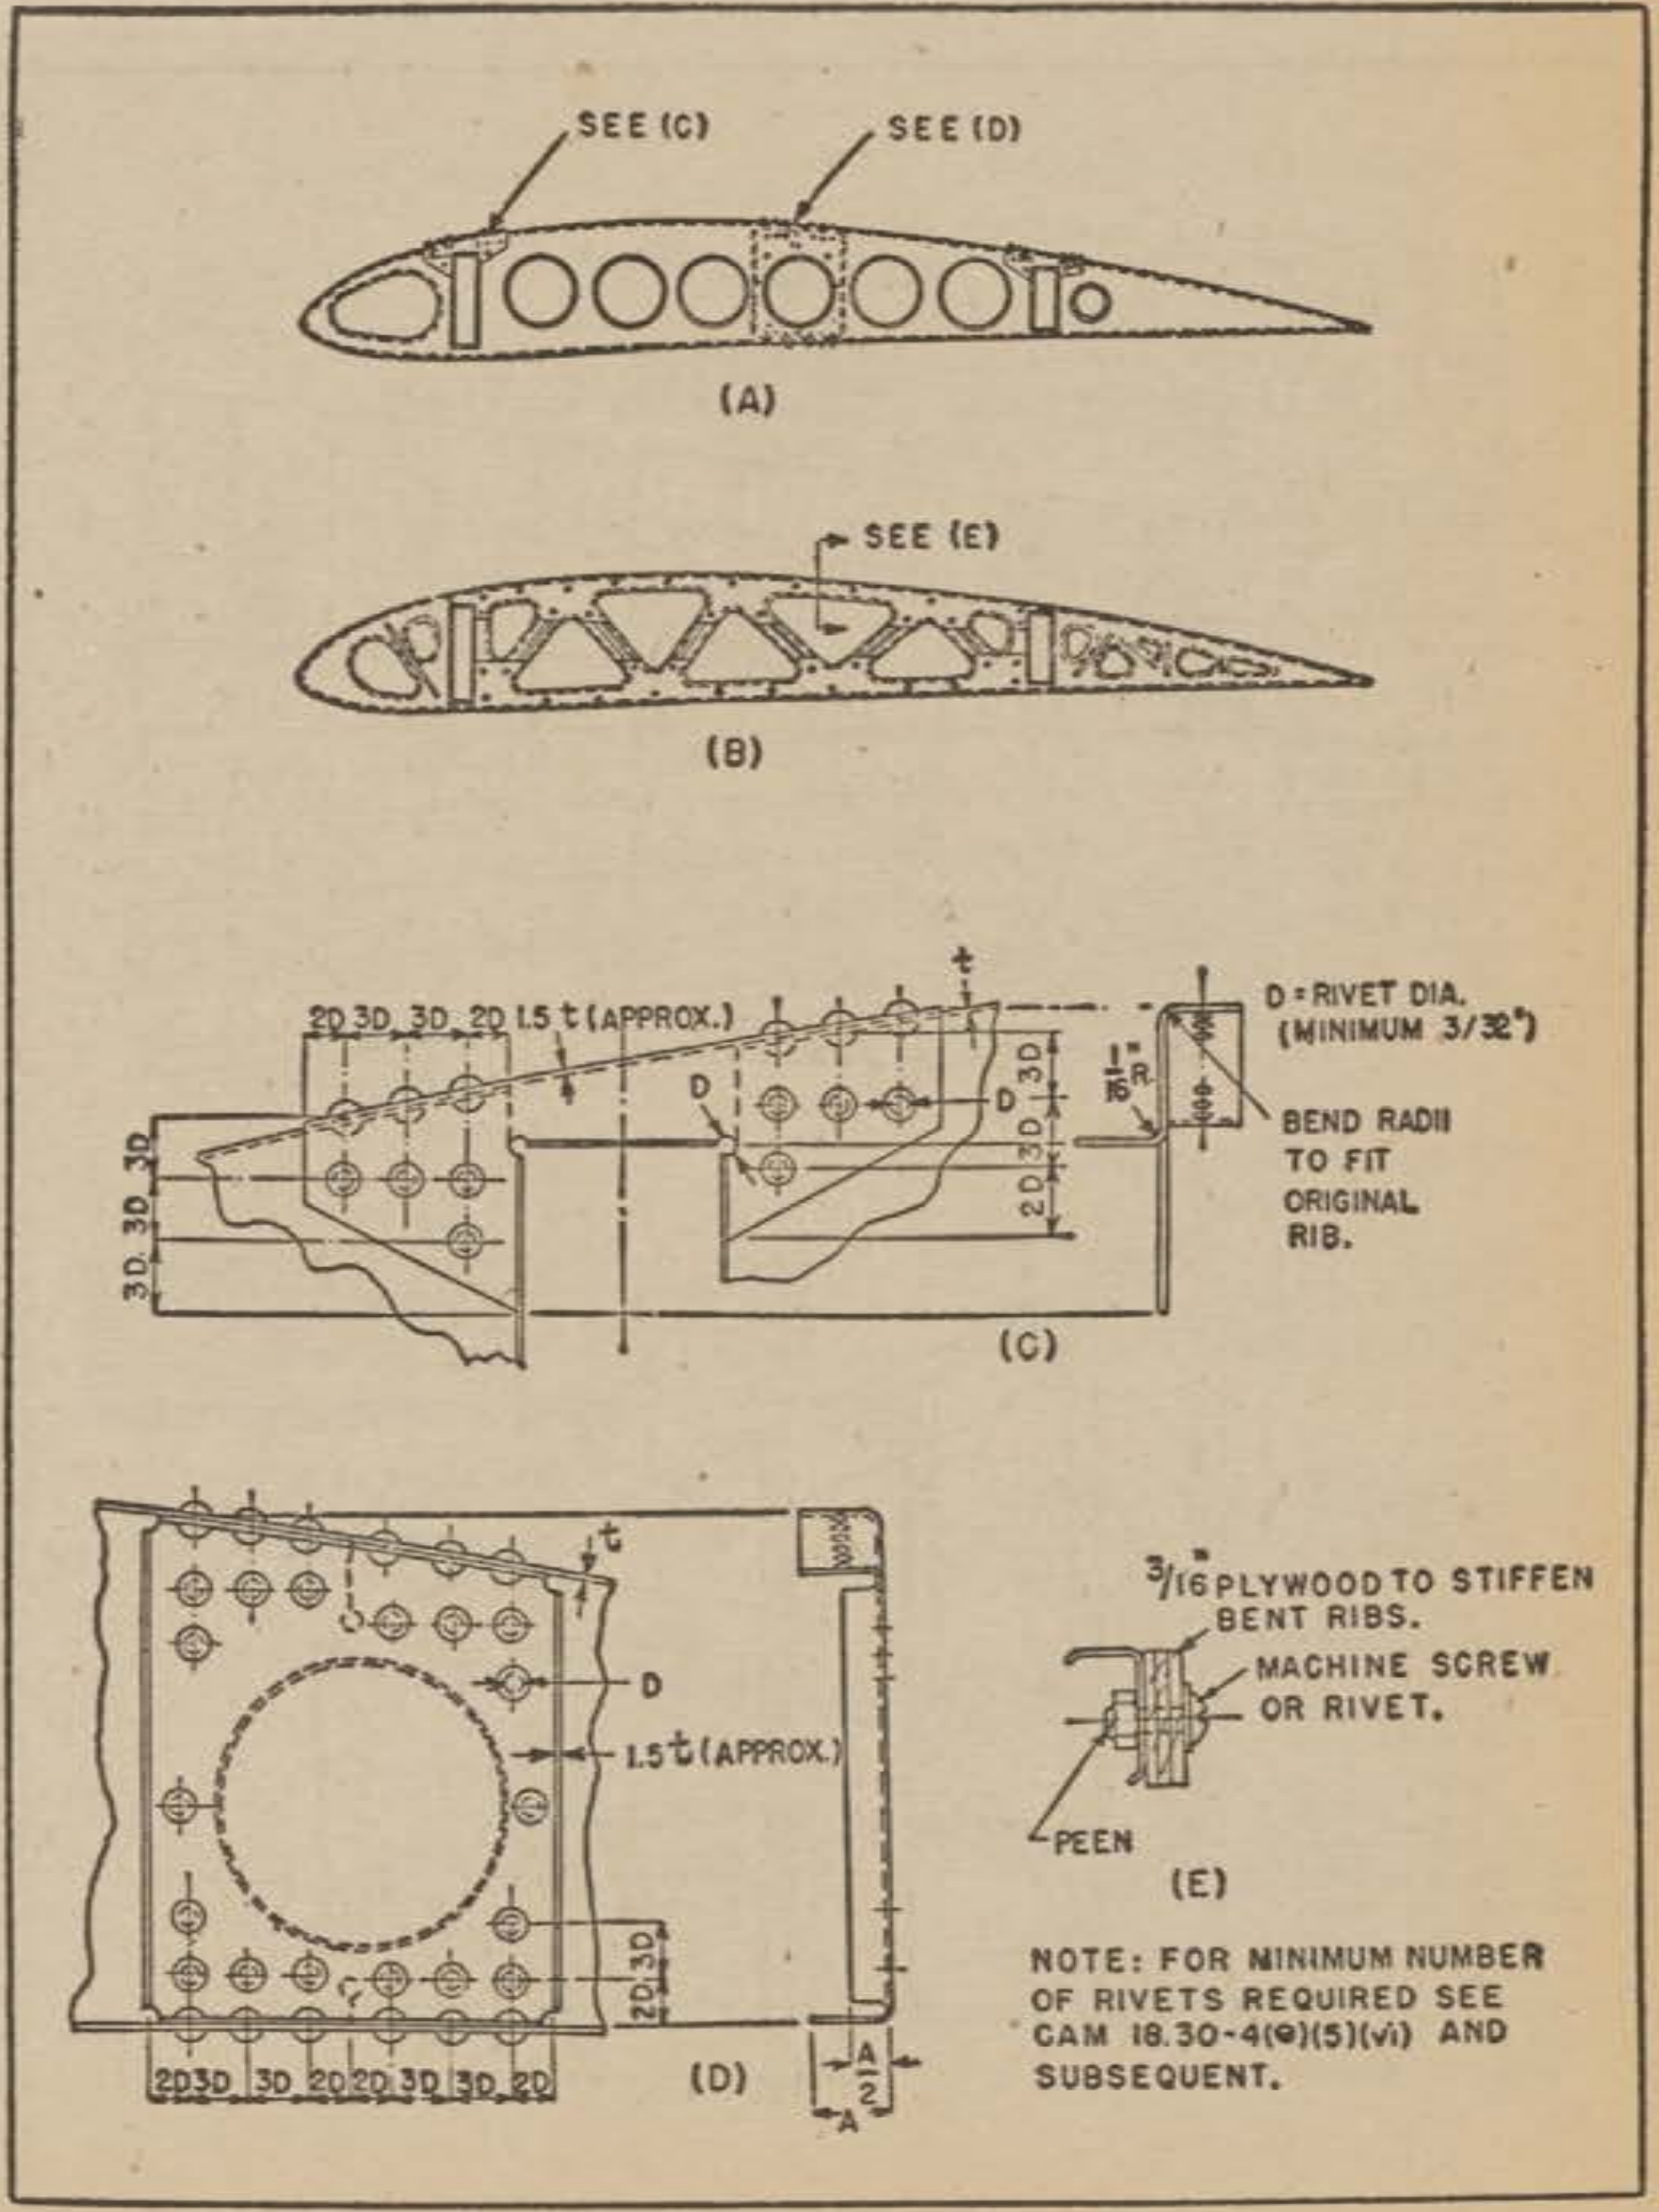
SEE (C)
SEE (D)
(A)
SEE (E)
(B)
2D 3D 3D 2D 1.5 t (APPROX.)
t
D
D
3D 3D 2D
3D 3D 3D
1/16" R
D = RIVET DIA. (MINIMUM 3/32")
BEND RADII TO FIT ORIGINAL RIB.
(C)
t
D
1.5 t (APPROX.)
2D 3D
2D 3D 3D 2D 2D 3D 3D 2D
(D)
A/2
A
3/16" PLYWOOD TO STIFFEN BENT RIBS.
MACHINE SCREW OR RIVET.
PEEN
(E)
NOTE: FOR MINIMUM NUMBER OF RIVETS REQUIRED SEE CAM 18.30-4(e)(5)(vi) AND SUBSEQUENT.

FIGURE 4-18—Typical metal rib repairs (usually found on small and medium-size aircraft).

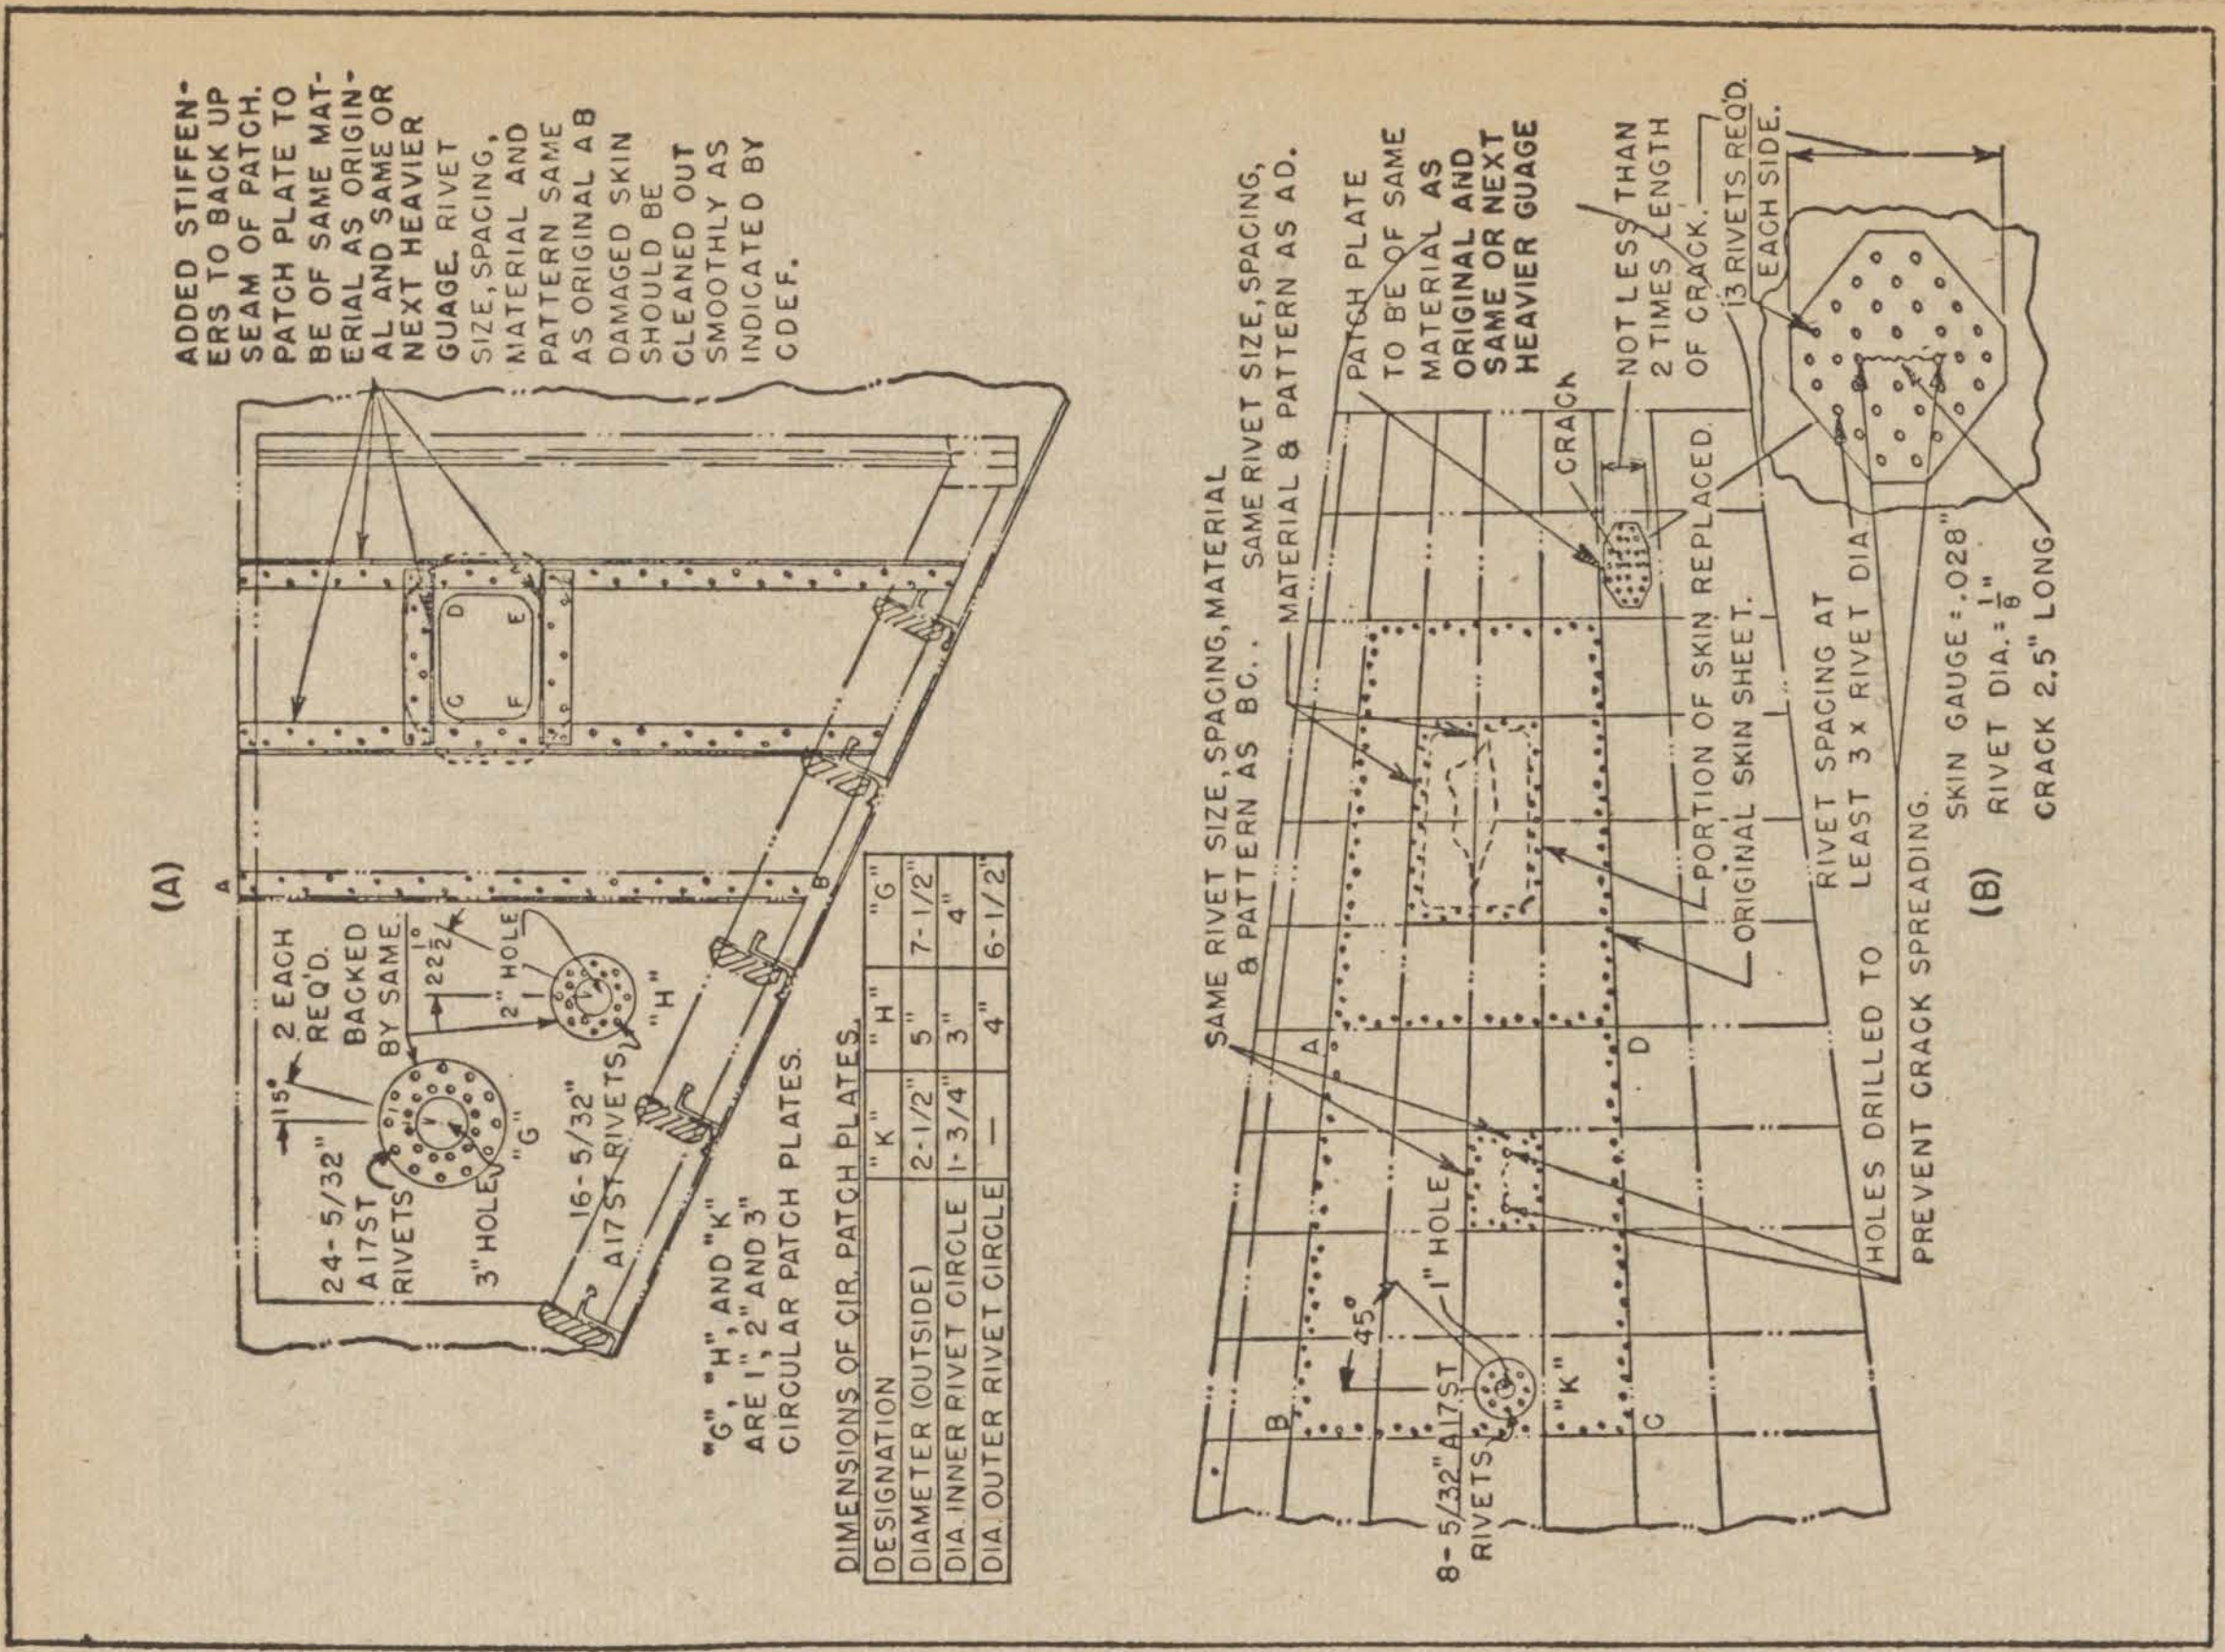
ADDED STIFFENERS TO BACK UP SEAM OF PATCH. PATCH PLATE TO BE OF SAME MATERIAL AS ORIGINAL AND SAME OR NEXT HEAVIER GUAGE. RIVET SIZE, SPACING, MATERIAL AND PATTERN SAME AS ORIGINAL AB DAMAGED SKIN SHOULD BE CLEANED OUT SMOOTHLY AS INDICATED BY CDEF.
(A)
A
B
C
D
E
F
24-5/32" A17ST RIVETS
15°
2 EACH REQ'D. BACKED BY SAME.
22½°
2" HOLE
3" HOLE
"G"
"H"
16-5/32" A17ST RIVETS
"G", "H", AND "K" ARE 1", 2" AND 3" CIRCULAR PATCH PLATES.
SAME RIVET SIZE, SPACING, MATERIAL & PATTERN AS BC.
SAME RIVET SIZE, SPACING, MATERIAL & PATTERN AS AD.
PATCH PLATE TO BE OF SAME MATERIAL AS ORIGINAL AND SAME OR NEXT HEAVIER GUAGE
CRACK
NOT LESS THAN 2 TIMES LENGTH OF CRACK.
3 RIVETS REQD. EACH SIDE.
PORTION OF SKIN REPLACED.
ORIGINAL SKIN SHEET.
RIVET SPACING AT LEAST 3 x RIVET DIA.
HOLES DRILLED TO PREVENT CRACK SPREADING.
SKIN GAUGE = .028"
RIVET DIA. = 1/8"
CRACK 2.5" LONG
8-5/32" A17ST RIVETS
1" HOLE
45°
"K"
(B)

DIMENSIONS OF CIR. PATCH PLATES.

| DESIGNATION | "K" | "H" | "G" |
|---|---|---|---|
| DIAMETER (OUTSIDE) | 2-1/2" | 5" | 7-1/2" |
| DIA. INNER RIVET CIRCLE | 1-3/4" | 3" | 4" |
| DIA. OUTER RIVET CIRCLE | — | 4" | 6-1/2" |

FIGURE 4-20—Typical repairs of stressed sheet covering.

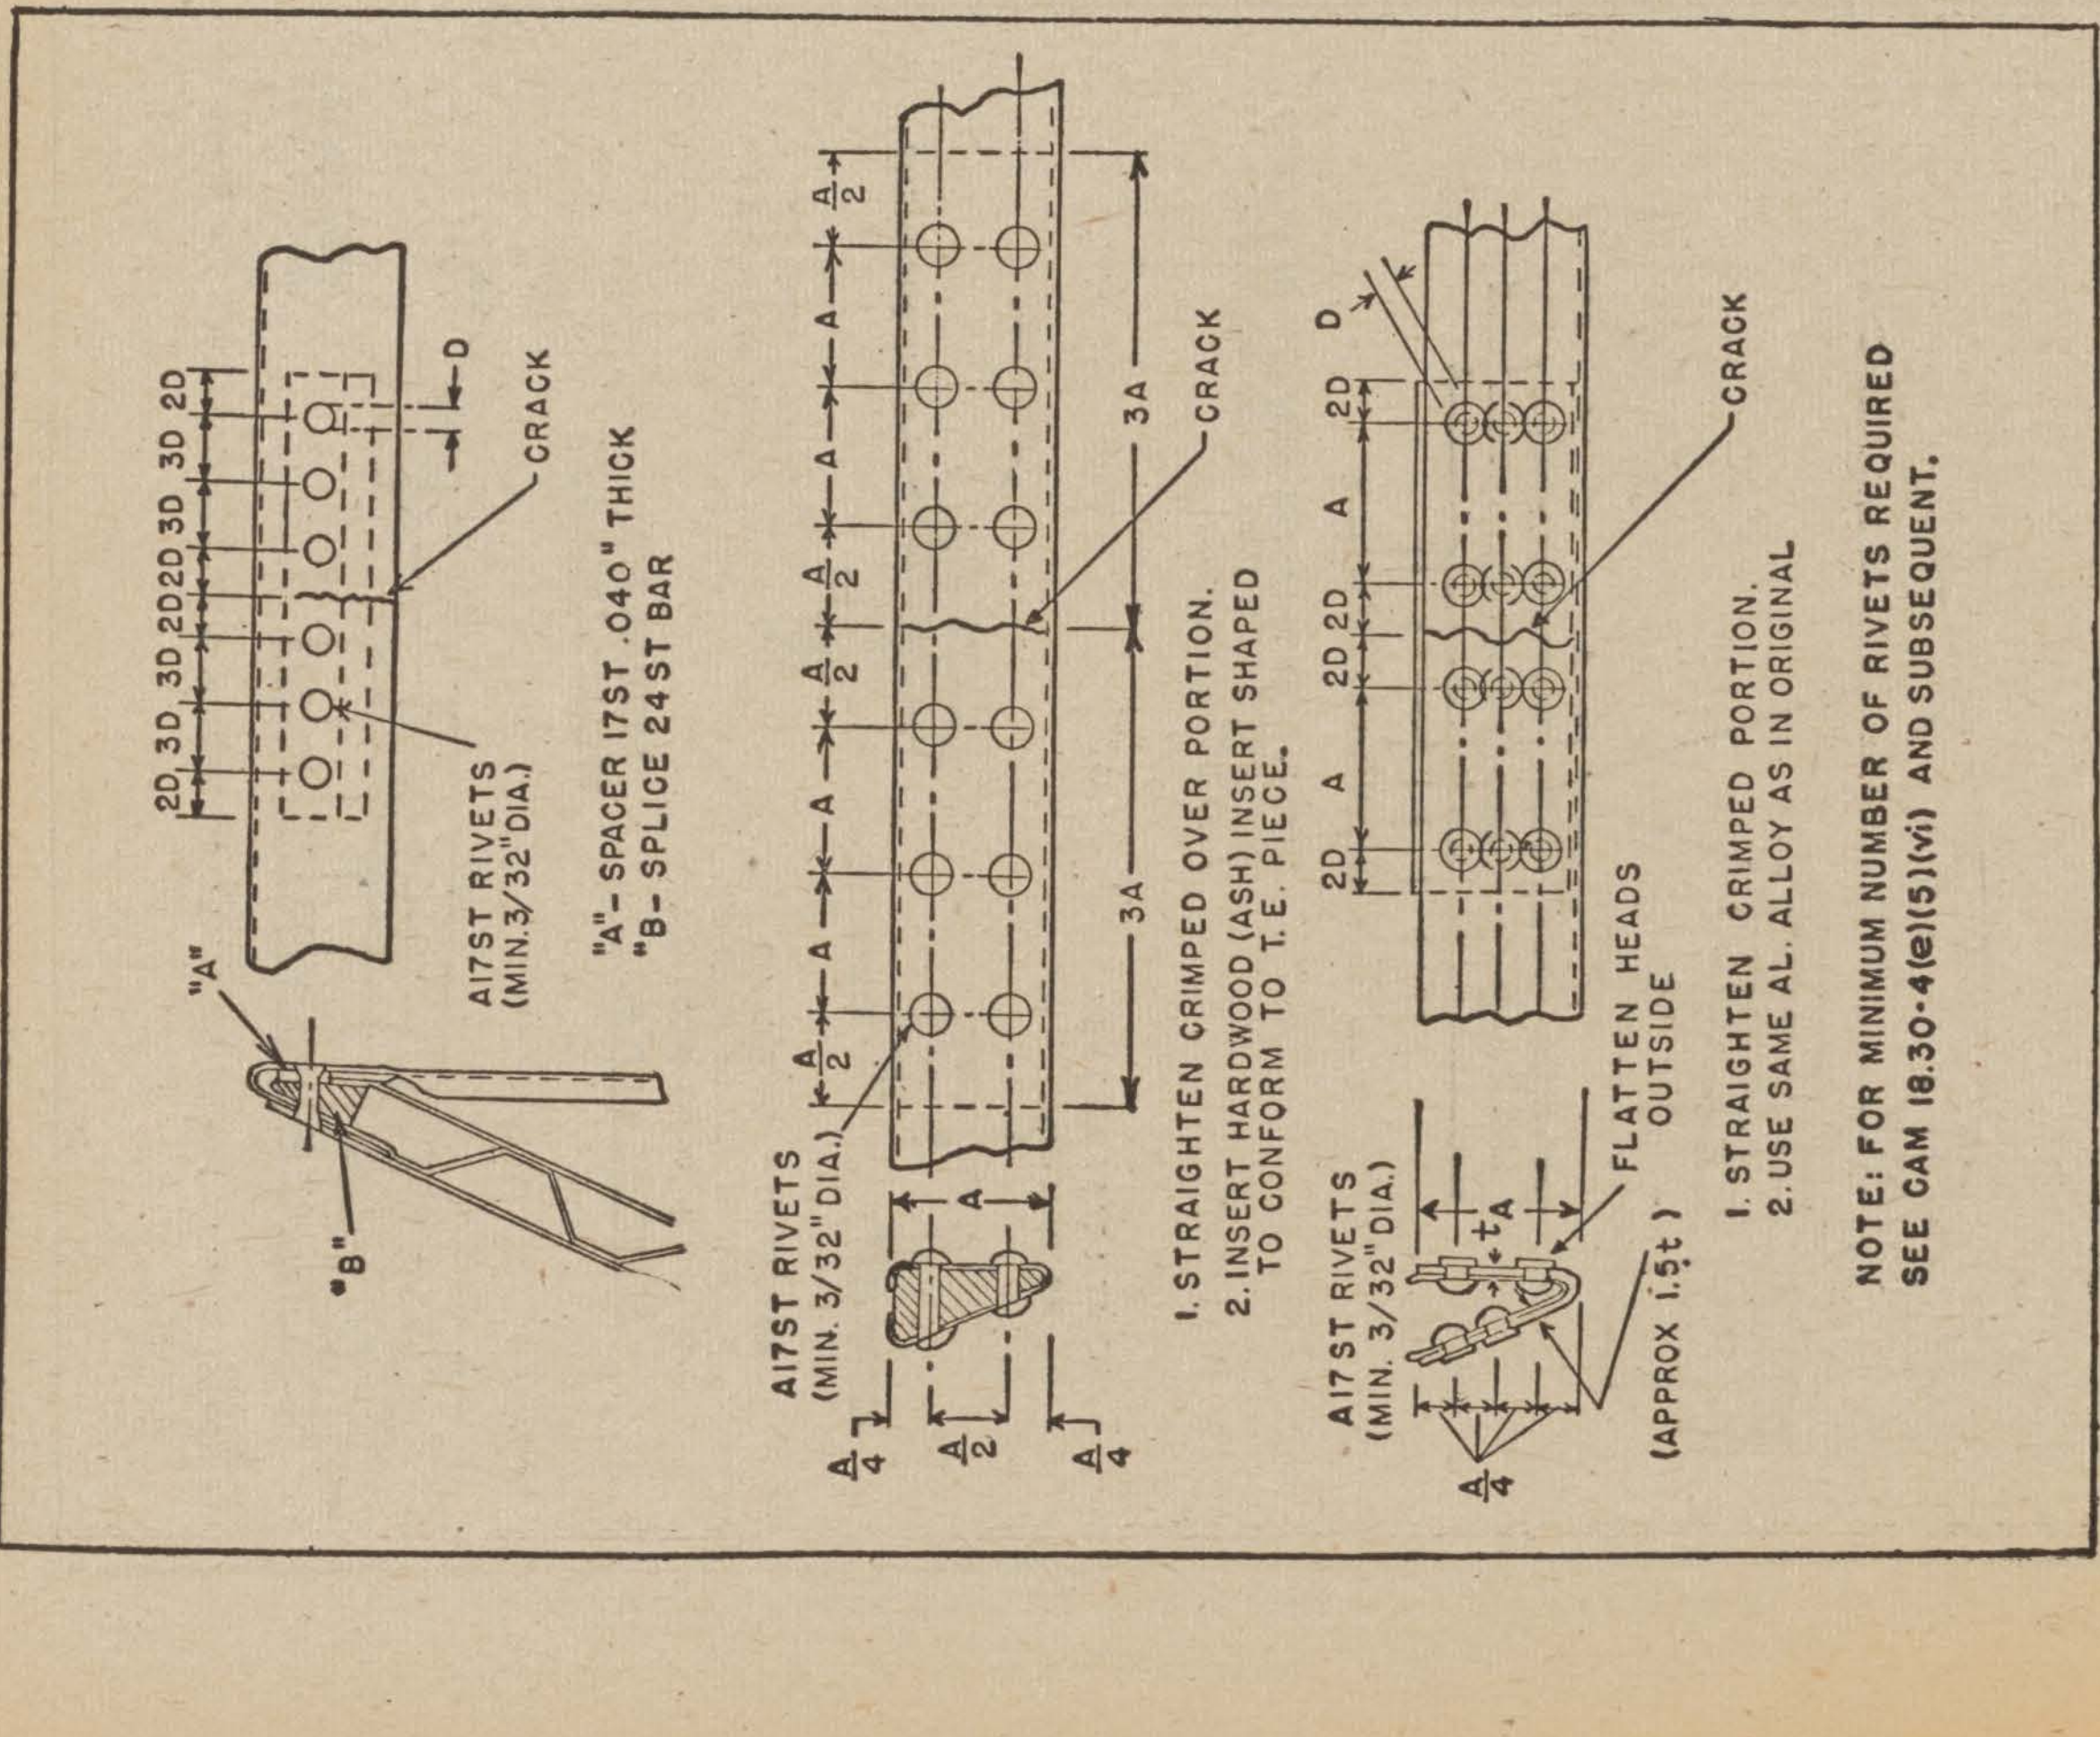
"A"
"B"
A17ST RIVETS (MIN. 3/32" DIA.)
2D 3D 3D 2D 2D 3D 3D 2D
D
CRACK
"A"- SPACER 17ST .040" THICK
"B"- SPLICE 24 ST BAR
A17ST RIVETS (MIN. 3/32" DIA.)
A/4
A/2
A/4
A
A/2 A A A/2 A/2 A A A/2
3A
3A
CRACK
1. STRAIGHTEN CRIMPED OVER PORTION.
2. INSERT HARDWOOD (ASH) INSERT SHAPED TO CONFORM TO T.E. PIECE.
A17ST RIVETS (MIN. 3/32" DIA.)
A/4
FLATTEN HEADS OUTSIDE
t_A
(APPROX 1.5t)
2D A 2D 2D A 2D
D
CRACK
1. STRAIGHTEN CRIMPED PORTION.
2. USE SAME AL. ALLOY AS IN ORIGINAL
NOTE: FOR MINIMUM NUMBER OF RIVETS REQUIRED SEE CAM 18.30-4(e)(5)(vi) AND SUBSEQUENT.

FIGURE 4-19—Typical repairs of trailing edges.

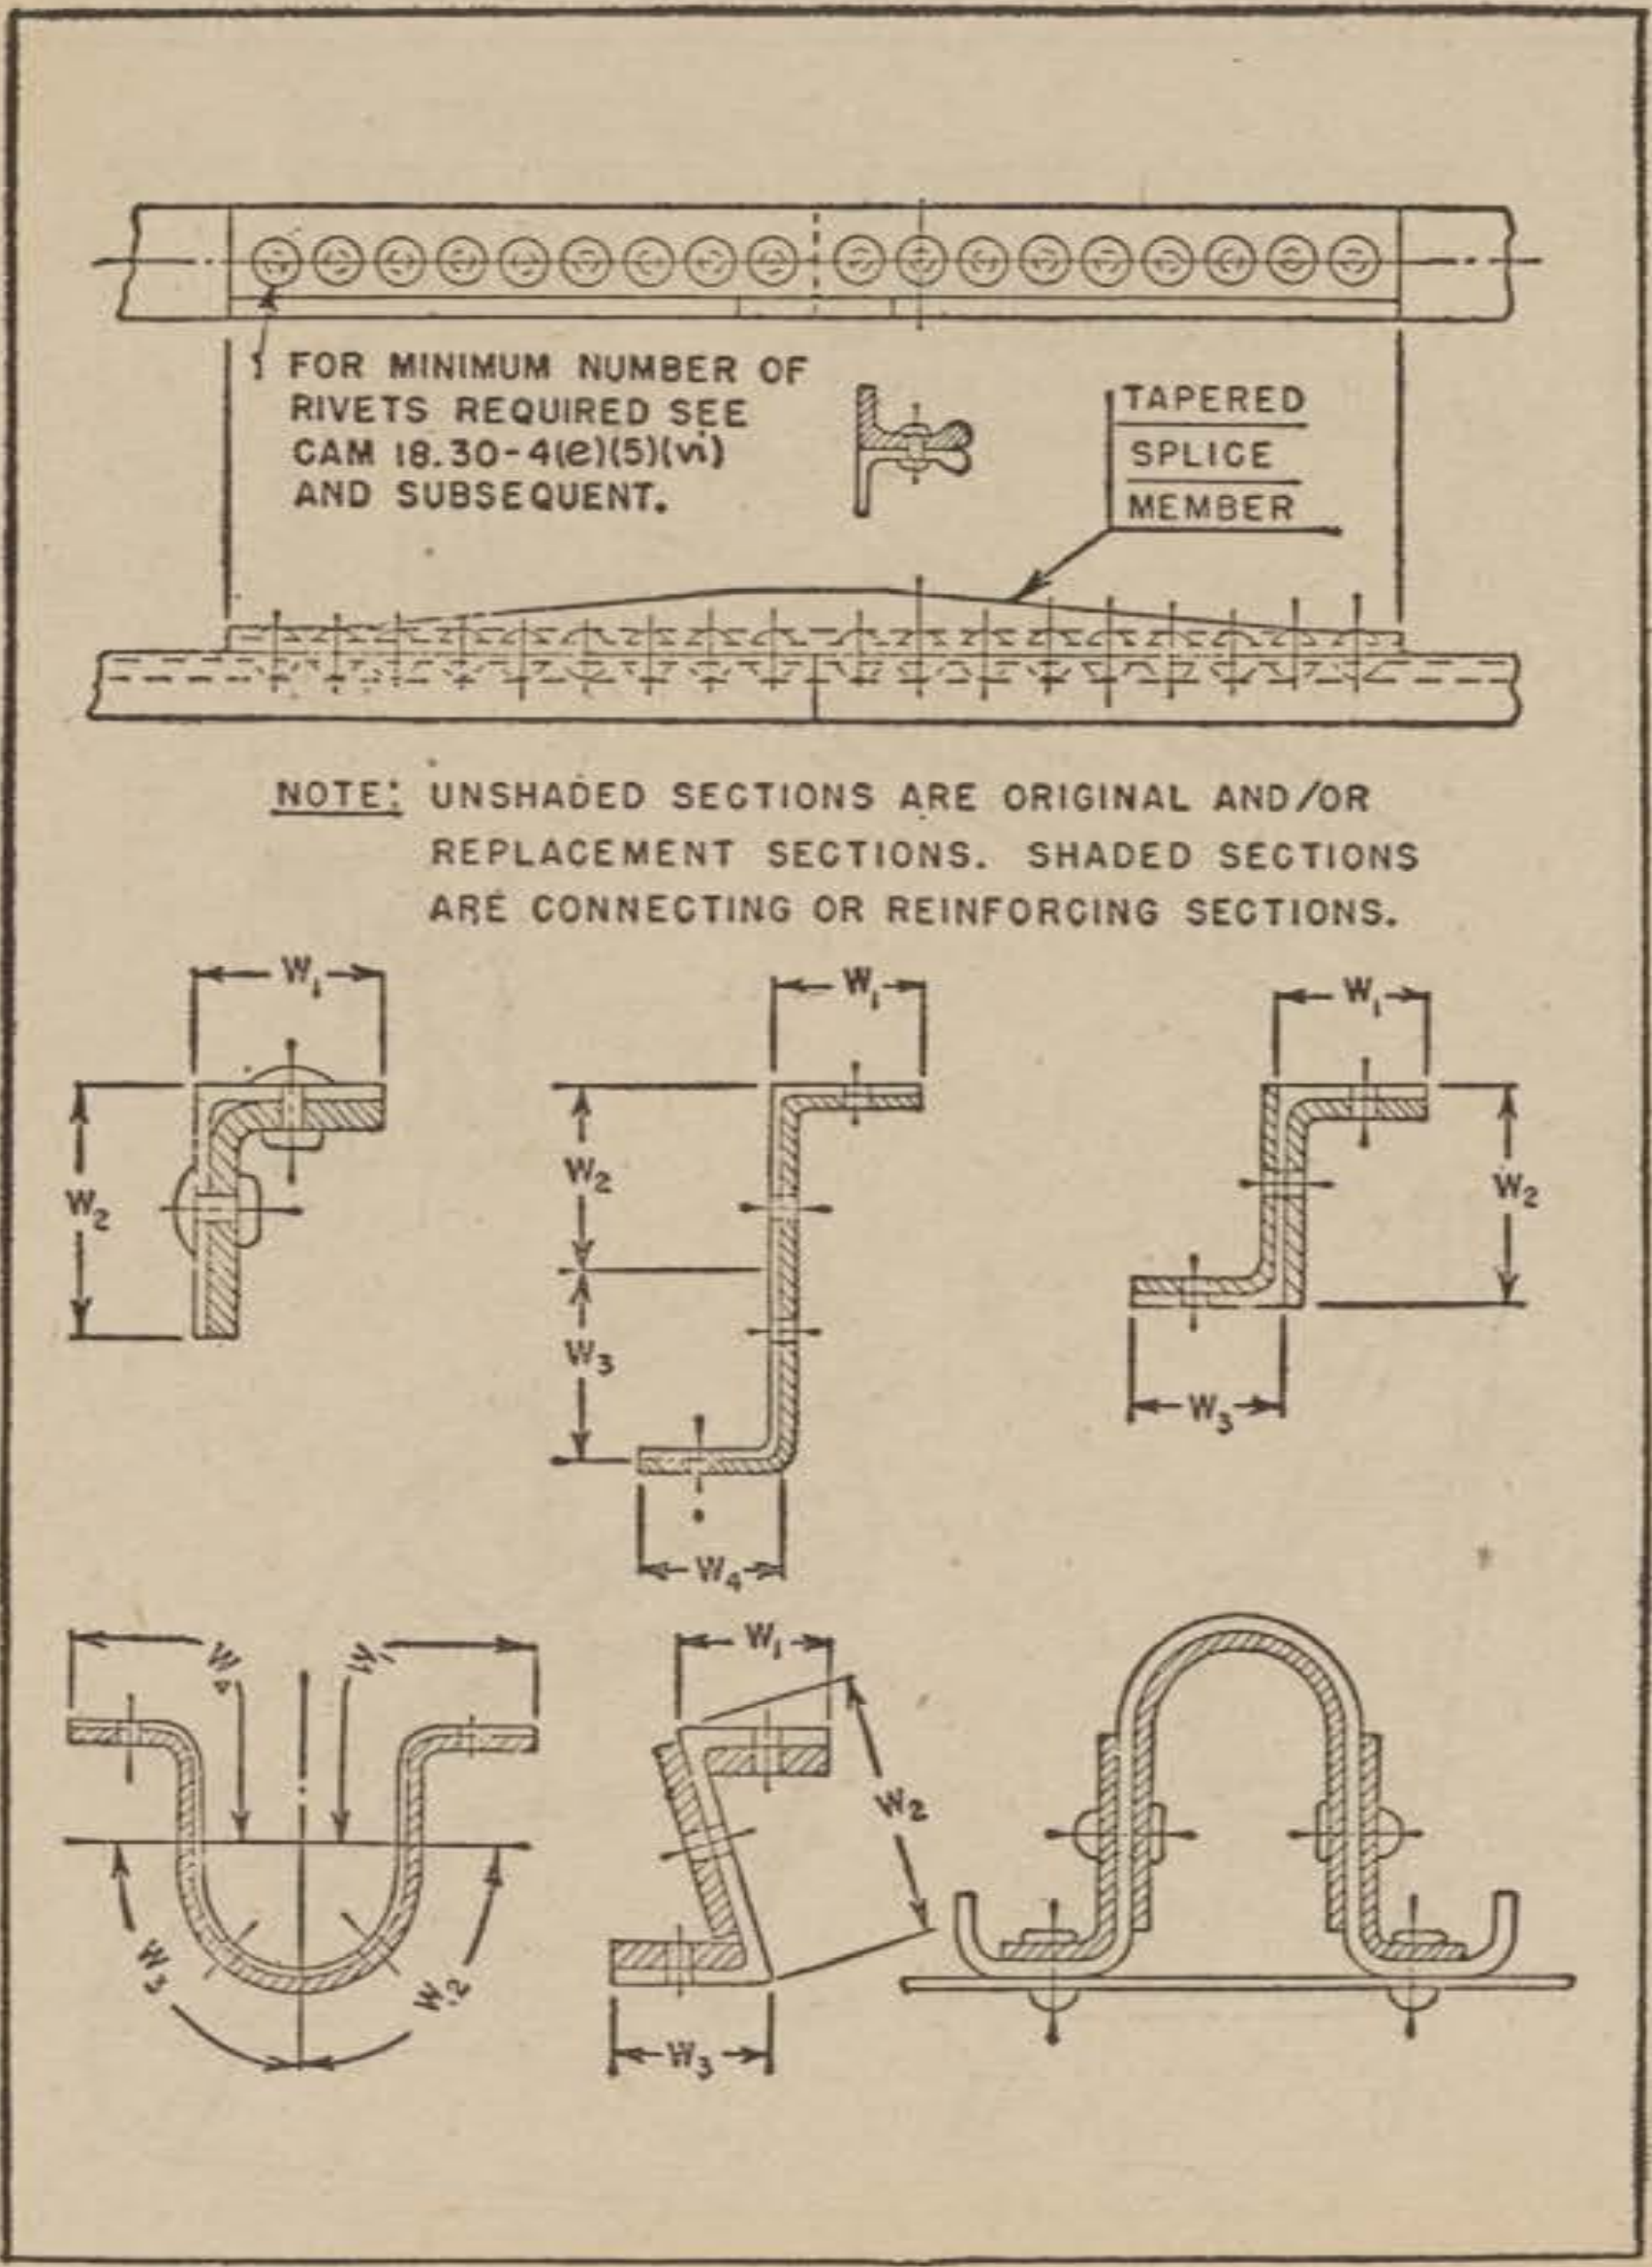

FOR MINIMUM NUMBER OF RIVETS REQUIRED SEE CAM 18.30-4(e)(5)(vi) AND SUBSEQUENT.

NOTE: UNSHADED SECTIONS ARE ORIGINAL AND/OR REPLACEMENT SECTIONS. SHADED SECTIONS ARE CONNECTING OR REINFORCING SECTIONS.

FIGURE 4-21—Typical stringer and flange splices.

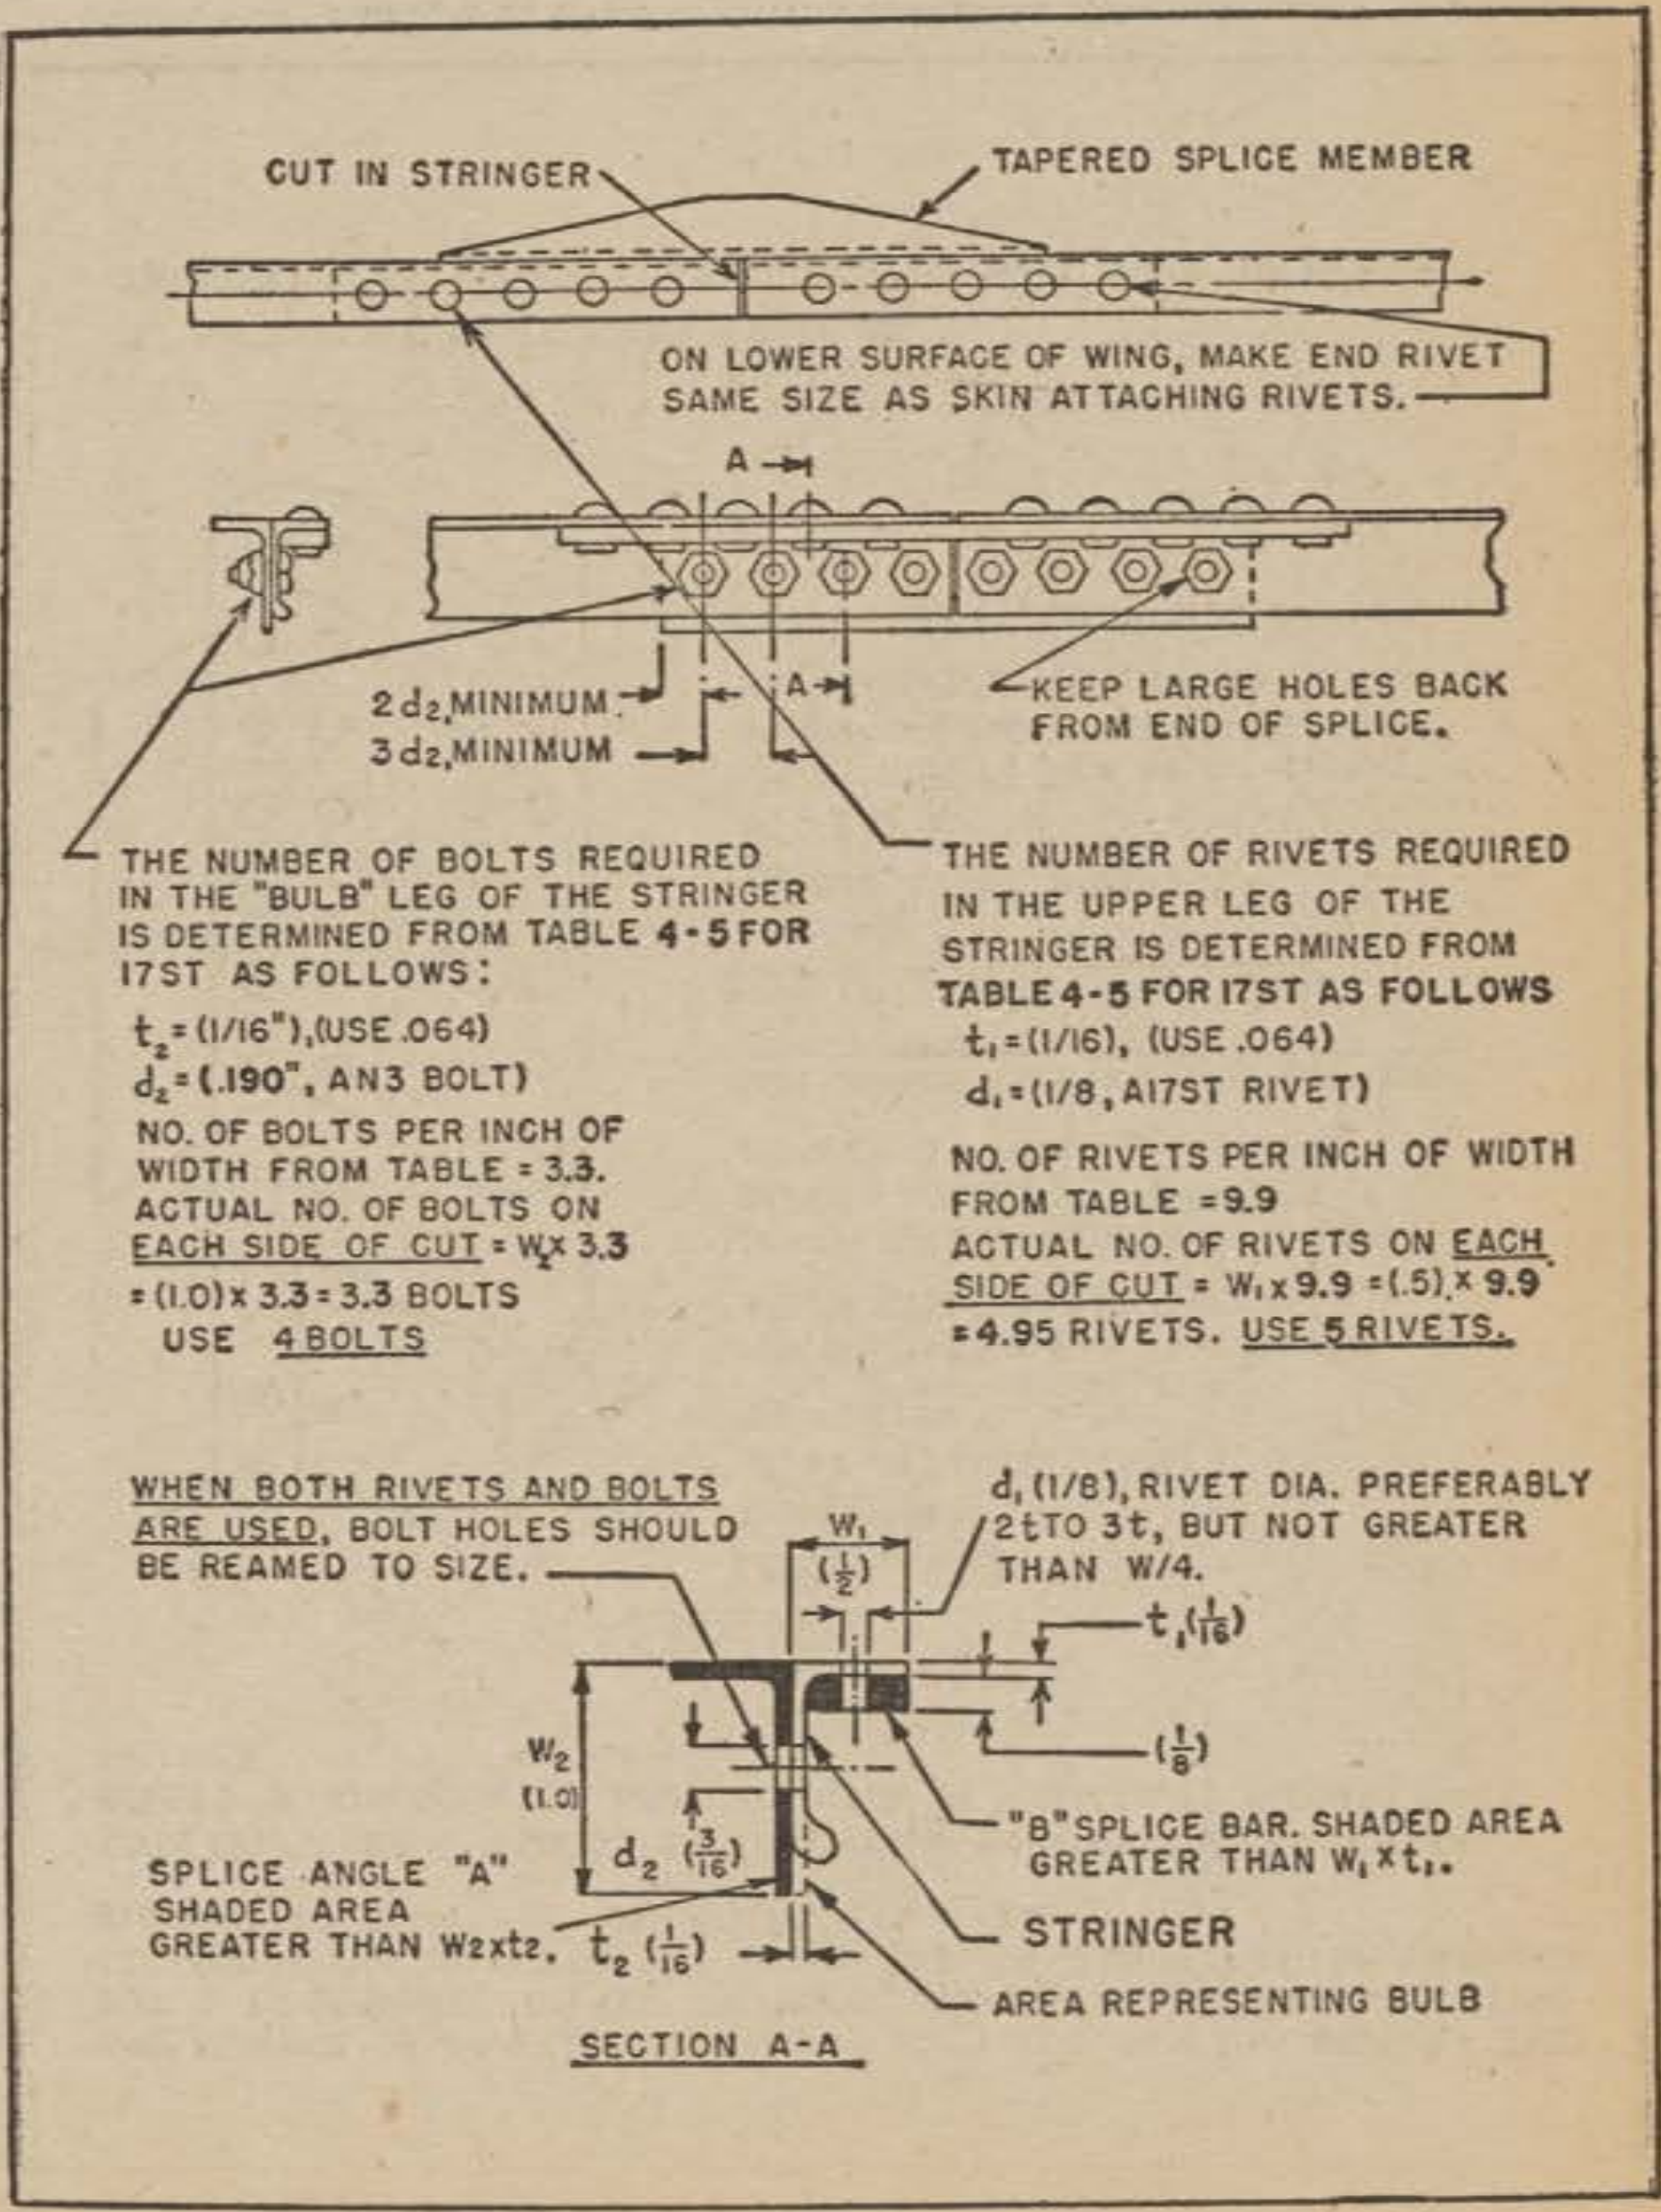

ON LOWER SURFACE OF WING, MAKE END RIVET SAME SIZE AS SKIN ATTACHING RIVETS.

KEEP LARGE HOLES BACK FROM END OF SPLICE.

THE NUMBER OF BOLTS REQUIRED IN THE "BULB" LEG OF THE STRINGER IS DETERMINED FROM TABLE 4-5 FOR 17ST AS FOLLOWS:

$t_2$ = (1/16"), (USE .064)
$d_2$ = (.190", AN3 BOLT)
NO. OF BOLTS PER INCH OF WIDTH FROM TABLE = 3.3.
ACTUAL NO. OF BOLTS ON EACH SIDE OF CUT = $W_2$ x 3.3 = (1.0) x 3.3 = 3.3 BOLTS
USE 4 BOLTS

THE NUMBER OF RIVETS REQUIRED IN THE UPPER LEG OF THE STRINGER IS DETERMINED FROM TABLE 4-5 FOR 17ST AS FOLLOWS

$t_1$ = (1/16), (USE .064)
$d_1$ = (1/8, A17ST RIVET)
NO. OF RIVETS PER INCH OF WIDTH FROM TABLE = 9.9
ACTUAL NO. OF RIVETS ON EACH SIDE OF CUT = $W_1$ x 9.9 = (.5) x 9.9 = 4.95 RIVETS. USE 5 RIVETS.

WHEN BOTH RIVETS AND BOLTS ARE USED, BOLT HOLES SHOULD BE REAMED TO SIZE.

$d_1$ (1/8), RIVET DIA. PREFERABLY 2t TO 3t, BUT NOT GREATER THAN W/4.

"B" SPLICE BAR. SHADED AREA GREATER THAN $W_1 \times t_1$.

SPLICE ANGLE "A" SHADED AREA GREATER THAN $W_2 \times t_2$.

AREA REPRESENTING BULB

FIGURE 4-22—Example of stringer splice (material—17ST AL alloy).

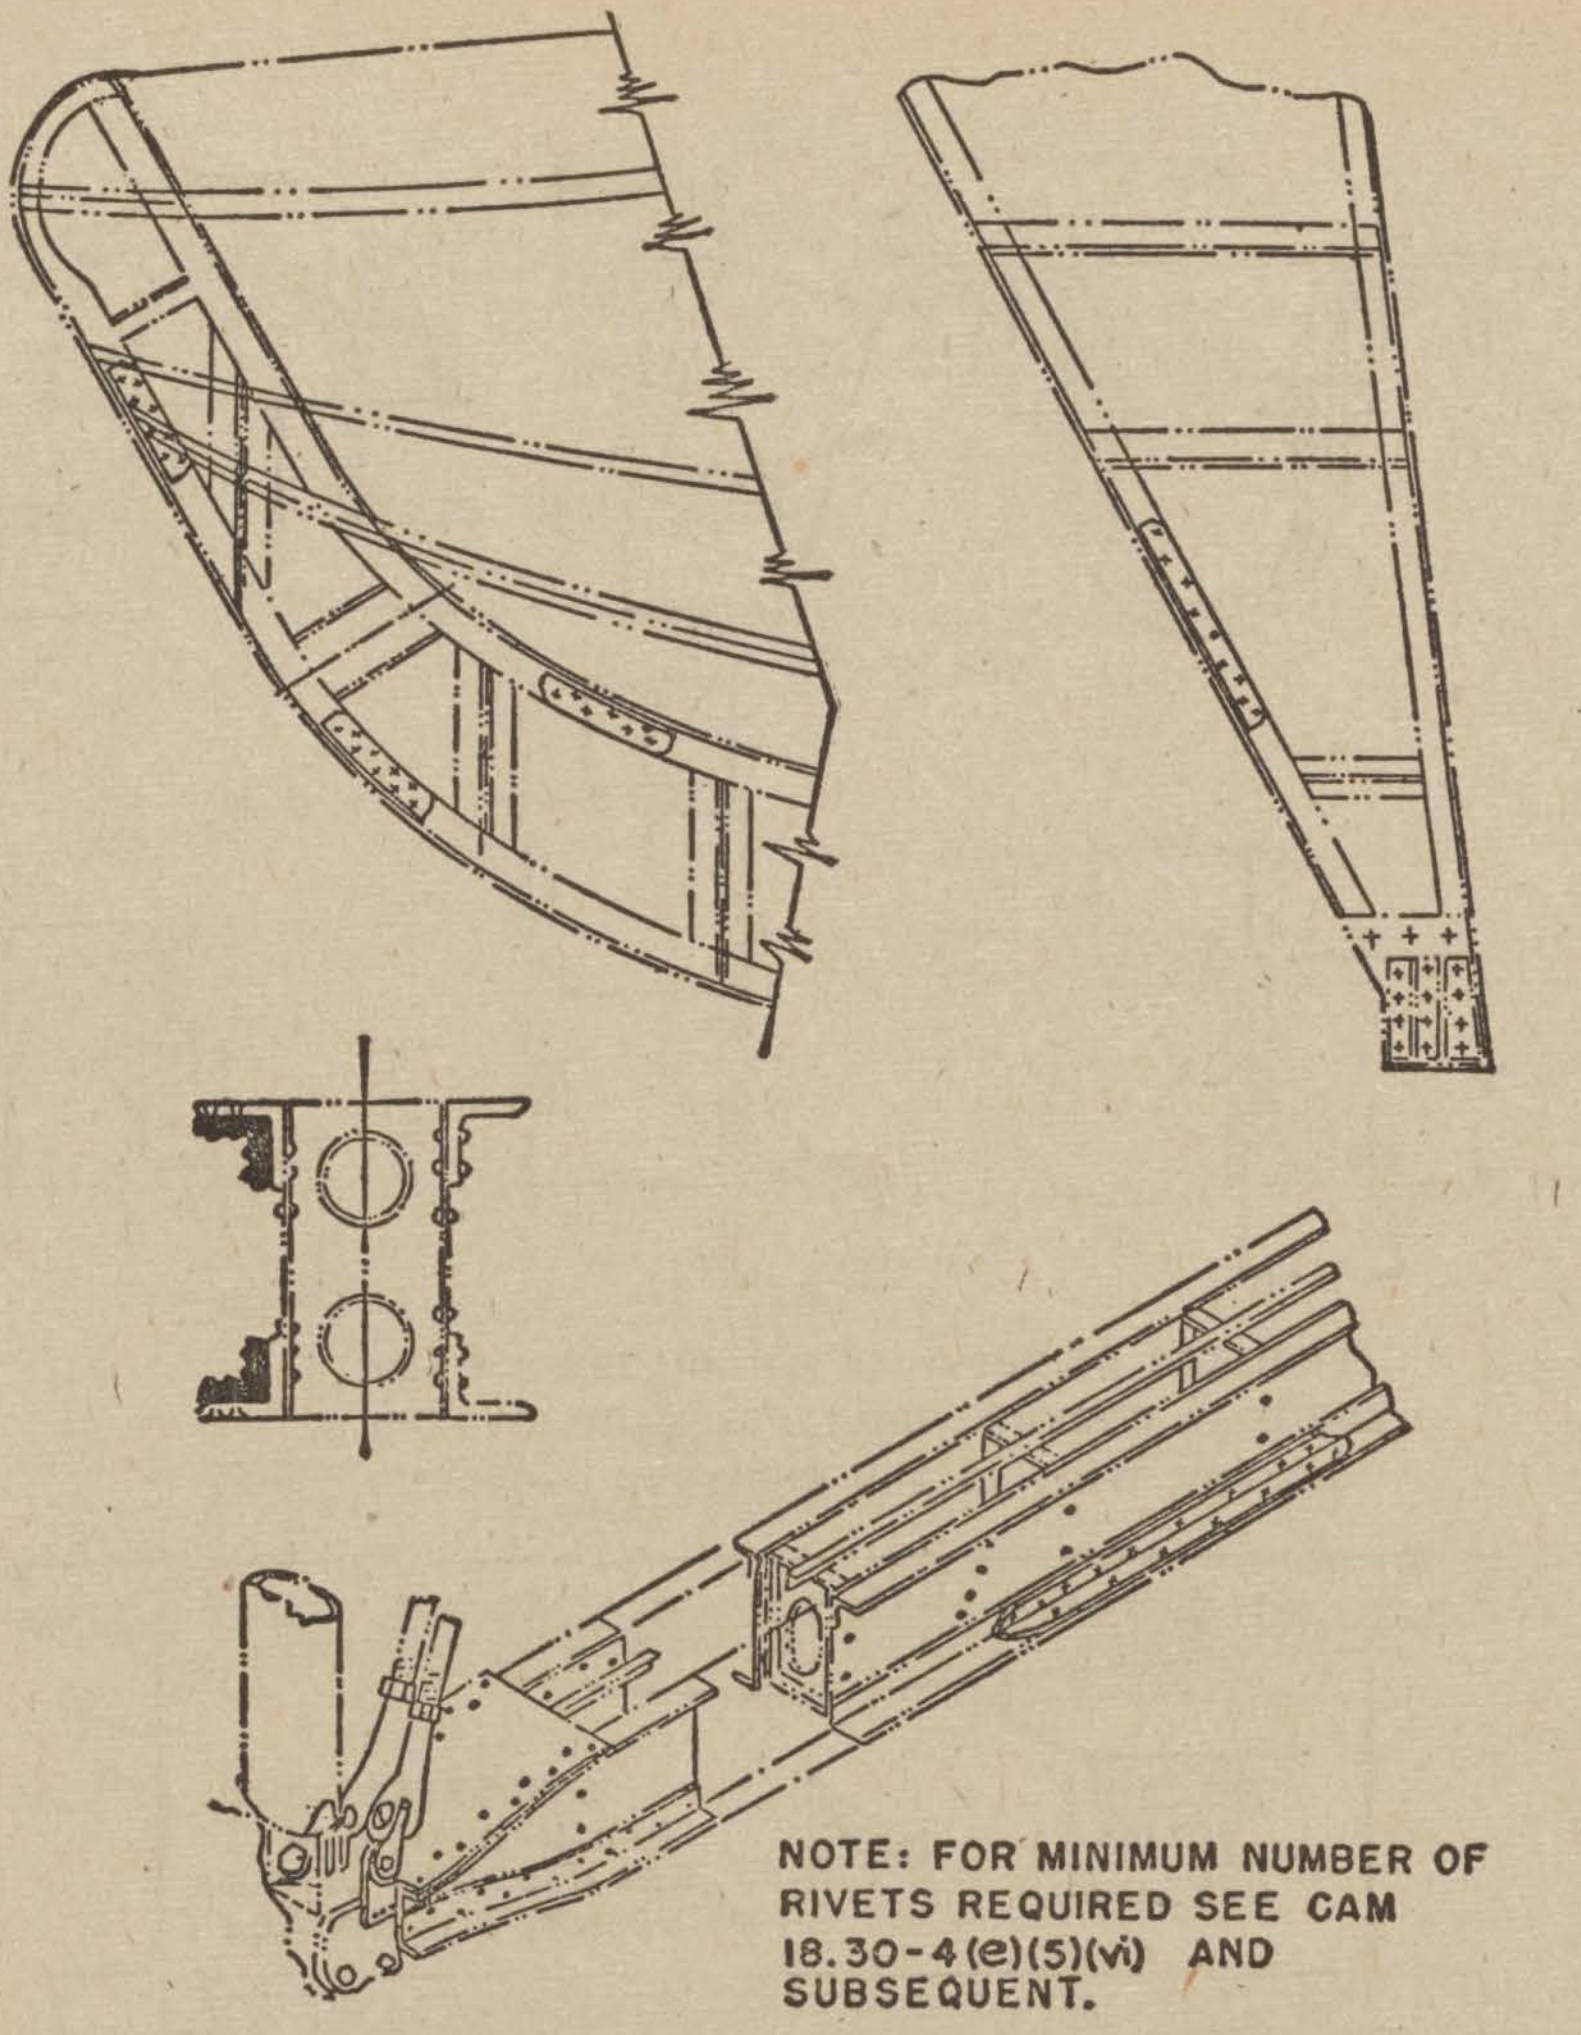

NOTE: FOR MINIMUM NUMBER OF RIVETS REQUIRED SEE CAM 18.30-4(e)(5)(vi) AND SUBSEQUENT.

NOTE: STRENGTH INVESTIGATION USUALLY REQUIRED FOR THIS TYPE OF REPAIR.

FIGURE 4-23—Application of typical flange splices and reinforcement.

THE NUMBER OF RIVETS REQUIRED IN EACH LEG ON EACH SIDE OF THE CUT IS DETERMINED BY THE WIDTH "W", THICKNESS OF FRAME MATERIAL "t" AND RIVET DIAMETER "d", USING **TABLE 4-5** (FOR 17ST) IN A MANNER SIMILAR TO THAT FOR STRINGERS, FIG. **4-22**

NOTE (b), **TABLE 4-5 INDICATES** THAT ONLY 60% OF THE NUMBER OF RIVETS SO CALCULATED NEED BE USED IN SPLICES IN INTERMEDIATE FRAMES.

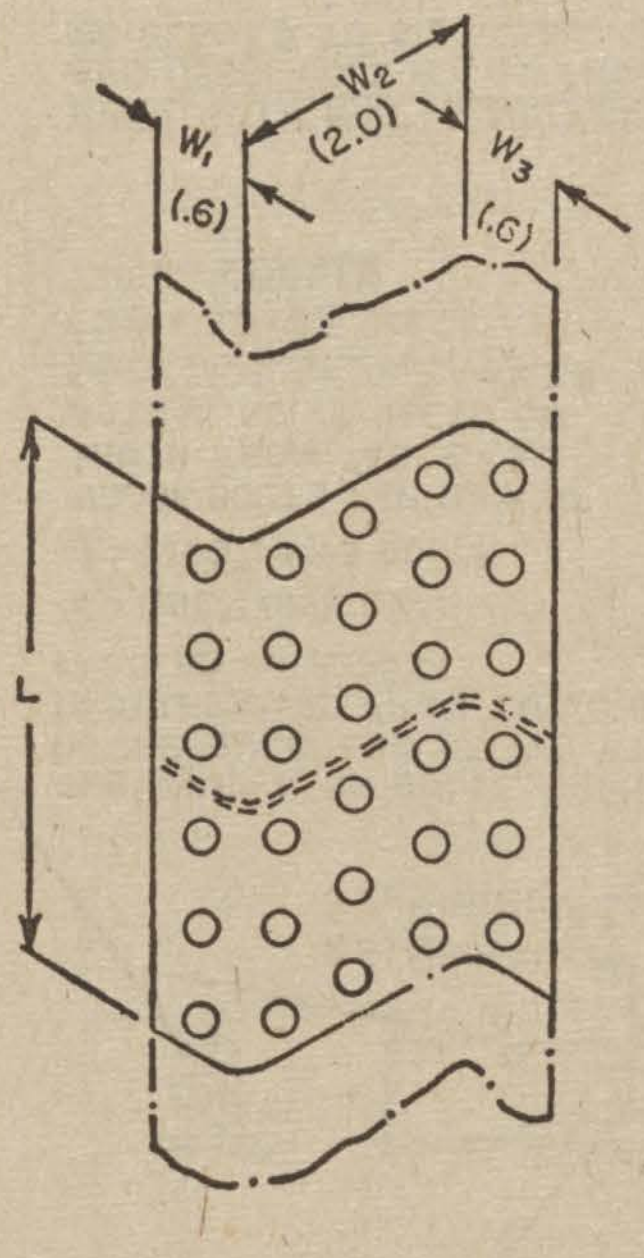

EXAMPLE

FLANGE LEG

$t$ = (.040)
$d_1$ = (1/8, A17ST RIVET)
$W_1$ = (.6) IN.

NO. OF RIVETS PER IN. OF WIDTH, **FROM TABLE 4-5 (FOR 17ST) = 6.2**

NO. OF RIVETS IN LEG = $W_1$ x 6.2 = (.6) x 6.2 = 3.72, SAY 4 RIVETS.
60% OF 4 = .6 x 4 = 2.4 RIVETS.

USE 3 RIVETS, EACH SIDE OF CUT.

BACK OF ZEE (OR CHANNEL)

$t$ = (.040)
$d_2$ = (1/8, A17ST RIVET)
$W_2$ = 2.0 INS.

NO. OF RIVETS PER IN. OF WIDTH, **FROM TABLE 4-5 = 6.2 = (2) X 6.2 = 12.4**
SAY **13** RIVETS. 60% OF 13 = 7.8 RIVETS.

USE 8 RIVETS, EACH SIDE OF CUT.

**"L" SHOULD BE MORE THAN TWICE $W_2$**

THICKNESS OF SPLICE PLATE GREATER THAN THAT OF FRAME.

FIGURE 4-24—Example of splice of intermediate frame (material—17ST AL alloy).

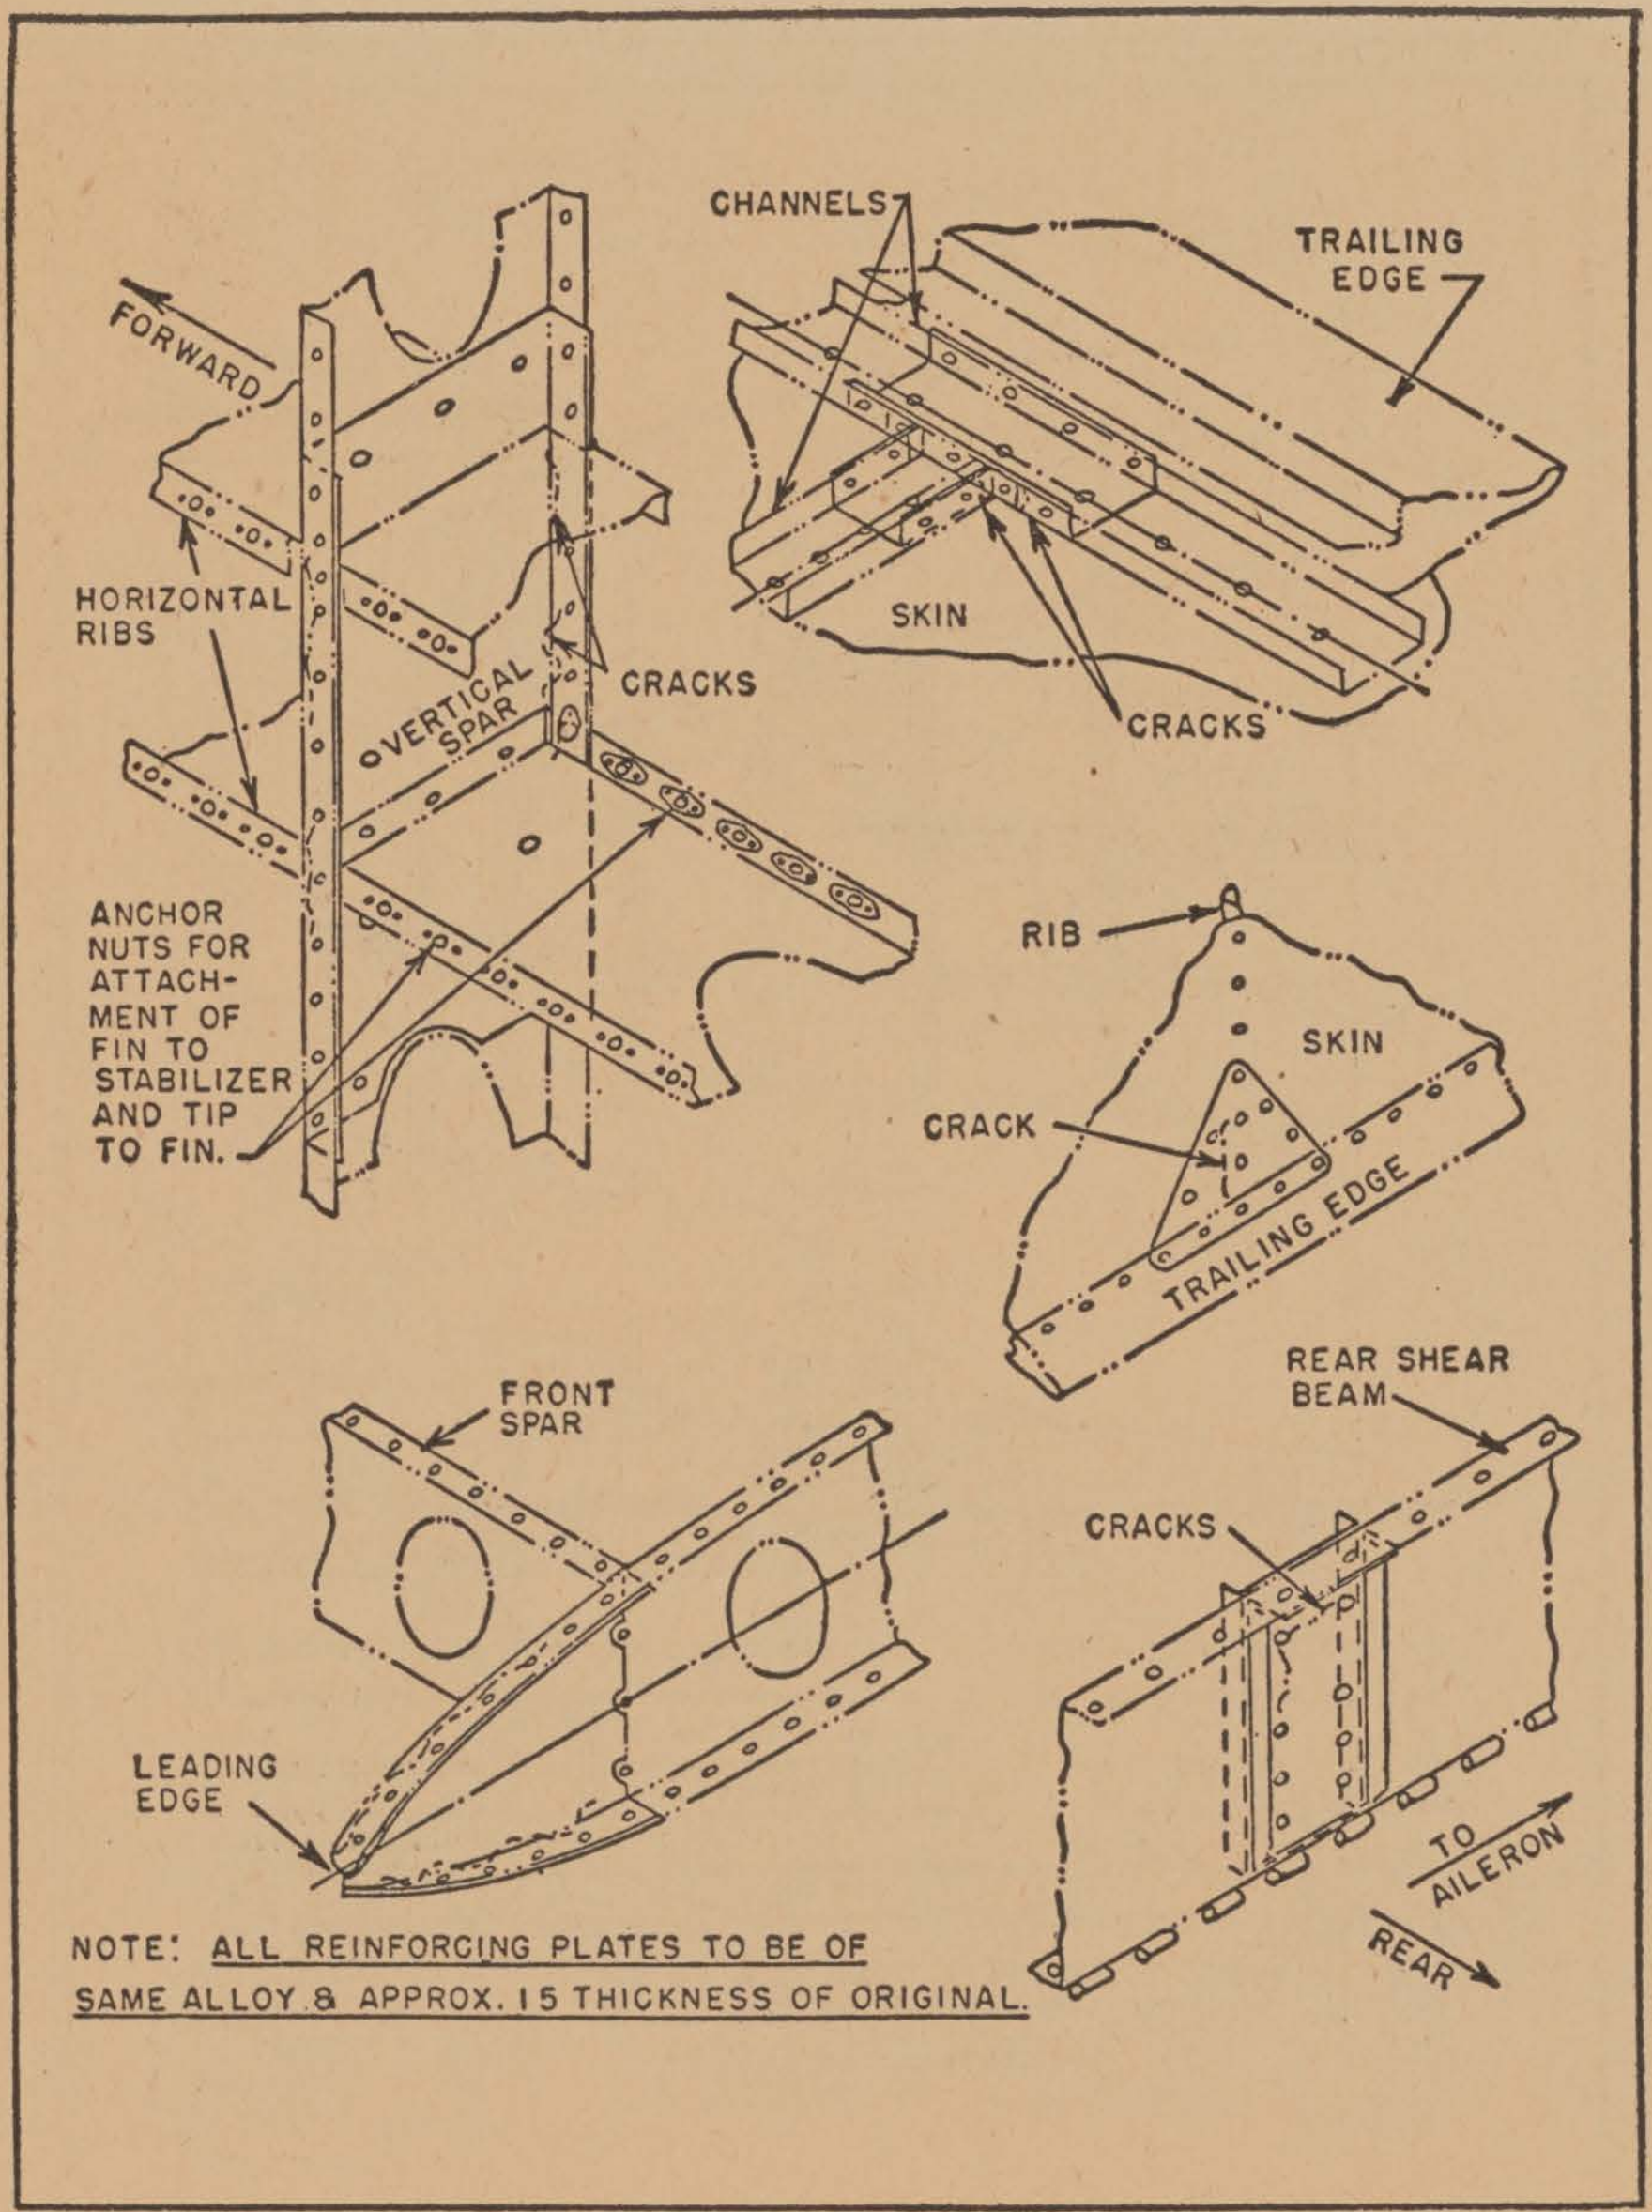

NOTE: ALL REINFORCING PLATES TO BE OF SAME ALLOY & APPROX. 1.5 THICKNESS OF ORIGINAL.

FIGURE 4-25—Typical methods of repairing cracked leading and trailing edges and rib intersections.

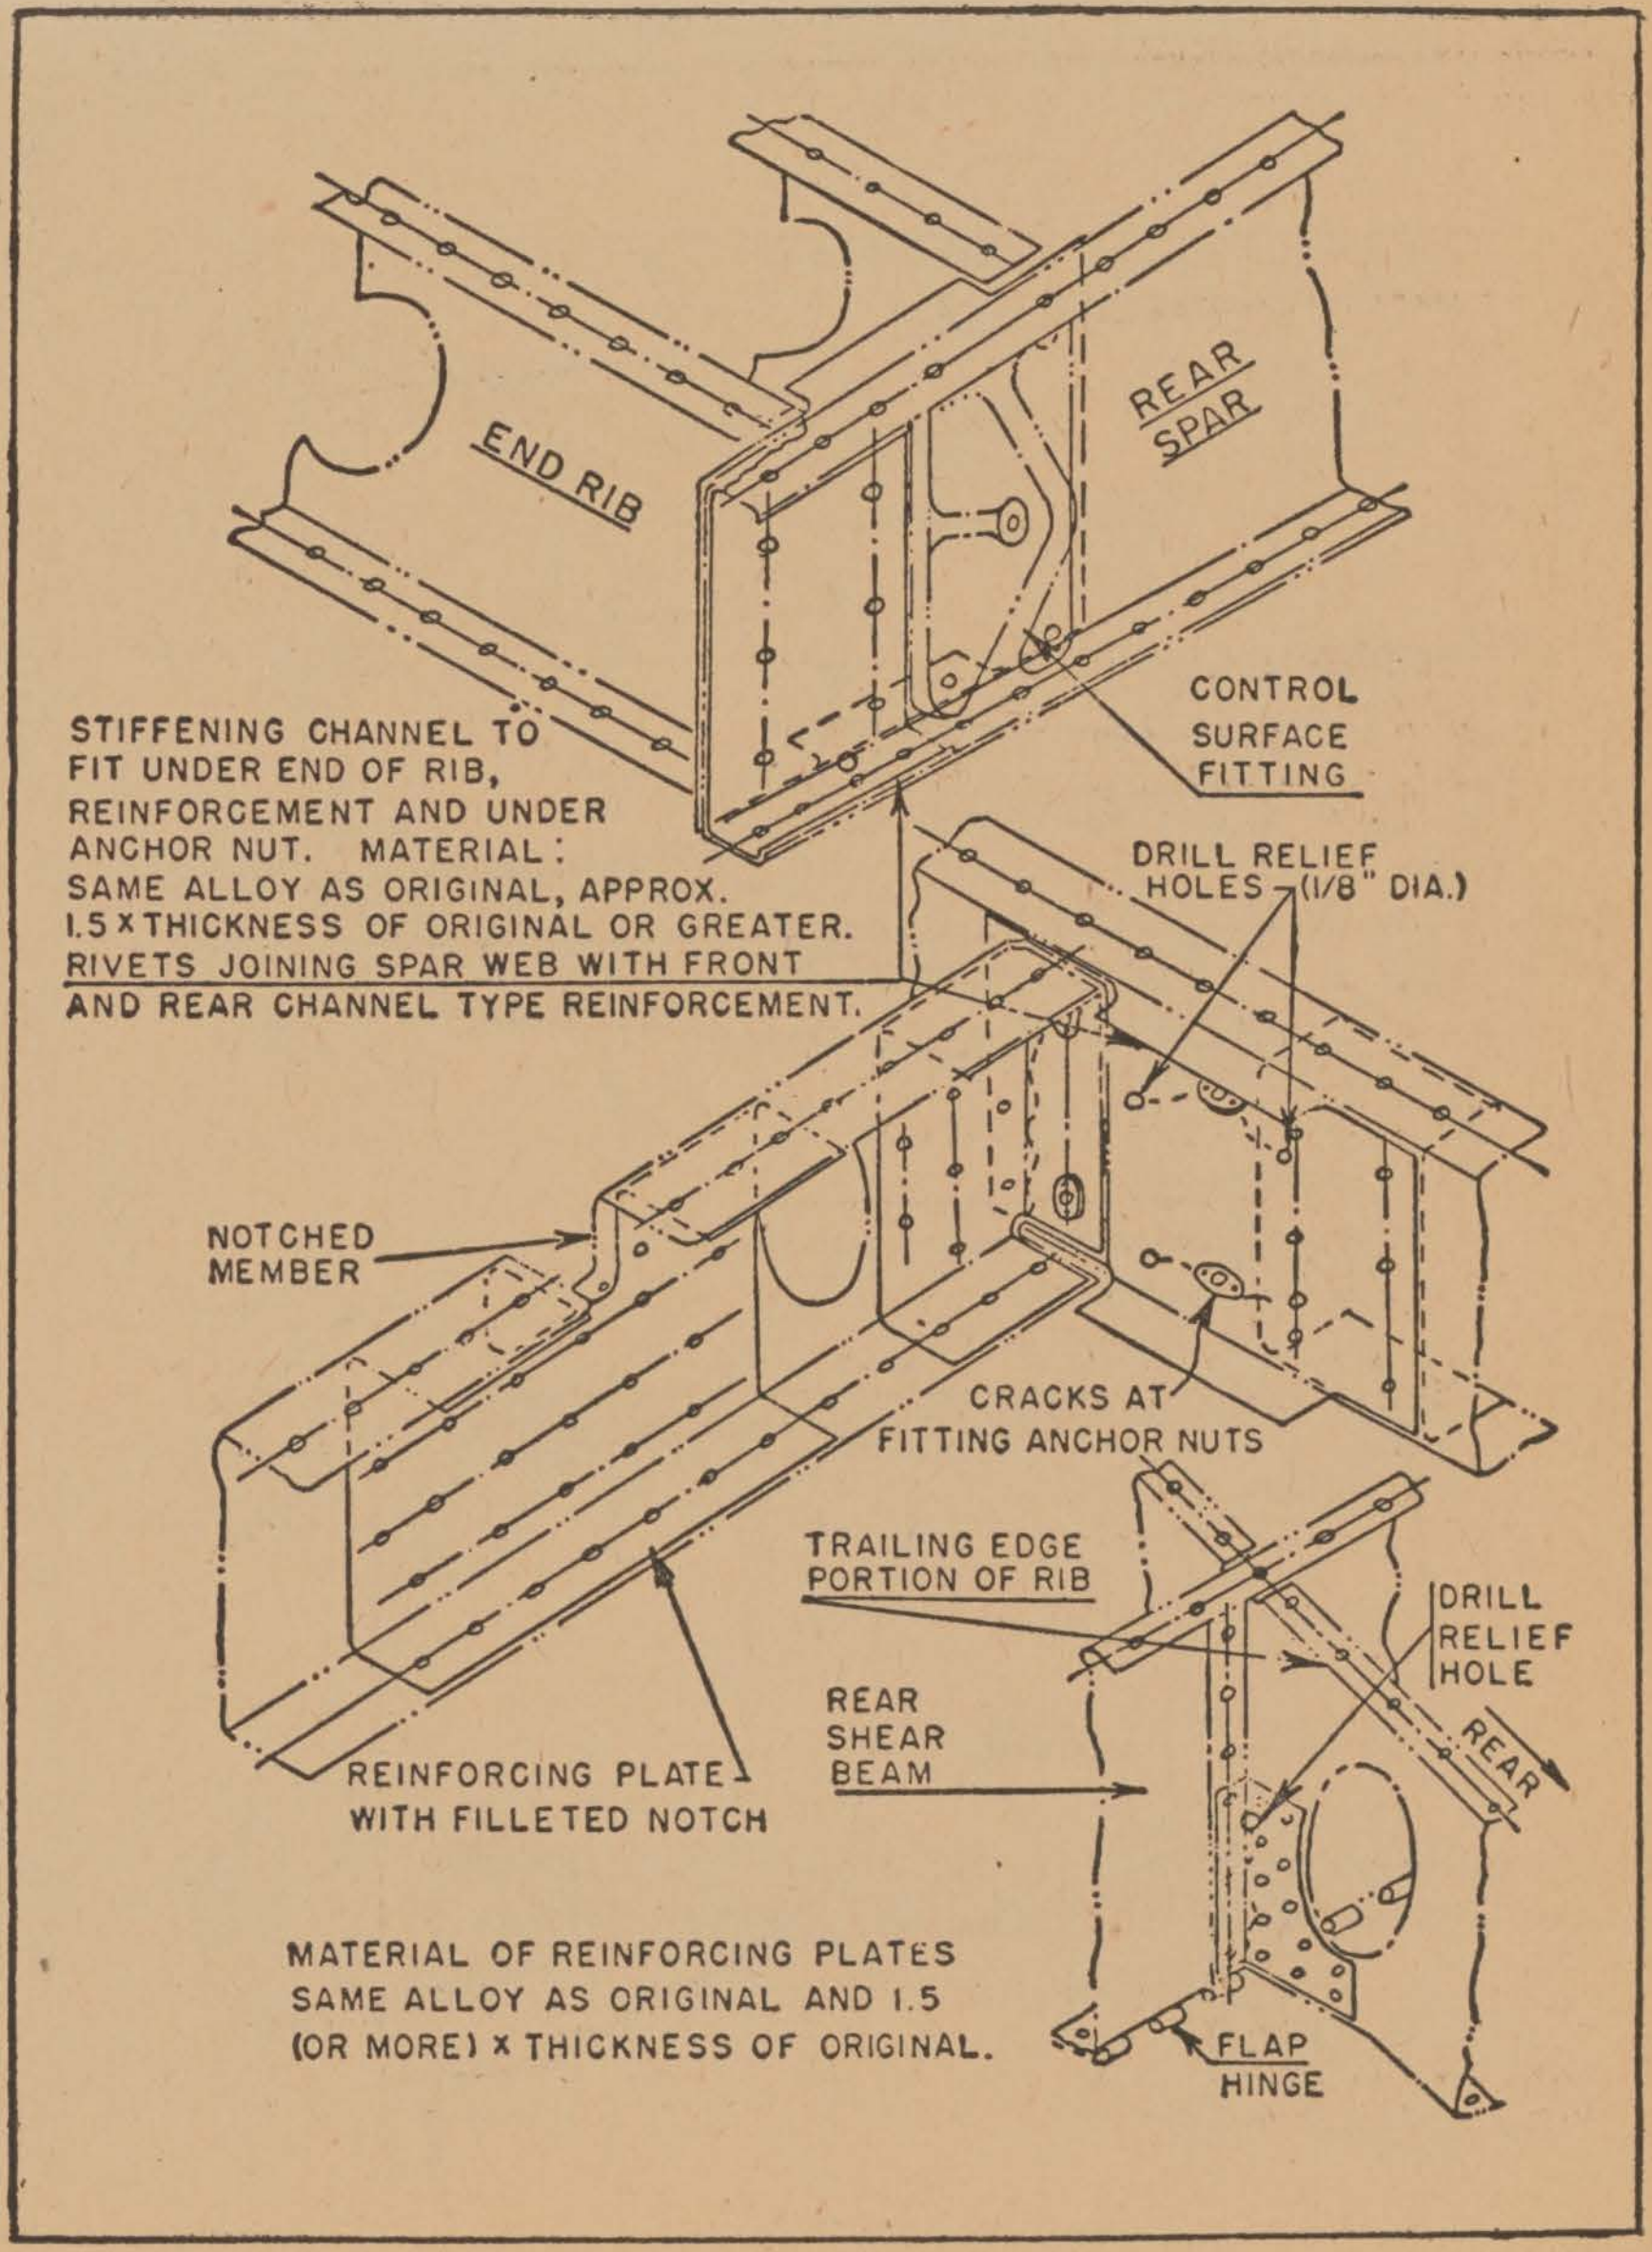
END RIB
REAR SPAR
CONTROL SURFACE FITTING
DRILL RELIEF HOLES (1/8" DIA.)
NOTCHED MEMBER
CRACKS AT FITTING ANCHOR NUTS
TRAILING EDGE PORTION OF RIB
DRILL RELIEF HOLE
REAR
REAR SHEAR BEAM
REINFORCING PLATE WITH FILLETED NOTCH
FLAP HINGE

STIFFENING CHANNEL TO FIT UNDER END OF RIB, REINFORCEMENT AND UNDER ANCHOR NUT. MATERIAL: SAME ALLOY AS ORIGINAL, APPROX. 1.5 x THICKNESS OF ORIGINAL OR GREATER. RIVETS JOINING SPAR WEB WITH FRONT AND REAR CHANNEL TYPE REINFORCEMENT.

MATERIAL OF REINFORCING PLATES SAME ALLOY AS ORIGINAL AND 1.5 (OR MORE) x THICKNESS OF ORIGINAL.

FIGURE 4-26—Typical methods of replacing cracked members at fittings.

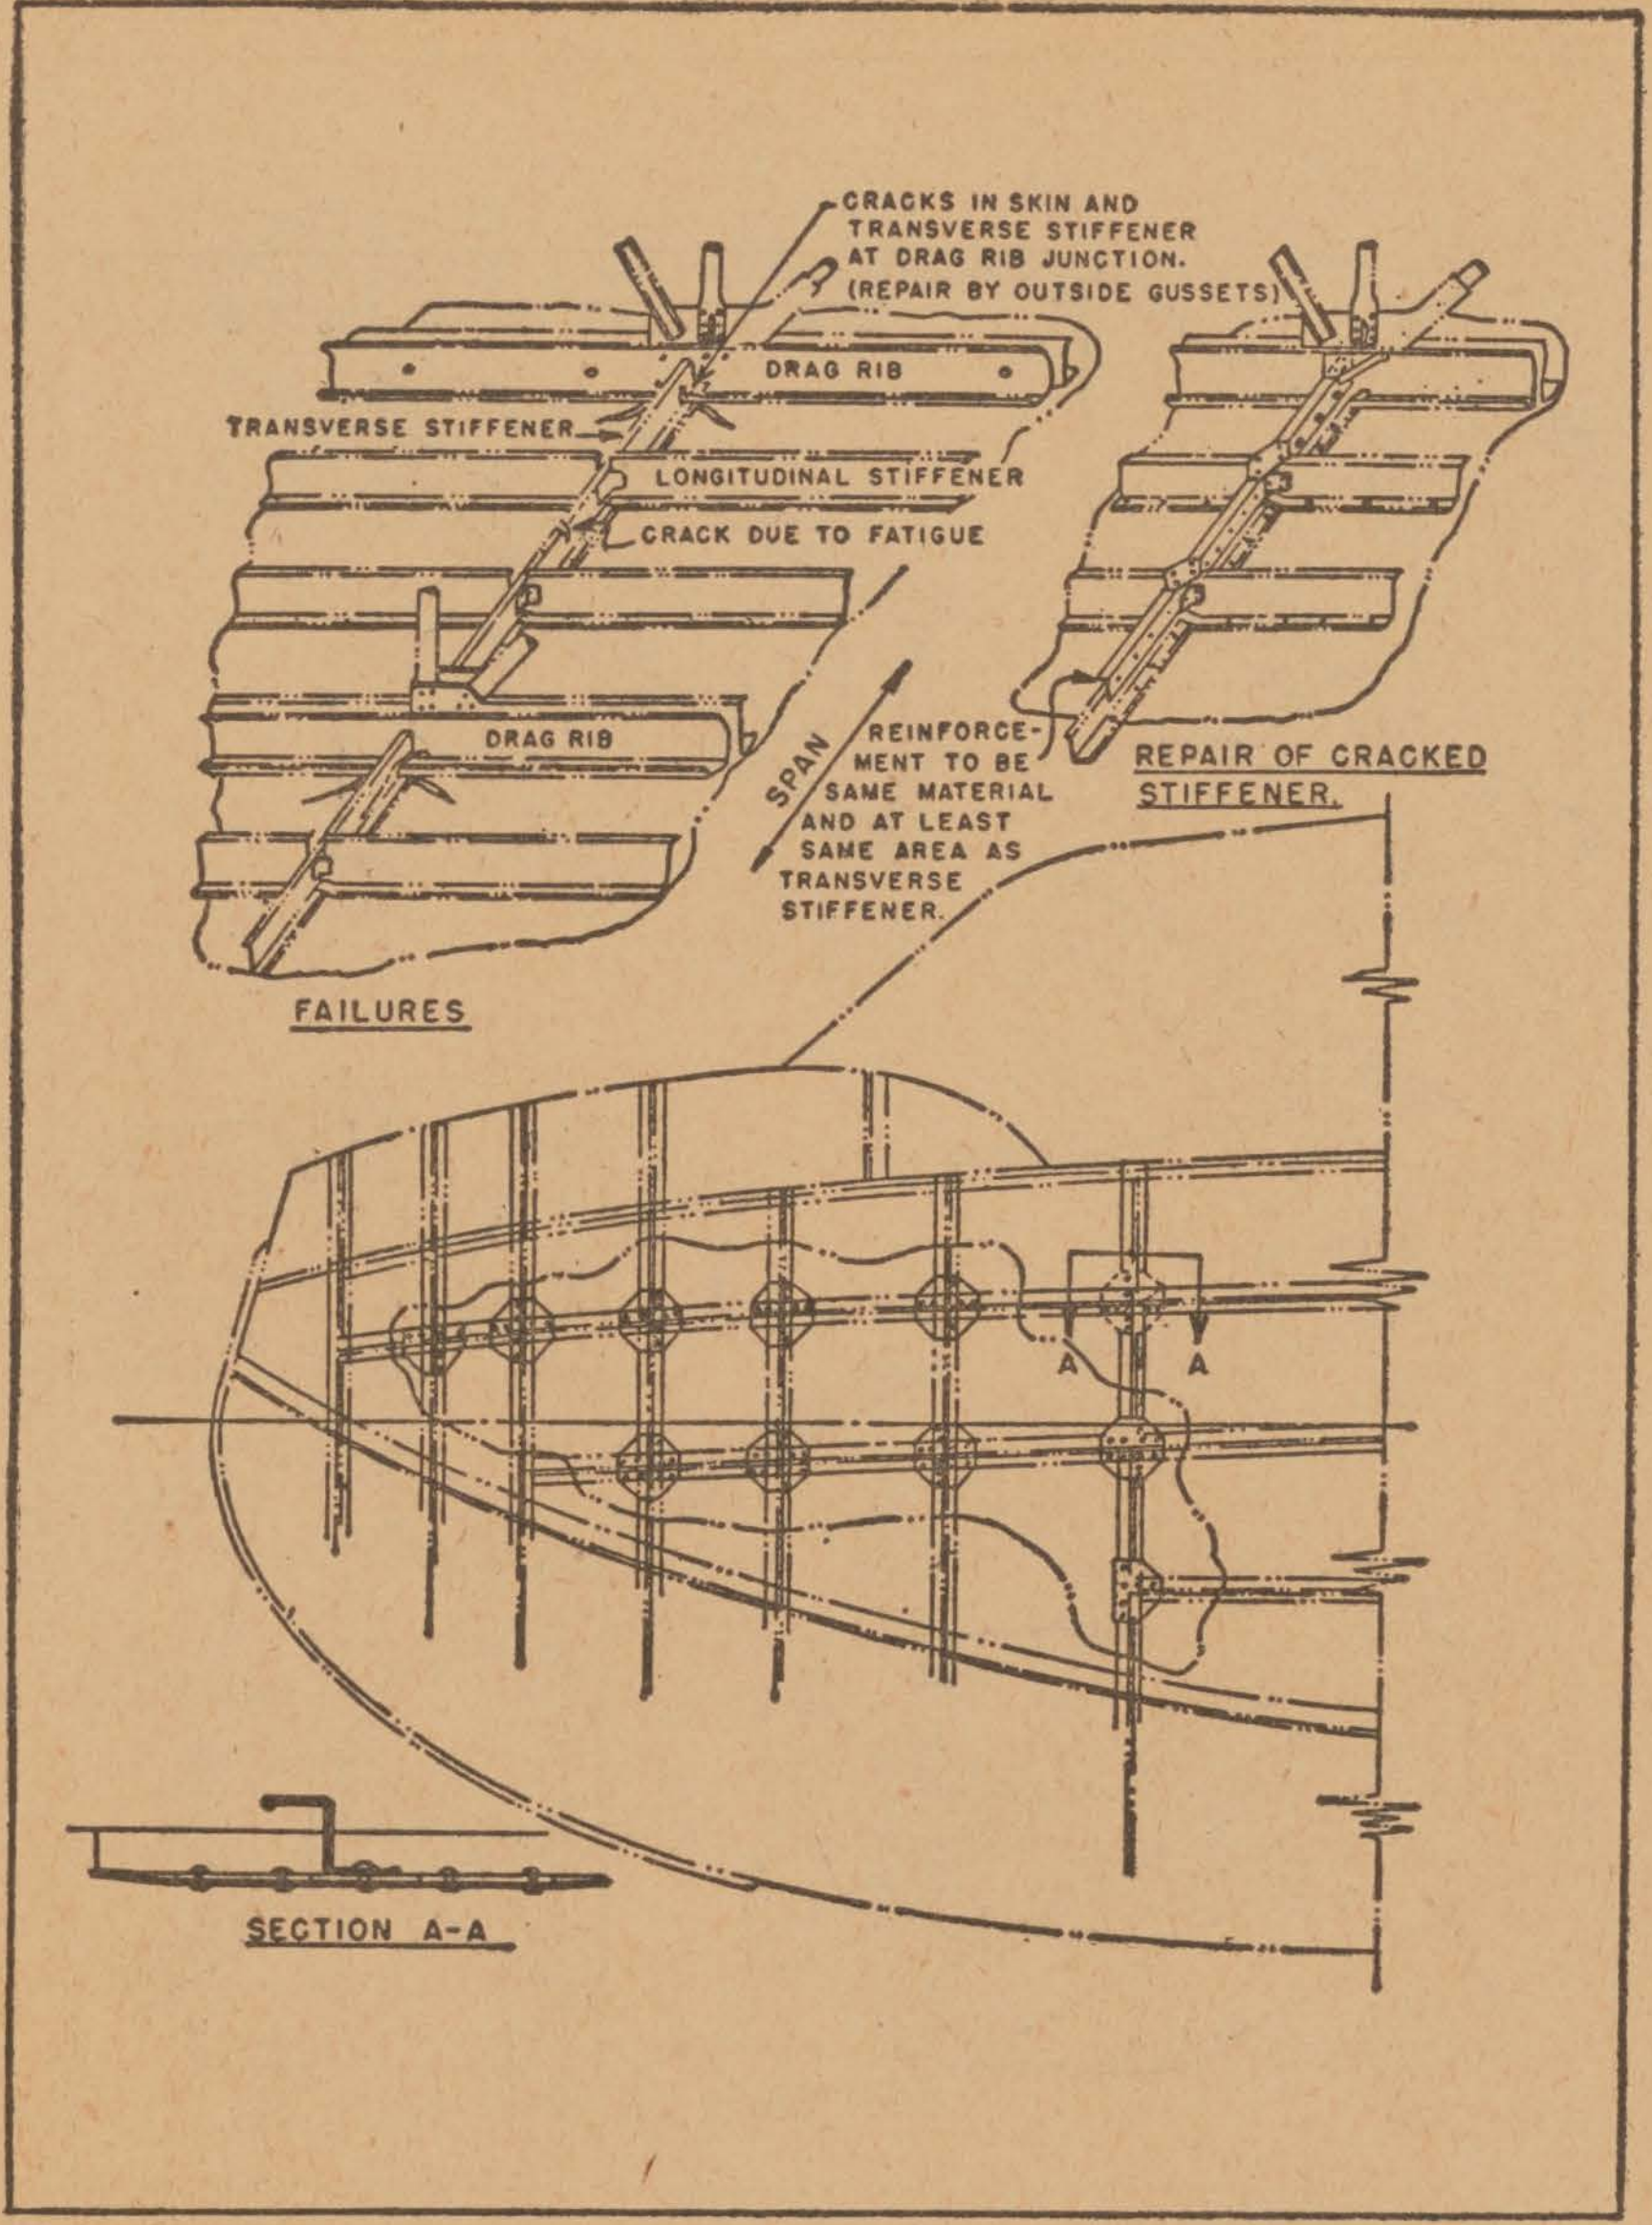
CRACKS IN SKIN AND TRANSVERSE STIFFENER AT DRAG RIB JUNCTION. (REPAIR BY OUTSIDE GUSSETS)
DRAG RIB
TRANSVERSE STIFFENER
LONGITUDINAL STIFFENER
CRACK DUE TO FATIGUE
DRAG RIB
SPAN
REINFORCEMENT TO BE SAME MATERIAL AND AT LEAST SAME AREA AS TRANSVERSE STIFFENER.
REPAIR OF CRACKED STIFFENER.
FAILURES
A
A
SECTION A-A

FIGURE 4-27—Typical methods of repairing cracked frame and stiffener combinations.

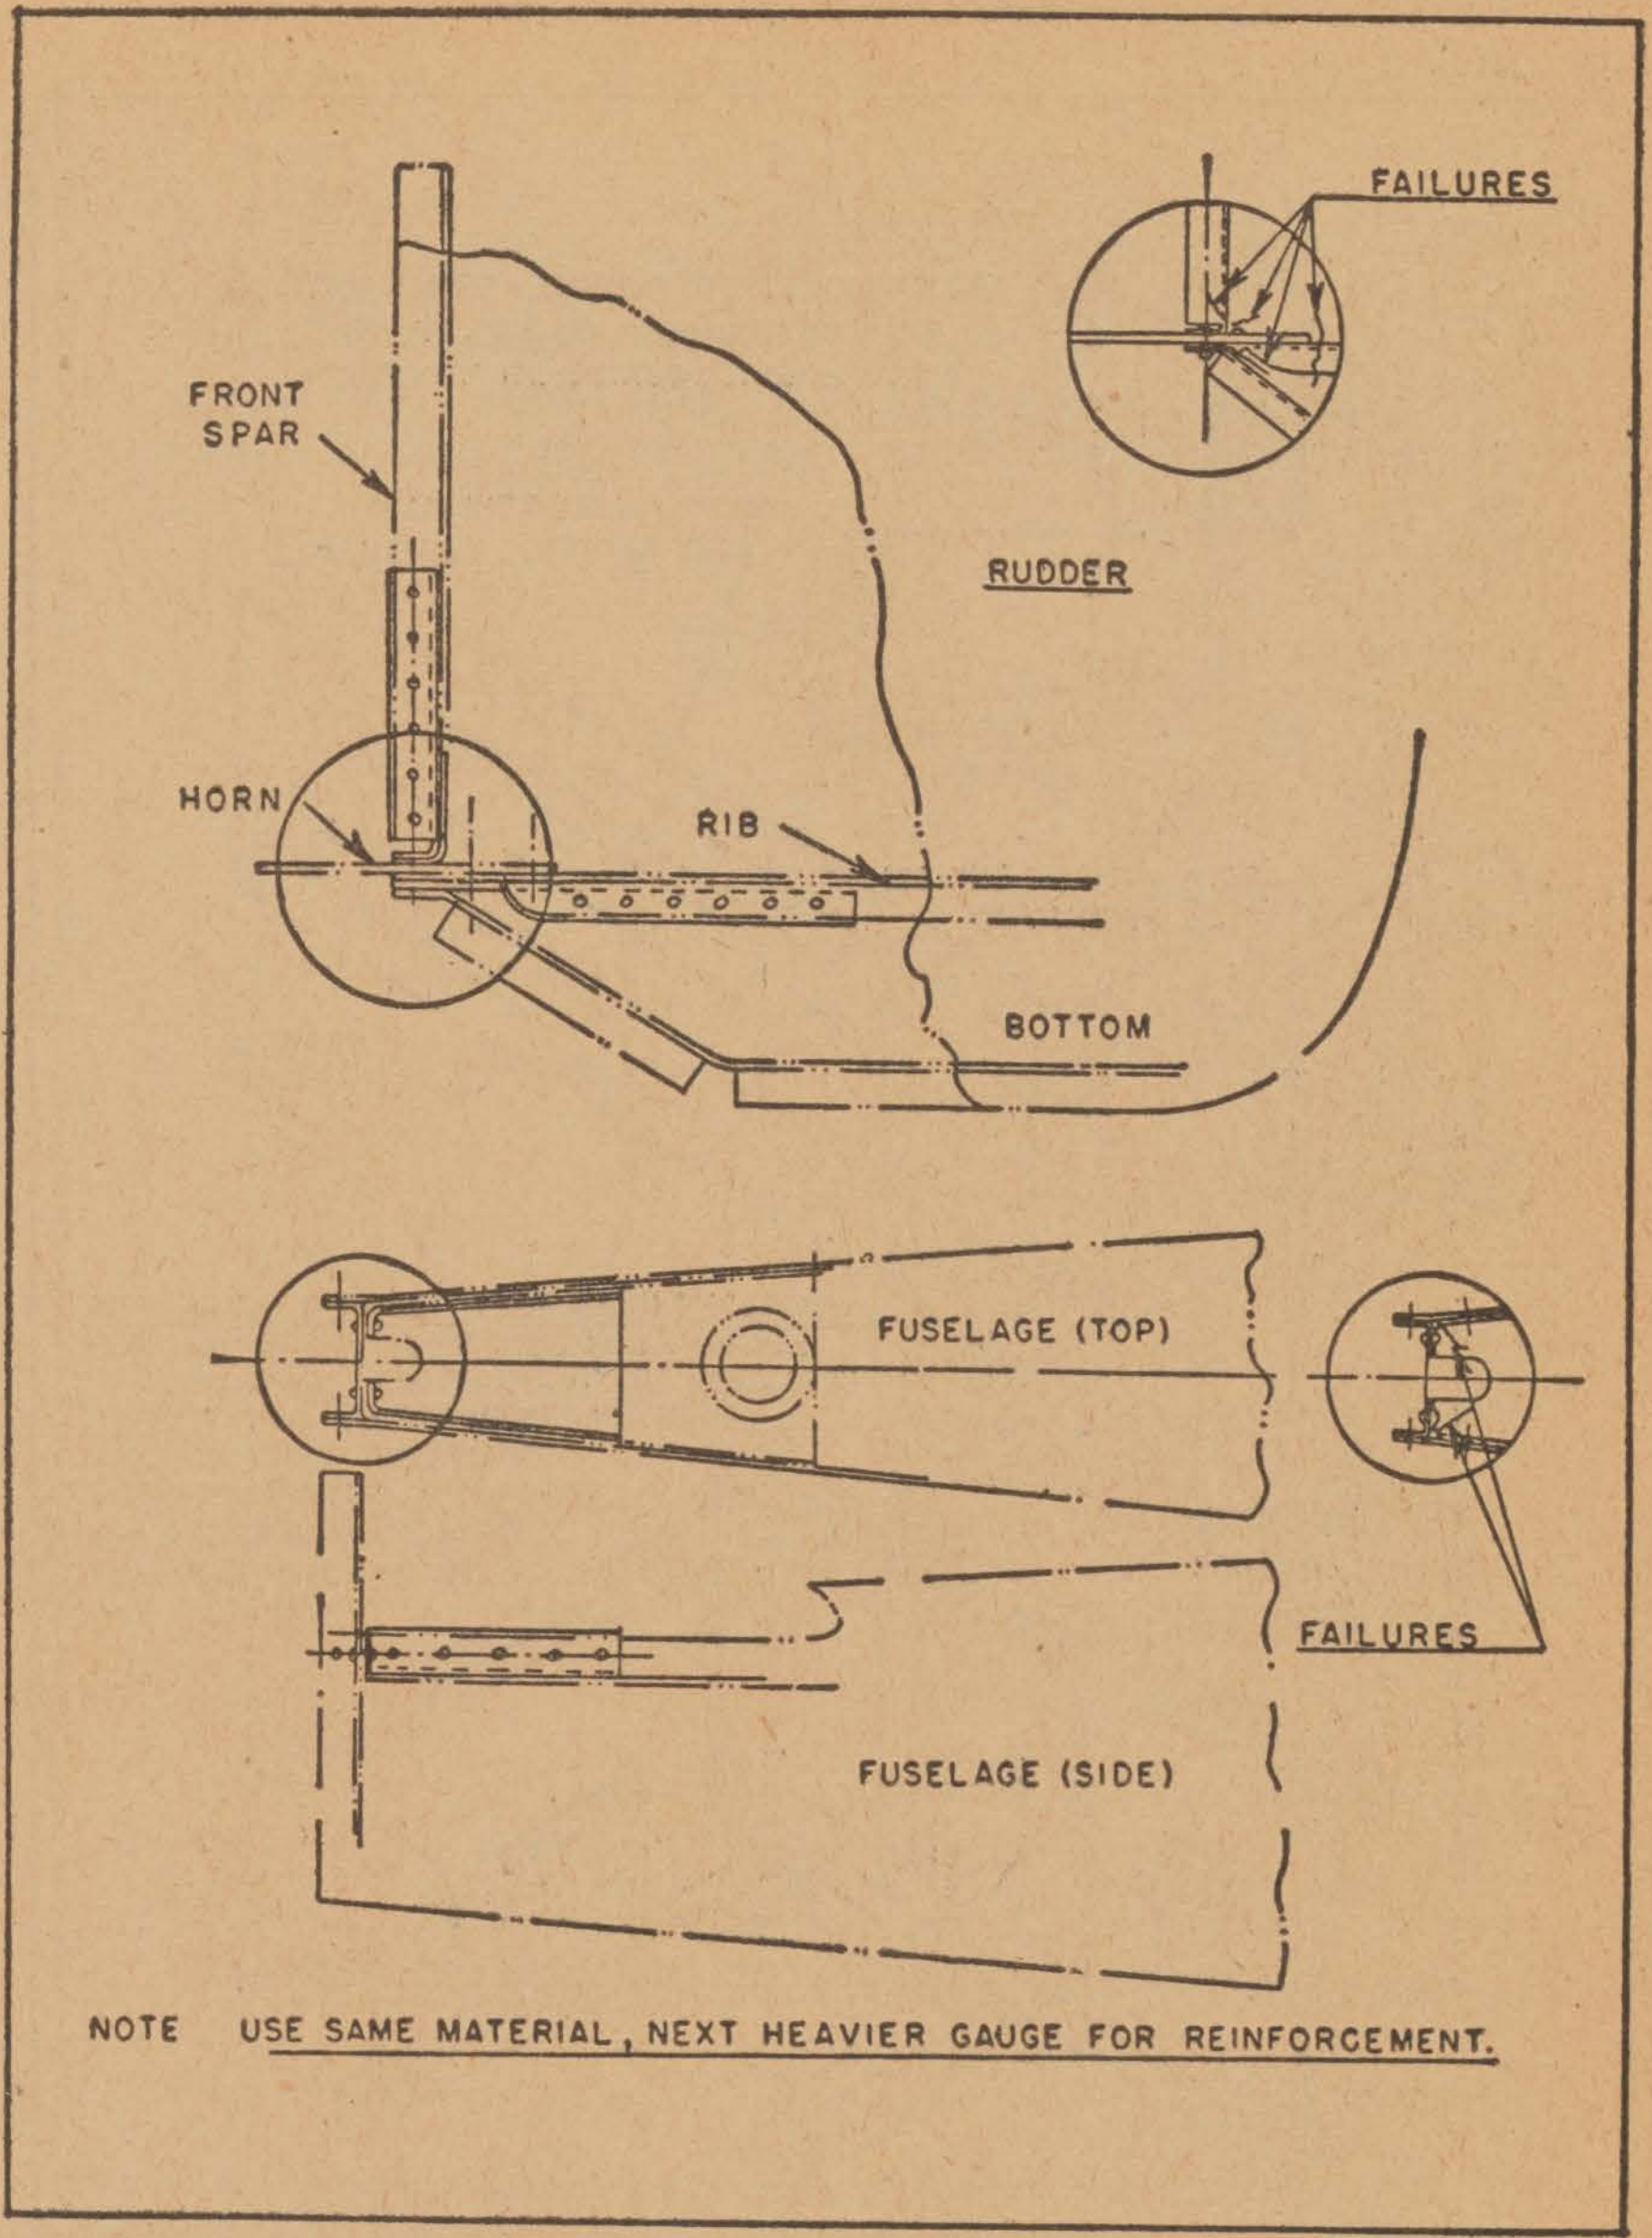

NOTE USE SAME MATERIAL, NEXT HEAVIER GAUGE FOR REINFORCEMENT.

FIGURE 4-28—Typical repairs to rudder and to fuselage at tail post.

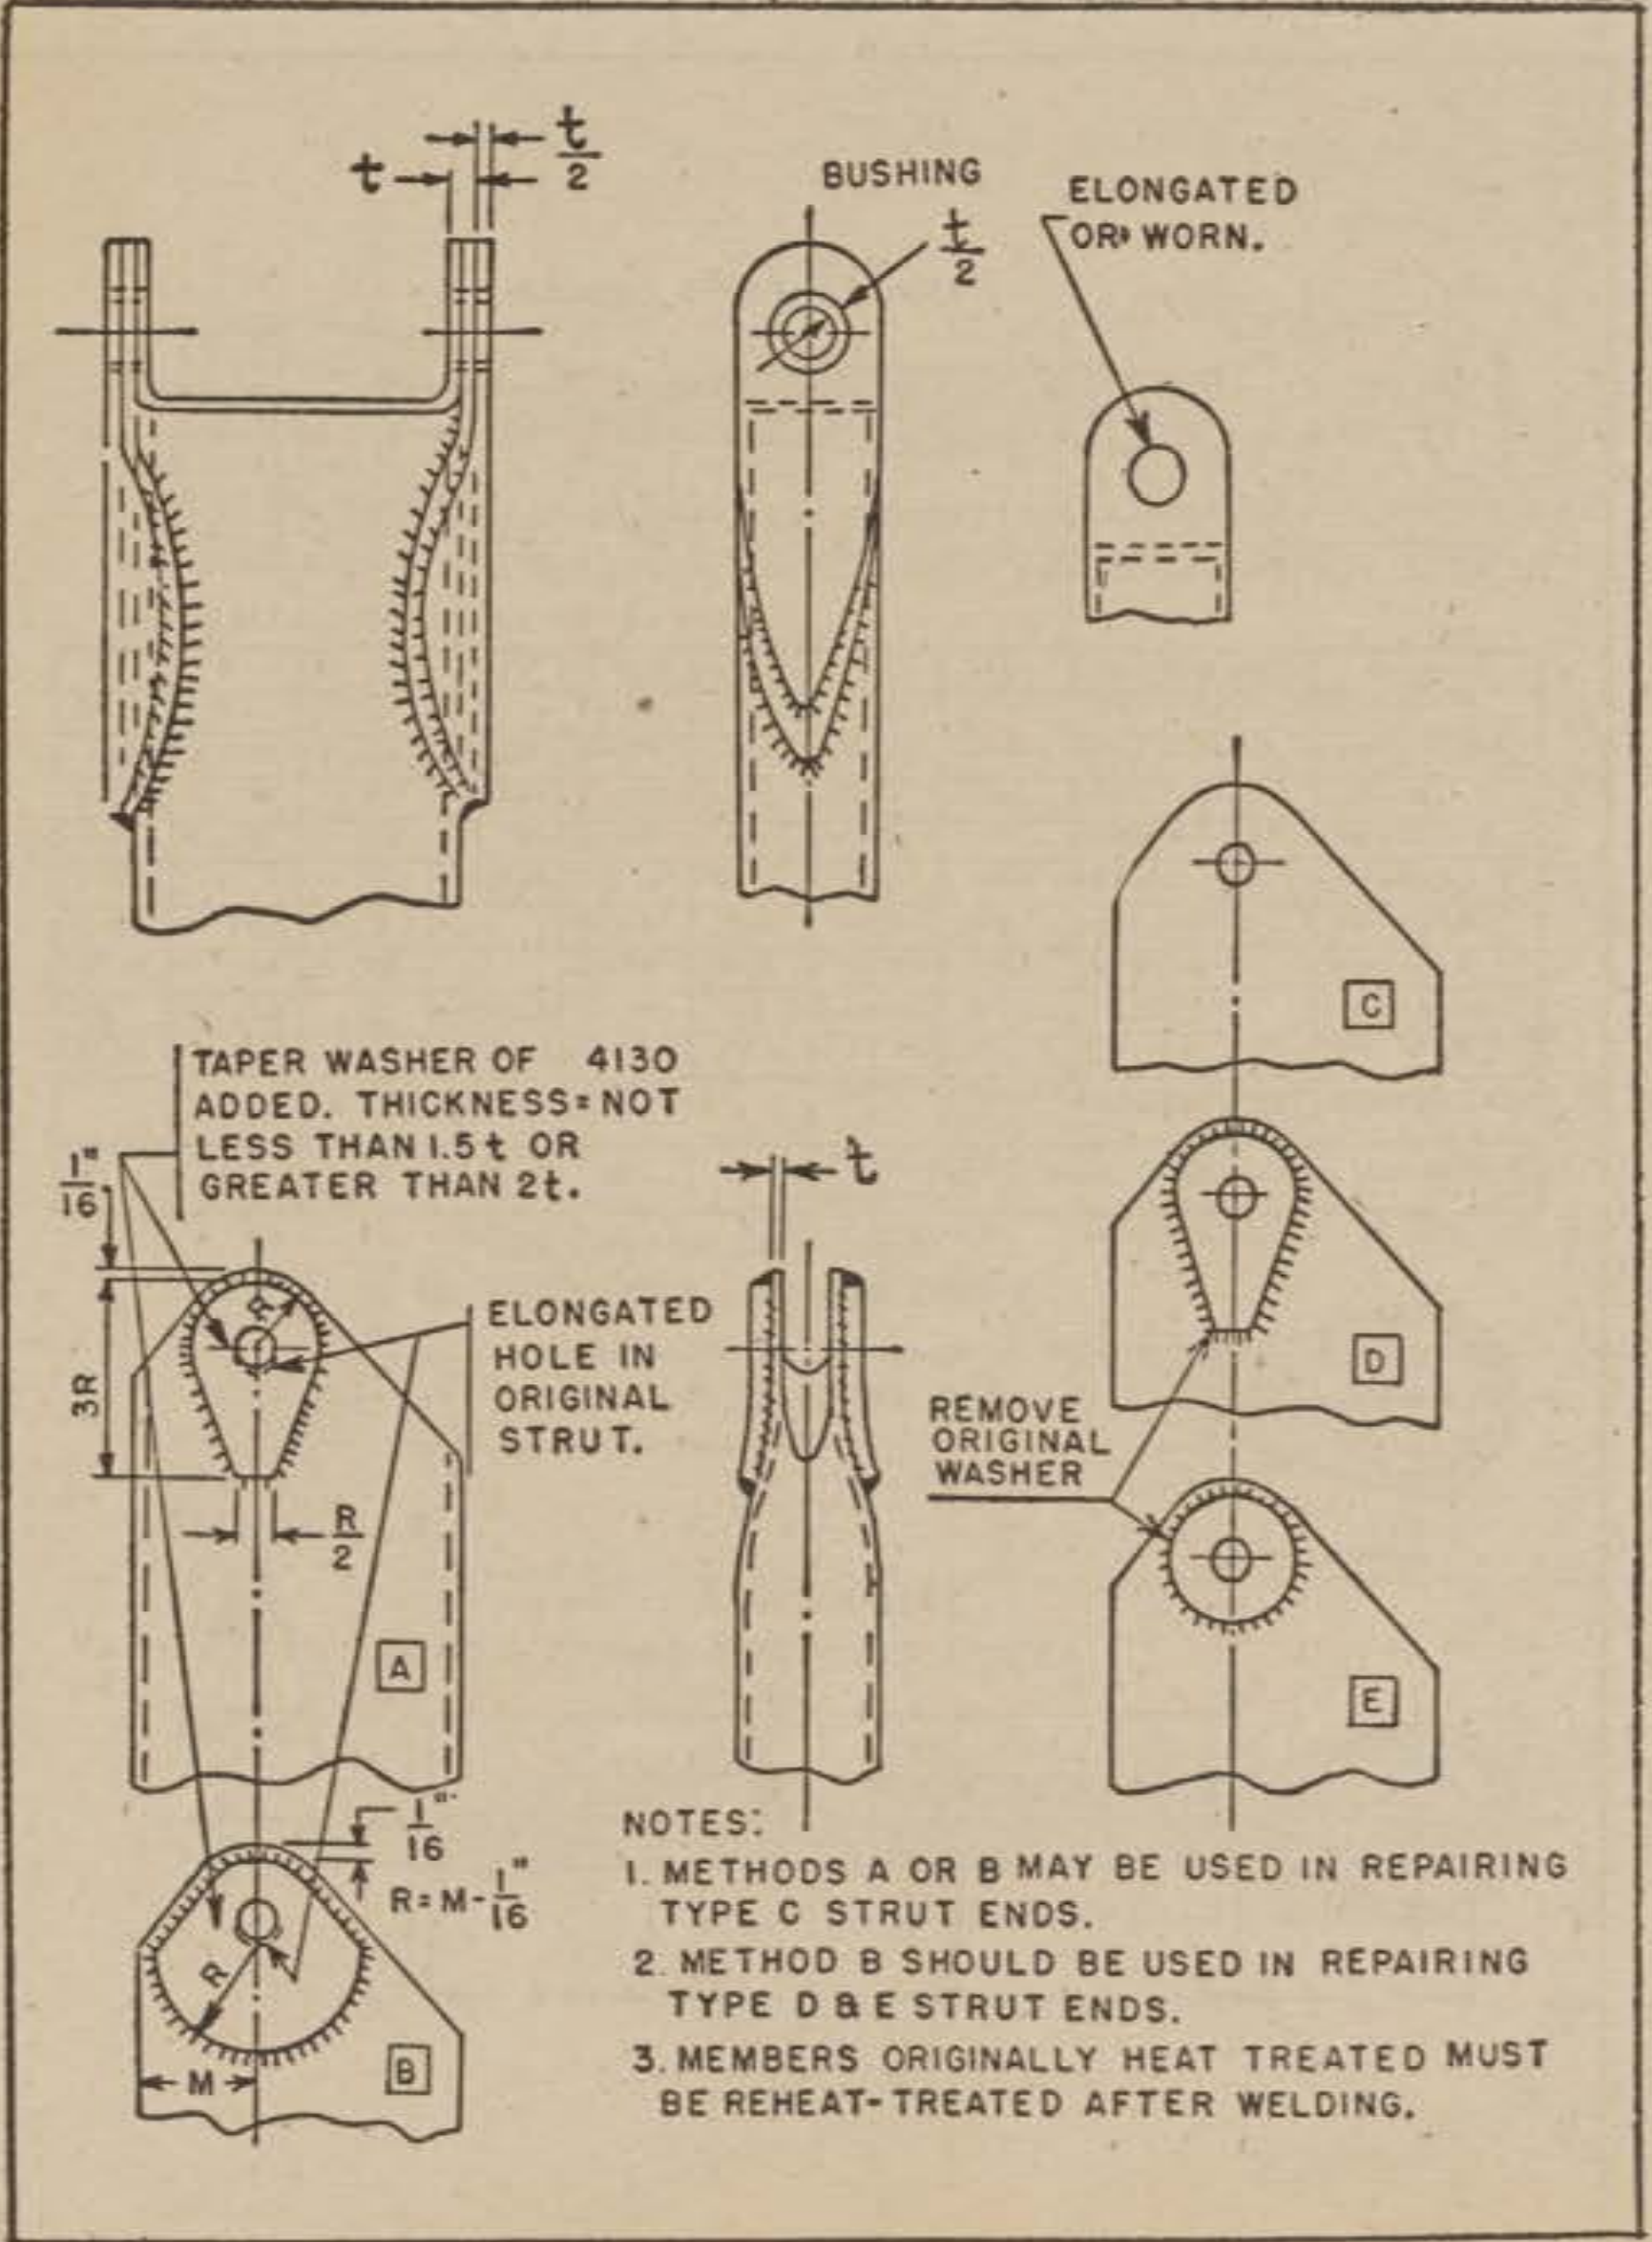
t
t/2
BUSHING
t/2
ELONGATED OR WORN.
TAPER WASHER OF 4130 ADDED. THICKNESS = NOT LESS THAN 1.5 t OR GREATER THAN 2t.
1"/16
3R
ELONGATED HOLE IN ORIGINAL STRUT.
R/2
A
1"/16
R = M - 1"/16
R
M
B
t
C
D
E
REMOVE ORIGINAL WASHER

NOTES:

1. METHODS A OR B MAY BE USED IN REPAIRING TYPE C STRUT ENDS.
2. METHOD B SHOULD BE USED IN REPAIRING TYPE D & E STRUT ENDS.
3. MEMBERS ORIGINALLY HEAT TREATED MUST BE REHEAT-TREATED AFTER WELDING.

FIGURE 4-29—Typical methods of repairing elongated or worn bolt holes.

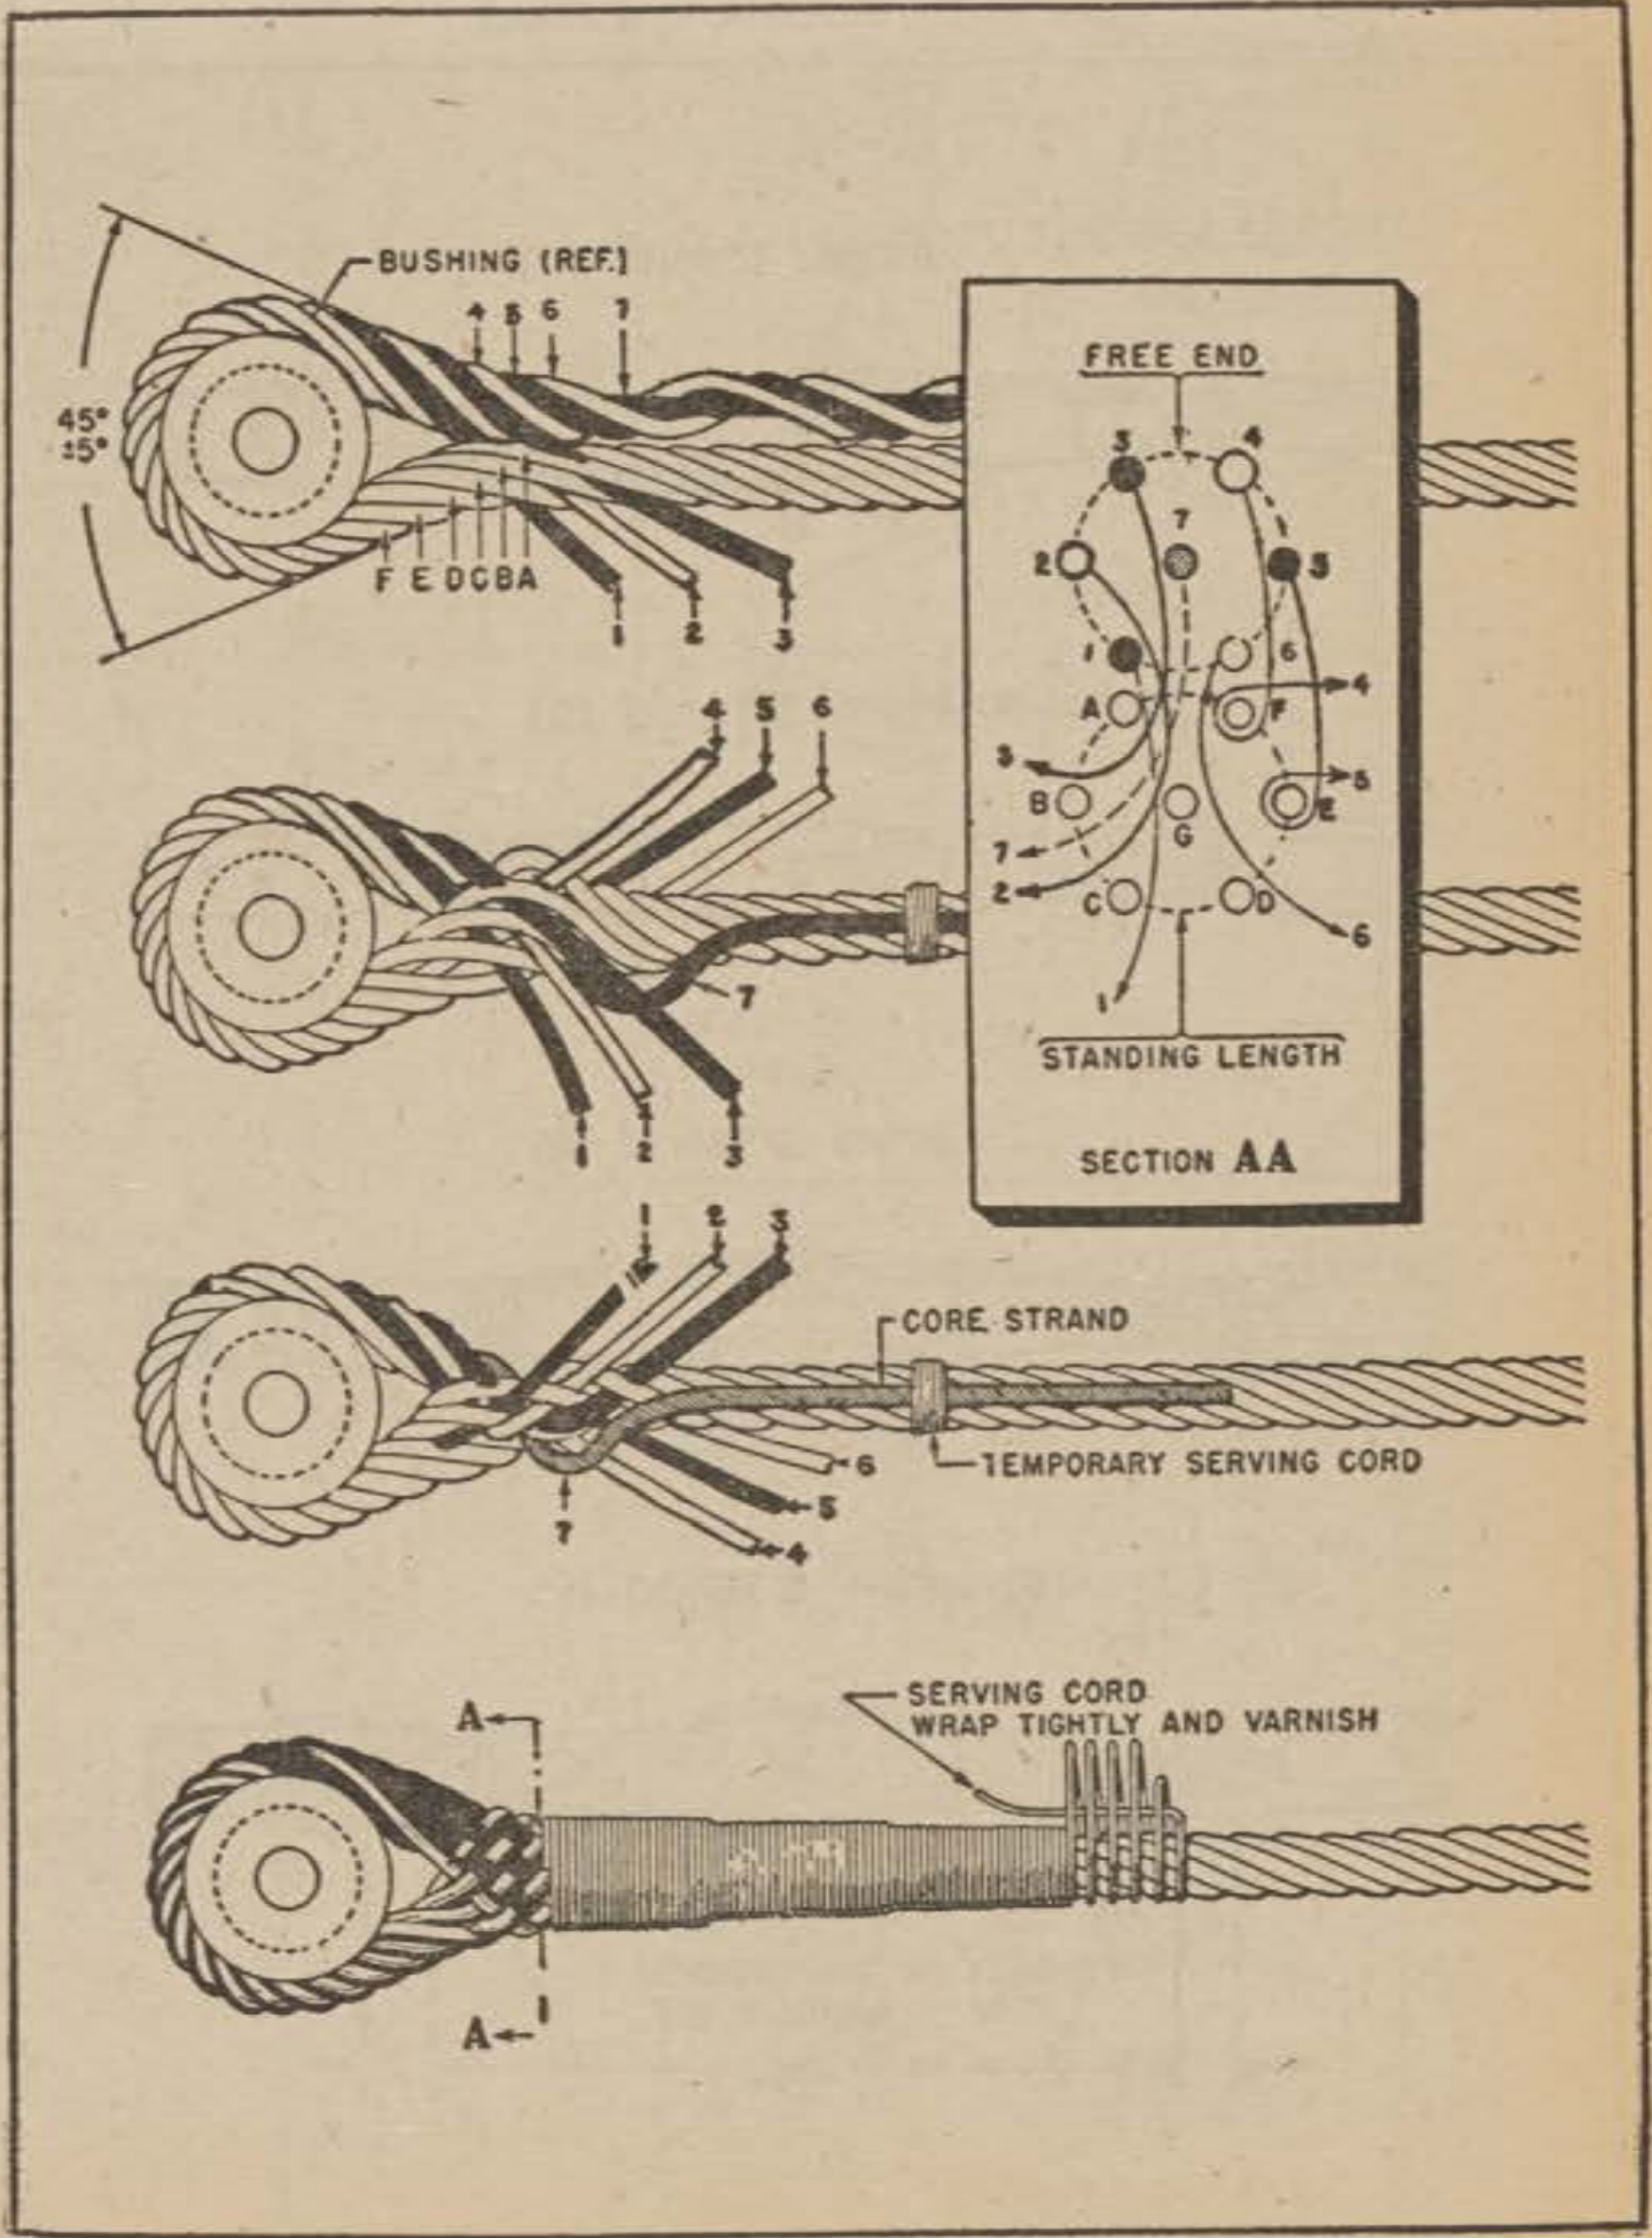

FIGURE 5-1—Preparation of a woven cable splice.

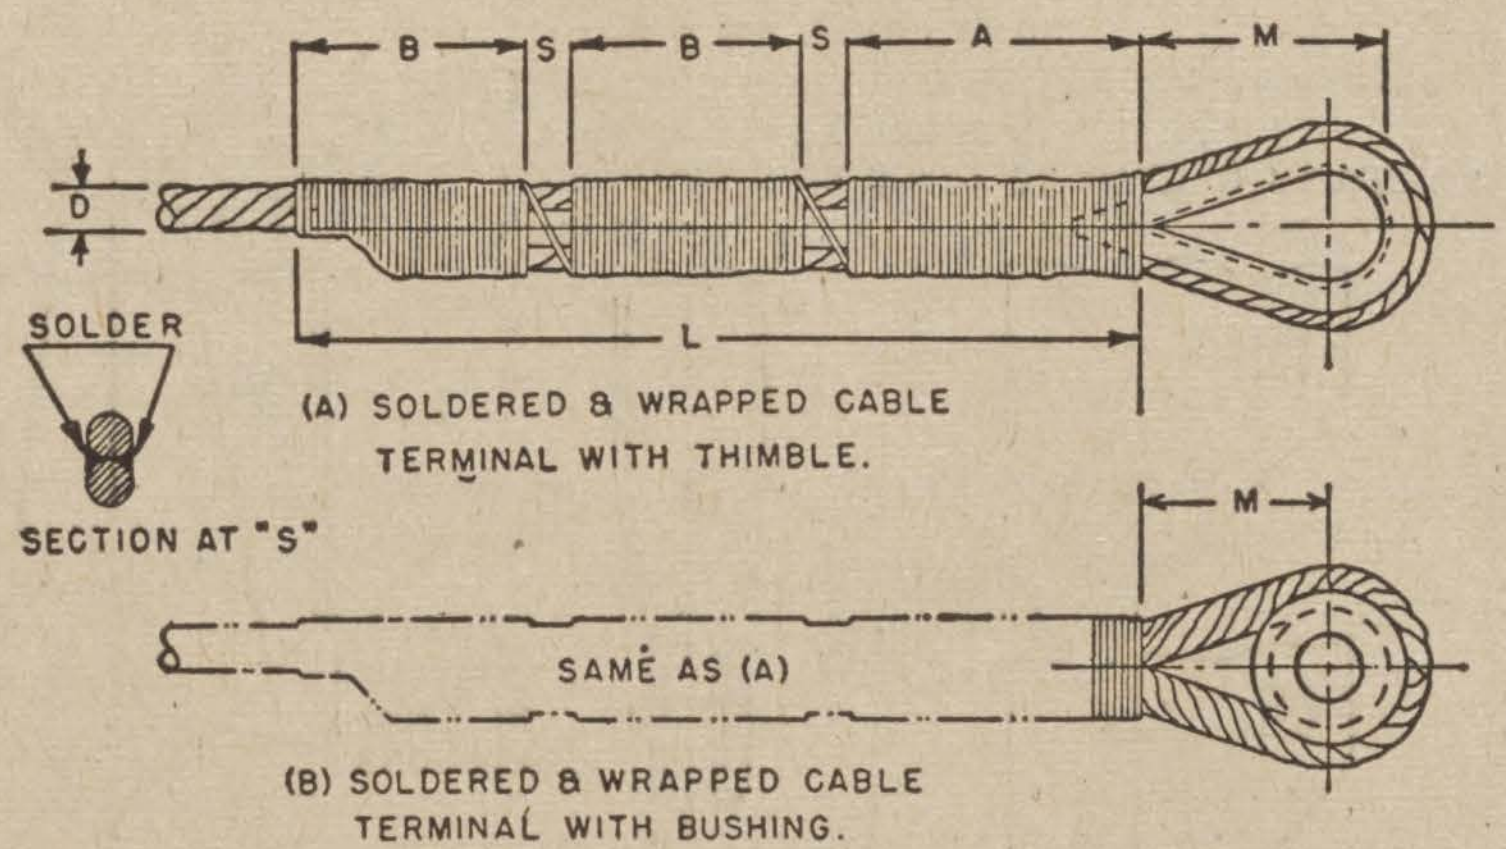

(A) SOLDERED & WRAPPED CABLE TERMINAL WITH THIMBLE.

(B) SOLDERED & WRAPPED CABLE TERMINAL WITH BUSHING.

| D | L | A | B | M | S | WRAPPING WIRE #48-19* | | SPECIFICATION NO. | |
|---|---|---|---|---|---|---|---|---|---|
| | | PLUS OR MINUS 1/32" | | | | DIA. INCH. | APPROX. LENGTH | THIMBLE (A) | BUSHING (B) |
| 3/32 | 2-1/4 | 3/4 | 5/8 | 3/4 | 1/8 | .020 | 37" | AN-100-3 | AN-111-3 |
| 1/8 | 2-3/4 | 1 | 3/4 | 3/4 | 1/8 | .025 | 58" | AN-100-4 | AN-111-4 |
| 5/32 | 3-3/8 | 1-1/8 | 1 | 7/8 | 1/8 | .025 | 82" | AN-100-5 | AN-111-5 |
| 3/16 | 3-5/8 | 1-1/4 | 1 | 1-1/8 | 3/16 | .035 | 109" | AN-100-6 | AN-111-6 |
| 7/32 | 4 | 1-3/8 | 1-1/8 | 1-1/4 | 3/16 | .035 | —— | AN-100-7 | AN-111-7 |
| 1/4 | 4-1/2 | 1-1/2 | 1-1/4 | 1-1/2 | 1/4 | .035 | 159" | AN-100-8 | AN-111-8 |
| 5/16 | 5-1/4 | 1-3/4 | 1-1/2 | 1-7/8 | 1/4 | .050 | 195" | AN-100-10 | AN-111-10 |
| 3/8 | 6-1/4 | 2-1/4 | 1-3/4 | 2-1/8 | 1/4 | .050 | —— | AN-100-12 | AN-111-12 |
| 7/16 | 7 | 2-1/2 | 2 | 2-1/2 | 1/4 | .050 | —— | AN-100-14 | —— |
| 1/2 | 8 | 2-3/4 | 2-1/4 | 2-7/8 | 3/8 | .050 | —— | AN-100-16 | —— |

*ARMY SPECIFICATION- AN-QQ-W-435

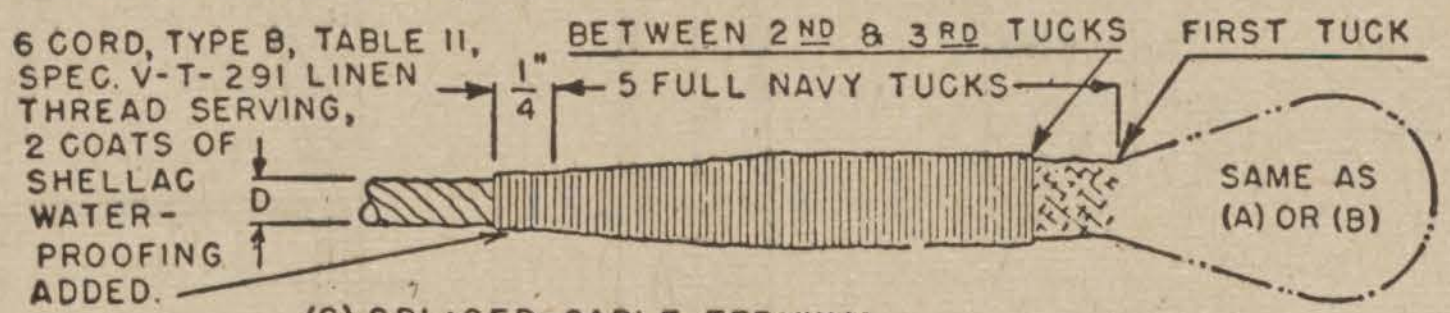
6 CORD, TYPE B, TABLE II, SPEC. V-T-291 LINEN THREAD SERVING, 2 COATS OF SHELLAC WATER-PROOFING ADDED.
1/4"
5 FULL NAVY TUCKS
BETWEEN 2ND & 3RD TUCKS
FIRST TUCK
D
SAME AS (A) OR (B)

(C) SPLICED CABLE TERMINAL

FIGURE 5-2—Wrapped or spliced cable terminals.

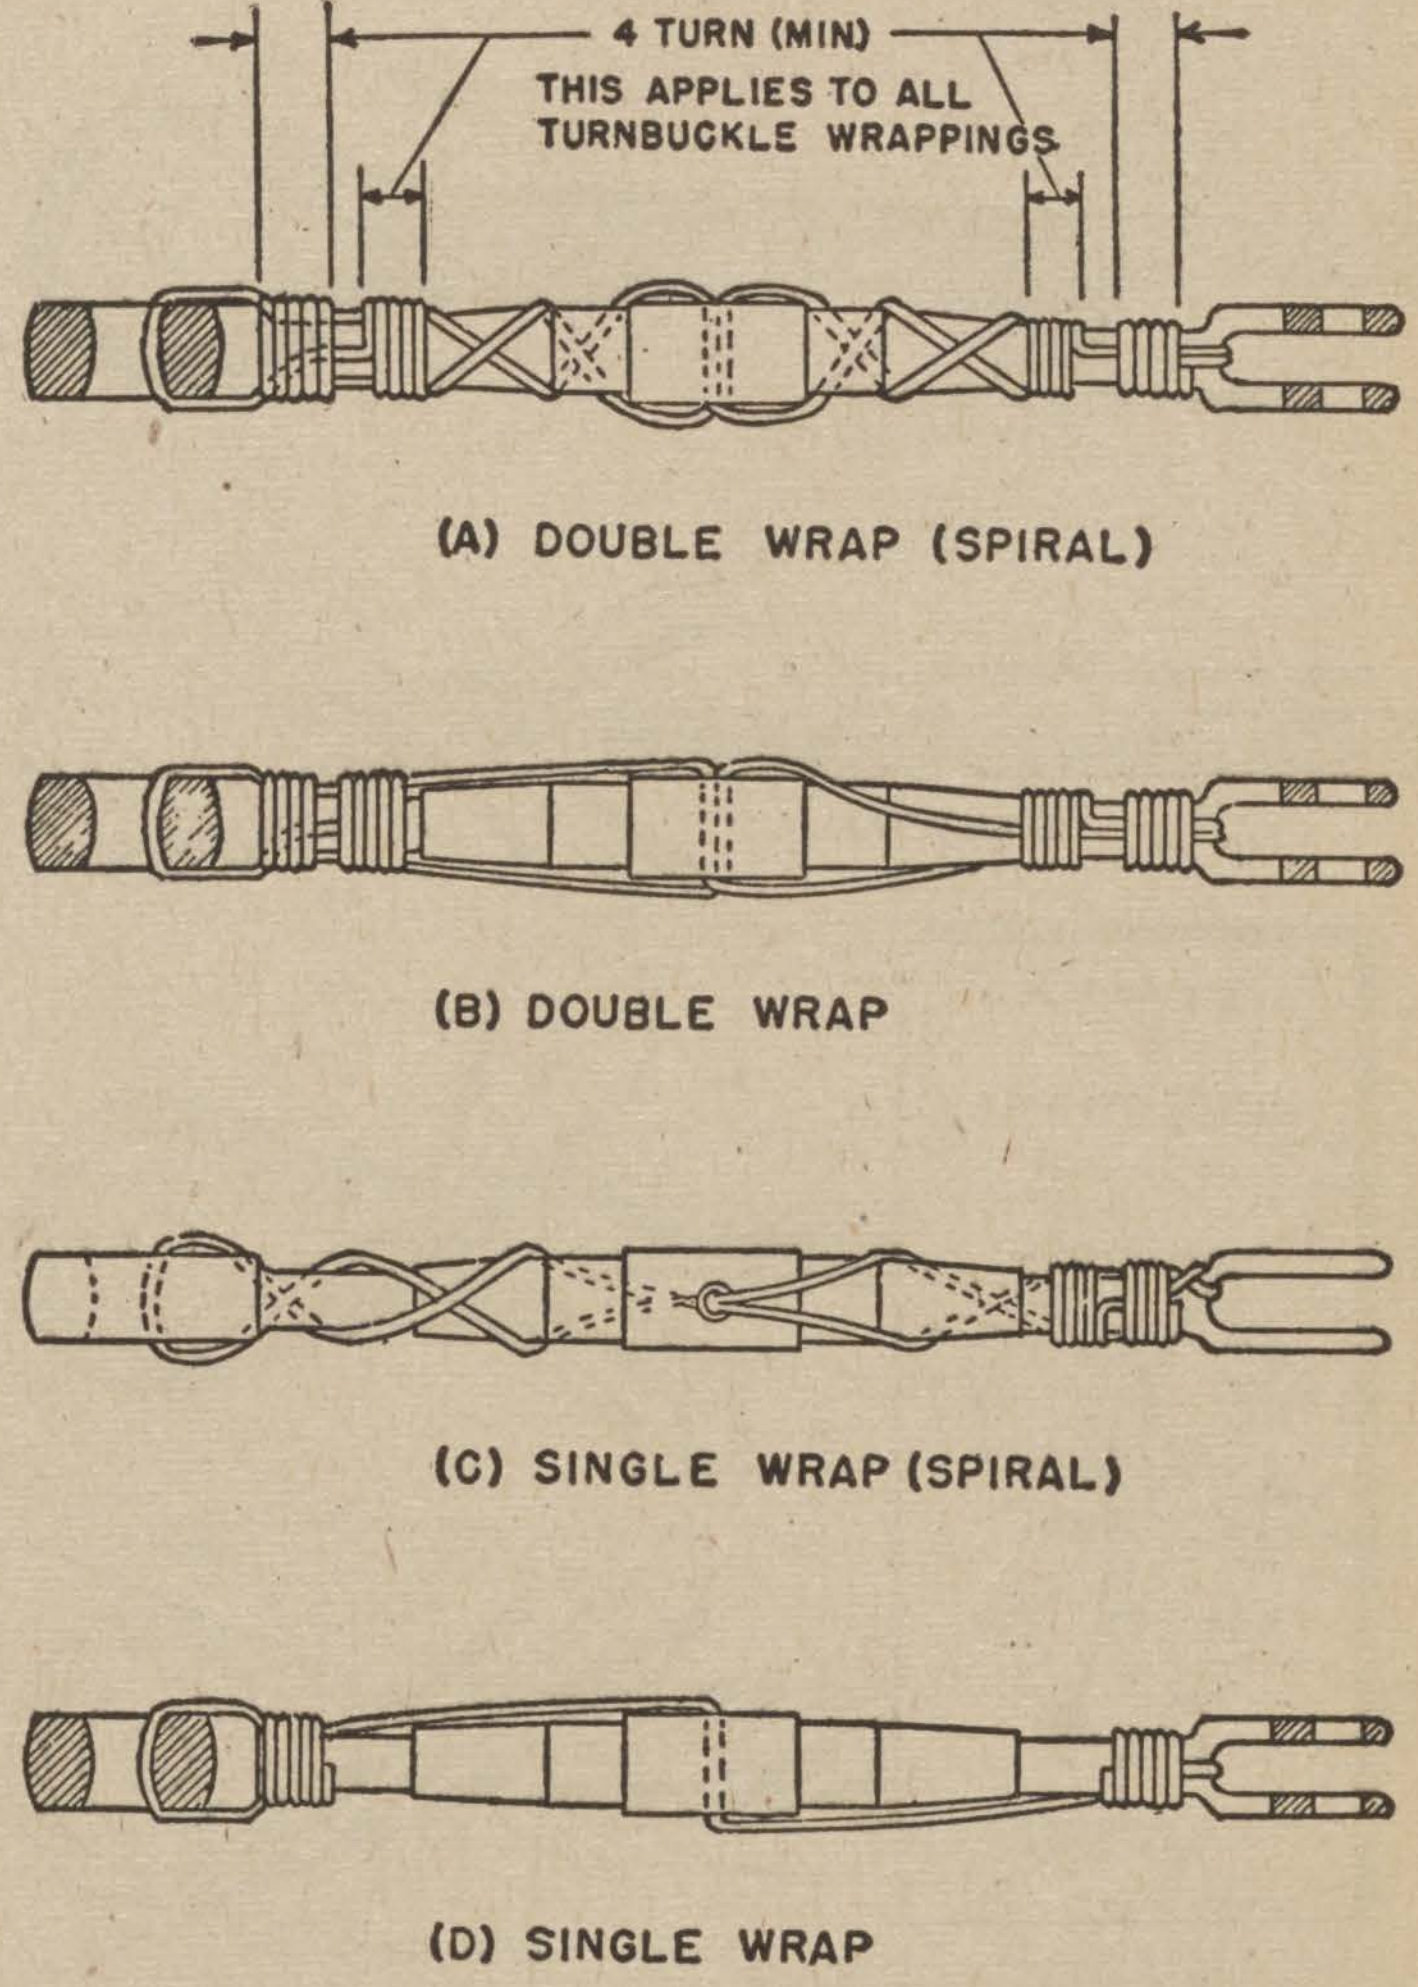

(A) DOUBLE WRAP (SPIRAL)

(B) DOUBLE WRAP

(C) SINGLE WRAP (SPIRAL)

(D) SINGLE WRAP

FIGURE 5-3—Safetying turnbuckles.

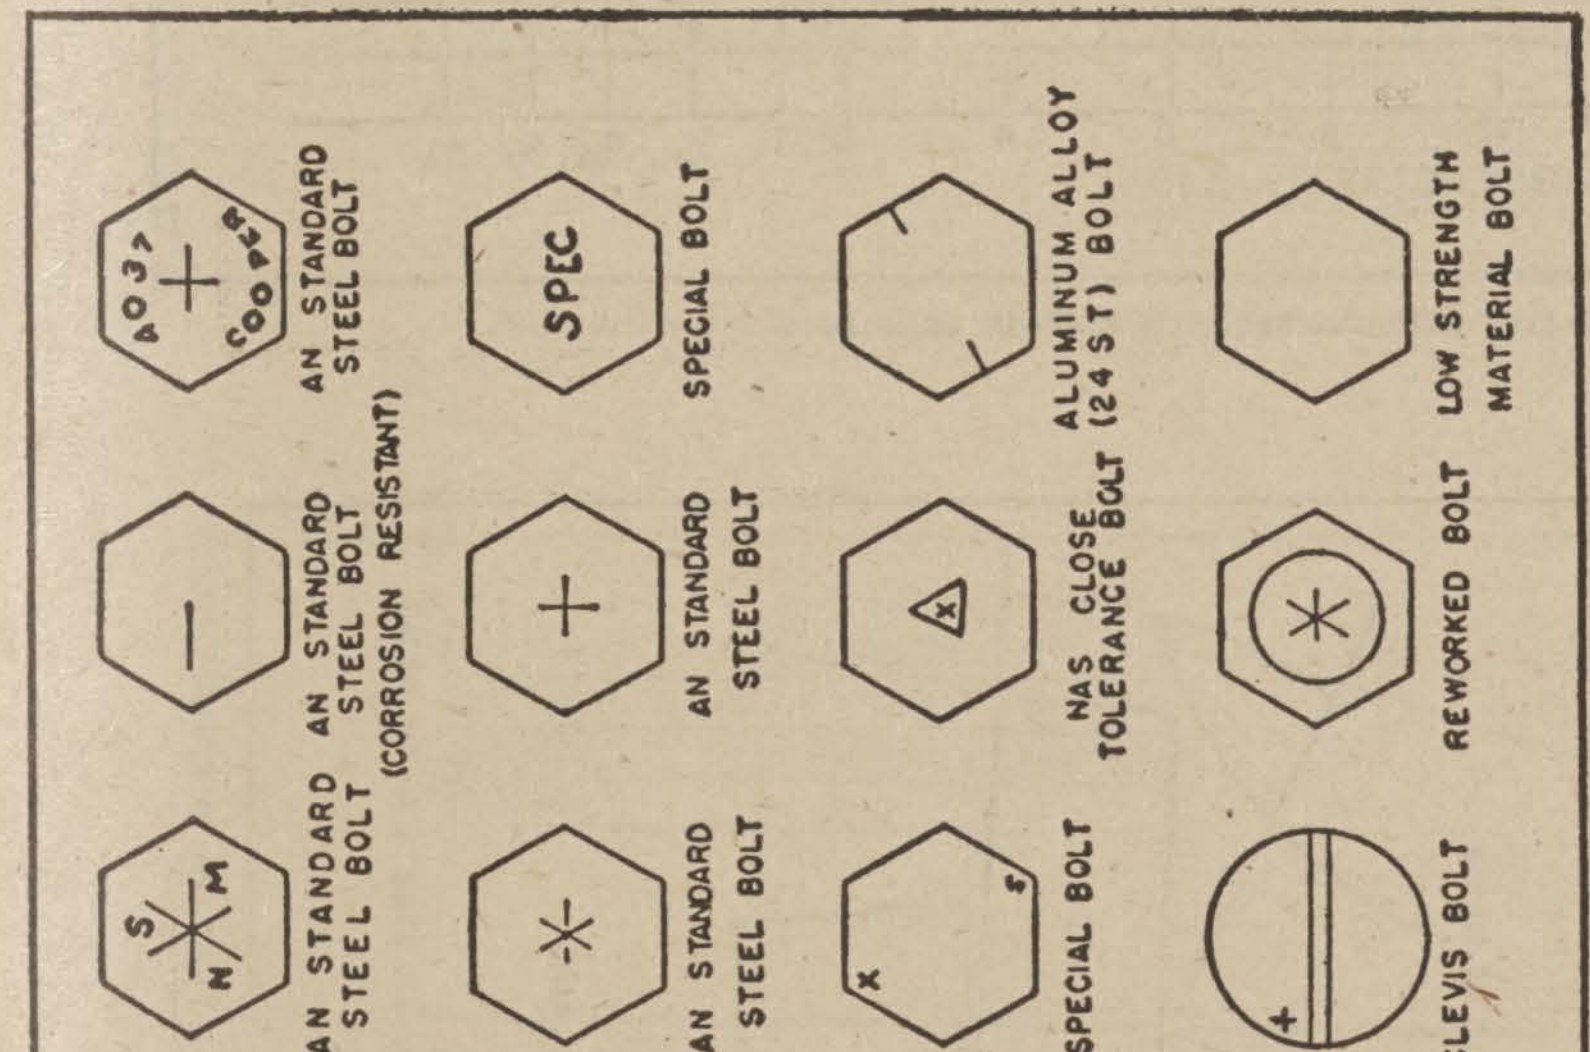

FIGURE 6-1—Bolt identification.

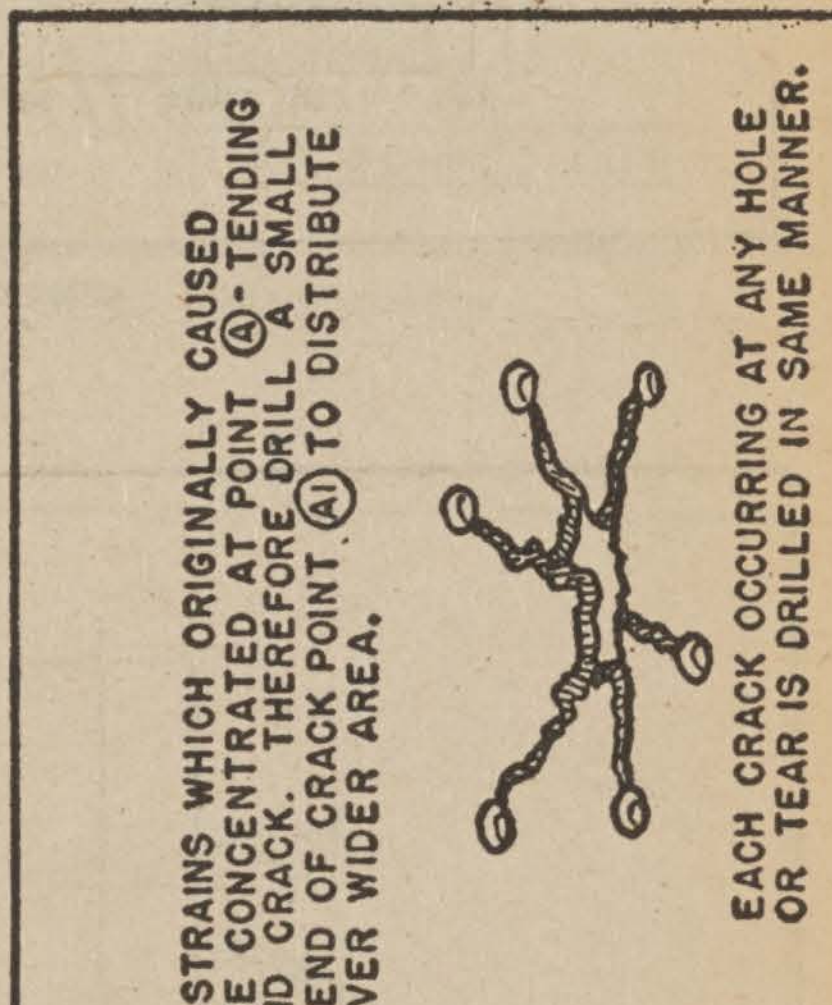
A
ALL THE STRAINS WHICH ORIGINALLY CAUSED CRACK ARE CONCENTRATED AT POINT Ⓐ- TENDING TO EXTEND CRACK. THEREFORE DRILL A SMALL HOLE AT END OF CRACK POINT (A1) TO DISTRIBUTE STRAIN OVER WIDER AREA.
A1
EACH CRACK OCCURRING AT ANY HOLE OR TEAR IS DRILLED IN SAME MANNER.

FIGURE 10-1—Stop-drilling cracks.

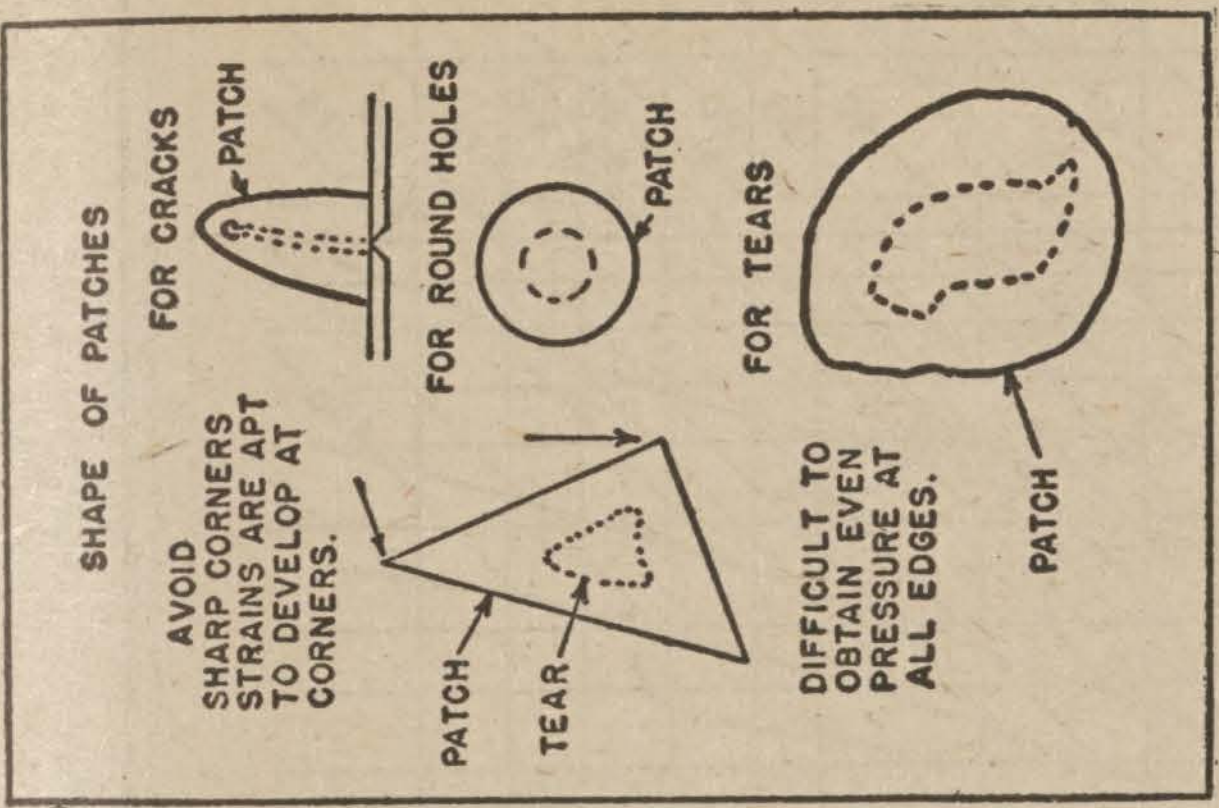
SHAPE OF PATCHES
AVOID SHARP CORNERS STRAINS ARE APT TO DEVELOP AT CORNERS.
PATCH
TEAR
FOR CRACKS
PATCH
FOR ROUND HOLES
PATCH
FOR TEARS
DIFFICULT TO OBTAIN EVEN PRESSURE AT ALL EDGES.
PATCH

FIGURE 10-2—Surface patches.

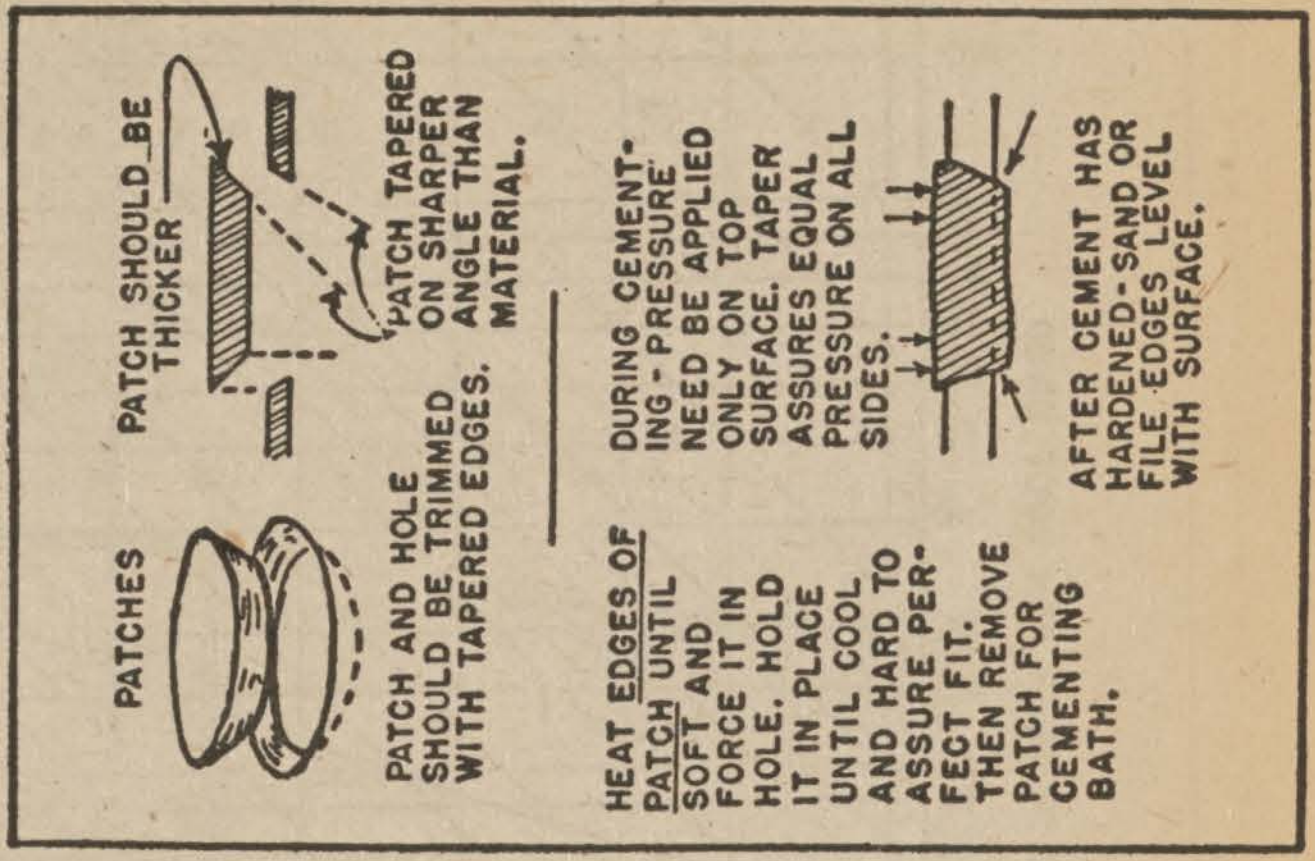
PATCHES
PATCH SHOULD BE THICKER
PATCH AND HOLE SHOULD BE TRIMMED WITH TAPERED EDGES.
PATCH TAPERED ON SHARPER ANGLE THAN MATERIAL.
HEAT EDGES OF PATCH UNTIL SOFT AND FORCE IT IN HOLE. HOLD IT IN PLACE UNTIL COOL AND HARD TO ASSURE PERFECT FIT. THEN REMOVE PATCH FOR CEMENTING BATH.
DURING CEMENTING - PRESSURE NEED BE APPLIED ONLY ON TOP SURFACE. TAPER ASSURES EQUAL PRESSURE ON ALL SIDES.
AFTER CEMENT HAS HARDENED - SAND OR FILE EDGES LEVEL WITH SURFACE.

FIGURE 10-3—Plug-patch repair.

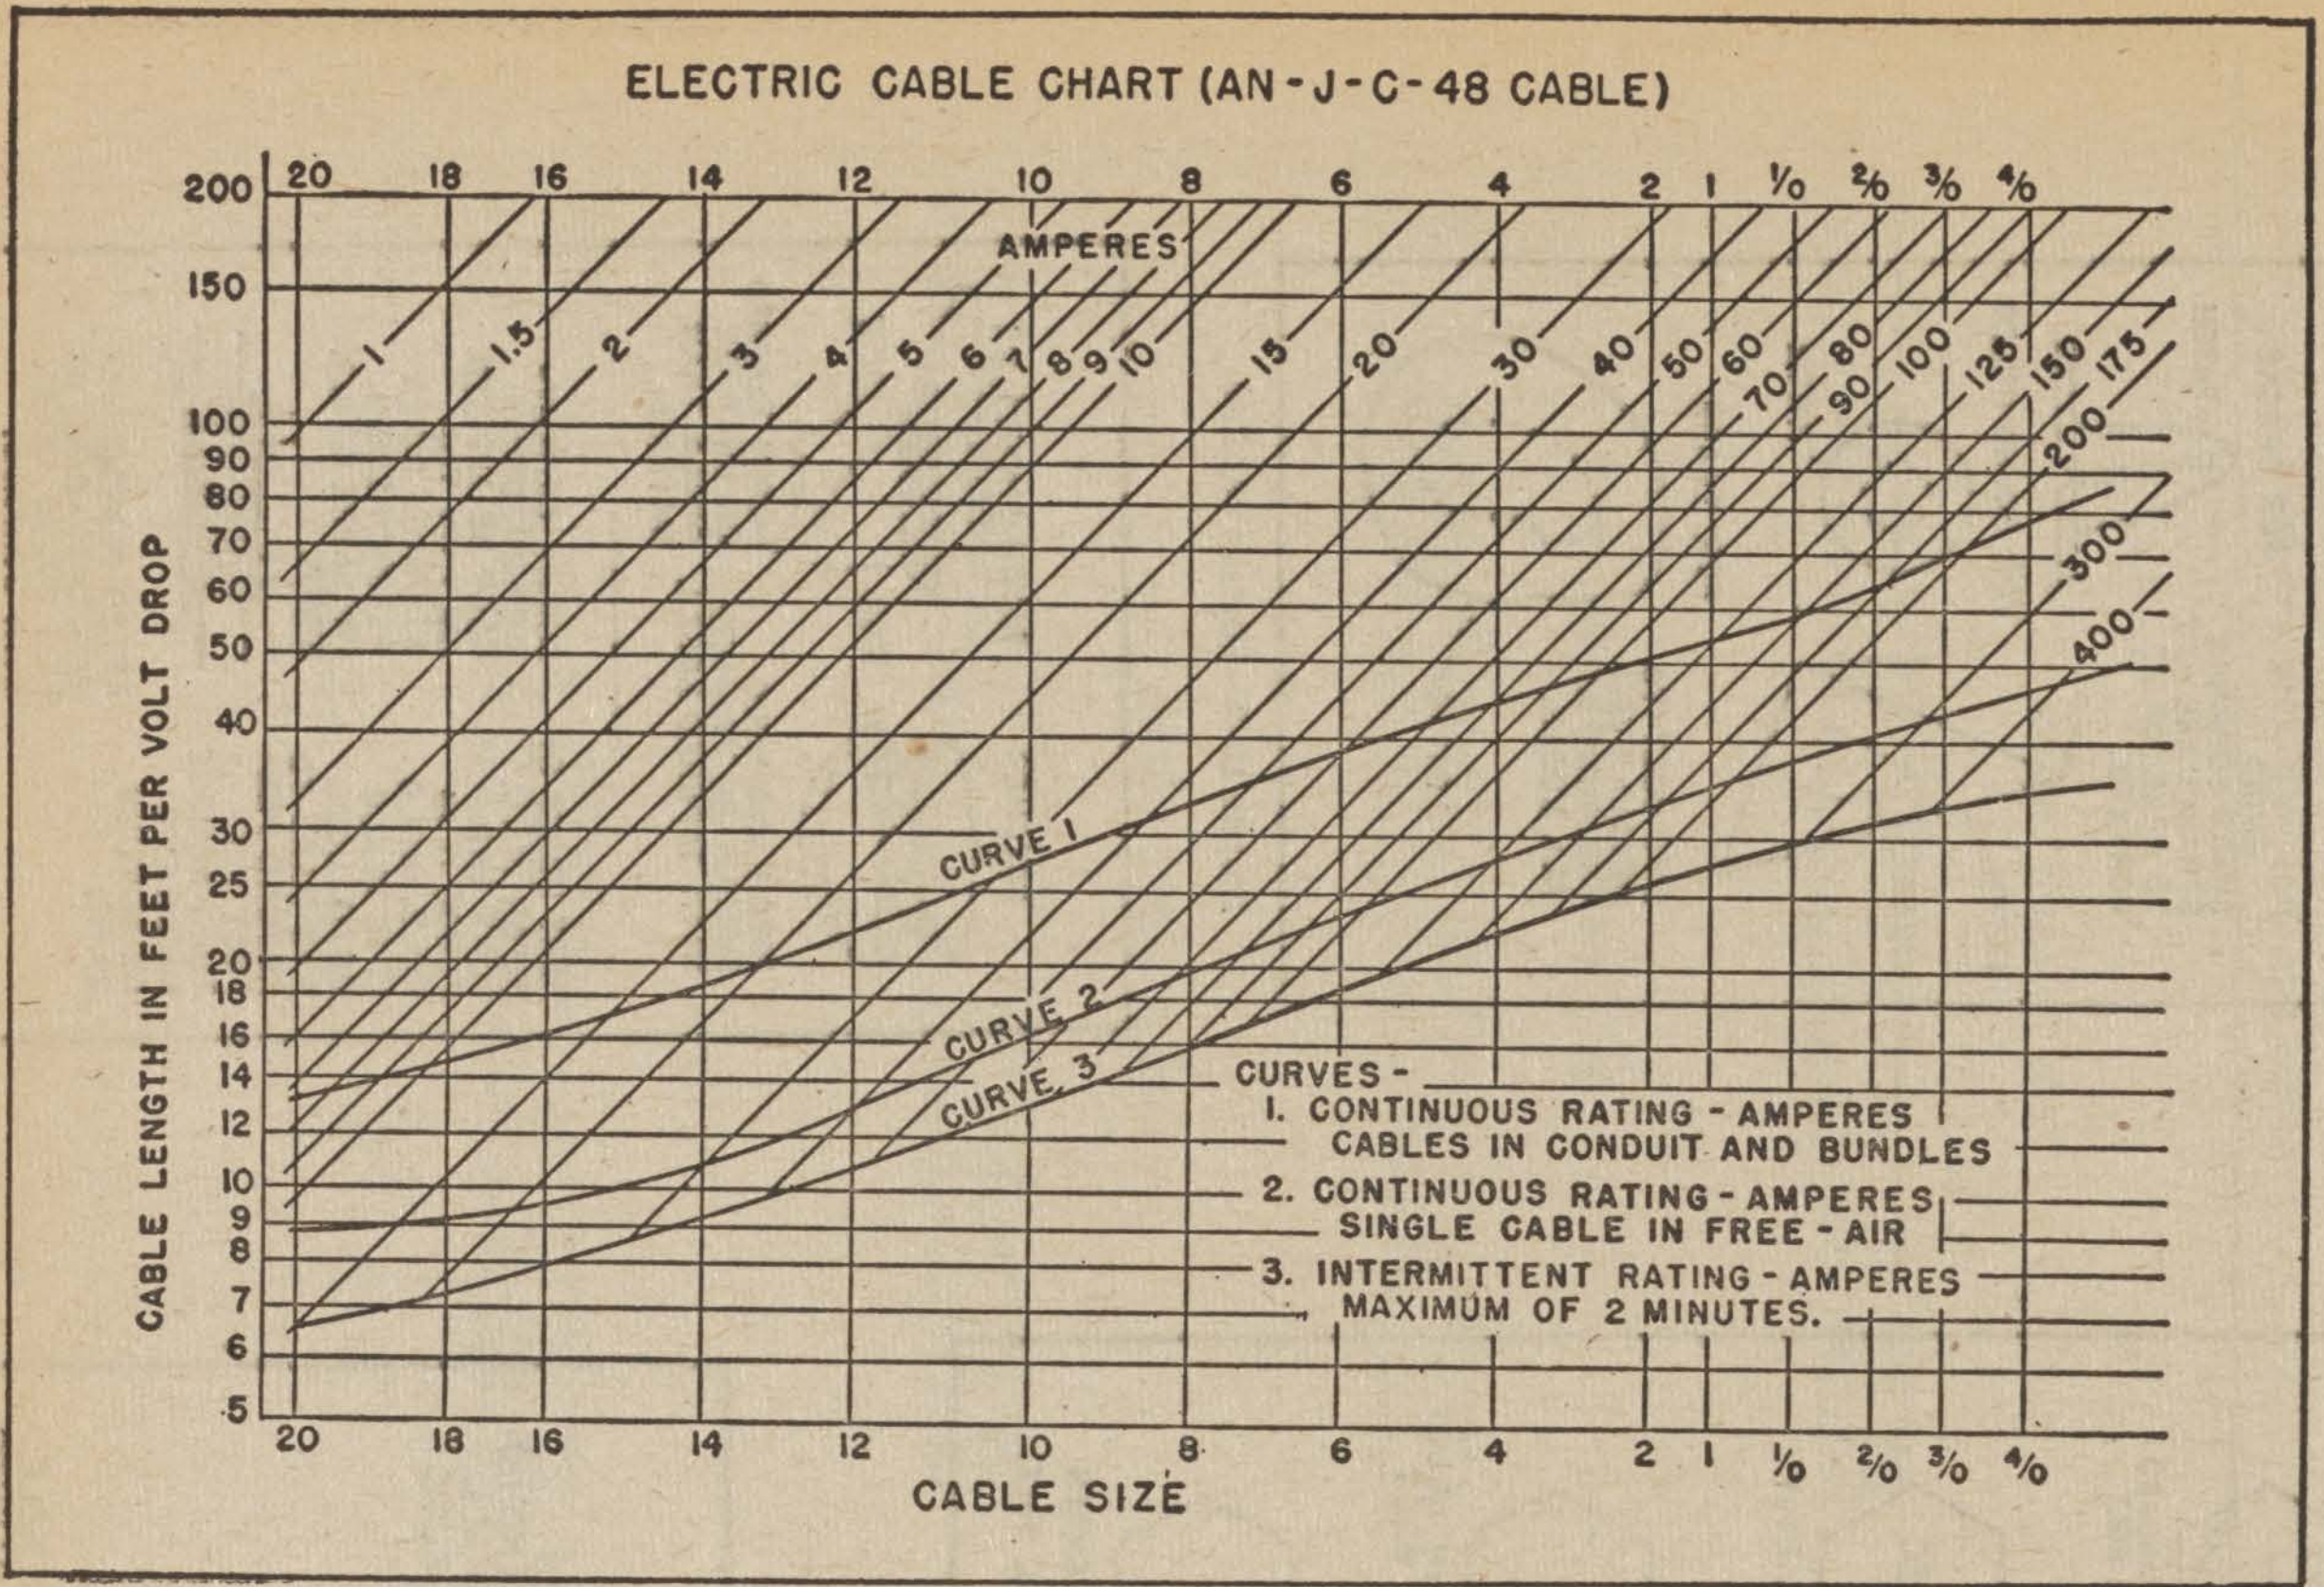

FIGURE 12-1—Electric cable chart (AN-S-C-48 cable).

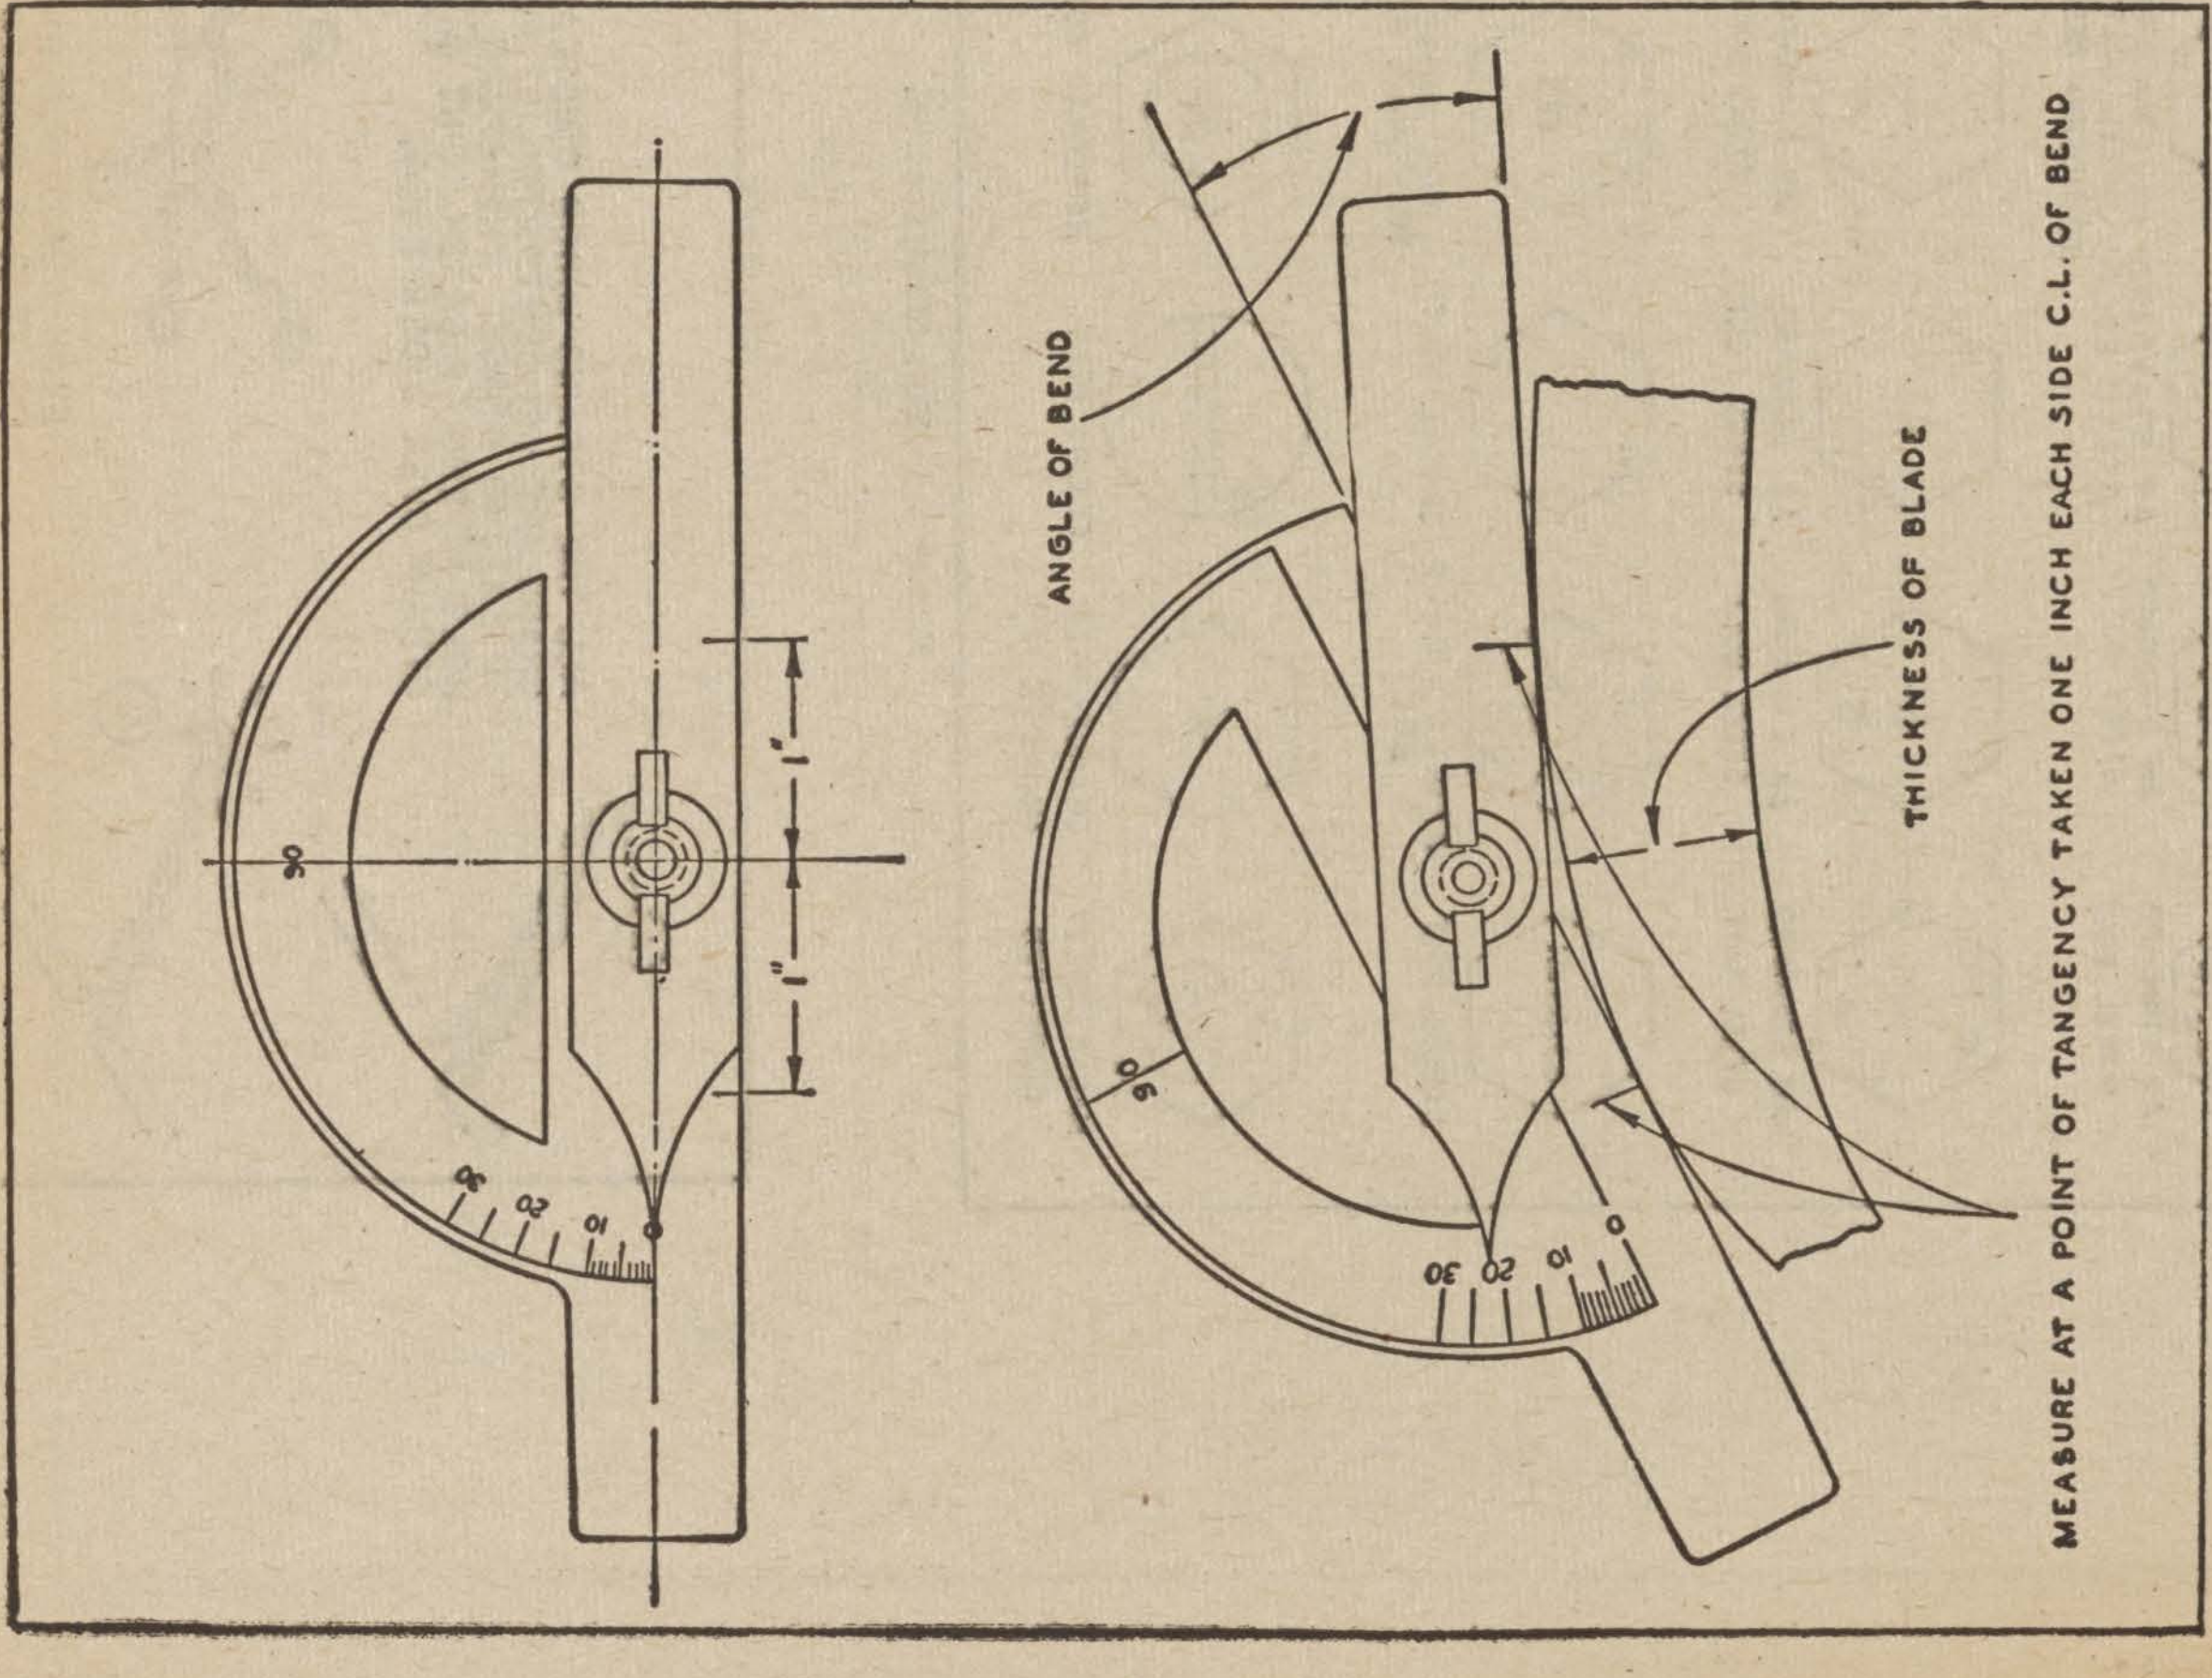
1"
1"
90
30
20
10
0
ANGLE OF BEND
THICKNESS OF BLADE
MEASURE AT A POINT OF TANGENCY TAKEN ONE INCH EACH SIDE C.L. OF BEND

FIGURE 15-1—Protractor and method of measuring angle of bend in aluminum-alloy propellers.

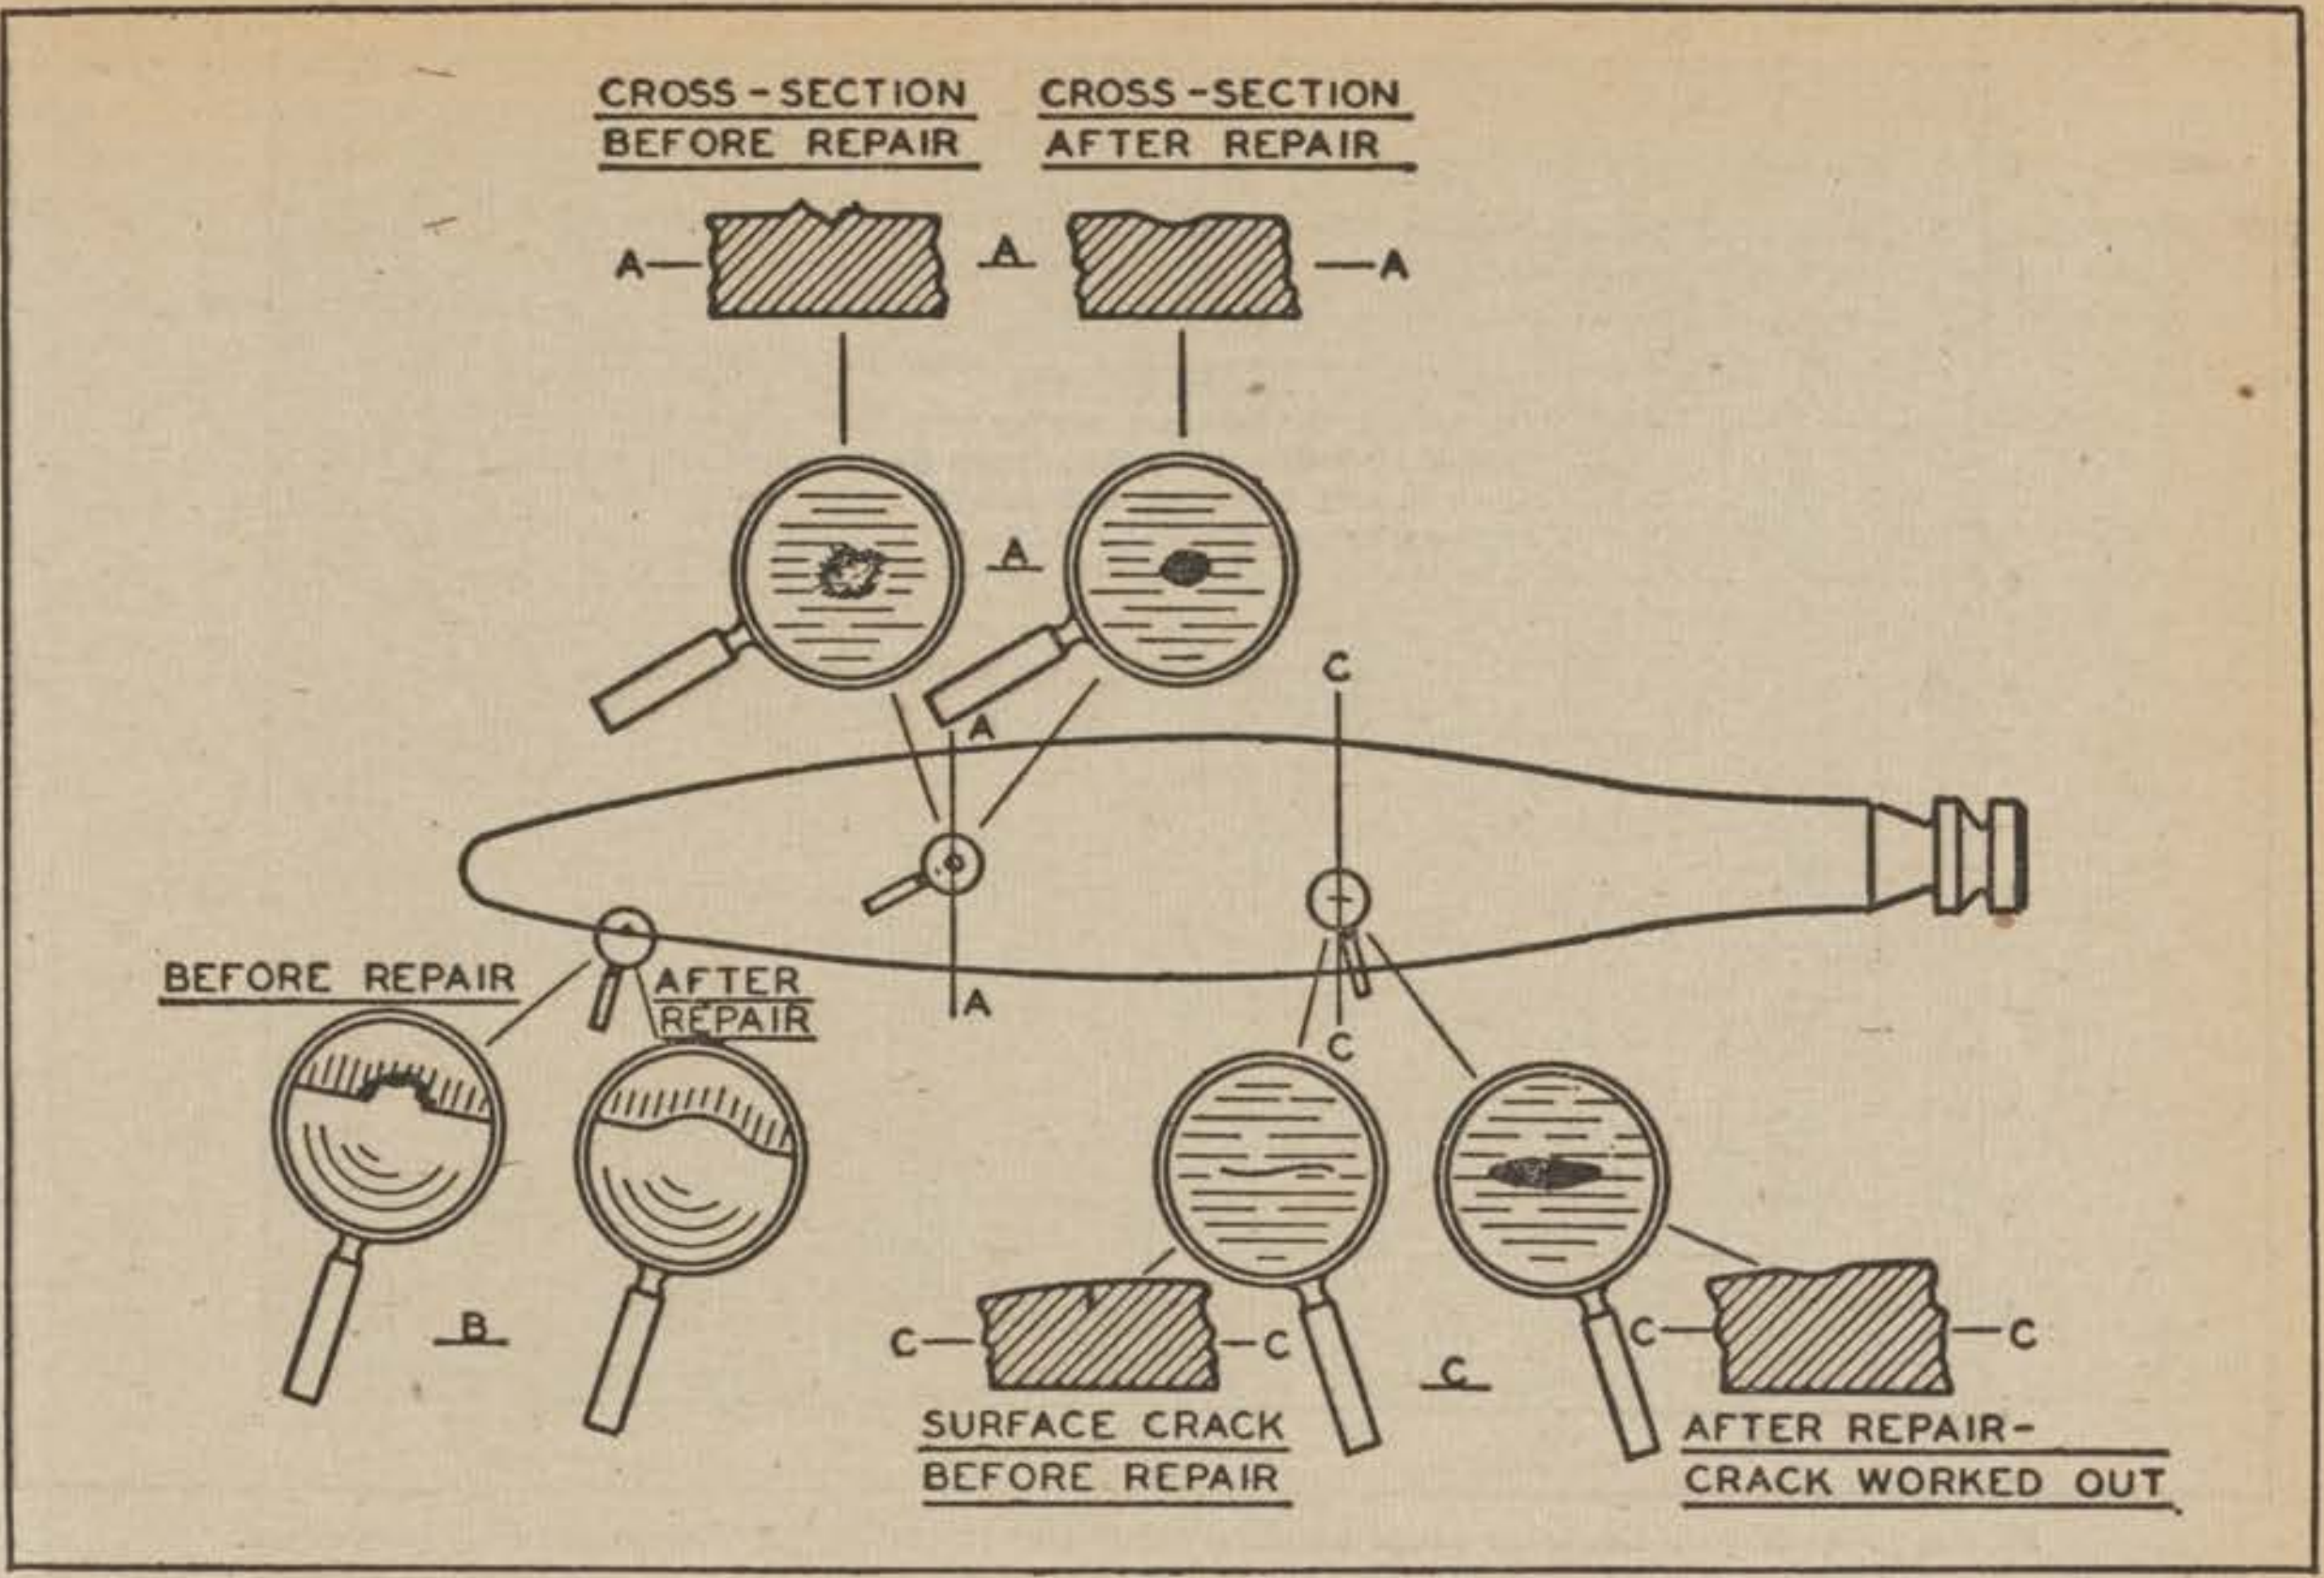
CROSS-SECTION BEFORE REPAIR
CROSS-SECTION AFTER REPAIR
A
A
A
A
A
A
C
BEFORE REPAIR
AFTER REPAIR
B
C
C
C
C
C
C
C
SURFACE CRACK BEFORE REPAIR
AFTER REPAIR- CRACK WORKED OUT

FIGURE 15-2—Method of repairing surface cracks, nicks, etc., on aluminum alloy propellers.

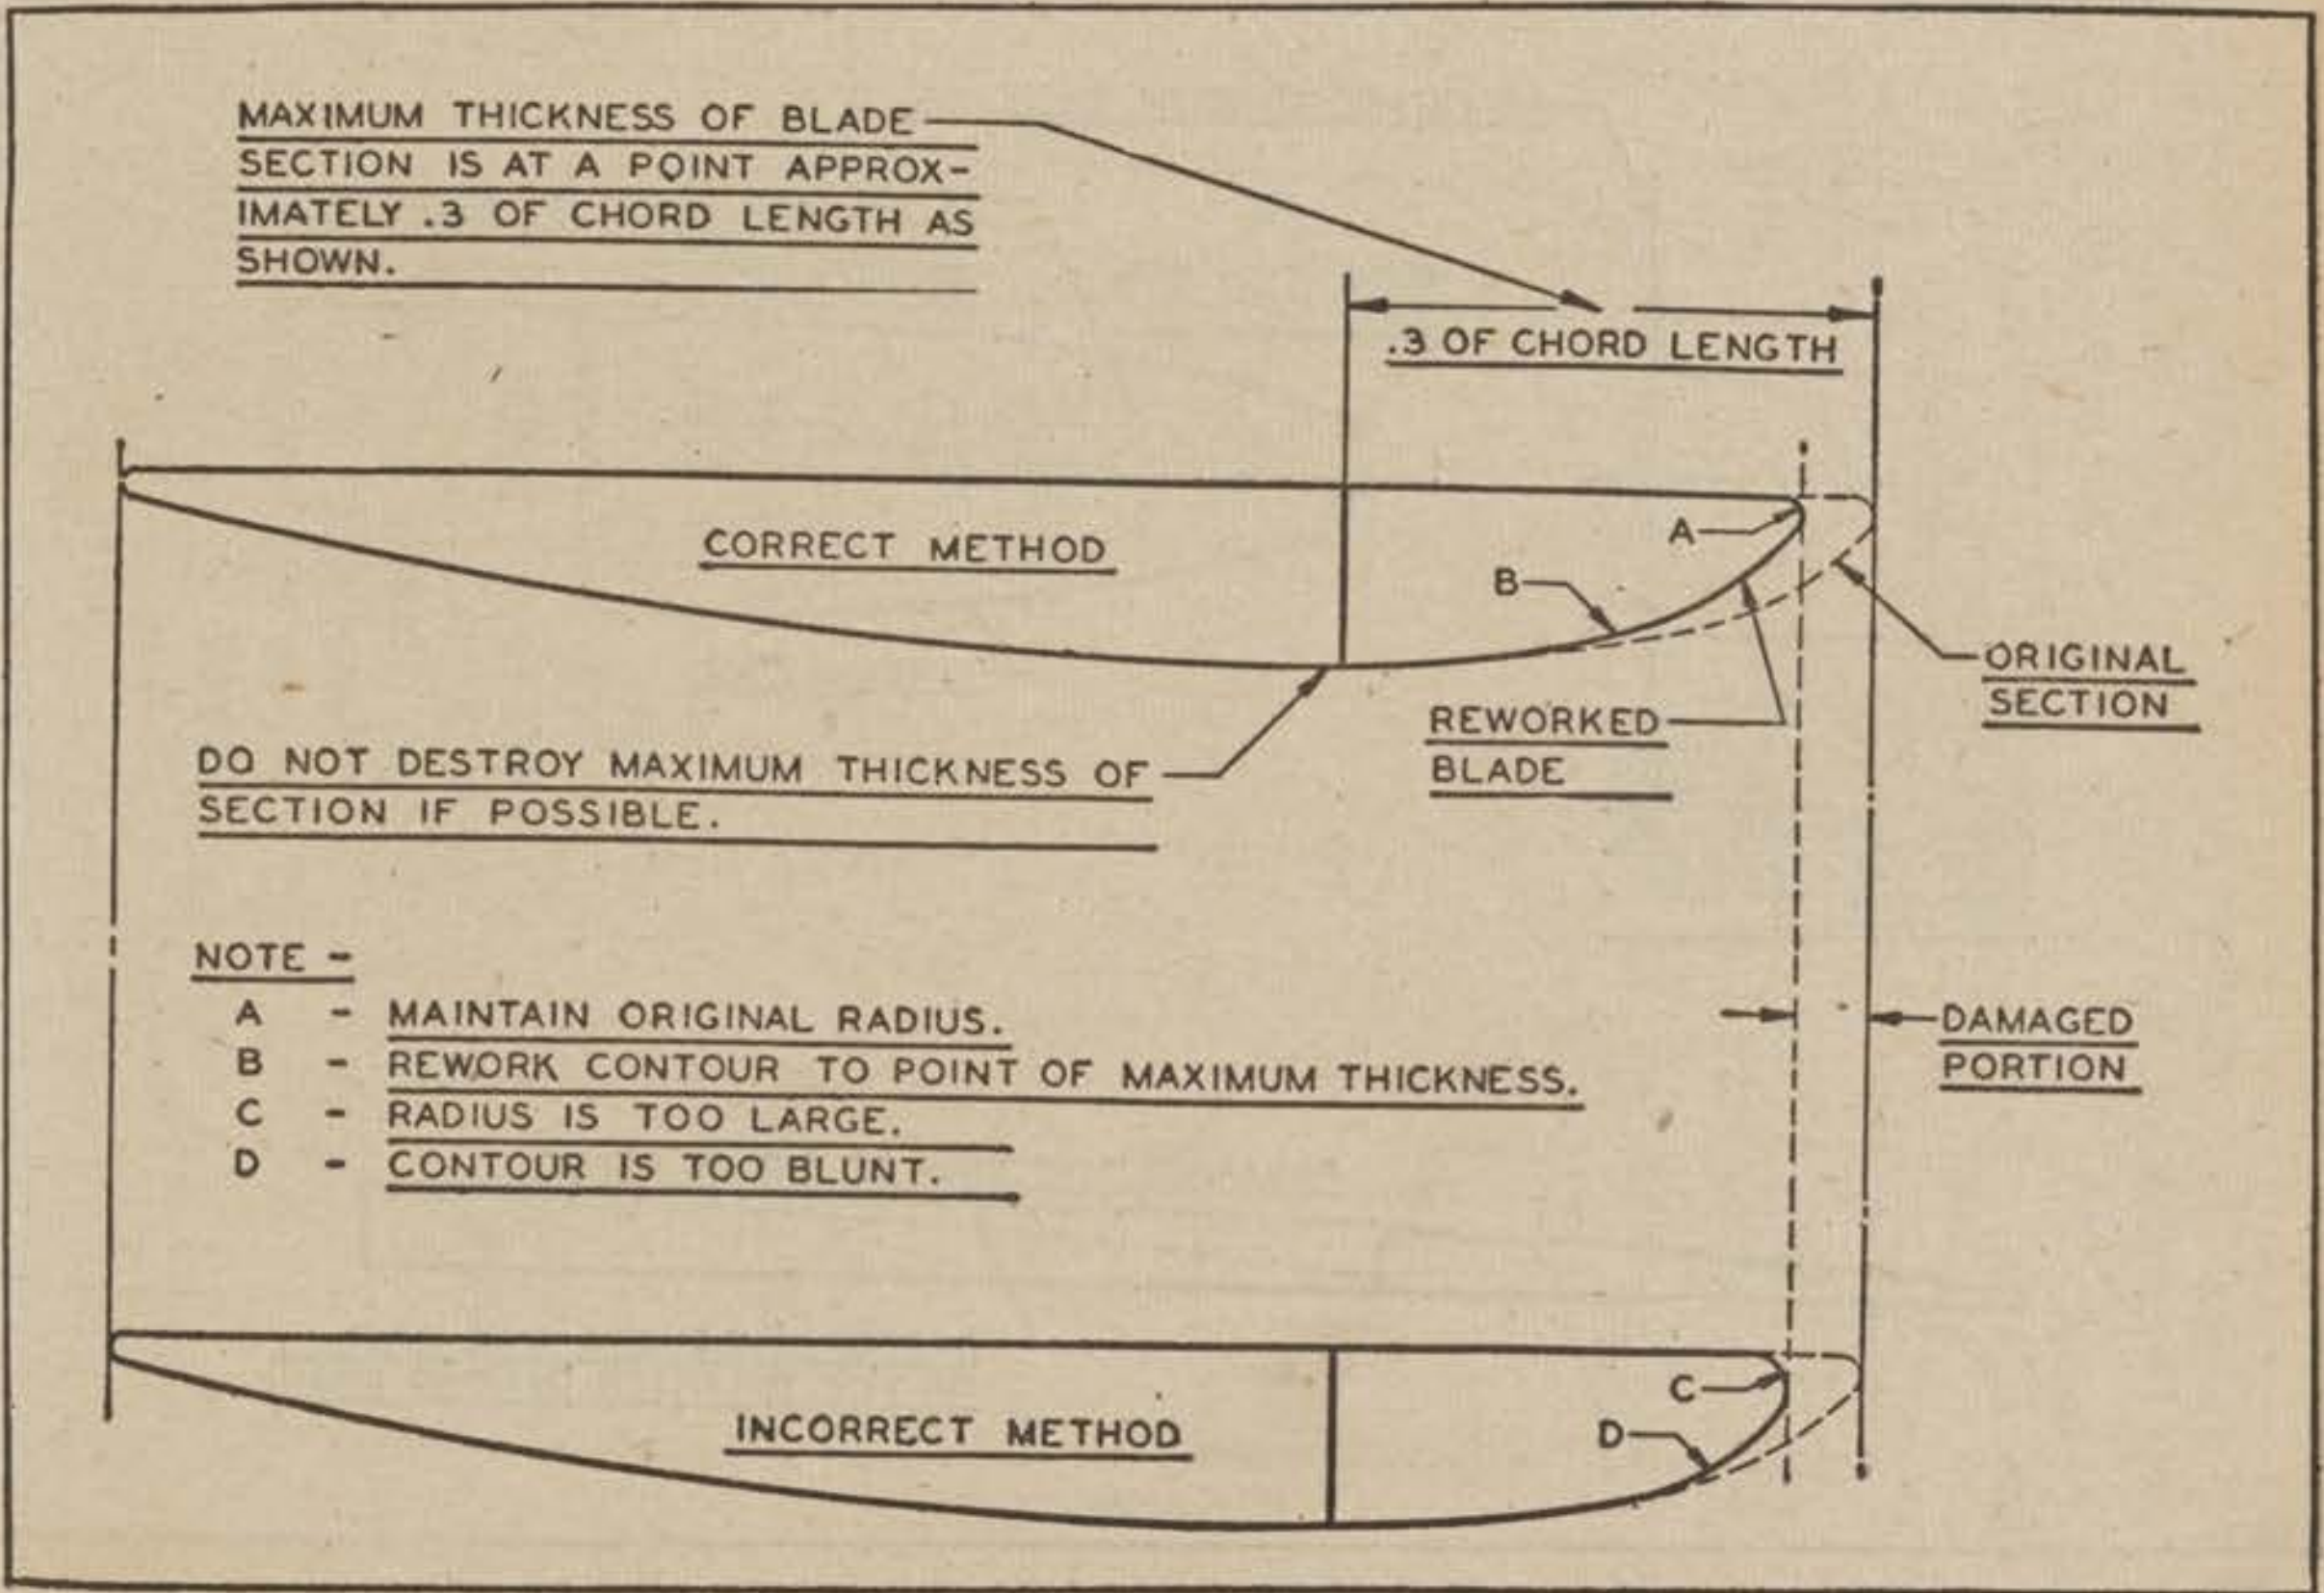
MAXIMUM THICKNESS OF BLADE SECTION IS AT A POINT APPROXIMATELY .3 OF CHORD LENGTH AS SHOWN.
.3 OF CHORD LENGTH
CORRECT METHOD
A
B
ORIGINAL SECTION
REWORKED BLADE
DO NOT DESTROY MAXIMUM THICKNESS OF SECTION IF POSSIBLE.
NOTE -
A - MAINTAIN ORIGINAL RADIUS.
B - REWORK CONTOUR TO POINT OF MAXIMUM THICKNESS.
C - RADIUS IS TOO LARGE.
D - CONTOUR IS TOO BLUNT.
DAMAGED PORTION
INCORRECT METHOD
C
D

FIGURE 15-3—Correct and incorrect method of reworking leading edge of aluminum alloy propellers.

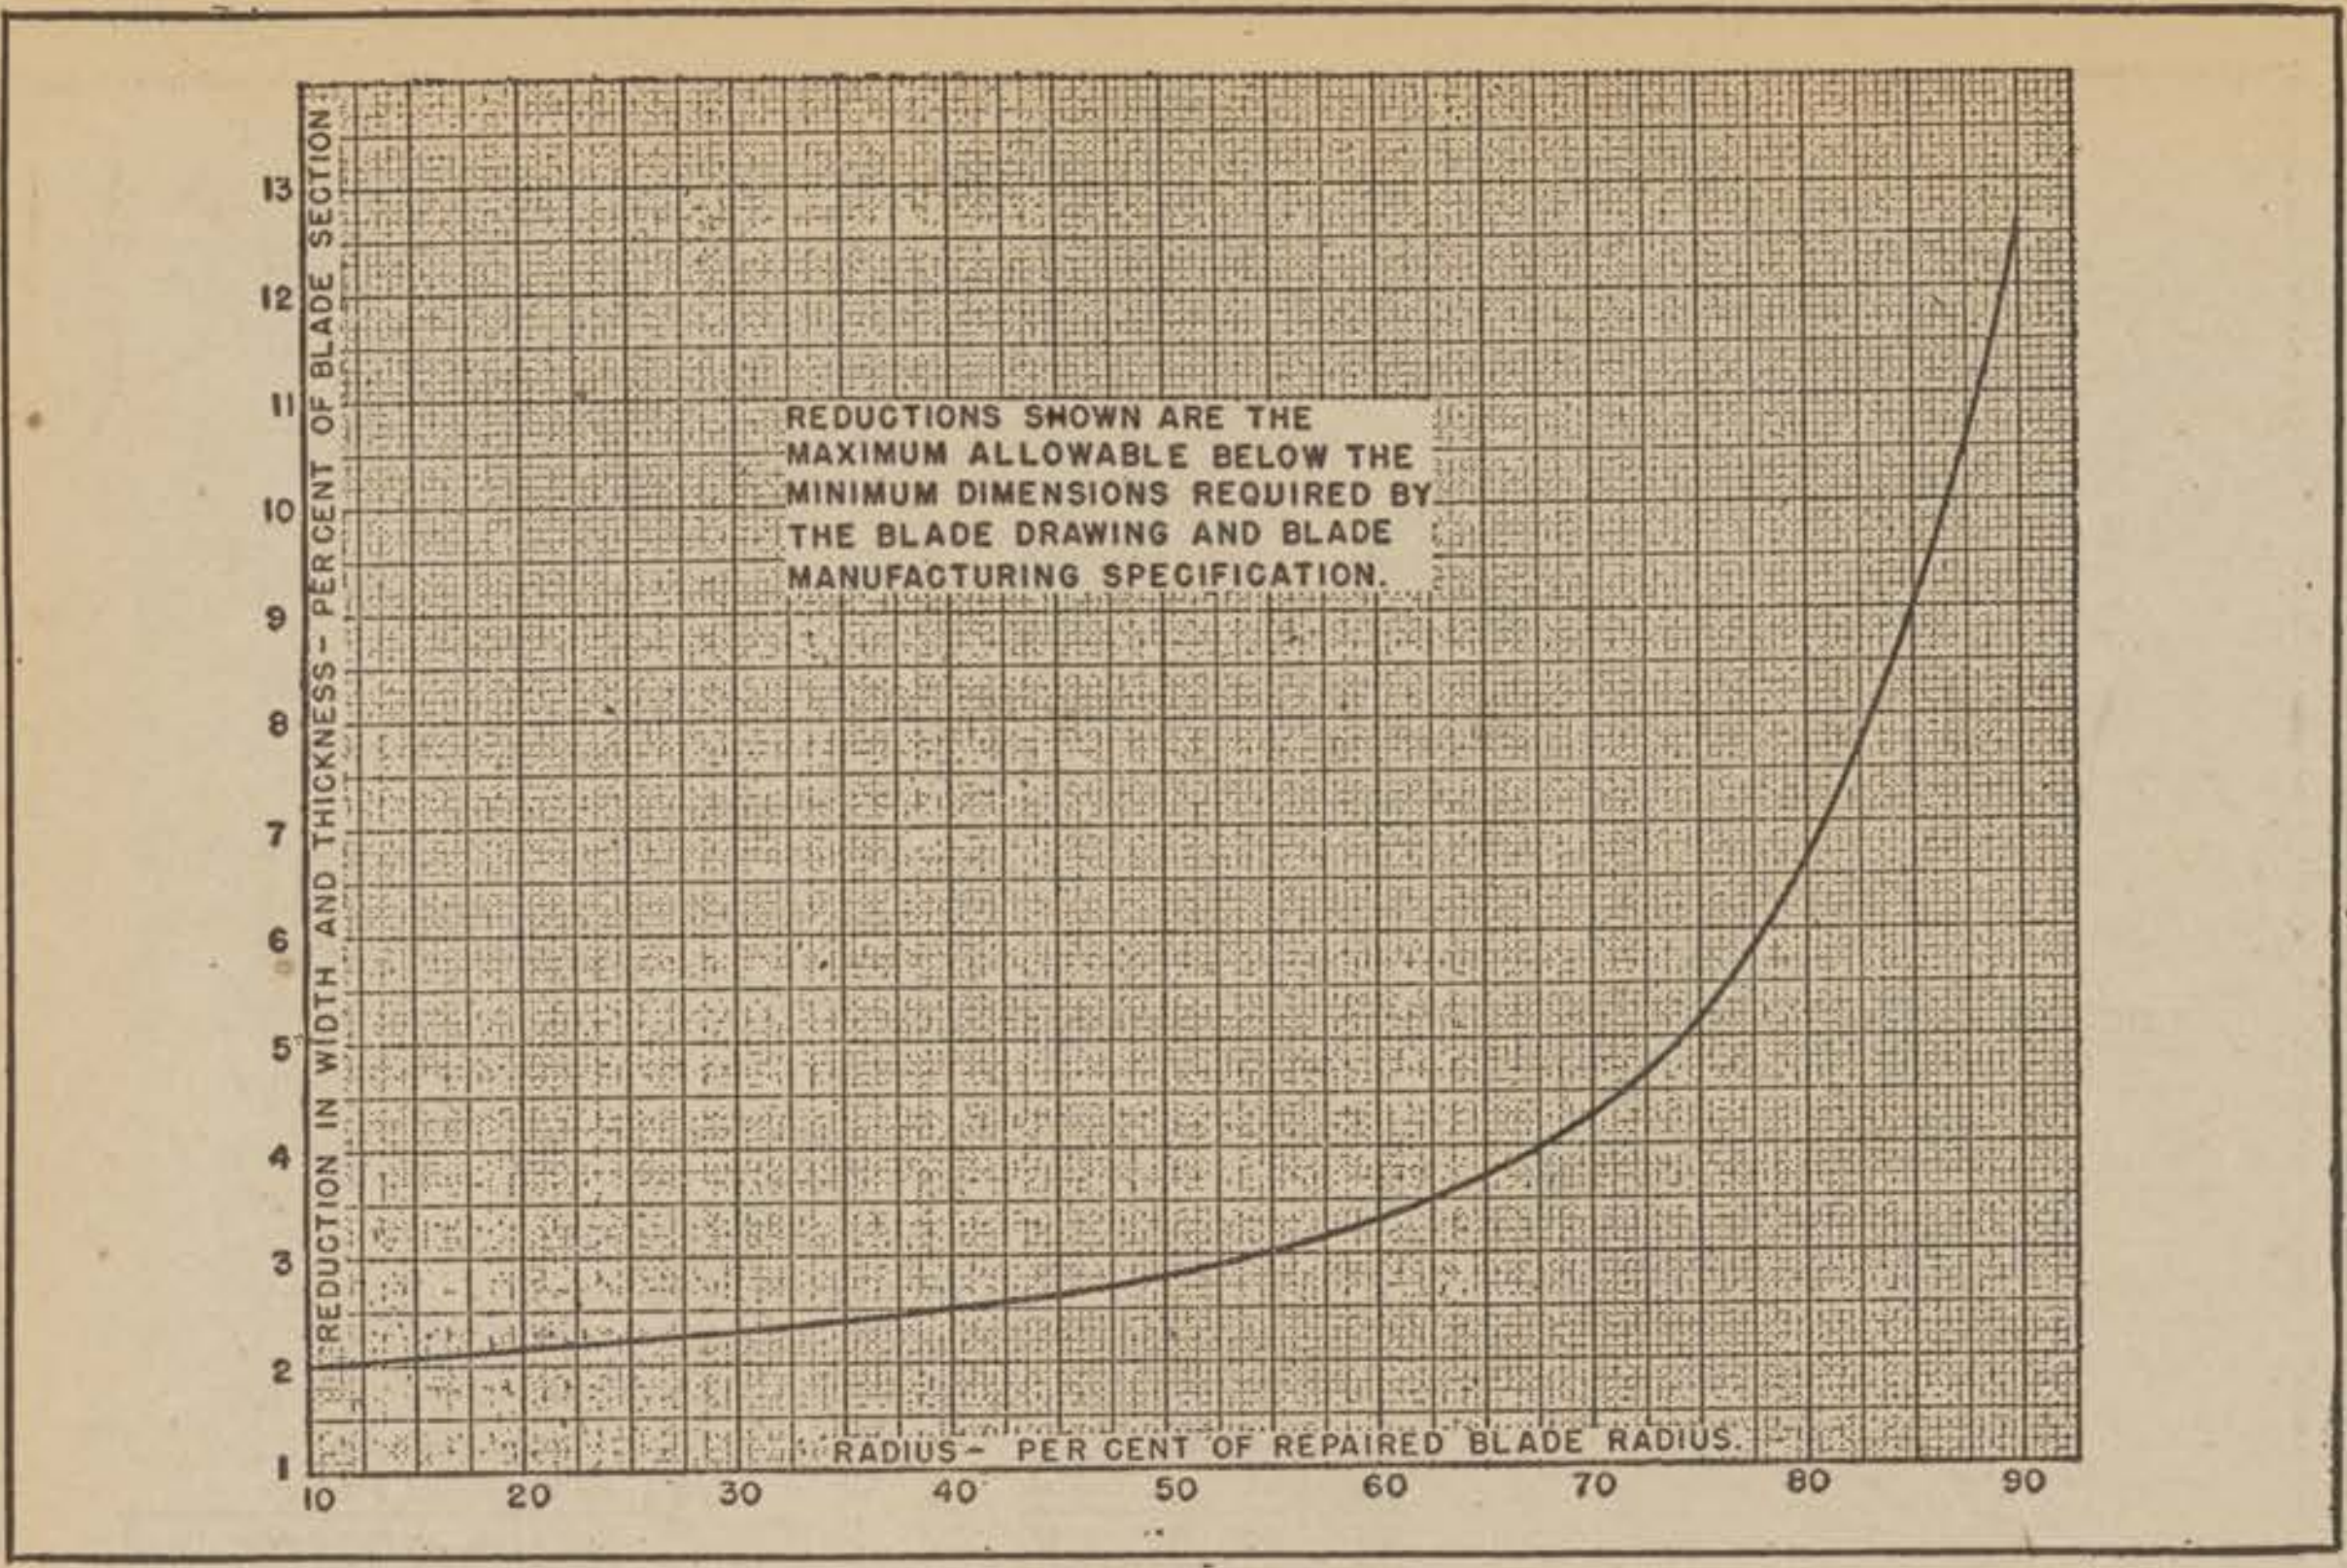

FIGURE 15-4—Repair limits to blade section width and thickness for aluminum alloy propellers.

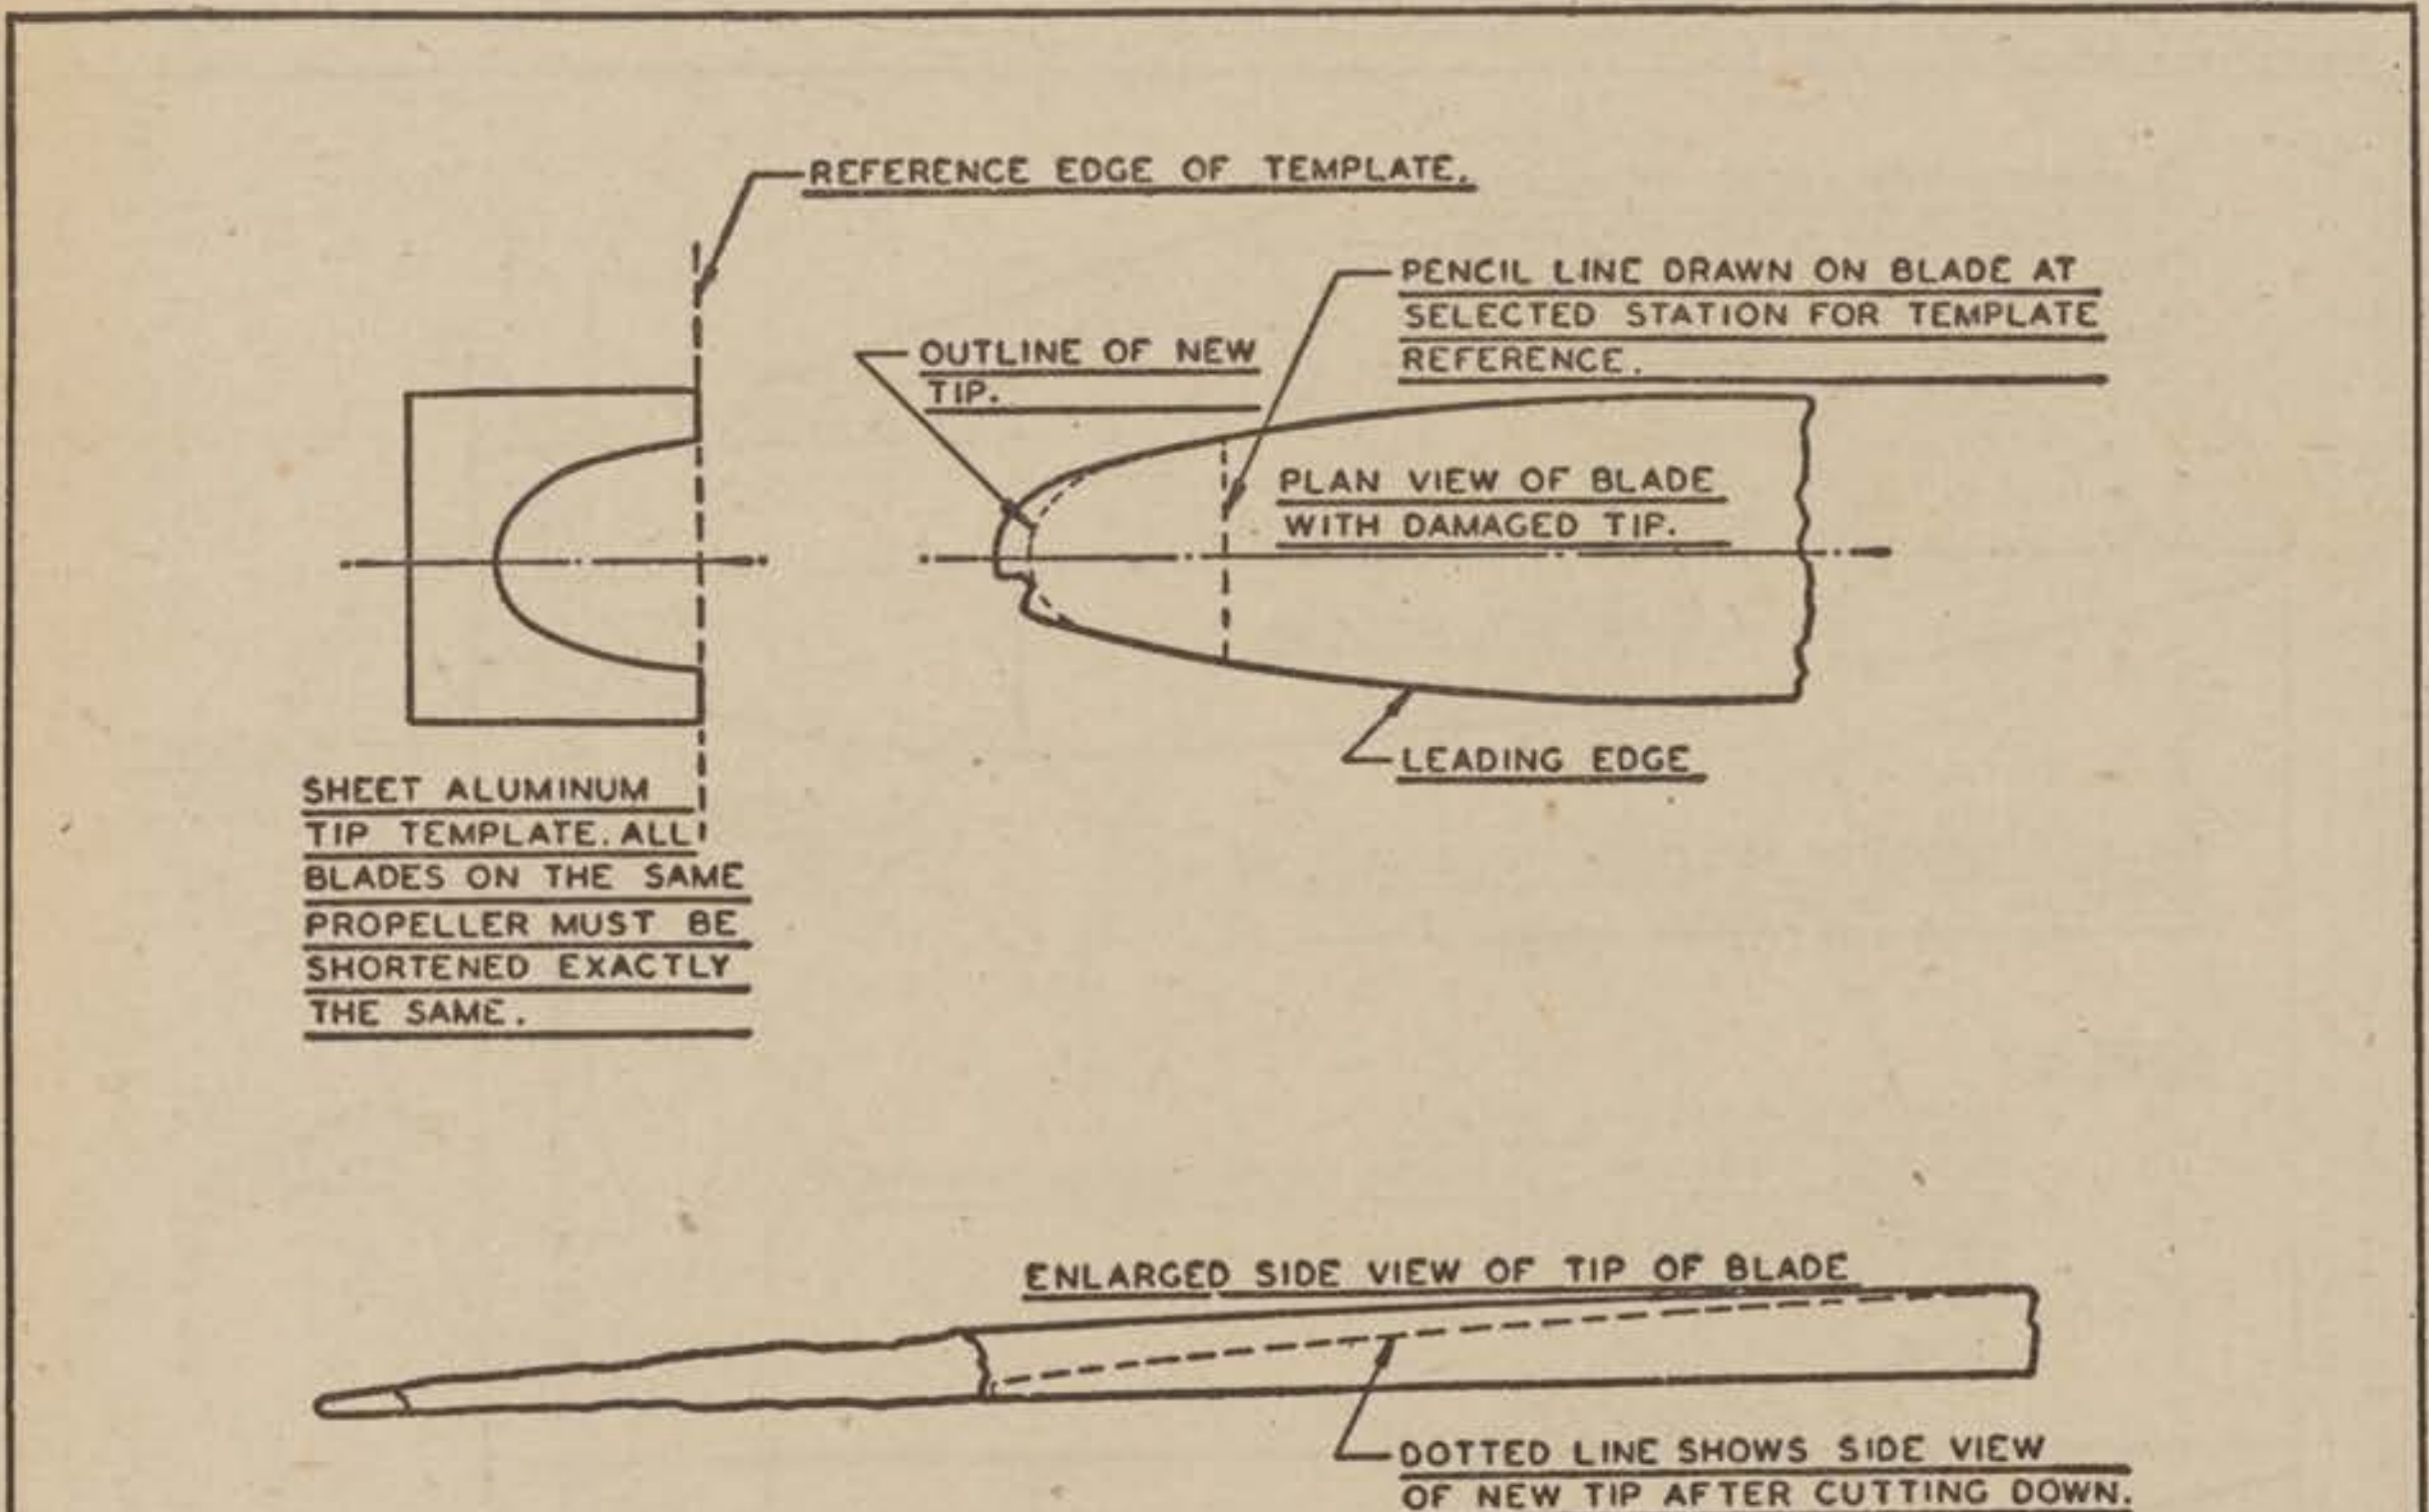
REFERENCE EDGE OF TEMPLATE.
PENCIL LINE DRAWN ON BLADE AT SELECTED STATION FOR TEMPLATE REFERENCE.
OUTLINE OF NEW TIP.
PLAN VIEW OF BLADE WITH DAMAGED TIP.
LEADING EDGE
SHEET ALUMINUM TIP TEMPLATE. ALL BLADES ON THE SAME PROPELLER MUST BE SHORTENED EXACTLY THE SAME.
ENLARGED SIDE VIEW OF TIP OF BLADE
DOTTED LINE SHOWS SIDE VIEW OF NEW TIP AFTER CUTTING DOWN.

FIGURE 15-5—Method of repairing damaged tip of aluminum alloy propellers.

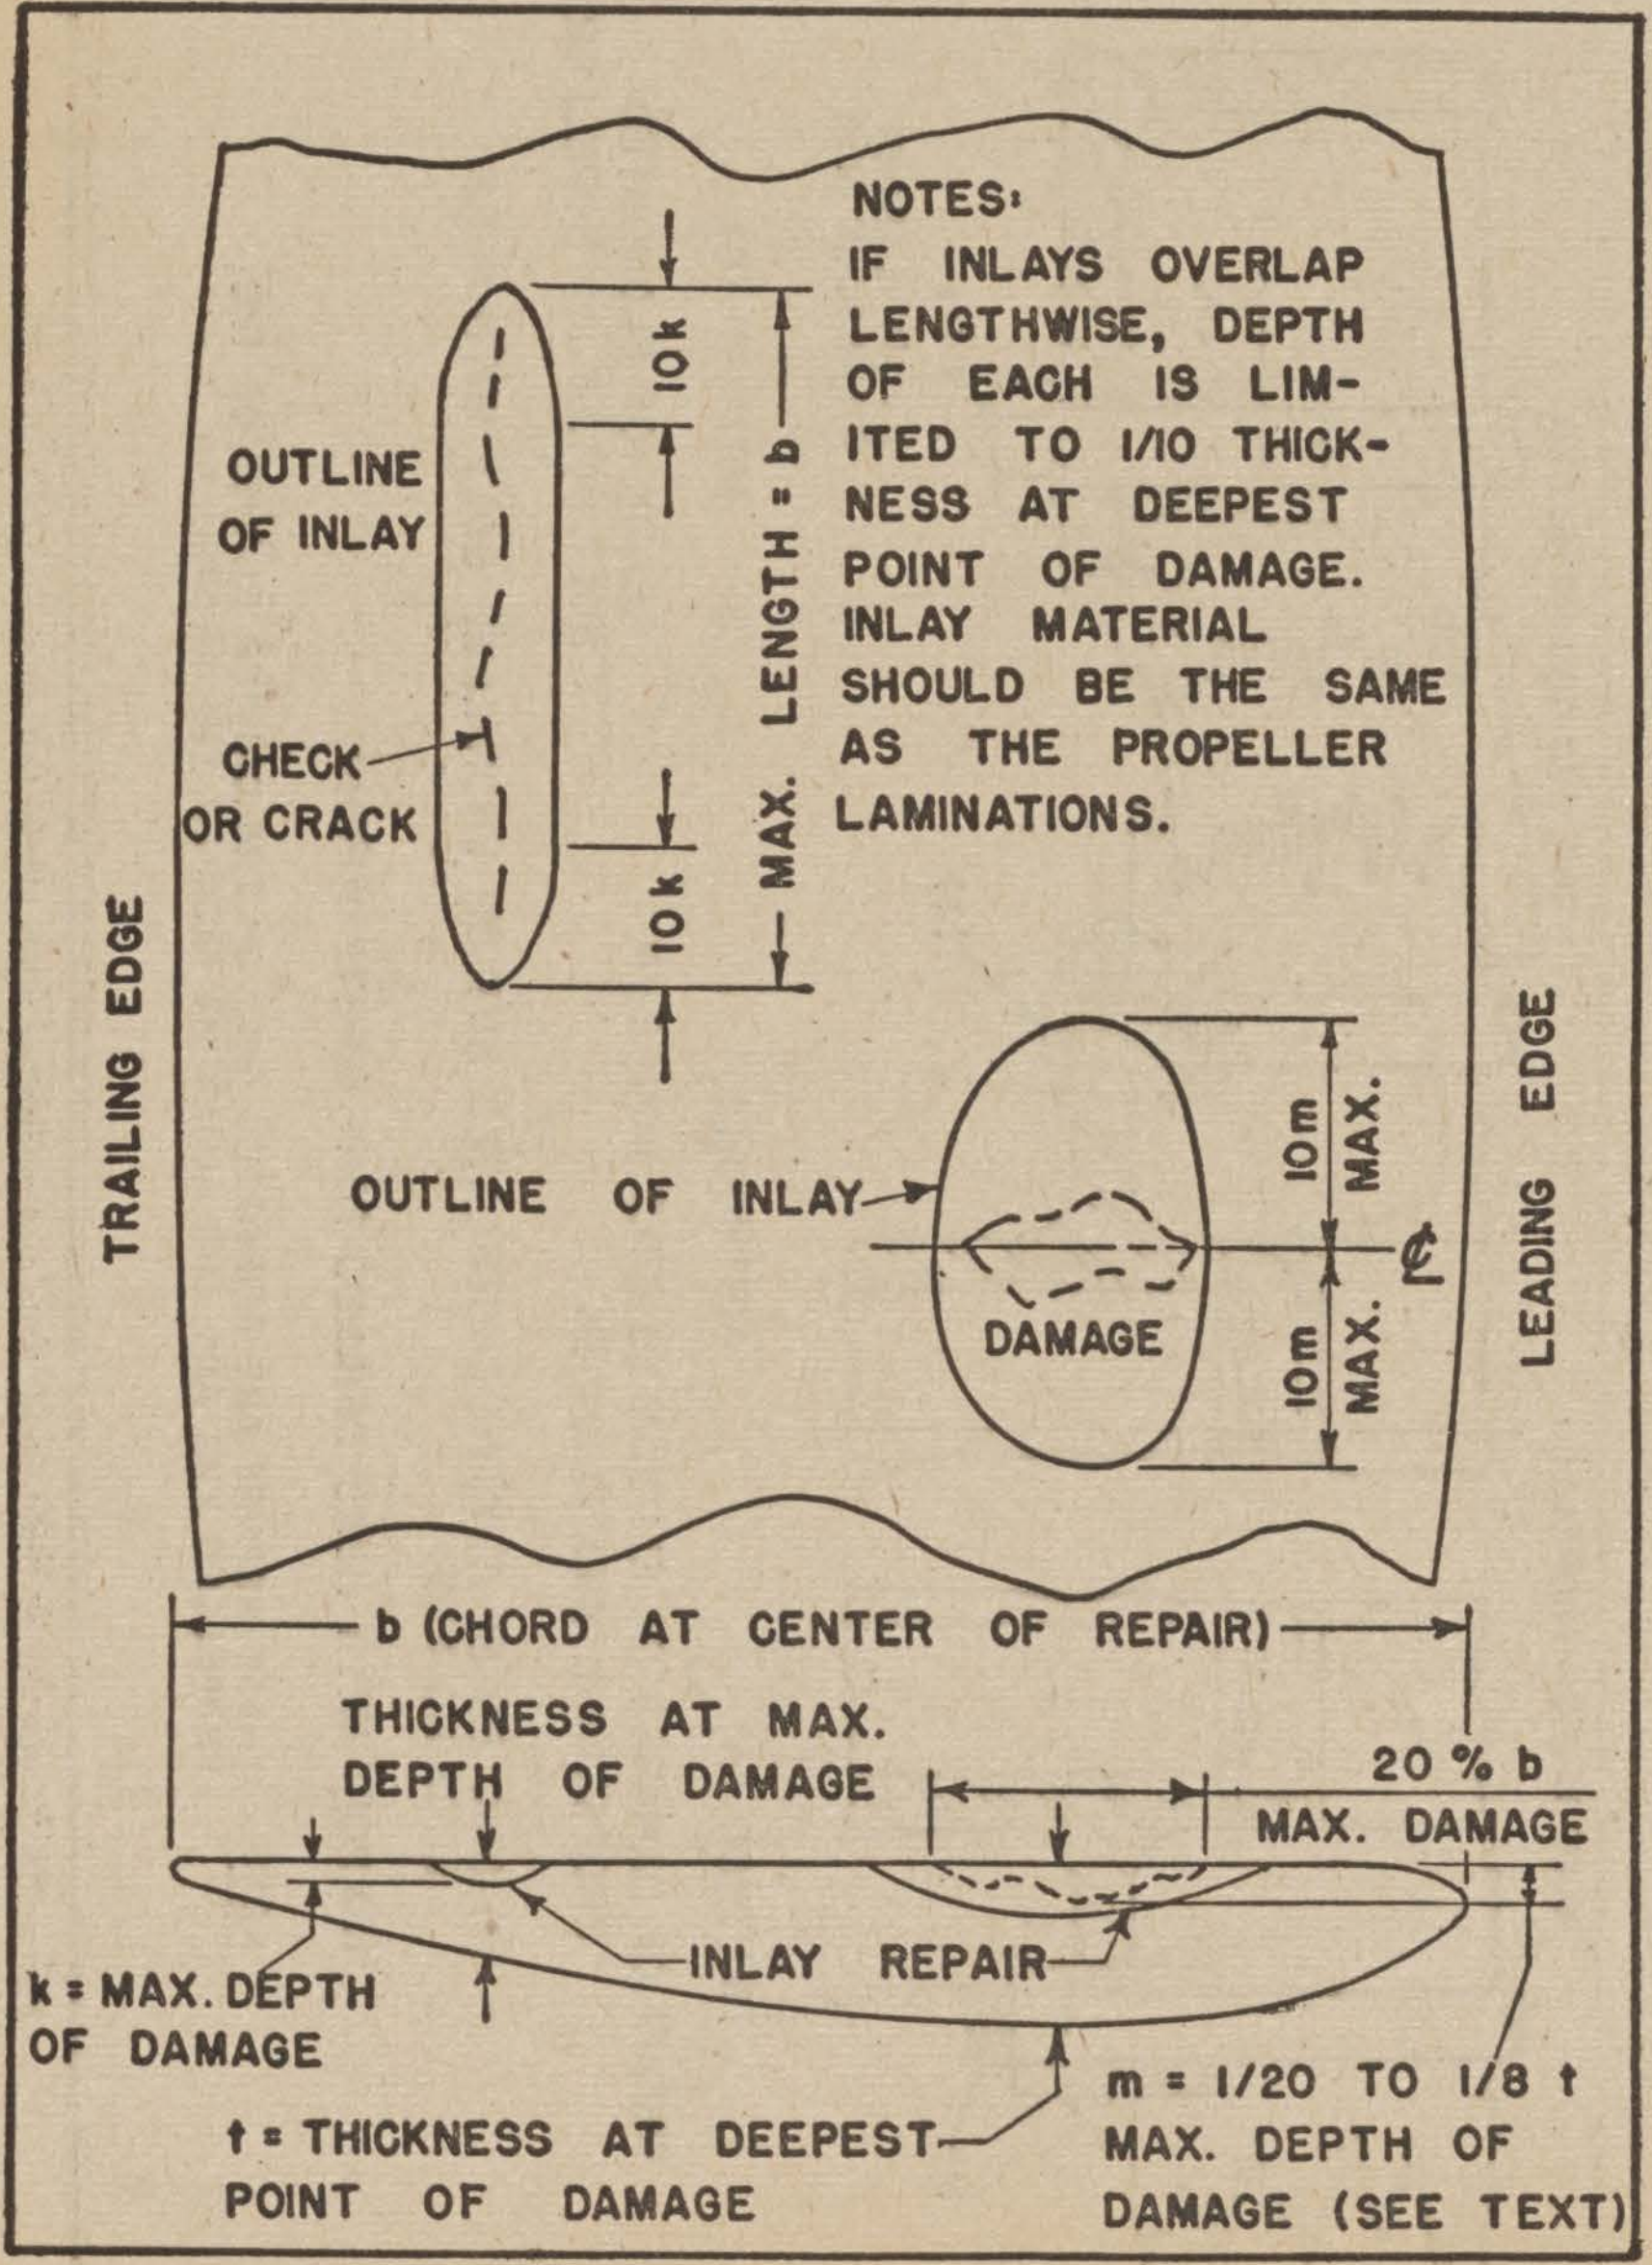
NOTES:
IF INLAYS OVERLAP LENGTHWISE, DEPTH OF EACH IS LIMITED TO 1/10 THICKNESS AT DEEPEST POINT OF DAMAGE. INLAY MATERIAL SHOULD BE THE SAME AS THE PROPELLER LAMINATIONS.
OUTLINE OF INLAY
CHECK OR CRACK
10 k
10 k
MAX. LENGTH = b
TRAILING EDGE
LEADING EDGE
OUTLINE OF INLAY
DAMAGE
10 m MAX.
10 m MAX.
℄
b (CHORD AT CENTER OF REPAIR)
THICKNESS AT MAX. DEPTH OF DAMAGE
20 % b
MAX. DAMAGE
INLAY REPAIR
k = MAX. DEPTH OF DAMAGE
t = THICKNESS AT DEEPEST POINT OF DAMAGE
m = 1/20 TO 1/8 t MAX. DEPTH OF DAMAGE (SEE TEXT)

FIGURE 15-6—Propeller repair by addition of small inlay. (See continuations.)

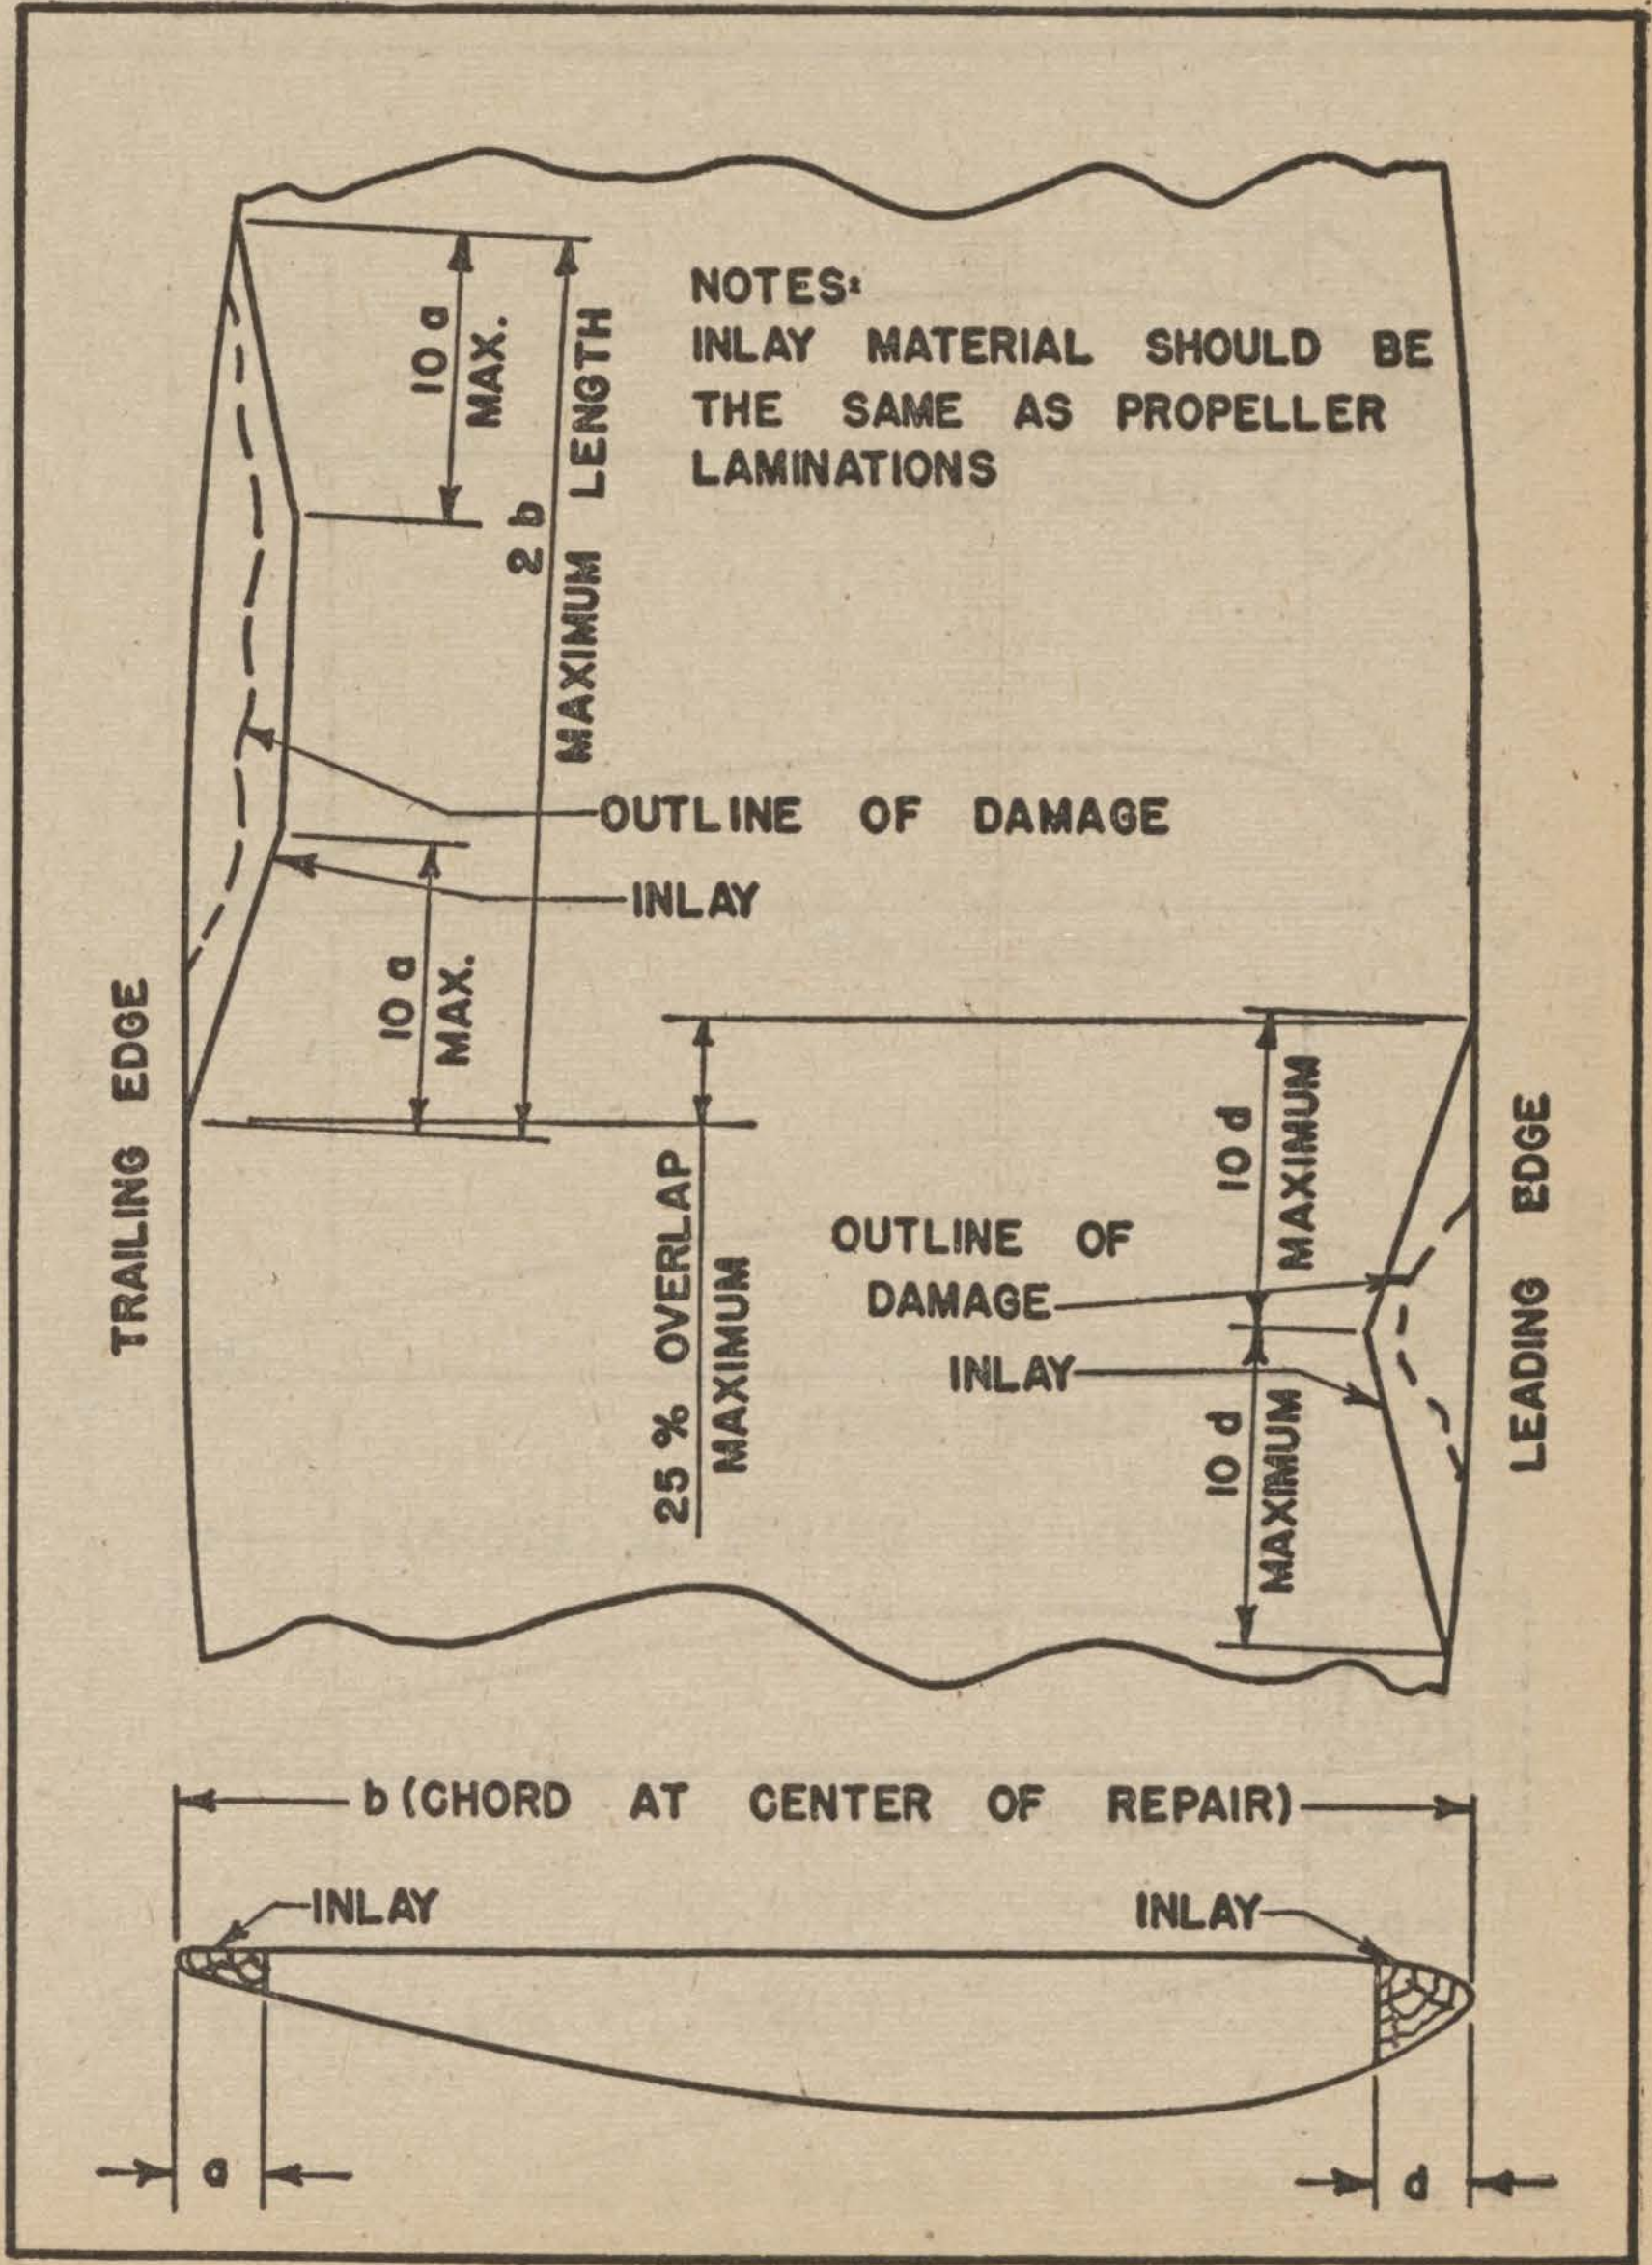

FIGURE 15-6 (continued)—Propeller repair by addition of small inlay.

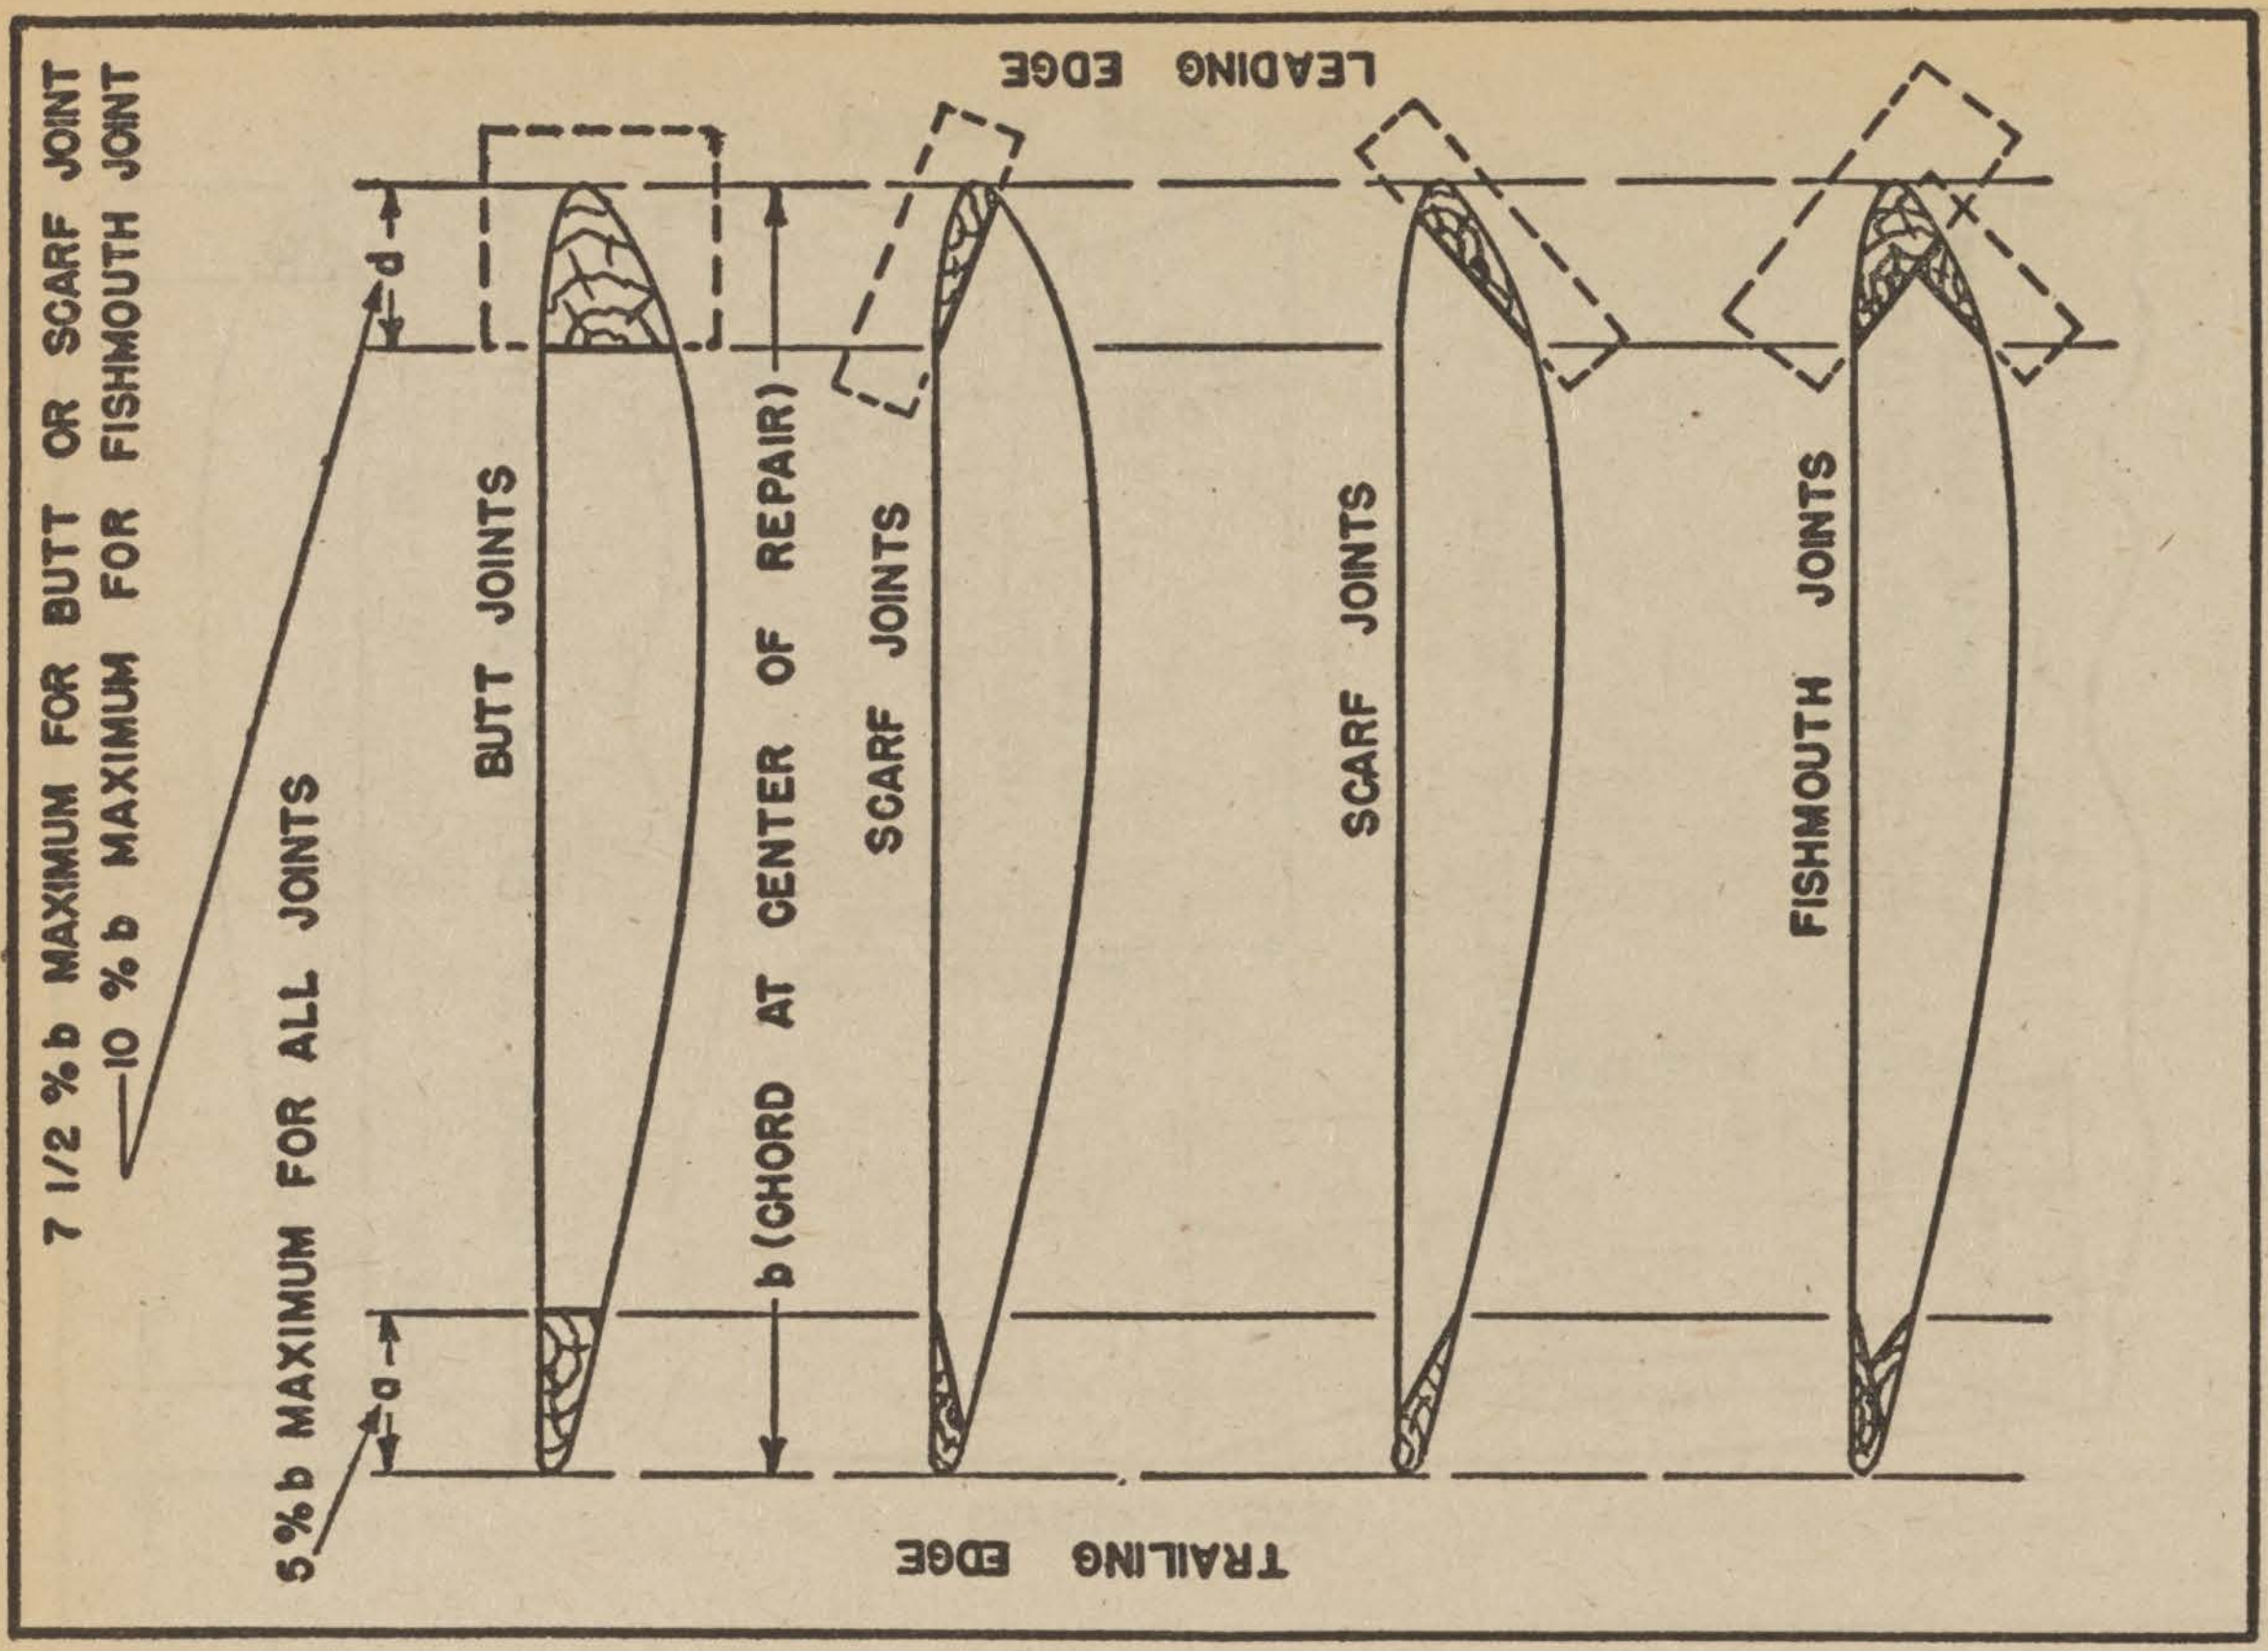
LEADING EDGE
7 1/2 % b MAXIMUM FOR BUTT OR SCARF JOINT
10 % b MAXIMUM FOR FISHMOUTH JOINT
d
BUTT JOINTS
b (CHORD AT CENTER OF REPAIR)
SCARF JOINTS
SCARF JOINTS
FISHMOUTH JOINTS
5 % b MAXIMUM FOR ALL JOINTS
a
TRAILING EDGE

FIGURE 15-6 (continued)—Propeller repair by addition of small inlay.

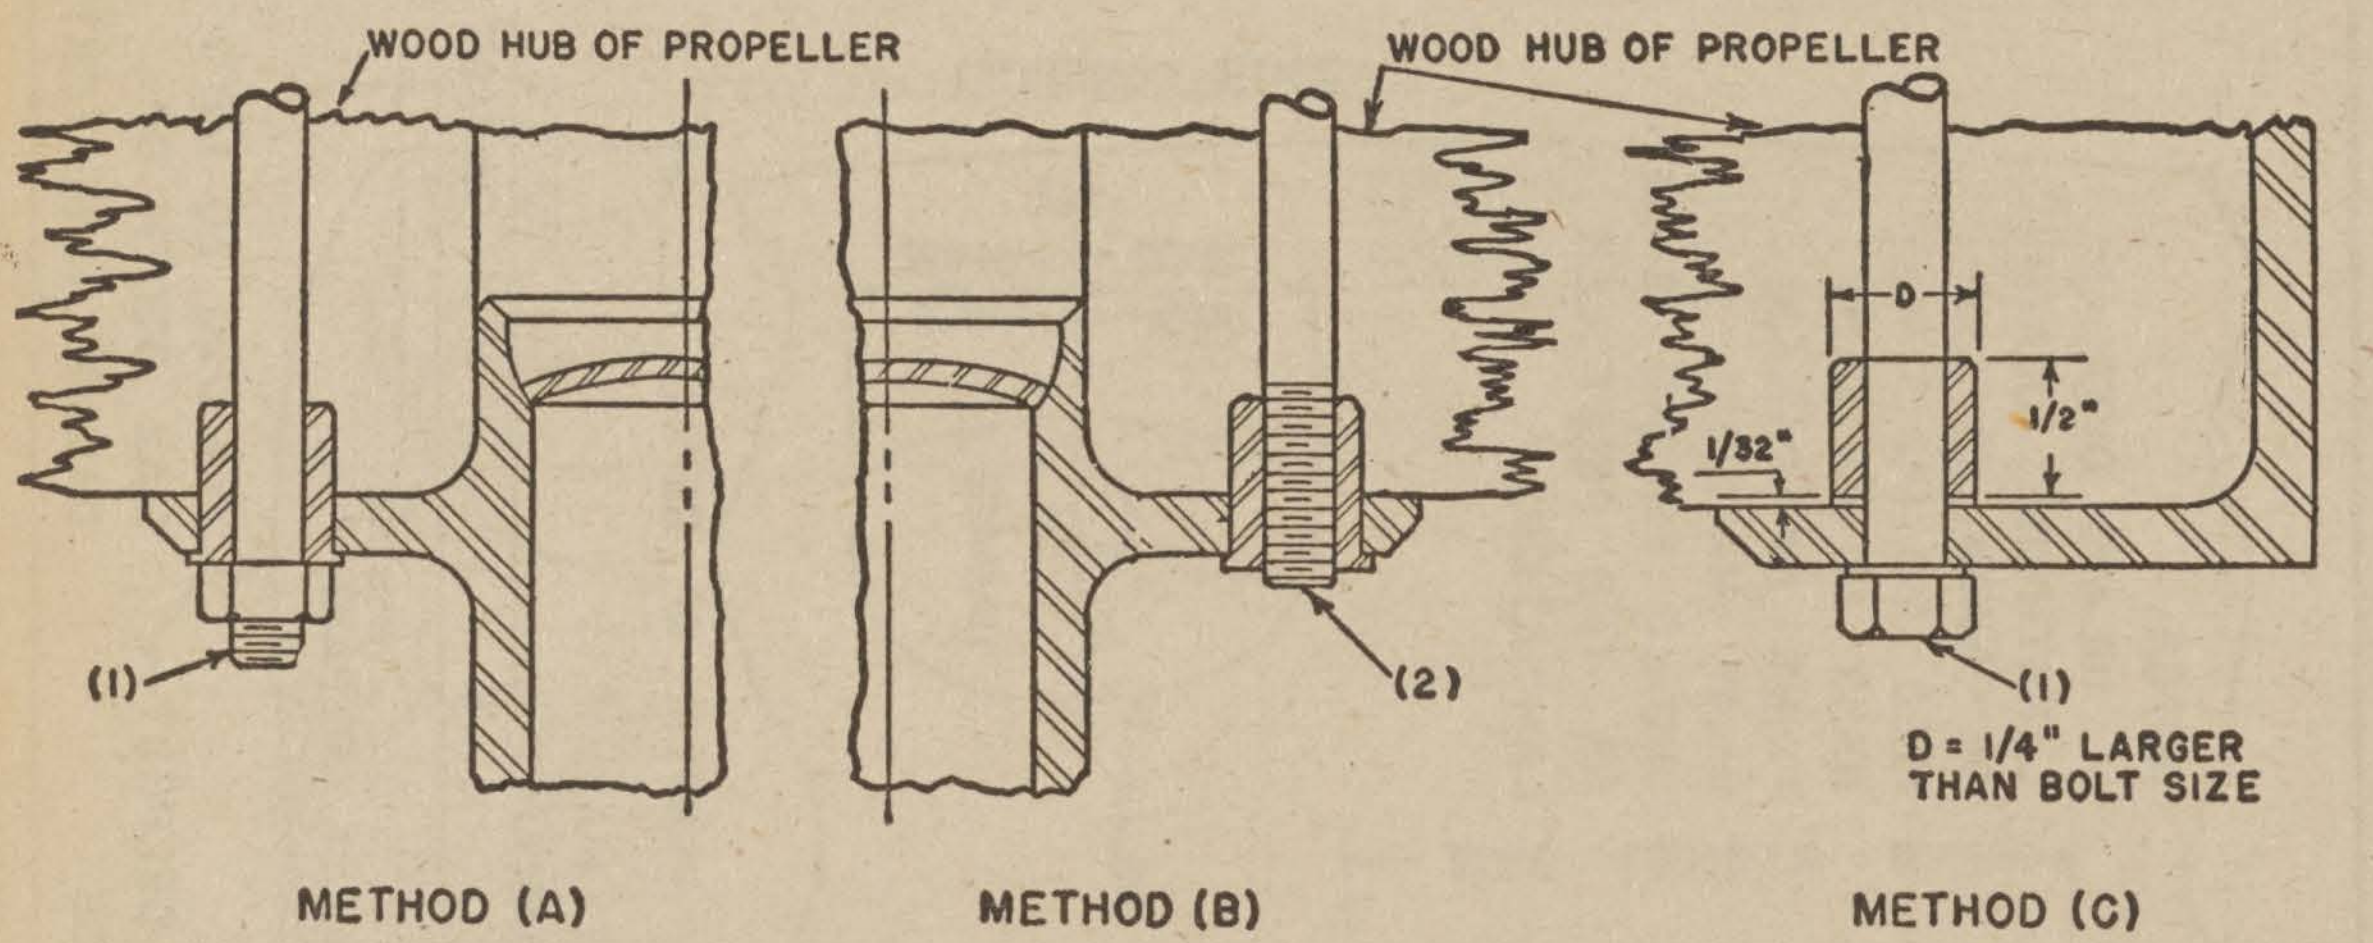

REPAIR OF DAMAGED OR ELONGATED BOLT HOLES IN PROPELLER HUB FLANGES

REPAIR OF ELONGATED BOLT HOLES IN PROPELLER

(1) DRILLED BOLT WITH CASTELATED NUT OR UNDRILLED BOLT WITH SELF-LOCKING NUT.

(2) BOLT WITH HEAD DRILLED FOR SAFETY WIRING.

NOTE: THESE REPAIRS ARE PERMITTED ONLY ON THE DRIVING FLANGE OF THE PROPELLER HUB AND THE ADJACENT FACE OF THE PROPELLER.

FIGURE 15-7—Repair of fixed pitch hub and propeller with elongated or damaged bolt holes.

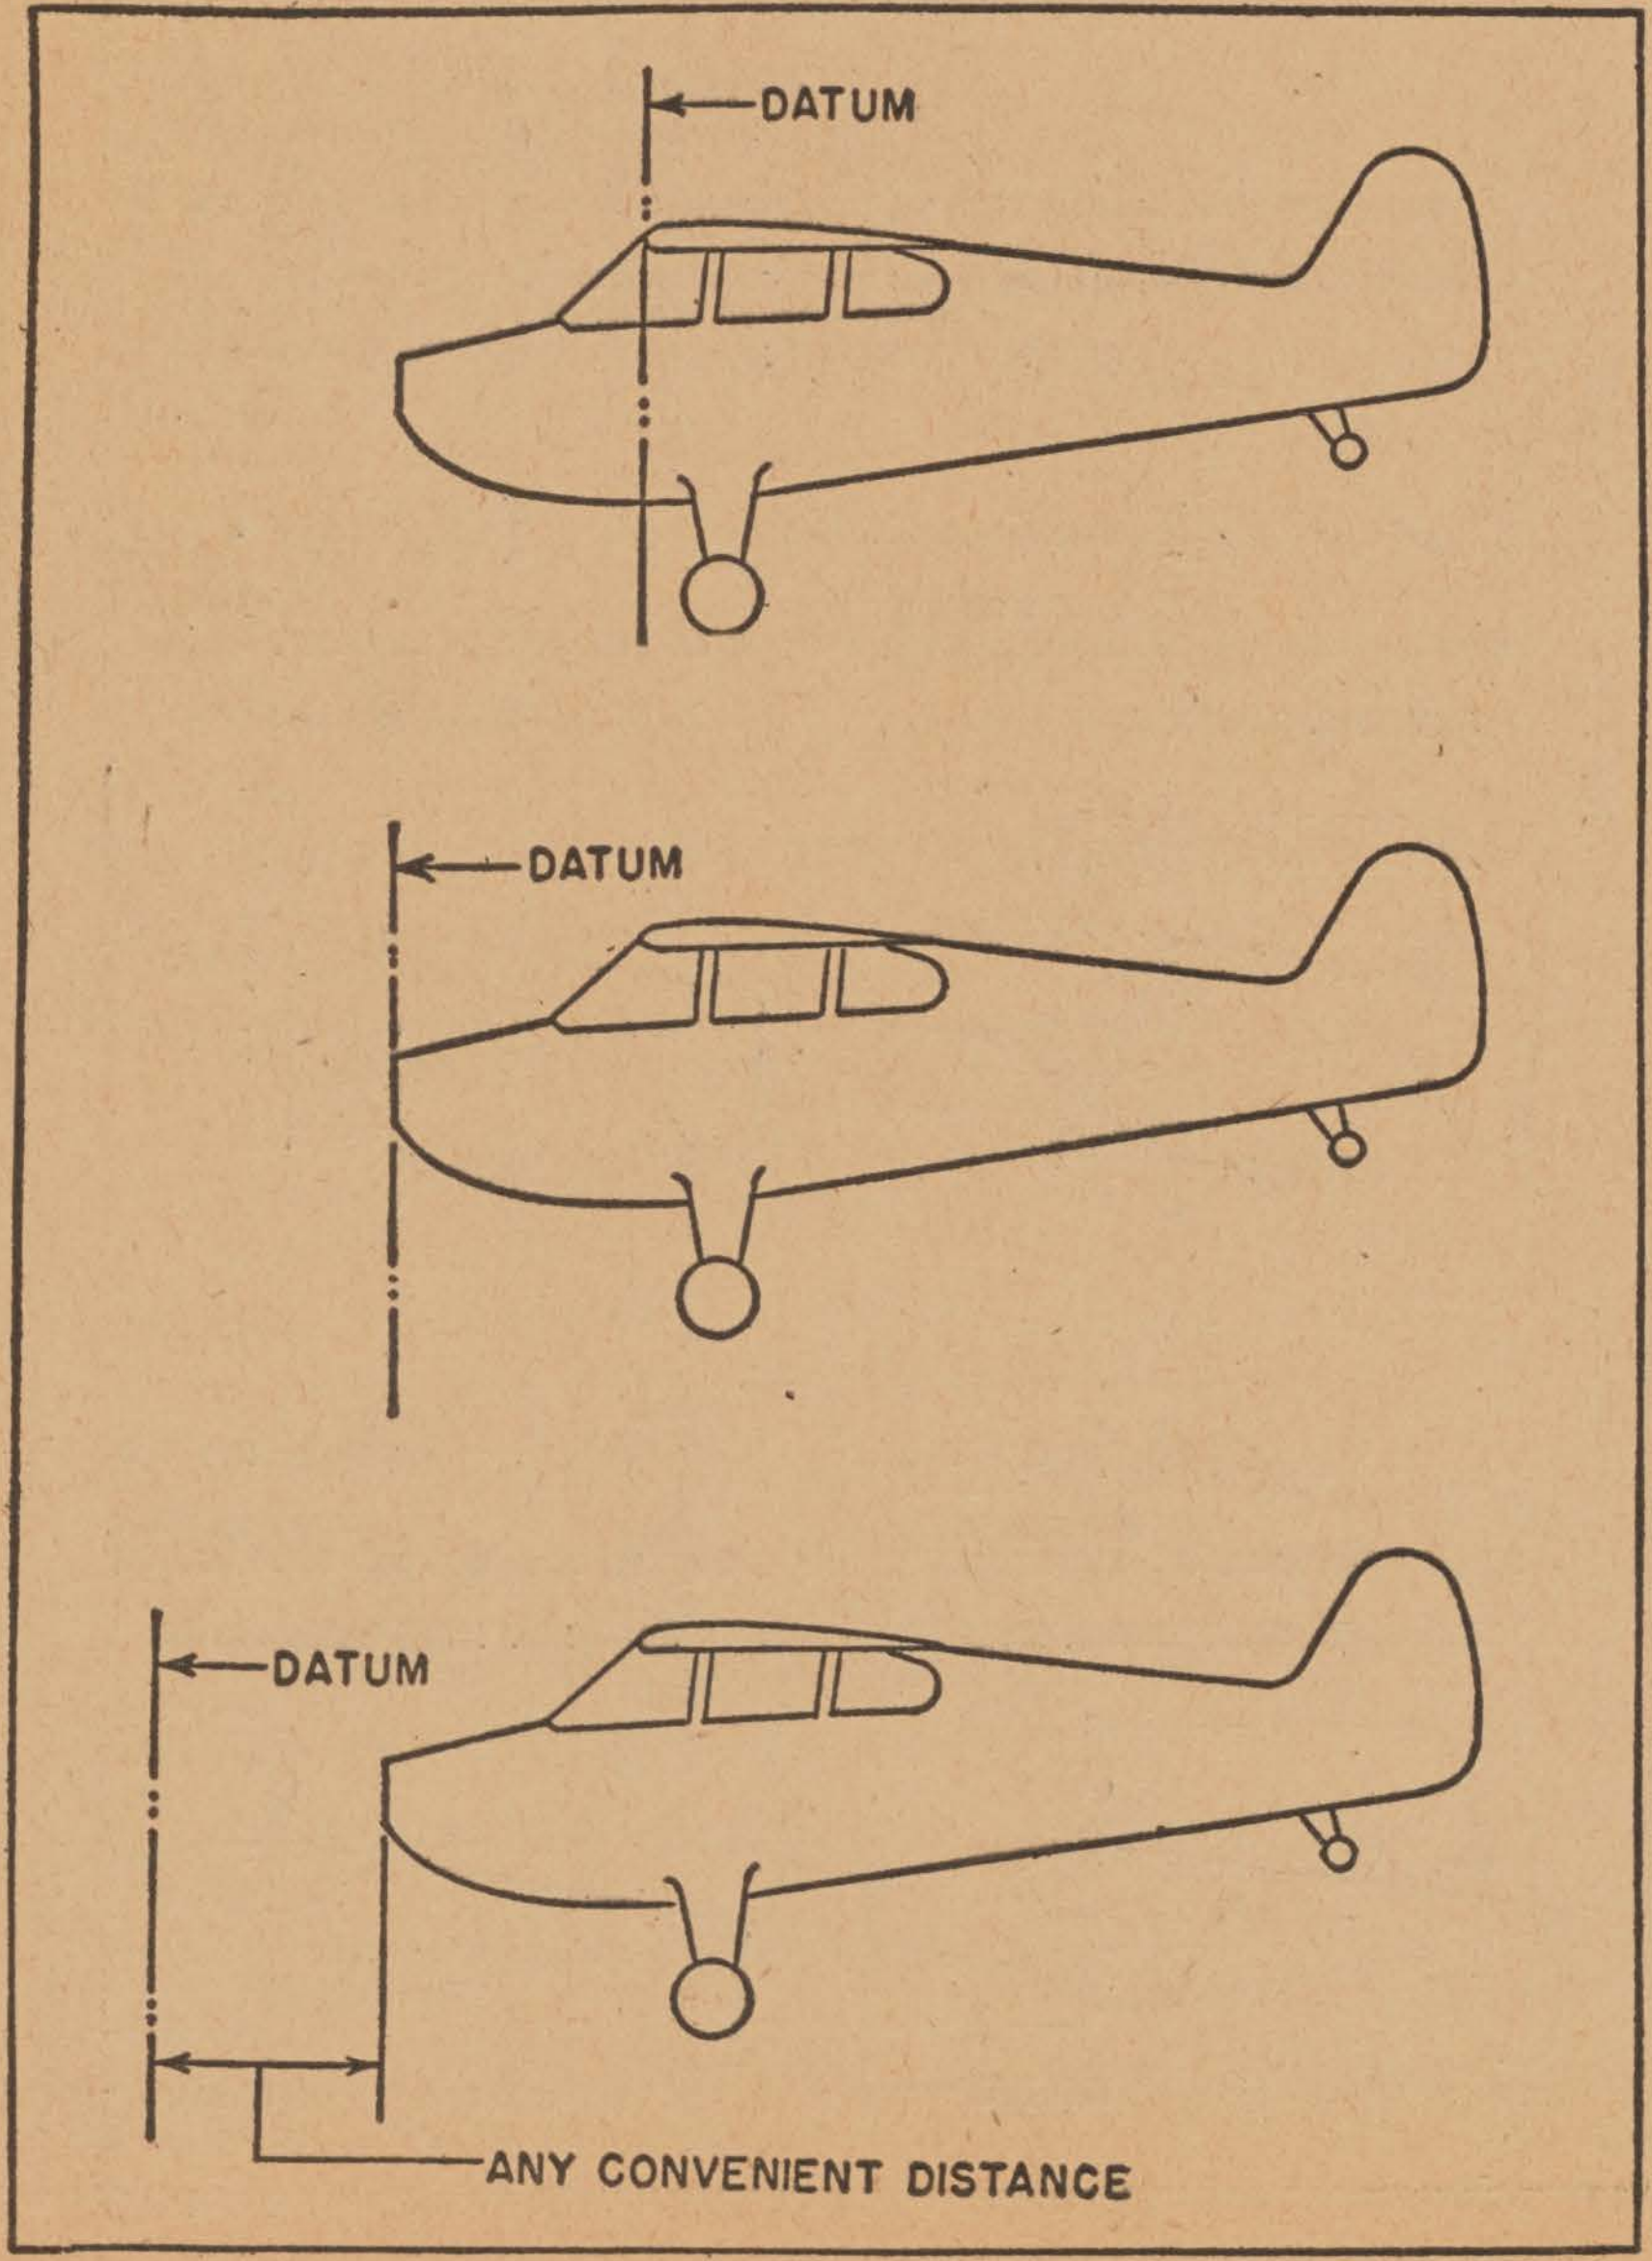

FIGURE 16-1—Typical datum locations.

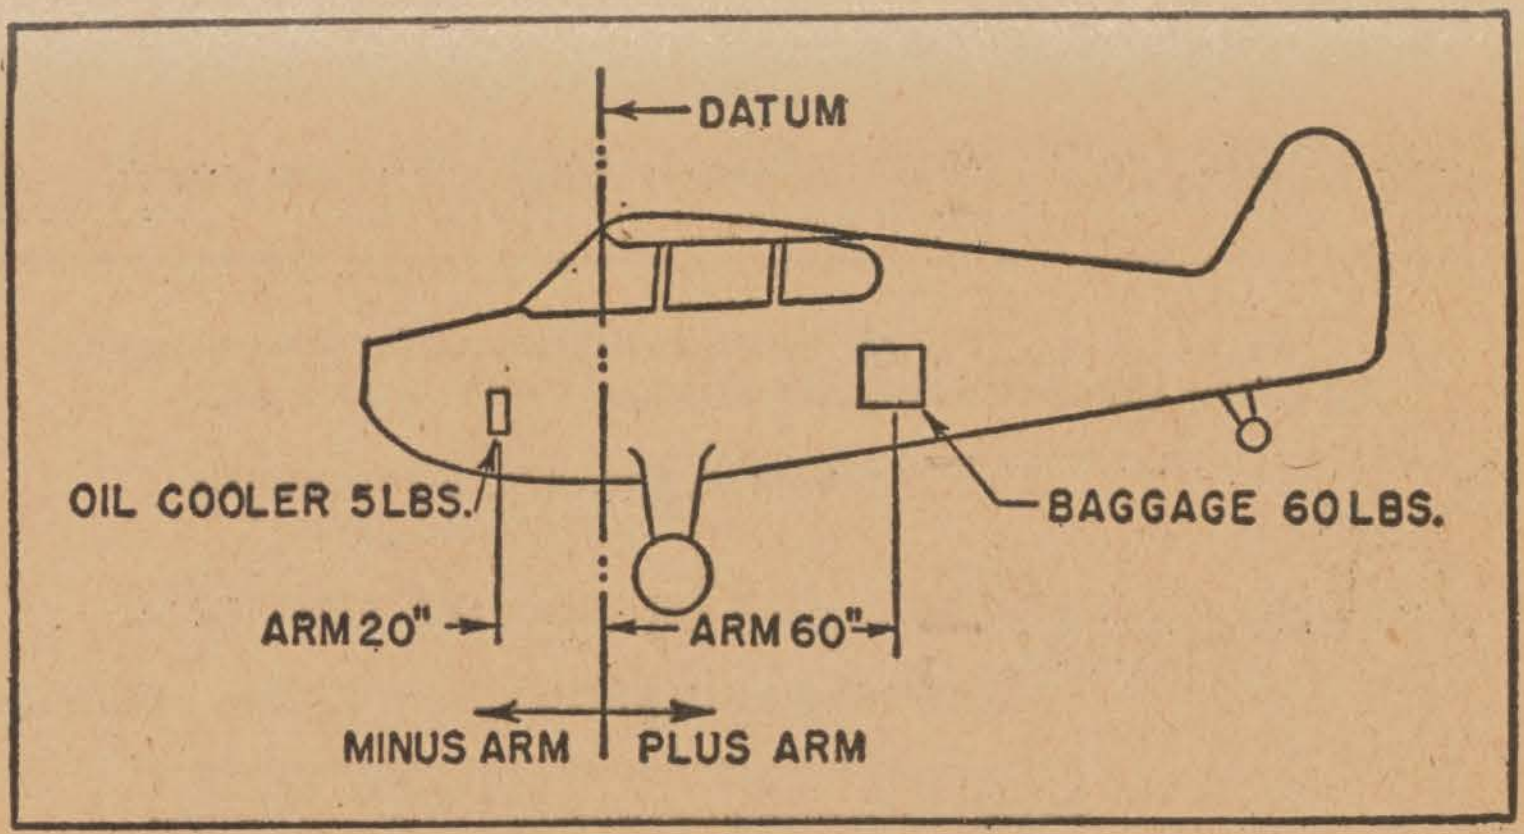

FIGURE 16-2—Illustration of arm (or moment arm).

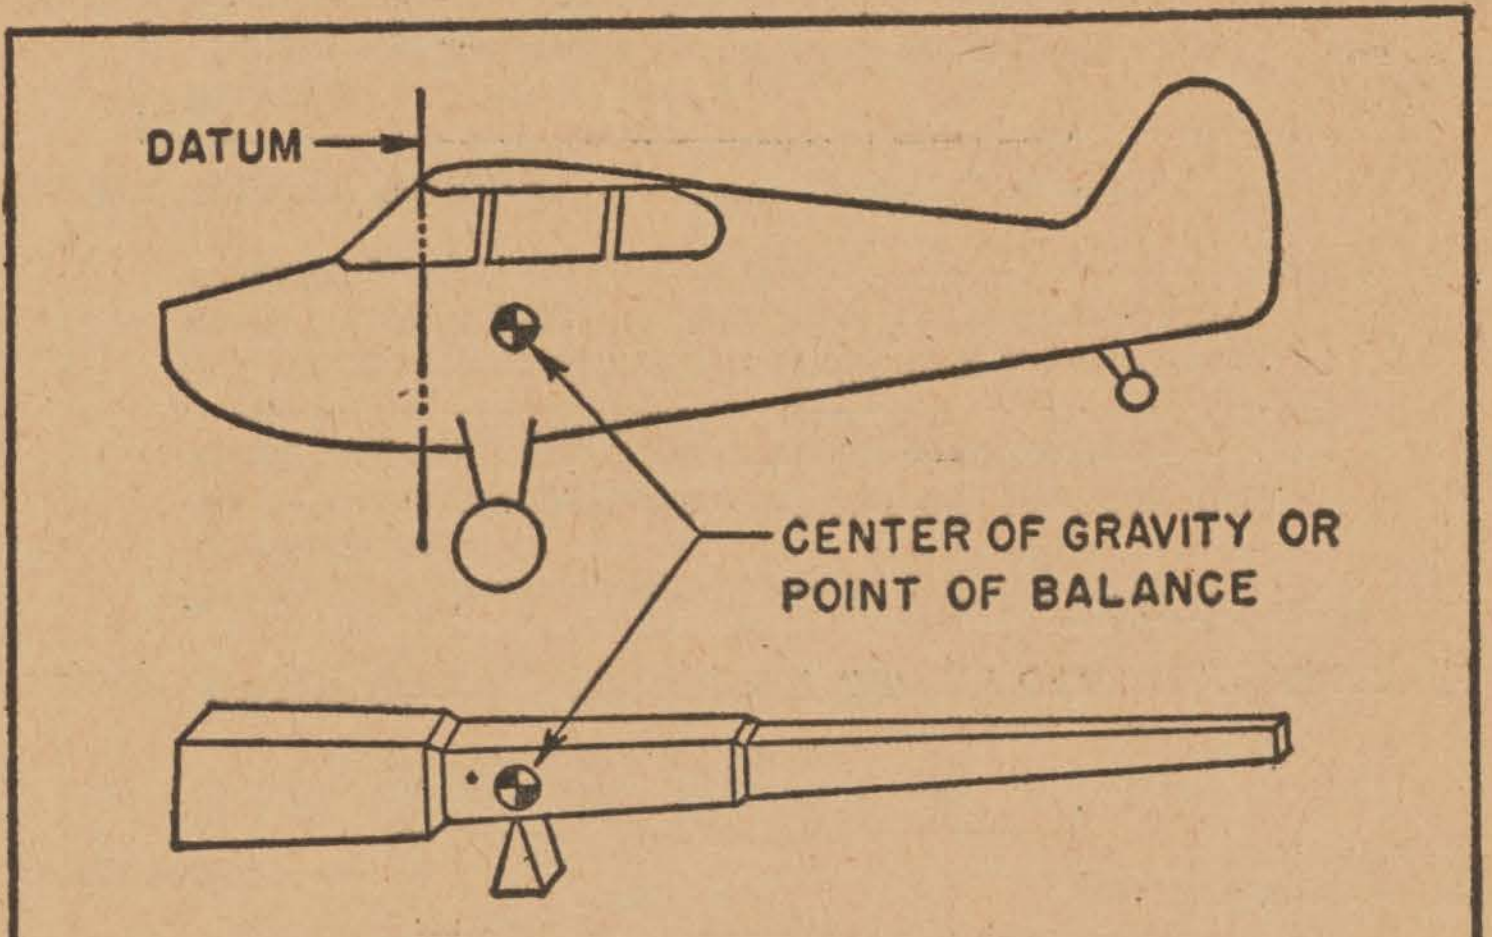

The entire aircraft weight may be considered to be concentrated at the center of gravity. Therefore, the moment of the aircraft about the datum is the weight of the aircraft times the horizontal distance between the C.G. and the datum.

Example: If the weight of this airplane is 2000 lbs. and the arm from the datum to the center of gravity is 16 inches, the moment of the aircraft about the datum is 2000 x 16 or 32,000 in. lbs.

FIGURE 16-3—Example of moment computation.

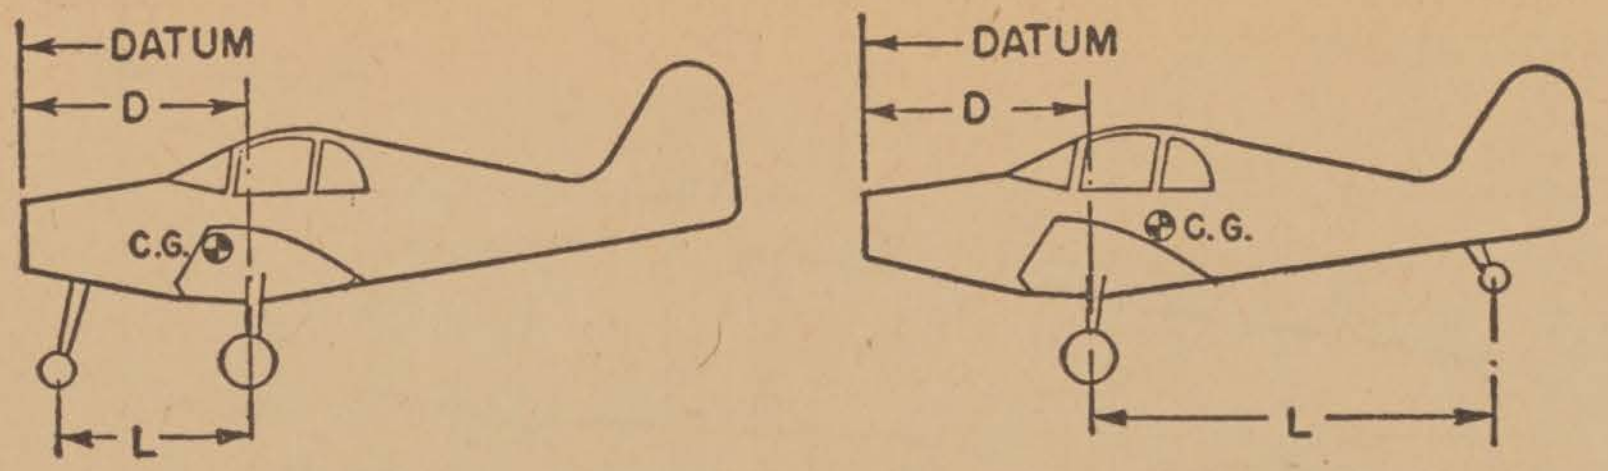

NOSE WHEEL TYPE AIRCRAFT

DATUM LOCATED FORWARD OF THE MAIN WHEELS

$C.G. = D - \left(\frac{F \times L}{W}\right)$

TAIL WHEEL TYPE AIRCRAFT

DATUM LOCATED FORWARD OF THE MAIN WHEELS

$C.G. = D + \left(\frac{R \times L}{W}\right)$

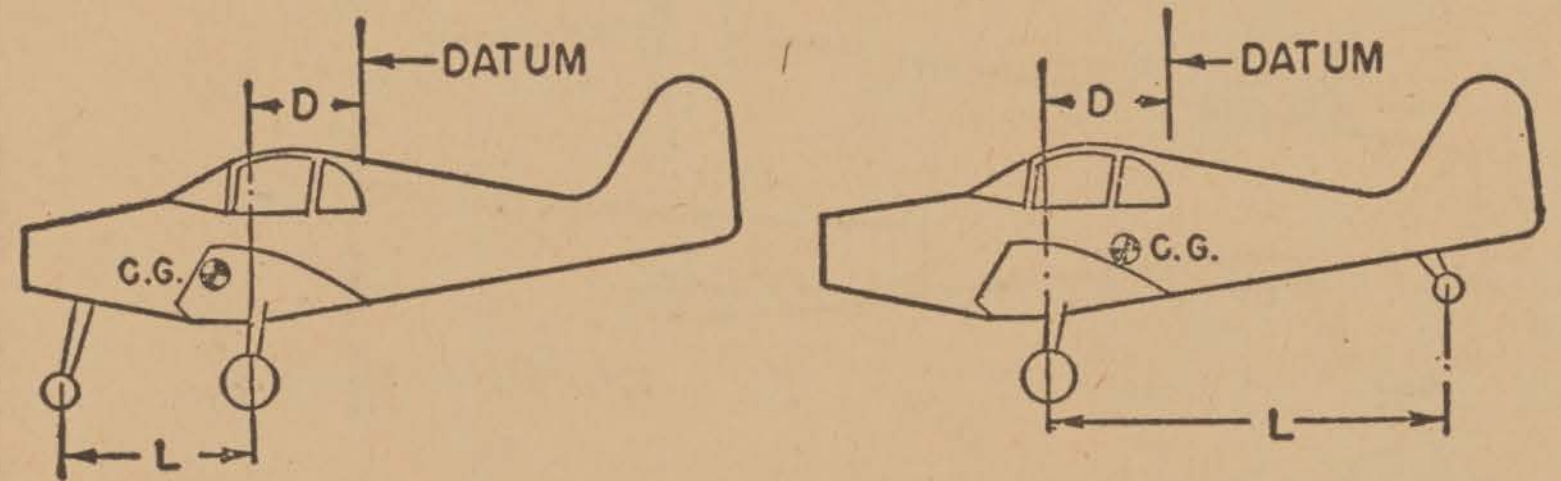

NOSE WHEEL TYPE AIRCRAFT

DATUM LOCATED AFT OF THE MAIN WHEELS

$C.G. = -\left(D + \frac{F \times L}{W}\right)$

TAIL WHEEL TYPE AIRCRAFT

DATUM LOCATED AFT OF THE MAIN WHEELS

$C.G. = -D + \left(\frac{R \times L}{W}\right)$

CG = Distance from datum to center of gravity of the aircraft.
W = The weight of the aircraft at the time of weighing.
D = The horizontal distance measured from the datum to the main wheel weighing point.
L = The horizontal distance measured from the main wheel weighing point to the nose or tail weighing point.
F = The weight at the nose weighing point.
R = The weight at the tail weighing point.

FIGURE 16-4—Empty weight center-of-gravity formulas.

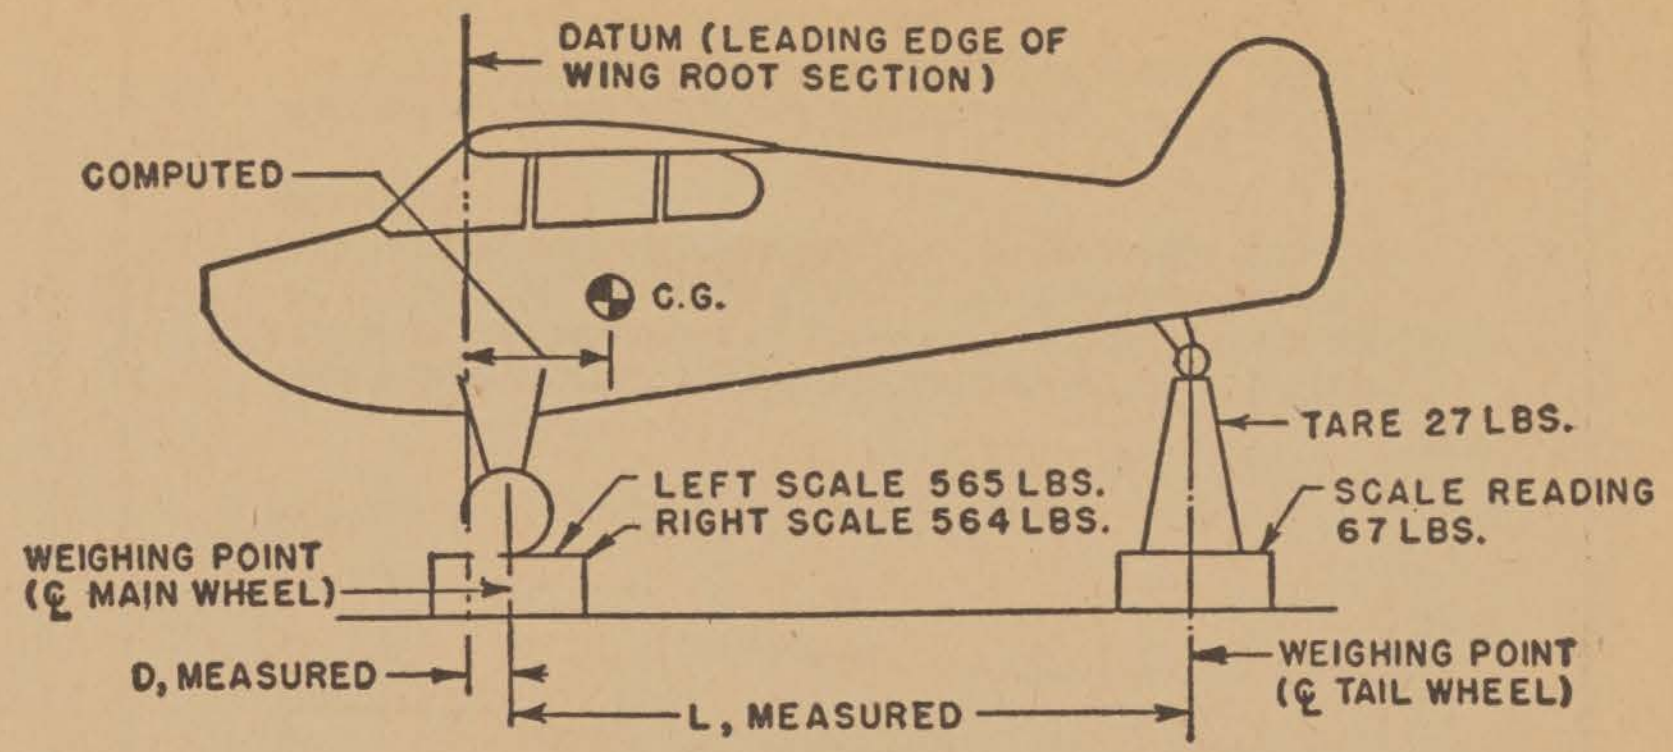

**TO FIND: EMPTY WEIGHT AND EMPTY WEIGHT CENTER OF GRAVITY**

Datum is the leading edge of the wing (from aircraft specification)
(D) Actual measured horizontal distance from the main wheel weighing point ℄ main wheel) to the Datum------------------------------------------------------3"
(L) Actual measured horizontal distance from the rear wheel weighing point (℄ rear wheel) to the main wheel weighing point----------------------------------------222"

**SOLVING: EMPTY WEIGHT**

| Weighing Point | Scale Reading # | Tare # | Net Weight # |
|---|---|---|---|
| Right | 564 | 0 | 564 |
| Left | 565 | 0 | 565 |
| Rear | 67 | 27 | 40 |
| Empty Weight (W) | | | 1169 |

**SOLVING: EMPTY WEIGHT CENTER OF GRAVITY**

Formula: $C.G. = D + \frac{R \times L}{W} = 3'' + \frac{40 \times 222}{1169} = 3'' + 7.6'' = 10.6''$

**Reference for formula Fig. 16-4**

**This case is shown properly entered on a sample weight and balance report form, Figure 16-17**

FIGURE 16-5—Empty weight and empty weight center-of-gravity—tail-wheel type aircraft.

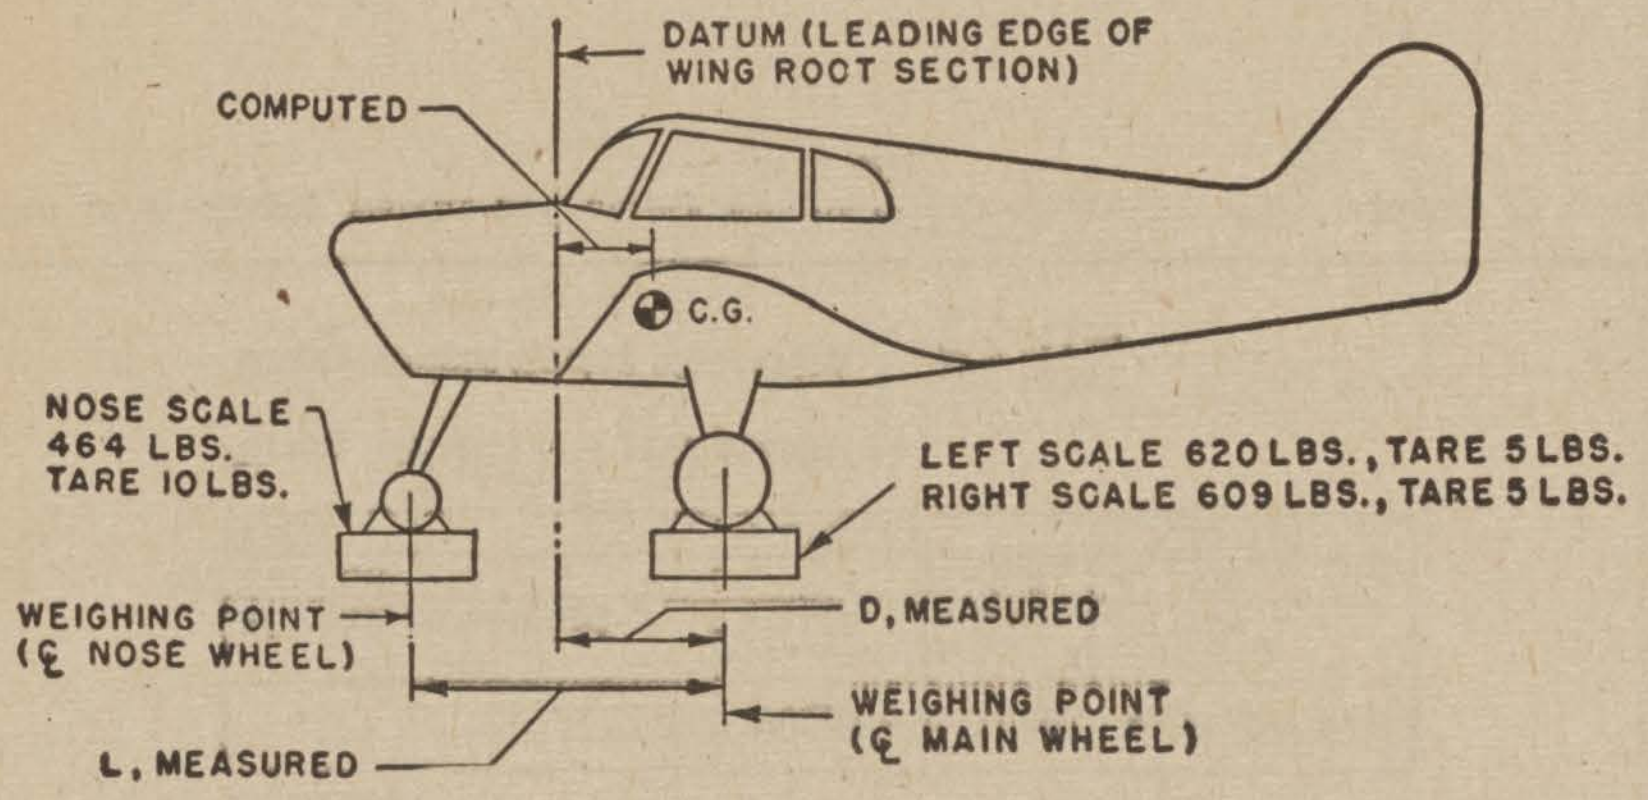
DATUM (LEADING EDGE OF WING ROOT SECTION)
COMPUTED
C.G.
NOSE SCALE 464 LBS. TARE 10 LBS.
LEFT SCALE 620 LBS., TARE 5 LBS.
RIGHT SCALE 609 LBS., TARE 5 LBS.
WEIGHING POINT (℄ NOSE WHEEL)
D, MEASURED
WEIGHING POINT (℄ MAIN WHEEL)
L, MEASURED

TO FIND: EMPTY WEIGHT AND EMPTY WEIGHT CENTER OF GRAVITY

Datum is the leading edge of the wing (from aircraft specification)

(D) Actual measured horizontal distance from the main wheel weight point (℄ main wheel) to the Datum-------------------------------------------------------- 34.0''

(L) Actual measured horizontal distance from the front wheel weighing point (℄ front wheel) to the main wheel weighing point------------------------------------ 67.8''

SOLVING: EMPTY WEIGHT

| Weighing Point | Scale Reading # | Tare # | Net Weight |
|---|---|---|---|
| Right | 609 | 5 | 604 |
| Left | 620 | 5 | 615 |
| Front | 464 | 10 | 454 |
| Empty Weight (W) | | | 1673 |

SOLVING: EMPTY WEIGHT CENTER OF GRAVITY

Formula: $\text{C.G.} = D - \frac{F \times L}{W} = 34'' - \frac{454 \times 67.8}{1673} = 34'' - 18.3'' = 15.7''$

Reference for formula Fig. 16-4

FIGURE 16-6—Empty weight and empty weight center-of-gravity—nose-wheel type aircraft.

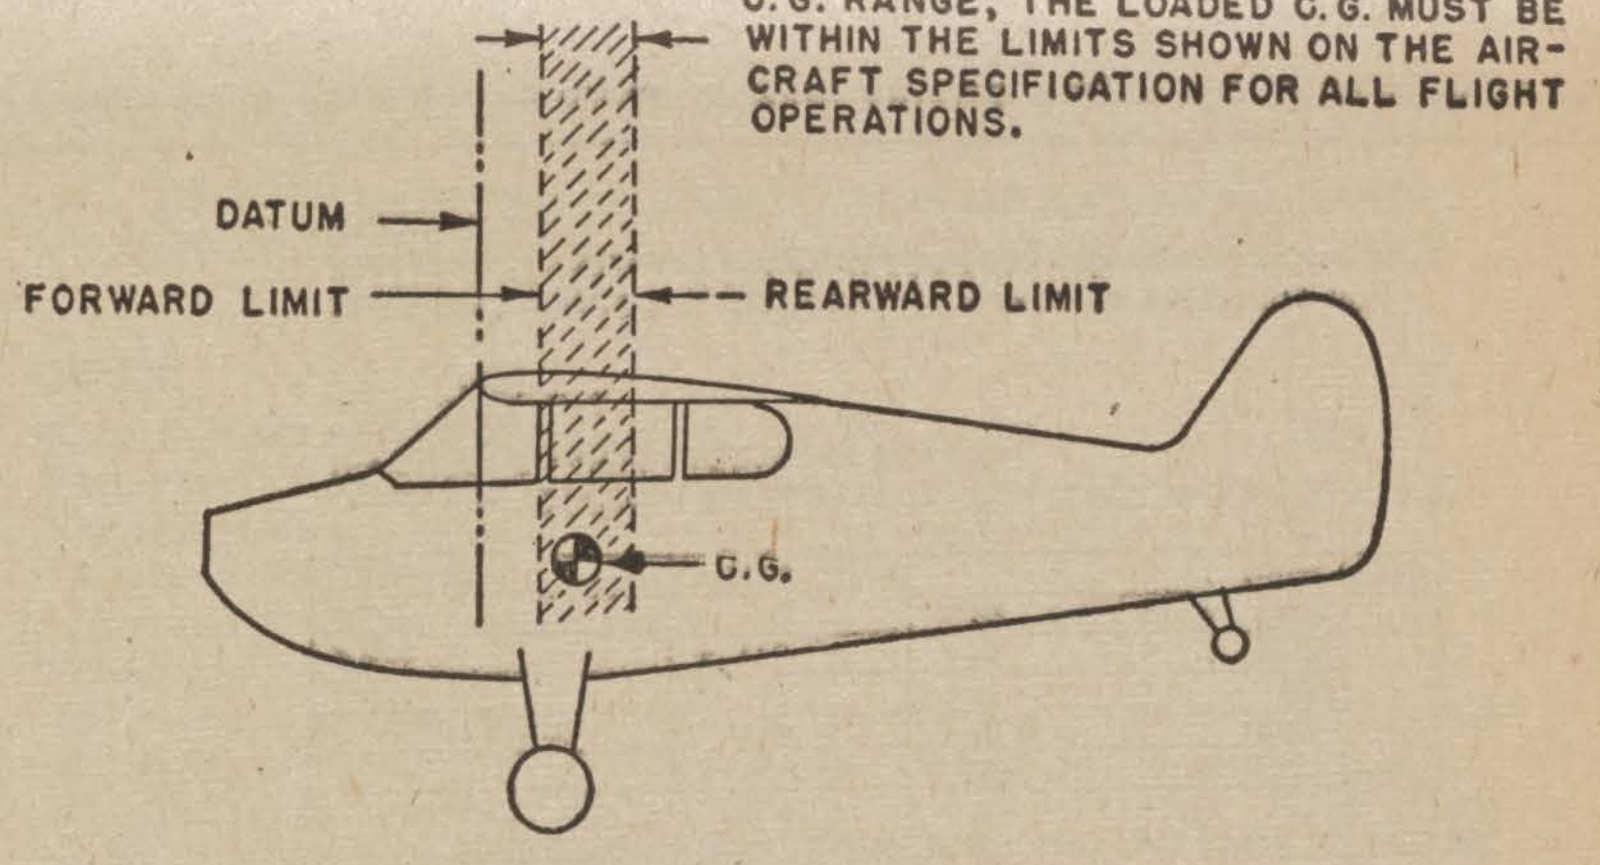
C.G. RANGE, THE LOADED C.G. MUST BE WITHIN THE LIMITS SHOWN ON THE AIRCRAFT SPECIFICATION FOR ALL FLIGHT OPERATIONS.
DATUM
FORWARD LIMIT
REARWARD LIMIT
C.G.

FIGURE 16-7—Operating center-of-gravity range.

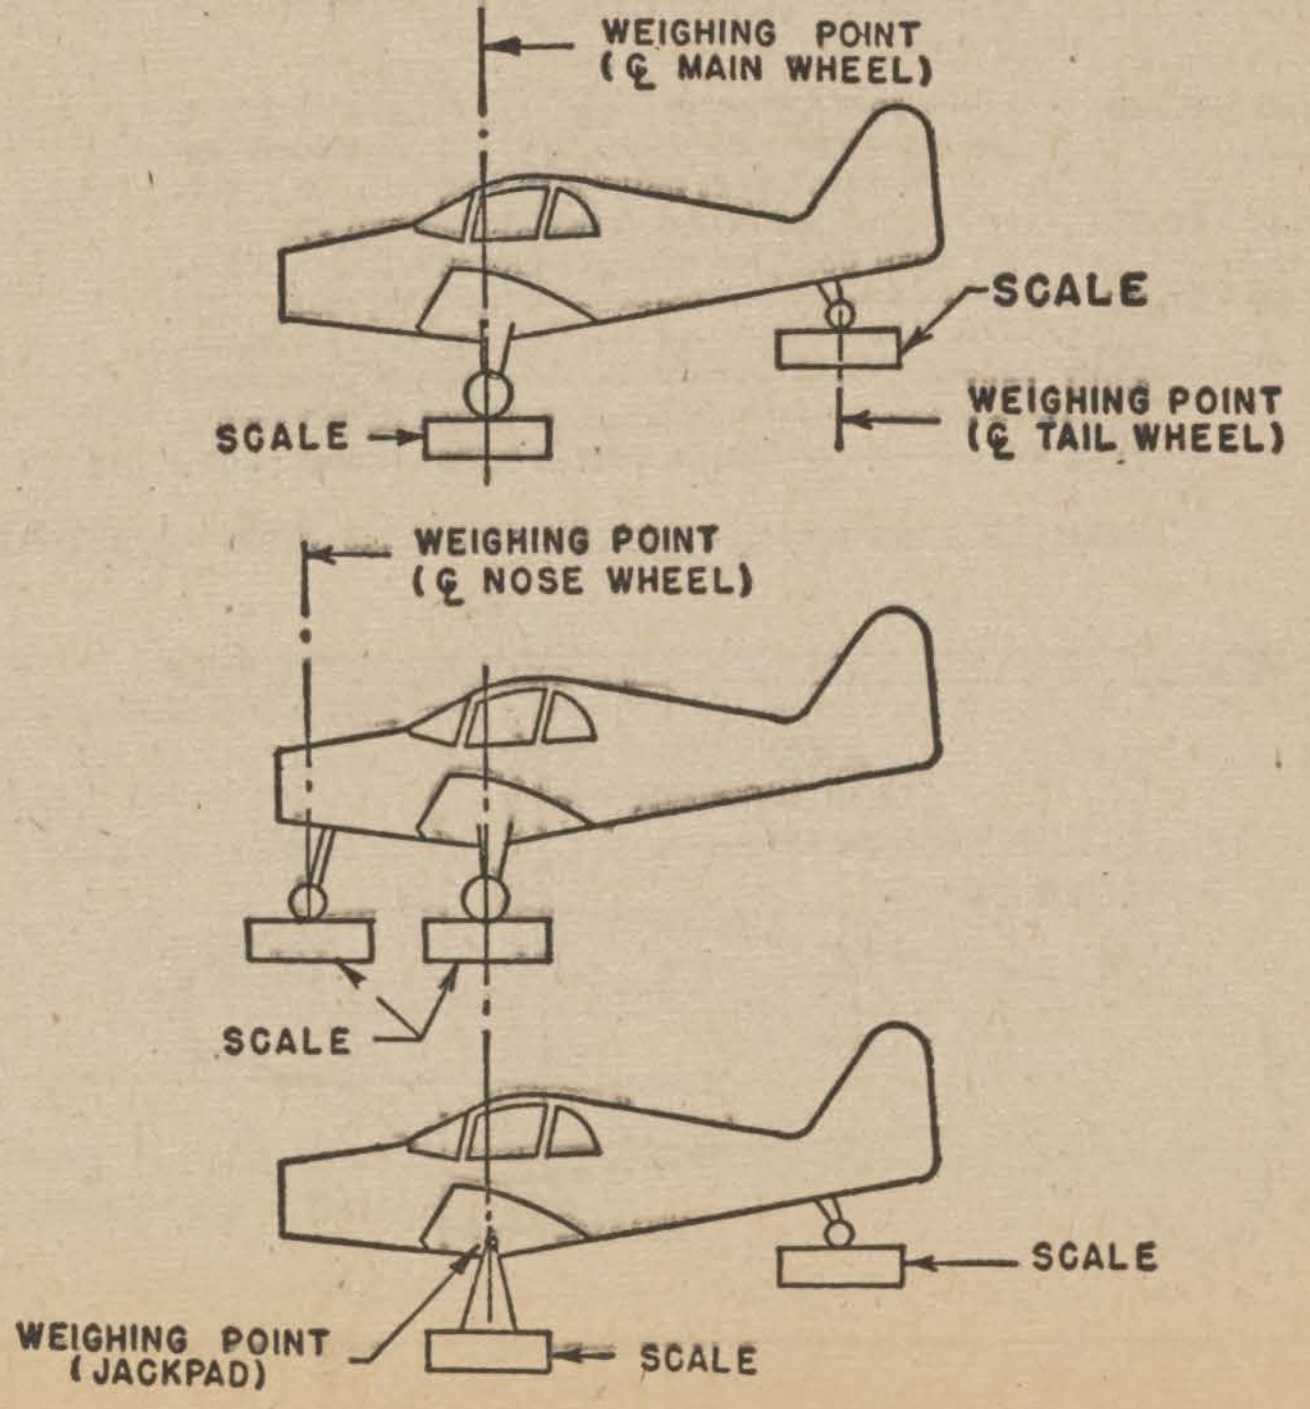
WEIGHING POINT (℄ MAIN WHEEL)
SCALE
SCALE
WEIGHING POINT (℄ TAIL WHEEL)
WEIGHING POINT (℄ NOSE WHEEL)
SCALE
SCALE
WEIGHING POINT (JACKPAD)
SCALE

FIGURE 16-8—Weighing point centerline.

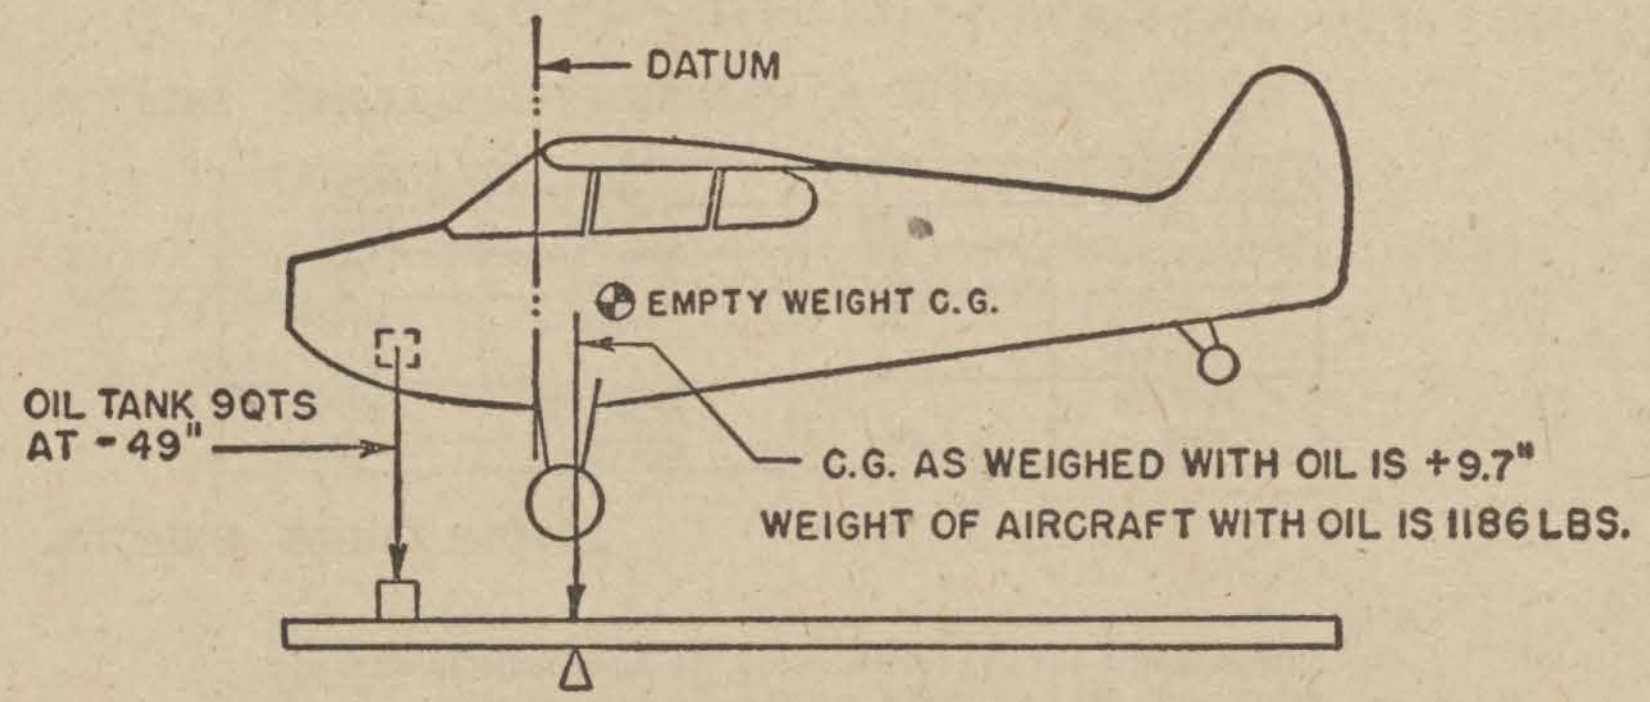
DATUM
EMPTY WEIGHT C.G.
OIL TANK 9QTS AT -49"
C.G. AS WEIGHED WITH OIL IS +9.7"
WEIGHT OF AIRCRAFT WITH OIL IS 1186 LBS.

**EMPTY WEIGHT AND EMPTY WEIGHT CENTER OF GRAVITY**
**(when aircraft is weighed with oil)**

**GIVEN:**

| | |
|---|---|
| Aircraft as weighed with full oil------ | 1186 lbs. |
| Center of gravity---------------------- | 9.7" |
| Full oil capacity 9 qts.----------------- | 17 lbs. |

**SOLVING:**

| | Weight # | x Arm" | Moment "# |
|---|---|---|---|
| Aircraft as weighed | + 1186 | + 9.7 | + 11504 |
| Less oil | - 17 | - 49.0 | + 833 |
| Total | + 1169(A) | | + 12337(B) |

Empty Weight (A) = 1169 pounds.

Empty Weight Center of Gravity $\frac{B}{A} = \frac{12337}{1169} = +10.6''$

FIGURE 16-9—Empty weight and empty weight center-of-gravity when aircraft is weighed with oil.

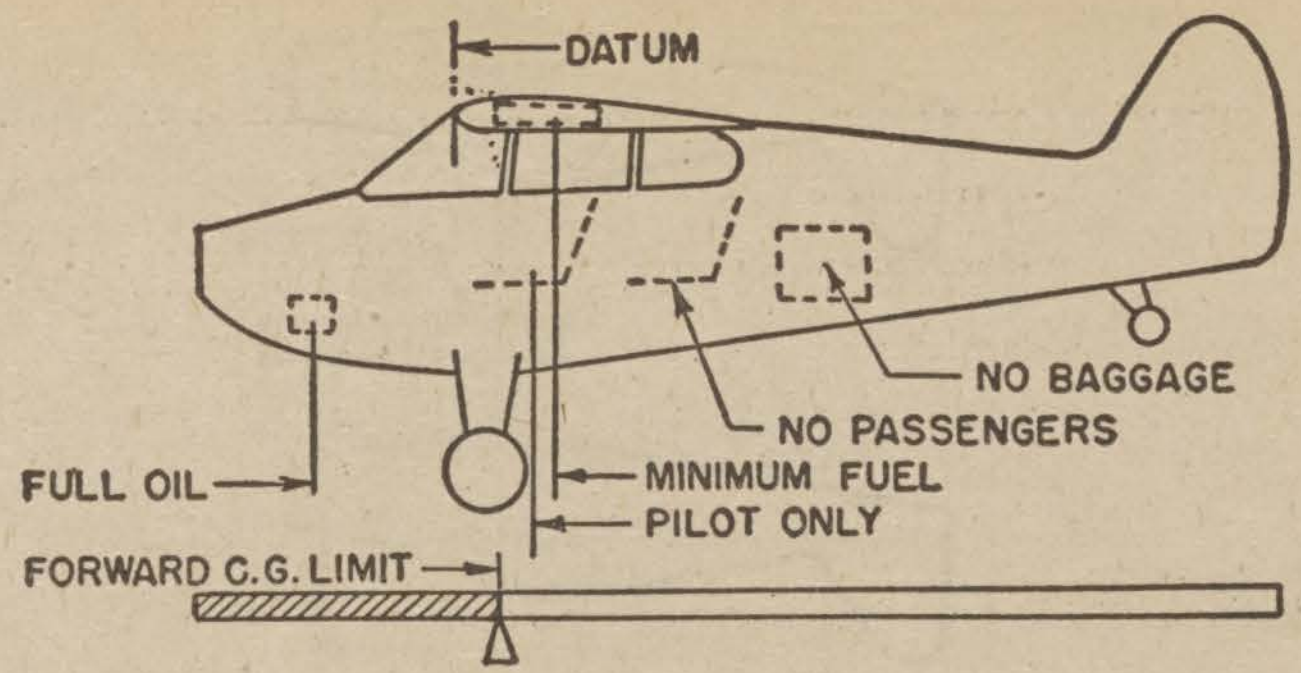

**TO CHECK: MOST FORWARD WEIGHT AND BALANCE EXTREME.**

GIVEN:

| | |
|---|---|
| Actual empty weight of the airplane-------------- | 1169# |
| Empty weight center of gravity ----------------- | +10.6" |
| *Maximum weight --------------------------- | 2100# |
| *Forward C.G. limit ------------------------- | + 8.5" |
| *Oil, capacity 9 qts. --------------------------- | 17# at - 49 |
| *Pilot in farthest forward seat equipped with controls (unless otherwise placarded) ---------- | 170# at + 16" |
| *Since the fuel tank is located to the rear of the forward C.G. limit, minimum fuel should be included. $\frac{\text{METO HP}}{12} = \frac{165}{12} = 13.75$ gal. x 6# ------- | 83# at + 22" |

*Information should be obtained from the aircraft specification.

Note: Any items or passengers must be used if they are located ahead of the forward C.G. limit.
Full fuel must be used if the tank is located ahead of the forward C.G. limit.

CHECK OF FORWARD WEIGHT AND BALANCE EXTREME

| | Weight (#) | x Arm (") | Moment ("#) |
|---|---|---|---|
| Aircraft Empty | + 1169 | + 10.6 | + 12391 |
| Oil | + 17 | - 49 | - 833 |
| Pilot | + 170 | + 16 | + 2720 |
| Fuel | + 83 | + 22 | + 1826 |
| Total | + 1439 (TW) | | + 16104 (TM) |

Divide the TM (Total Moment) by the TW (Total Weight) to obtain the forward weight and balance extreme.

$\frac{TM}{TW} = \frac{16104}{1439} = +\ 11.2''$

Since the forward C.G. limit and the maximum weight are not exceeded, the forward weight and balance extreme condition is satisfactory.

FIGURE 16-10—Example of check of most forward weight and balance extreme.

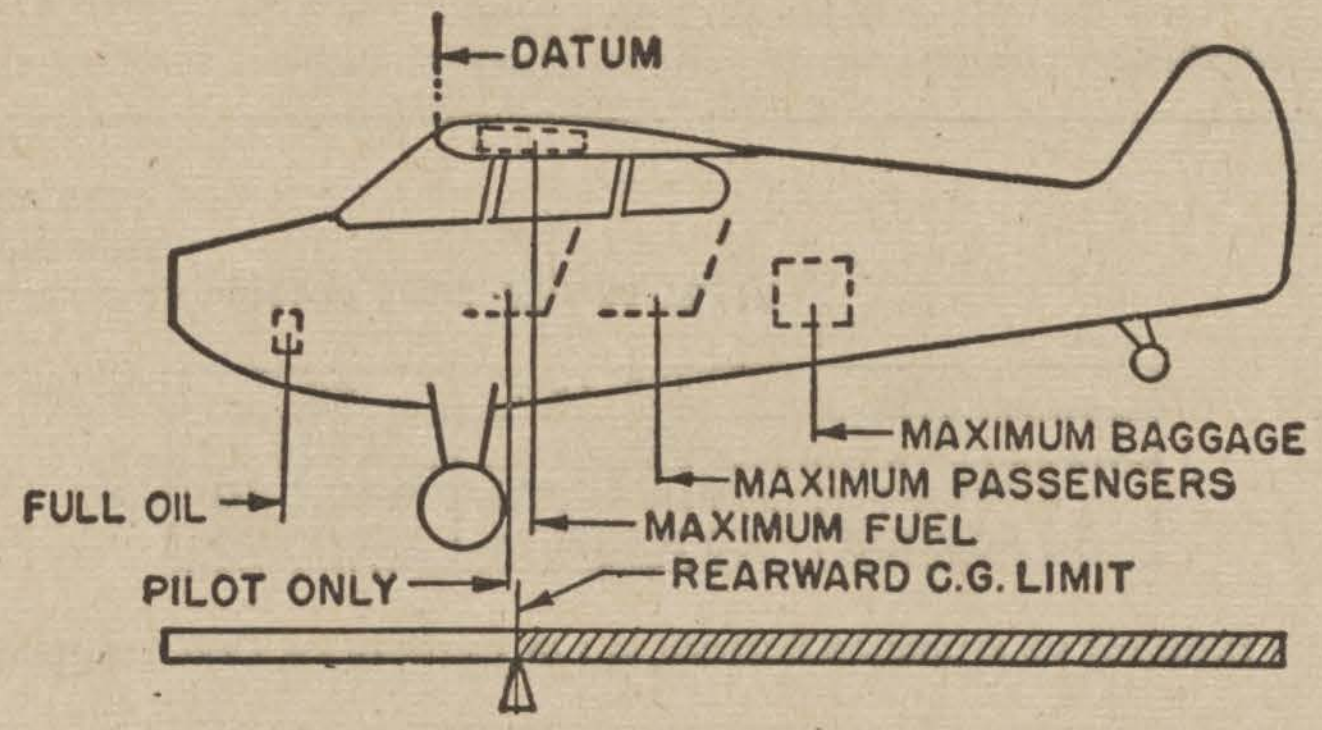

**TO CHECK: MOST REARWARD WEIGHT AND BALANCE EXTREME.**

GIVEN: Actual empty weight of the airplane --------- 1169#
Empty weight center of gravity ------------- 10.6"
*Maximum weight ------------------------ 2100#
*Rearward C.G. limit --------------------- 21.9"
*Oil capacity 9 qts. ----------------------- 17# at - 49"
*Baggage, placarded do not exceed 100 lbs. --- 100# at + 75.5"
*Two passengers in rear seats, 170 x 2 ------ 340# at + 48"
*Pilot in most rearward seat equipped with
controls (unless otherwise placarded) ------- 170# at + 16"
*Since the fuel tank is located aft of the
rearward C.G. limit full fuel must be used --- 240# at + 22"

* Information should be obtained from the aircraft specification.

Note: If fuel tanks are located ahead of the rearward C.G. limit minimum fuel should be used.

**CHECK OF REARWARD WEIGHT AND BALANCE EXTREME**

| | Weight (#) | x Arm (") | = Moment ("#) |
|---|---|---|---|
| Aircraft empty | + 1169 | + 10.6 | + 12391 |
| Oil | + 17 | - 49 | - 833 |
| Pilot (1) | + 170 | + 16 | + 2720 |
| Passengers (2) | + 340 | + 48 | + 16320 |
| Fuel (40 gals.) | + 240 | + 22 | + 5280 |
| Baggage | + 100 | + 75.5 | + 7550 |
| Total | + 2036 (TW) | | + 43428 (TM) |

Divide the TM (Total Moment) by the TW (Total Weight) to obtain the rearward weight and balance extreme.

$$\frac{TM}{TW} = \frac{43428}{2036} = +21.3''$$

Since the rearward C.G. limit and the maximum weight are not exceeded, the rearward weight and balance extreme condition is satisfactory.

FIGURE 16–11—Example of check of most rearward weight and balance extreme.

**EXAMPLE OF THE DETERMINATION OF THE NUMBER OF PASSENGERS AND BAGGAGE PERMISSIBLE WITH FULL FUEL**

GIVEN:
Actual empty weight of the aircraft ------------------ 1169#
Empty weight center of gravity ---------------------- 10.6"
Maximum weight ---------------------------------- 2100#
Datum is leading edge of the wing
Forward center of gravity limit ---------------------- 8.5"
Rearward center of gravity limit --------------------- 21.9"
Oil capacity, 9 qts.; show full capacity ---------------- 17# at -49"
Baggage, maximum ------------------------------- 100# at +75.5"
Two passengers in rear seat, 170# x 2 --------------- 340# at +48"
Pilot in most rearward seat equipped with
controls (unless otherwise placarded) ---------------- 170# at +16"
Full fuel, 40 gals. x 6# ---------------------------- 240# at +22"

| | Weight(#) | x Arm(") | = Moment("#) |
|---|---|---|---|
| Aircraft empty | + 1169 | + 10.6 | + 12391 |
| Oil | + 17 | - 49 | - 833 |
| Full fuel | + 240 | + 22 | + 5280 |
| Passengers, 2 rear | + 340* | + 48 | + 16320 |
| Pilot | + 170 | + 16 | + 2720 |
| Baggage | + 100 | + 75.5 | + 7550 |
| Total | + 2036 (TW) | | + 43428 (TM) |

Divide the TM (total moment) by the TW (total weight) to obtain the loaded center of gravity.

$$\frac{TM}{TW} = \frac{43428}{2036} = +21.3''$$

The above computations show that with full fuel, 100 pounds of baggage and two passengers in the rear seat may be carried in this aircraft without exceeding either the maximum weight or the approved C.G. range.

This condition may be entered in the loading schedule as follows:

| GALLONS OF FUEL | NUMBER OF PASSENGERS | POUNDS OF BAGGAGE |
|---|---|---|
| Full | 2 Rear | 100 |

* Only two passengers are listed to prevent the maximum weight of 2100 lbs. from being exceeded.

FIGURE 16–12—Loading conditions: Determination of the number of passengers and baggage permissible with full fuel.

EXAMPLE OF THE DETERMINATION OF THE POUNDS OF FUEL AND BAGGAGE PERMISSIBLE WITH MAXIMUM PASSENGERS

| | Weight (#) | x Arm (") | = Moment ("#) |
|---|---|---|---|
| Aircraft empty | + 1169 | + 10.6 | + 12391 |
| Oil | + 17 | - 49 | - 833 |
| Pilot | + 170 | + 16 | + 2720 |
| Passenger, 1 front | + 170 | + 16 | + 2720 |
| Passengers, 2 rear | + 340 | + 48 | + 16320 |
| Fuel (39 gals.) | + 234 | + 22 | + 5148 |
| Baggage | --- | --- | --- |
| Total | + 2100 | | + 38466 |

Divide the TM (total moment) by the TW (total weight) to obtain the loaded center of gravity.

$$\frac{TM}{TW} = \frac{38466}{2100} = +18.3''$$

The above computations show that with the maximum number of passengers, 39 gallons of fuel and zero pounds of baggage may be carried in this aircraft without exceeding either the maximum weight or the approved C.G. range.

This condition may be entered in the loading schedule as follows:

| GALLONS OF FUEL | NUMBER OF PASSENGERS | POUNDS OF BAGGAGE |
|---|---|---|
| * FULL | *2 rear | * 100 |
| 39 | 1(F) 2(R) | None |

* Conditions as entered from Figure 16-12
(F) Front seat
(R) Rear seat

FIGURE 16-13—Loading conditions: Determination of the fuel and baggage permissible with maximum passengers.

EXAMPLE OF THE DETERMINATION OF THE FUEL AND THE NUMBER AND LOCATION OF PASSENGERS PERMISSIBLE WITH MAXIMUM BAGGAGE

| | Weight (#) | x Arm ('') | = Moment (''#) |
|---|---|---|---|
| Aircraft empty | + 1169 | + 10.6 | + 12391 |
| Oil | + 17 | - 49 | - 833 |
| Pilot | + 170 | + 16 | + 2720 |
| Passenger (1) rear | + 170 | + 48 | + 8160 |
| Passenger (1) front | + 170 | + 16 | + 2720 |
| Fuel (40 gals.) | + 240 | + 22 | + 5280 |
| Baggage | + 100 | + 75.5 | + 7550 |
| Total | + 2036 | | + 37988 |

Divide the TM (total moment) by the TW (total weight) to obtain the loaded center of gravity.

$$\frac{TM}{TW} = \frac{37988}{2036} = +18.7$$

The above computations show that with maximum baggage, full fuel and 2 passengers (1 in the front seat and 1 in the rear seat) may be carried in this aircraft without exceeding either the maximum weight or the approved C.G. range.

This condition may be entered in the loading schedule as follows:

| GALLONS OF FUEL | NUMBER OF PASSENGERS | POUNDS OF BAGGAGE |
|---|---|---|
| * Full | * 2 Rear | *100 |
| ** 39 | *1(F) 2(R) | **None |
| Full | 1(F) 1(R) | Full |

*Conditions as entered from Figure 16-12
**Conditions as entered from Figure 16-13
(F) Front seat
(R) Rear seat

FIGURE 16-14—Loading conditions: Determination of the fuel and the number and location of passenger permissible with maximum baggage.

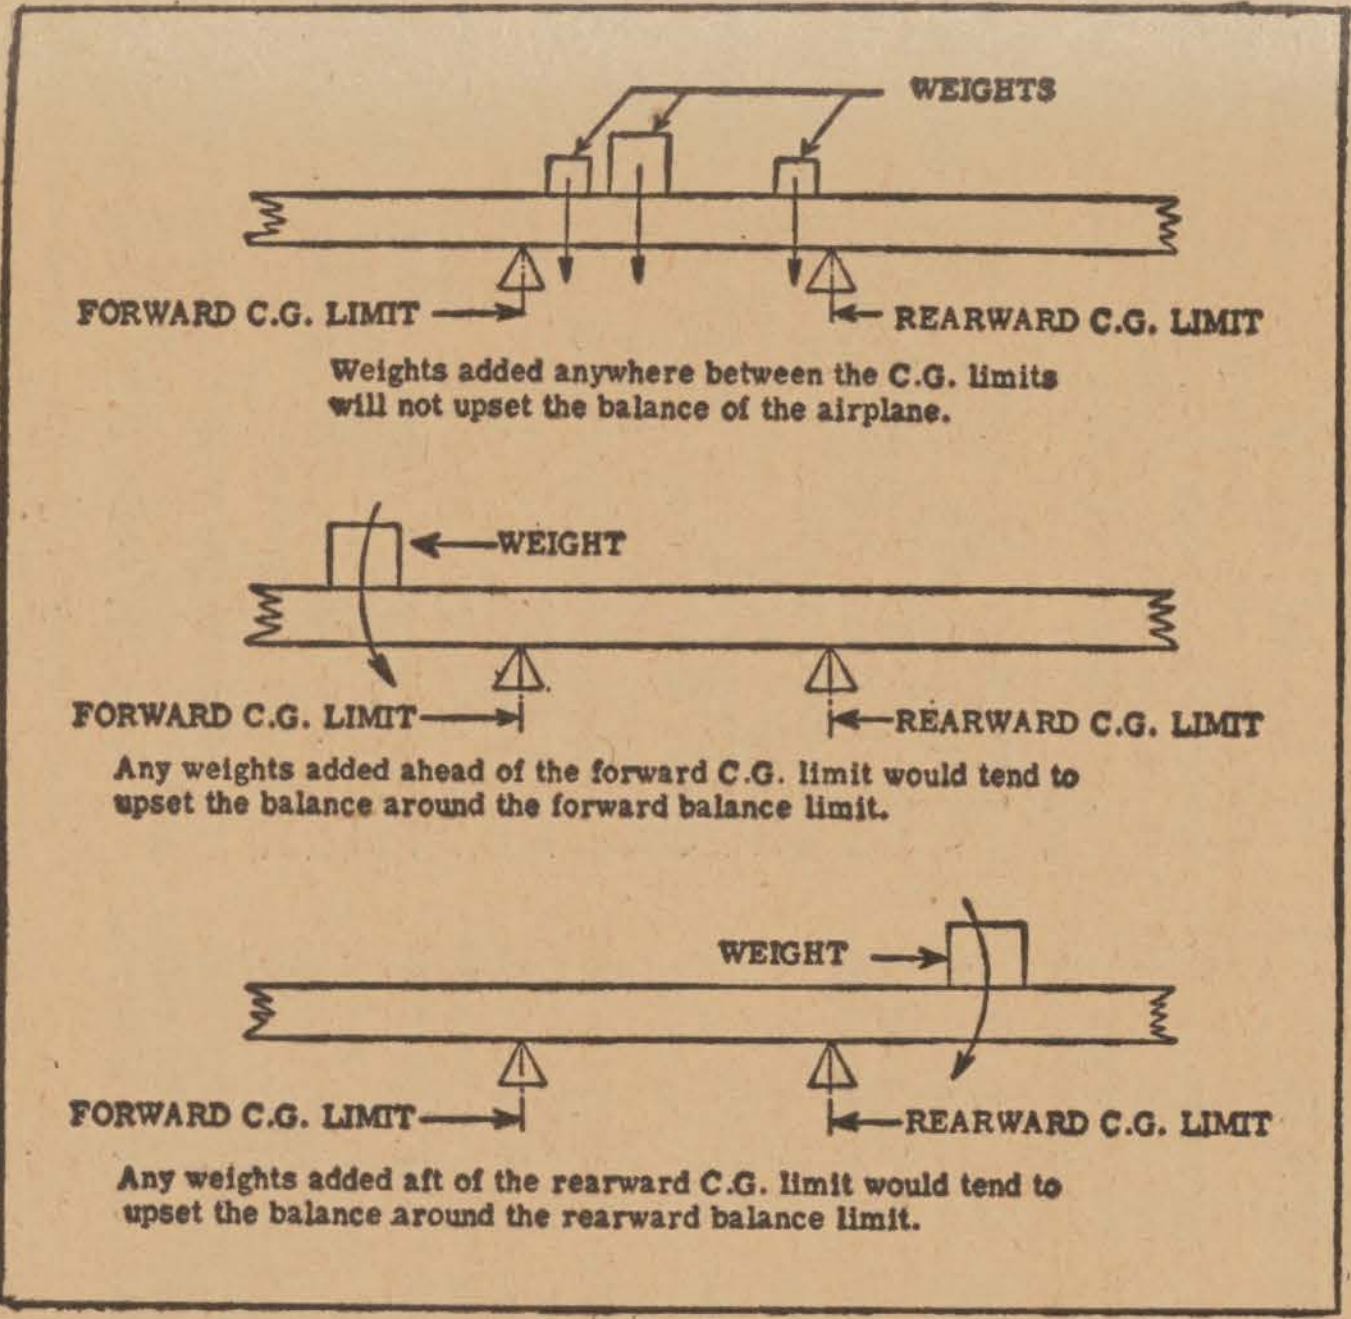

Weights added anywhere between the C.G. limits will not upset the balance of the airplane.

Any weights added ahead of the forward C.G. limit would tend to upset the balance around the forward balance limit.

Any weights added aft of the rearward C.G. limit would tend to upset the balance around the rearward balance limit.

FIGURE 16-15—Effects of the addition of equipment items on balance.

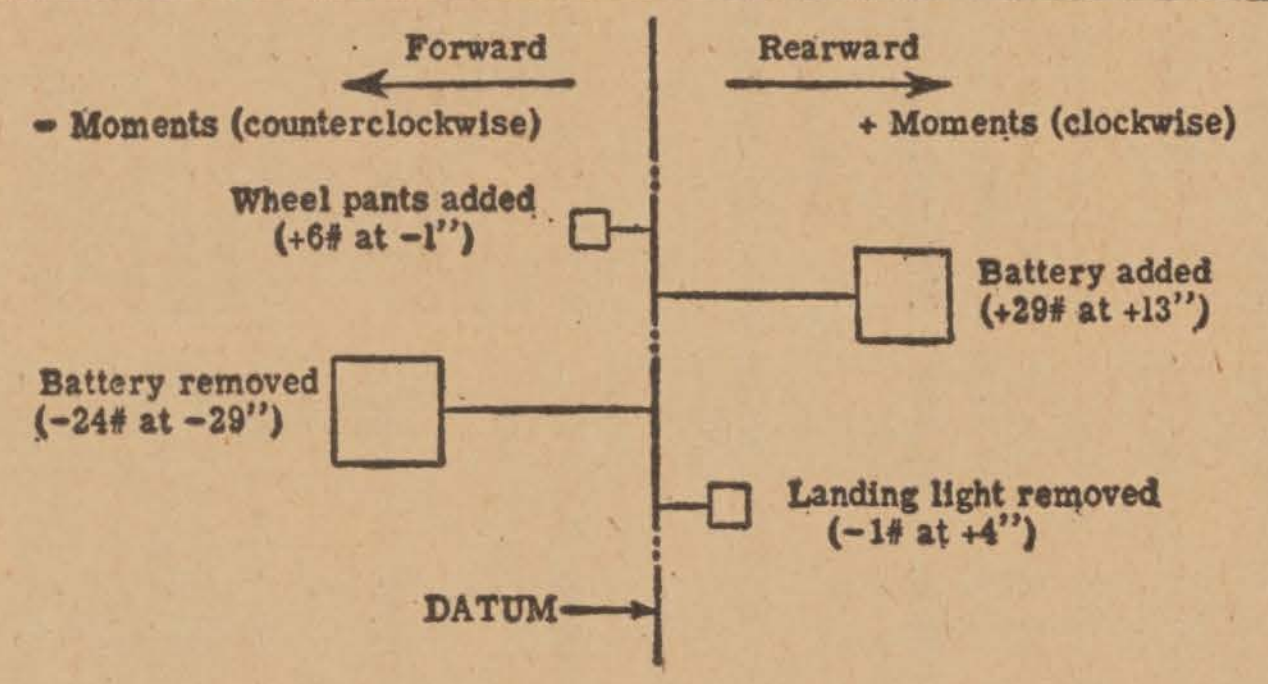
Forward
- Moments (counterclockwise)
Rearward
+ Moments (clockwise)
Wheel pants added (+6# at -1")
Battery added (+29# at +13")
Battery removed (-24# at -29")
Landing light removed (-1# at +4")
DATUM

| Weight (#) | x Arm (") | = Moment ("#) |
|---|---|---|
| ADDED | | |
| Item 204 wheel pants + 6 | - 1 | - 6 |
| Item 302b Battery + 29 | +13 | +377 |
| REMOVED | | |
| Item 302a Battery - 24 | -29 | +696 |
| Item 303 Landing light - 1 | + 4 | - 4 |

This condition is shown properly entered on a sample weight and balance report on Figure 16-18 under Equipment Change.

FIGURE 16-16—Example of moment and weight changes resulting from equipment changes.

MAKE MA-700 MODEL A SERIAL # 0000 REGISTRATION # N1234
DATUM IS leading edge of wing.

COMPUTE AS FOLLOWS IF AIRCRAFT WEIGHED

1. Leveling means: level top longeron between front and rear seats.
2. Main wheel weighing point is located (____ "FORWARD)(+ 3 " AFT) of datum.
3. Actual measured distance from the main weight point centerline to the tail (or nose) point centerline 222 ".
4. Oil over and above "ZERO" tank reading = (a. — Gals.)(b. — Lbs.)(c. — In.)

ACTUAL EMPTY WEIGHT

| | Weight Point | Scale Reading | - Tare | = Net Weight |
|---|---|---|---|---|
| 5. | Right | 564 | 0 | 564 |
| 6. | Left | 565 | 0 | 565 |
| 7. | Tail | 67 | 27 | 40 |
| 8. | Nose | — | — | — |
| 9. | Total Net Weight | | | 1169 |

CENTER OF GRAVITY AS WEIGHED

10. C.G. relative to main wheel weighing point:
(a) Tail wheel airc. $\frac{(\text{item } 3,\ 222) \quad X \quad (\text{Item } 7,\ 40)}{(\text{Item } 9,\ 1169)}$ = + 7.6 = C.G.
(b) Nose wheel airc. $\frac{(\text{Item } 3\ —) \quad X \quad (\text{Item } 8\ —)}{(\text{Item } 9\ —)}$ = ____ = C.G.

11. C.G. relative to datum:
(a) Tail wheel airc. (Item 10a, + 7.6) added to (Item 2, + 3) = + 10.6" = C.G.
(b) Nose wheel airc. (Item 10b, ) added to (Item 2, ) = ____ = C.G.

COMPUTE IF AIRCRAFT WEIGHED WITH OIL (Item 4)

| | Weight | X Arm | = Moment |
|---|---|---|---|
| Aircraft | (9) | (11) | |
| Less Oil | (4b) | (4c) | |
| Empty Totals | (a) | | (b) |

12. $\frac{(b)}{(a)}$ ---------- = (c)----------" = Empty weight C.G.

REPAIR AGENCY ________ Name ________ Number DATE ________

FIGURE 16-17 —Sample weight and balance report to determine empty weight center-of-gravity.

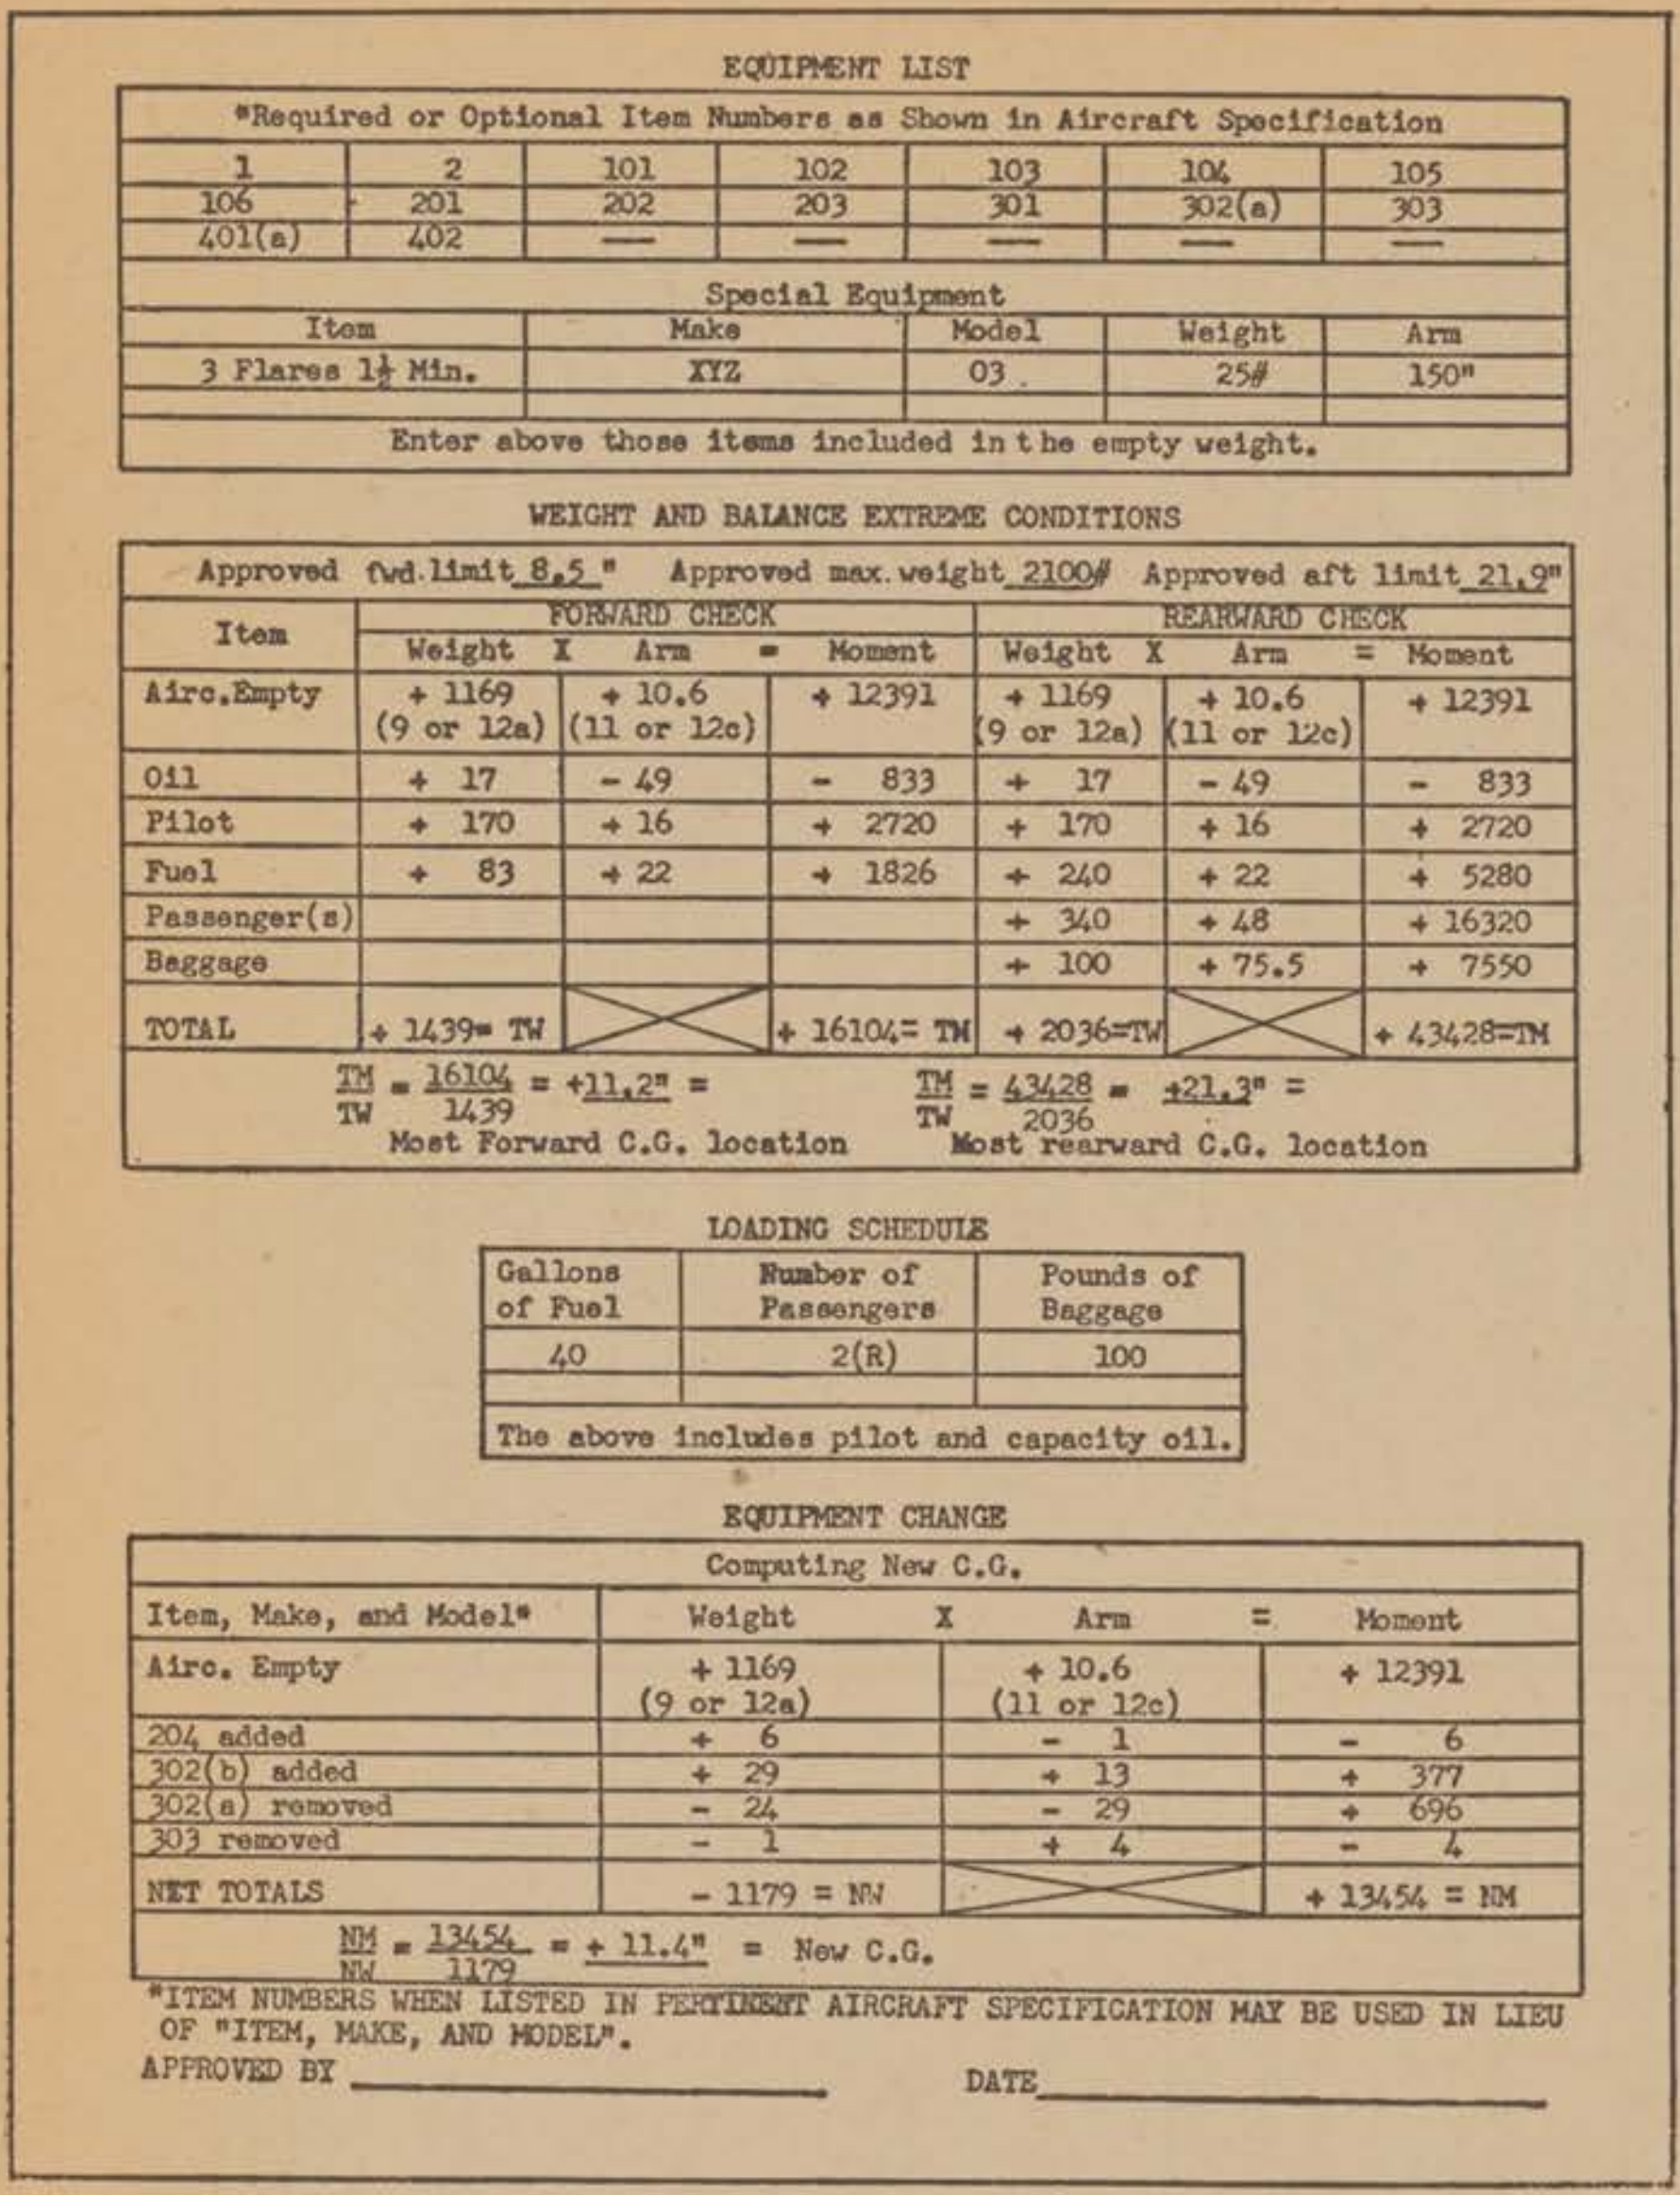

EQUIPMENT LIST

| *Required or Optional Item Numbers as Shown in Aircraft Specification | | | | | | |
|---|---|---|---|---|---|---|
| 1 | 2 | 101 | 102 | 103 | 104 | 105 |
| 106 | 201 | 202 | 203 | 301 | 302(a) | 303 |
| 401(a) | 402 | — | — | — | — | — |

Special Equipment

| Item | Make | Model | Weight | Arm |
|---|---|---|---|---|
| 3 Flares 1½ Min. | XYZ | 03 | 25# | 150" |
| | | | | |

Enter above those items included in the empty weight.

WEIGHT AND BALANCE EXTREME CONDITIONS

Approved fwd. limit 8.5" Approved max. weight 2100# Approved aft limit 21.9"

| Item | FORWARD CHECK | | | REARWARD CHECK | | |
|---|---|---|---|---|---|---|
| | Weight X | Arm = | Moment | Weight X | Arm = | Moment |
| Airc. Empty | + 1169<br>(9 or 12a) | + 10.6<br>(11 or 12c) | + 12391 | + 1169<br>(9 or 12a) | + 10.6<br>(11 or 12c) | + 12391 |
| Oil | + 17 | - 49 | - 833 | + 17 | - 49 | - 833 |
| Pilot | + 170 | + 16 | + 2720 | + 170 | + 16 | + 2720 |
| Fuel | + 83 | + 22 | + 1826 | + 240 | + 22 | + 5280 |
| Passenger(s) | | | | + 340 | + 48 | + 16320 |
| Baggage | | | | + 100 | + 75.5 | + 7550 |
| TOTAL | + 1439 = TW | ╳ | + 16104 = TM | + 2036 = TW | ╳ | + 43428 = TM |

$\frac{TM}{TW} = \frac{16104}{1439} = +11.2" =$ Most Forward C.G. location

$\frac{TM}{TW} = \frac{43428}{2036} = +21.3" =$ Most rearward C.G. location

LOADING SCHEDULE

| Gallons of Fuel | Number of Passengers | Pounds of Baggage |
|---|---|---|
| 40 | 2(R) | 100 |
| | | |

The above includes pilot and capacity oil.

EQUIPMENT CHANGE

Computing New C.G.

| Item, Make, and Model* | Weight X | Arm = | Moment |
|---|---|---|---|
| Airc. Empty | + 1169<br>(9 or 12a) | + 10.6<br>(11 or 12c) | + 12391 |
| 204 added | + 6 | - 1 | - 6 |
| 302(b) added | + 29 | + 13 | + 377 |
| 302(a) removed | - 24 | - 29 | + 696 |
| 303 removed | - 1 | + 4 | - 4 |
| NET TOTALS | - 1179 = NW | ╳ | + 13454 = NM |

$\frac{NM}{NW} = \frac{13454}{1179} = +11.4" =$ New C.G.

*ITEM NUMBERS WHEN LISTED IN PERTINENT AIRCRAFT SPECIFICATION MAY BE USED IN LIEU OF "ITEM, MAKE, AND MODEL".

APPROVED BY ______________ DATE ______________

FIGURE 16-18—Sample weight and balance report including an equipment change for aircraft fully loaded.

This supplement shall become effective November 30, 1953.

[SEAL]

F. B. LEE,
*Administrator of Civil Aeronautics.*

[F. R. Doc. 53-9127; Filed, Nov. 20, 1953; 8:55 a. m.]

---

## Chapter II—Civil Aeronautics Administration, Department of Commerce

[Amdt. 21]

### PART 600—DESIGNATION OF CIVIL AIRWAYS

ALTERATIONS

The civil airway alterations appearing hereinafter have been coordinated with the civil operators involved, the Army, the Navy, and the Air Force, through the Air Coordinating Committee, Airspace Subcommittee, and are adopted to become effective when indicated in order to promote safety of the flying public. Compliance with the notice, procedures, and effective date provisions of section 4 of the Administrative Procedure Act would be impracticable and contrary to public interest and therefore is not required. Part 600 is amended as follows:

1. Section 600.281 is amended to read:

§ 600.281 *Red civil airway No. 81 (Lansing, Mich., to Detroit, Mich.).* From the Lansing, Mich., radio range station to the intersection of the southeast course of the Lansing, Mich., radio range and the west course of the Detroit, Mich., radio range.

2. Section 600.630 *Blue civil airway No. 30 (Brownsville, Tex., to Pueblo, Colo.),* is amended by substituting the words: "excluding the portion which lies more than 3 miles southeast of the southwest course of the Corpus Christi, Tex., radio range;" for the words: "excluding the portion which lies more than 2 miles southeast of the southwest course of the Corpus Christi, Tex., radio range;"

3. Section 600.645 *Blue civil airway No. 45 (Greenfield, Mass., to Lebanon, N. H.),* is corrected by substituting the words "and the southwest course of the Concord, N. H., radio range" for the words: "and the southeast course of the Concord, N. H., radio range"

(Sec. 205, 52 Stat. 984, as amended; 49 U. S. C. 425. Interprets or applies sec. 302, 52 Stat. 985, as amended; 49 U. S. C. 452)

This amendment shall become effective 0001 e. s. t. November 24, 1953.

[SEAL]

F. B. LEE,
*Administrator of Civil Aeronautics.*

[F. R. Doc. 53-9800; Filed, Nov. 20, 1953; 8:45 a. m.]

---

[Amdt. 21]

### PART 601—DESIGNATION OF CONTROL AREAS, CONTROL ZONES, AND REPORTING POINTS

ALTERATIONS

The control area and reporting point alterations appearing hereinafter have been coordinated with the civil operators involved, the Army, the Navy, and the Air Force, through the Air Coordinating Committee, Airspace Subcommittee, and are adopted to become effective when indicated in order to promote safety of the flying public. Compliance with the notice, procedures, and effective date provisions of section 4 of the Administrative Procedure Act would be impracticable and contrary to public interest and therefore is not required. Part 601 is amended as follows:

1. Section 601.281 is amended by changing the caption to read: § 601.281 *Red civil airway No. 81 control areas (Lansing, Mich., to Detroit, Mich.).*

2. Section 601.1029 is amended to read:

§ 601.1029 *Control area extension (Corpus Christi, Tex.).* All that airspace lying in the north quadrant of the Corpus Christi, Tex., radio range within a 58-mile radius of the range station bounded on the southwest by Blue civil airway No. 30 and on the southeast by Green civil airway No. 6 including the airspace within 6 miles either side of the northeast course of the Refugio, Tex., radio range extending from the radio range station to a point 32 miles northeast and the airspace within 6 miles either side of the northwest course of the Beeville, Tex., radio range extending from the radio range station to a point 25 miles northwest.

3. Section 601.1229 *Control area extension (Tampa, Fla.),* is revoked.

4. Section 601.1229 is added to read:

§ 601.1229 *Control area extension (Atterbury, Ind.).* That airspace bounded on the south by Lat. 39°10′00″, on the west by Long. 86°00′00″ and on the east and northeast by VOR civil airway No. 51, excluding the portion which overlaps Atterbury danger area (D-65).

5. Section 601.4016 *Green civil airway No. 6 (Laredo, Tex., to Norfolk, Va.)*, is amended after "Mobile, Ala., radio range station;" by adding the following reporting point: "the intersection of the northeast course of the Mobile, Ala., radio range and the northwest course of the Pensacola, Fla., radio range;"

6. Section 601.4281 is amended by changing the caption to read: § 601.4281 *Red civil airway No. 81 (Lansing, Mich., to Detroit, Mich.)*.

7. Section 601.4628 is amended to read:

§ 601.4628 *Blue civil airway No. 28 (Charleston, S. C., to Bulls Gap, Tenn.)*. The intersection of the northwest course of the Spartanburg, S. C., radio range and a line bearing 57° True from the Asheville, N. C. (Hendersonville), nondirectional radio beacon.

8. Section 601.4639 is amended to read:

§ 601.4639 *Blue civil airway No. 39 (Savannah, Ga., to Elmira, N. Y.)*. The Paynesville, W. Va., nondirectional radio beacon; the intersection of the southeast course of the Pittsburgh, Pa., radio range and the northeast course of the Morgantown, W. Va., radio range.

9. Section 601.7001 *Domestic VOR reporting points* is amended by deleting the following reporting point:

Fairville intersection: the intersection of the Rochester, N. Y., omnirange 087° True and the Elmira, N. Y., omnirange 004° True radials.

(Sec. 205, 52 Stat. 984, as amended; 49 U. S. C. 425. Interprets or applies sec. 601, 52 Stat. 1007, as amended; 49 U. S. C. 551)

This amendment shall become effective 0001 e. s. t. November 24, 1953.

[SEAL] F. B. LEE,
*Administrator of Civil Aeronautics.*

[F. R. Doc. 53-9801; Filed, Nov. 20, 1953; 8:45 a. m.]

---

# NOTICES

## DEPARTMENT OF THE TREASURY

### Foreign Assets Control

### IMPORTATION OF CERTAIN MERCHANDISE DIRECTLY FROM HONG KONG, JAPAN, TAIWAN, THE REPUBLIC OF KOREA, AND THE FEDERAL REPUBLIC OF GERMANY

### AVAILABLE CERTIFICATIONS BY SPECIFIED FOREIGN GOVERNMENTS

Notice is hereby given that certificates of origin issued by the governments hereinafter listed under procedures agreed upon between the specified certifying agencies of those governments and the Foreign Assets Control are available with respect to the importation into the United States, directly or on a through bill of lading, from the respective countries of the following commodities:

From Hong Kong (certificates issued by the Hong Kong Department of Commerce and Industry):
- Bean curd (Aug. 15, 1953).
- Bean thread (Apr. 23, 1953).
- Confectionery (Aug. 15, 1953).
- Cotton dolls (June 18, 1953).
- Cotton pincushions (June 18, 1953).
- Cotton waste (Jan. 9, 1953).
- Cotton wearing apparel (Jan. 12, 1953).
- Footwear, embroidered (Sept. 29, 1953).
- Hardwood furniture (Jan. 9, 1953).
- Ivory manufactures (Jan. 9, 1953).
- Joss candles (Oct. 27, 1953).
- Linen manufactures, embroidered (Sept. 29, 1953).
- Needlework tapestries (June 18, 1953).
- Oysters and oyster sauce (Aug. 15, 1953).
- Plums, preserved (Jan. 9, 1953).
- Rice sticks (Aug. 15, 1953).
- Salt fish in oil (Jan. 9, 1953).
- Seagrass mats and squares (made from Formosan seagrass) (Oct. 27, 1953).
- Shrimp noodles (Oct. 27, 1953).
- Shrimp sauce and paste (Aug. 15, 1953).
- Shrimp slices, dried (Oct. 27, 1953).
- Silk manufactures (Jan. 9, 1953).
- Sugar, slab and white rock (Sept. 29, 1953).
- Tea, Formosan (June 18, 1953).
- Tungsten ore and concentrates (Jan. 9, 1953).
- Wastepaper baskets, folding, silk and rayon (Sept. 29, 1953).
- Water chestnuts (Jan. 9, 1953).

From Japan (certificates issued by the Japanese Ministry of International Trade and Industry):
- Abalone, canned or dried (Aug. 25, 1953).
- Bamboo, split (Aug. 25, 1953).
- Bamboo, sprouts, canned (May 5, 1953).
- Bamboo, sprouts, dried shredded (Aug. 25, 1953).
- Bamboo, sprouts, raw (Aug. 25, 1953).
- Braids, straw (Aug. 25, 1953).
- Cuttlefish, dried (Aug. 25, 1953).
- Fish (sea bream), canned prepared (Aug. 25, 1953).
- Floor coverings, grass and straw (Aug. 25, 1953).
- Floor coverings, seagrass mats and squares (Aug. 25, 1953).
- Ginko nuts, in the shells, canned or otherwise prepared (Aug. 25, 1953).
- Ginger (Jul. 30, 1953).
- Hog bristles (Jan. 29, 1953).
- Iriko (Oct. 6, 1953).
- Lotus root, canned (Aug. 25, 1953).
- Menthol (Aug. 25, 1953).
- Mushrooms, canned baked (Aug. 25, 1953).
- Mushrooms, dried (Aug. 25, 1953).
- Mushrooms, prepared (Aug. 25, 1953).
- Oysters, dried (Aug. 25, 1953).
- Quail, frozen (Aug. 25, 1953).
- Red beans (Oct. 6, 1953).
- Sardines, dried (Aug. 25, 1953).
- Scallions, pickled (Aug. 25, 1953).
- Scallops, dried (Aug. 25, 1953).
- Seaweed, dried (Aug. 25, 1953).
- Shark fins (July 30, 1953).
- Soy bean sauce (May 5, 1953).
- Walnuts (July 30, 1953).

From Taiwan (Formosa) certificates issued by the Ministry of Economic Affairs of the Republic of China):
- Bamboo shoots, canned (June 10, 1953).
- Bamboo, split (June 10, 1953).
- Duck eggs, salted or preserved (Apr. 15, 1953).
- Ginger root, candied or otherwise preserved (June 10, 1953).
- Hog bristles, black, not to exceed four inches in length (June 10, 1953).
- Millet wine (Kaoliang) (Oct. 20, 1953).
- Olives, preserved (June 10, 1953).
- Plums, preserved (June 10, 1953).
- Prunes, preserved (June 10, 1953).
- Rice wine (Shaohsing) (Oct. 20, 1953).
- Seagrass squares (Feb. 5, 1953).
- Soy bean sauce (Nov. 9, 1953).
- Water chestnuts (Feb. 5, 1953).

From Republic of Korea (certificates issued by the Ministry of Commerce and Industry of the Republic of Korea):
- Hog bristles (Mar. 12, 1953).

From Federal Republic of Germany (Certificates issued by the Federal Ministry of Economics or the Federal Agency for Commodity Trade):
- Hog bristles, dyed (Sept. 21, 1953).

The date in parentheses following each type of merchandise set forth above is the date on which certification first became available for the merchandise specified.

It is contemplated that from time to time additions will be made to the list of certifiable commodities. Notices with respect to such commodities will be published in the FEDERAL REGISTER.

[SEAL] ELTING ARNOLD,
*Acting Director,*
*Foreign Assets Control.*

[F. R. Doc. 53-9869; Filed, Nov. 20, 1953; 8:56 a. m.]

---

### Office of the Secretary

[Treasury Department Order 180]

### COMMISSIONER OF NARCOTICS

### DELEGATION OF AUTHORITY WITH RESPECT TO FINAL APPROVAL OF COMPROMISES

By virtue of the authority vested in me by Reorganization Plan No. 26 of 1950, it is ordered as follows:

1. There are transferred to the Commissioner of Narcotics all the functions of the Secretary of the Treasury, the Under Secretary of the Treasury, or any Assistant Secretary of the Treasury under section 3761 (a) of the Internal Revenue Code with respect to the compromise of any criminal case arising under chapter 23 or part V or VI of subchapter A of chapter 27 of the Internal Revenue Code, except where the criminal liability relates only to delinquency in registration or delinquency in payment of tax.

2. In any case in which a general offer is made in compromise of civil or criminal liability compromisable by the Commissioner of Internal Revenue and of criminal liability compromisable by the Commissioner of Narcotics, they may jointly exercise the authority of the Secretary, the Under Secretary, or any Assistant Secretary under section 3761 (a) of the Internal Revenue Code.

3. Treasury Department Order No. 150-25, dated June 1, 1953, is modified accordingly.

Dated: November 17, 1953.

[SEAL] H. CHAPMAN ROSE,
*Acting Secretary of the Treasury.*

[F. R. Doc. 53-9844; Filed, Nov. 20, 1953; 8:54 a. m.]

# DEPARTMENT OF THE INTERIOR

## Bureau of Reclamation

### Bear River Project, Utah

#### ORDER OF REVOCATION

August 14, 1952.

Pursuant to the authority delegated by Departmental Order No. 2515 of April 7, 1949 (14 F. R. 1937), I hereby revoke Departmental Order of August 31, 1948, insofar as said order affects the following described lands; provided however that such revocation shall not affect the withdrawal of any other lands by said order or affect any other orders withdrawing or reserving the lands hereinafter described:

Salt Lake Base and Meridian, Utah

T. 12N., R. 9W.,
Sec. 1, all.

The above area aggregates 636.92 acres.

G. W. Lineweaver,
*Assistant Commissioner.*

November 17, 1953.

I concur. The records of the Bureau of Land Management will be noted accordingly.

The soil is a sandy clay loam and fairly free of surface rock. The topography is gently sloping. Adjoining land is now cultivated to small grains by dry-farm methods.

This order shall not otherwise become effective to change the status of the described lands until 10:00 a. m. on the 35th day after the date of this order. At that time the said lands shall become subject to application, petition, location and selection under the applicable public-land laws, subject to valid existing rights, the provisions of existing withdrawals, the requirements of applicable laws, and the 91-day preference right filing period for veterans and others entitled to preference under the act of September 27, 1944 (58 Stat. 747; 43 U. S. C. 279-284), as amended.

Information showing the periods during which, and the conditions under which, veterans and others may file applications for these lands may be obtained on request from the Manager of the Land and Survey Office, Salt Lake City, Utah.

William Pincus,
*Assistant Director,*
*Bureau of Land Management.*

[F. R. Doc. 53-9803; Filed, Nov. 20, 1953; 8:46 a. m.]

---

## Office of the Secretary

### Fort Belknap Indian Community, Montana

#### ADOPTION OF FEDERAL INDIAN LIQUOR LAWS ON RESERVATION

Pursuant to the act of August 15, 1953 (Public Law 277—83d Cong., 1st Sess.), I certify that the following ordinance relating to the application of the Federal Indian liquor laws on the Fort Belknap Reservation was duly adopted by the Fort Belknap Indian Community of Montana which has jurisdiction over the area of Indian country included in the resolution:

Whereas Public Law 277, 83d Congress, approved August 15, 1953 provides that sections 1154, 1156, 3113, 3488 and 3618 of title 18, United States Code, commonly referred to as the Federal Indian liquor laws, shall not apply to any act or transaction within any area of Indian country provided such act or transaction is in conformity with both the laws of the State in which such act or transaction occurs and with an ordinance duly adopted by the tribe having jurisdiction over such area of Indian country, certified by the Secretary of the Interior, and published in the Federal Register.

Therefore, be it resolved that the introduction or possession of intoxicating beverages shall be lawful within the Indian country under the jurisdiction of the Fort Belknap Indian Community: *Provided*, That such introduction or possession is in conformity with the laws of Montana.

Be it further resolved that any tribal laws, resolutions or ordinances heretofore enacted which prohibits the introduction or possession of intoxicating beverages are hereby repealed.

Orme Lewis,
*Assistant Secretary of the Interior.*

November 17, 1953.

[F. R. Doc. 53-9805; Filed, Nov. 20, 1953; 8:56 a. m.]

---

### Cheyenne River Sioux Tribe of South Dakota

#### ADOPTION OF FEDERAL INDIAN LIQUOR LAWS ON RESERVATION

Pursuant to the act of August 15, 1953 (Public Law 277, 83d Cong., 1st Sess.), I certify that the resolution designated as Resolution No. 99-53 was duly adopted by the Cheyenne River Sioux Tribe of South Dakota which has jurisdiction over the area of Indian country included in the resolution.

Orme Lewis,
*Assistant Secretary of the Interior.*

November 17, 1953.

[Resolution No. 99-53]

Whereas, Public Law 277, repealing what is commonly known as the Indian Liquor Law, provides in part that the provisions of sections 1154, 1156, 3113, 3488 and 3618 of Title 18, United States Code, shall not apply within any area that is not Indian country, nor to any act or transaction within any area of Indian country provided such act or transaction is in conformity both with the laws of the State in which the act or transaction occurs and with an ordinance duly adopted by the tribe having jurisdiction over such area of Indian country, certified by the Secretary of the Interior, and published in the Federal Register;

Now, therefore, be it resolved, by the Cheyenne River Sioux Tribal Council, this 27th day of August, 1953, that from and after this date the sale, trade, transport or manufacture of intoxicating liquor and non-intoxicating beer or wine on the Cheyenne River Sioux Reservation shall be controlled by the provisions of the attached ordinances, subject to certification by the Secretary of the Interior, and publication in the Federal Register as provided by the said Public Law 277, and

Be it further resolved, that Section XXVIII—Liquor Violation—of Ordinance No. 9, Chapter V of the Code of Offenses of the Cheyenne River Sioux Tribal Court is hereby repealed, and

Be it further resolved, that in lieu of the said Section XXVIII, hereby repealed, there shall be inserted in the Code of Offenses, also numbered XXVIII, the following section:

Sec. XXVIII. *Drunken driving.* Any person who shall operate a motor vehicle while under the influence of intoxicating liquor shall be deemed guilty of an offense, and upon conviction thereof shall be sentenced to labor for a period not to exceed 60 days or to a fine not to exceed $100.00, or to both such imprisonment or fine, with costs, and upon any subsequent conviction of such offense shall, in addition to such imprisonment or fine, or both, be prohibited from operating a motor vehicle for a period of one year.

and,

Be it further resolved, that a supplemental section, numbered LIII, shall be added to the said Ordinance No. 9, Chapter V, of the Code of Offenses, to read as follows:

Sec. LIII. *Sale of intoxicating liquor to minors.* Any person, not covered by the provisions of the attached ordinances, who shall sell or give to any person under 21 years of age any intoxicating liquor, shall be deemed guilty of an offense, and upon conviction thereof shall be sentenced to labor for a period not to exceed 60 days, or to a fine not to exceed $100.00, or to both such imprisonment or fine, with costs.

*Certificate of Secretary.* I, Alice Bowker, the duly elected, qualified and acting secretary of the Cheyenne River Sioux Tribal Council, do hereby certify that the above resolution was duly adopted by the Cheyenne River Sioux Tribal Council, which is composed of 15 members of whom 14, constituting a quorum, were present at a meeting duly noticed, called, convened, and held at Cheyenne Agency, South Dakota, August 25, 26 and 27, 1953, by a vote of 11 for 0 against and 3 not voting.

Alice Bowker,
*Secretary,*
*Cheyenne River Sioux Tribal Council.*

[Ordinance No. ----]

#### Chapter XI—Intoxicating Liquors

Section I. Any person, firm, company, association or corporation desiring to engage in the possession, sale, trade, transport or manufacture of intoxicating liquors on the Cheyenne River Sioux Reservation shall comply with the rules and regulations set forth in this ordinance.

Sec. II. *Granting of licenses.* Any person, firm, company, association or corporation authorized to sell, trade, transport or manufacture intoxicating liquors in the communities on the Reservation, or other designated place, shall make application in writing for a permit and present same to the Cheyenne River Sioux Tribal Council for approval.

Sec. III. *Payment of license fees.* Any person, firm, company, association or corporation authorized to sell, trade, transport or manufacture intoxicating liquor within the territorial limits of the Reservation on restricted or tribally owned or controlled land shall pay to the Tribal Treasurer in annual payments on January 1 of each calendar year, the following prescribed fees:

(a) For operating a plant distilling intoxicating liquors—two thousand dollars;

(b) For operating a wholesale liquor store—fifteen hundred dollars;

(c) For operating a package liquor store—one hundred dollars;

(d) For on sale dealers—one hundred and fifty dollars;

(e) For solicitors—twenty-five dollars.

(f) For transportation companies—twenty-five dollars:

(g) For clubs as on sale dealers—two hundred dollars:

(h) For dealers in high point beer, being on sale dealers under part (d) hereof.

SEC. IV. *Restrictions as to eligibility of licenses.* The granting of licenses under this ordinance shall be subject to the following restriction:

(a) No license under part (d) of section 3 hereof shall be granted where the applicant's place of business is within one hundred yards, measured by the regular and usual path of travel, of any door or exit of any school or church:

(b) No license shall be granted to operate on the campus of any educational institution, or within two hundred yards of the outside boundary thereof:

(c) No more than one license of any or different classes shall be issued to any one person except that:

1. Both an on sale and a package dealer's license may be granted to a club or a person operating a hotel, the respective business operated under such licenses to be conducted in disconnected rooms on the licensee's premises;

2. Three licenses under part (c) of section 3 hereof may be issued to the same person, the business under each to be operated in a separate town or community;

(d) Any licensee under parts (a), (b), (c), or (d) of section 3 hereof must be:

1. A resident of the Cheyenne River Reservation for more than one year next prior to application for such license;

2. A person of good moral character, never convicted of a felony;

3. The owner or actual lessee of the premises where the applicant intends to conduct business;

4. The sole owner of the business to be operated under the license.

SEC. V. *Period covered by license.* The period covered by licenses under section 3 hereof shall be from twelve o'clock noon on the thirty-first day of December to twelve o'clock noon on the thirty-first day of next December and the full fee shall be charged for any license for any part of such period.

SEC. VI. *License required.* It shall be unlawful for any person, firm, association or corporation to engage in, pursue, or transact any business in liquor traffic within the territorial limits of the Reservation on restricted or tribally owned or controlled land without first having a license therefor as herein provided. The Tribal Council shall not approve an application for such license unless the applicant agrees in writing to comply with the provisions of this ordinance.

SEC. VII. *Complying with laws and regulations.* Any person, firm, company, association or corporation licensed and operating a business within the territorial limits of the Reservation under the provisions of this ordinance shall comply with all laws and regulations as provided by the Code of Offenses of the Cheyenne River Sioux Tribal Court: *Provided,* That any person, firm, company, association or corporation proved to be charging excessive rates, or failing to comply with all the provisions of this ordinance, or otherwise indulging in practices detrimental to the economic and/or moral welfare of the tribe or its members shall have its license revoked.

SEC. VIII. *Transfer of license.* In the event a licensee under this ordinance transfers the ownership of his place of business to another person, firm, company, association or corporation, he may also transfer his license without additional cost to the parties concerned: *Provided,* That notice of intention of such transfer shall be filed with the Tribal Council not less than thirty days before the effective date of the transfer, and that record of such transfer shall be made with the Tribal Treasurer.

SEC. IX. *Restrictions on general conduct of business in intoxicating liquors.* Conduct of business authorized under this ordinance by licensees shall be subject to the following restrictions:

(a) No licensee under part (d) of section 3 of this ordinance shall make delivery of intoxicating liquor outside of his place of business.

(b) No licensee shall sell any intoxicating liquor:

1. To any person under the age of twenty-one year;

2. To any person who is intoxicated at the time, or who is known to the seller to be an habitual drunkard;

3. To any person to whom the seller has been requested in writing not to make such sale, where such request is by the Tribal Council, any police or peace officer, or the husband, wife, mother, father, brother, sister, or child of the person;

4. To any spendthrift, insane, or feebleminded person.

5. To any person who is known to be the object of charity, or is known to be supported by any charitable association or institution.

(c) No licensee of any class shall sell, serve, or allow to be consumed on the premises covered by the license, intoxicating liquor, other than in the hours permitted by his license;

(d) No licensee under parts (d), (g), and (h) of section 3 hereof shall sell, serve, or allow to be consumed on the premises covered by the license, intoxicating liquor between the hour of two o'clock a. m. and the hour of seven o'clock a. m. of any day, and no licensee under part (c) of section 3 hereof shall sell intoxicating liquor between the hour of ten o'clock p. m. and the hour of seven o'clock a. m. of the following day except on Saturday when no intoxicating liquor shall be sold under such license between the hour of twelve o'clock midnight and the hour of seven o'clock a. m. of the following day, and no licensee of any class shall sell intoxicating liquor on Sunday, Memorial Day, or on any general or special election day, until after the close of the polls on such election day;

(e) No licensee under part (d) of section 3 hereof shall be permitted to serve intoxicating liquor except on the premises authorized by his license. The view through the windows of such premises shall be completely unobstructed either by curtains, advertising, window glazing, or any other obstruction whatsoever, and no intoxicating liquor shall be served in any booth wherein all the occupants are not within full view of the bartender, or other person in charge of the establishment, and observable from all points in the said room, and that no license shall allow any game of skill or chance or dancing or athletic contest, or other form of amusement or recreation on said premises, or permit any slot machine or other like devices in or about the licensed premises;

(f) No on sale licensee shall permit any person less than twenty-one years old on the premises where the business under the license is authorized, except when such person is in the company of his parent or guardian;

(g) No licensee of any class shall permit any intoxicated person to enter the premises where the business under the license is authorized or to become intoxicated thereon or therein;

(h) No licensee under parts (d), (g), and (h) of section 3 hereof shall be permitted to serve patrons who are not seated, nor will patrons be permitted to move drinks from one part of the room to another, and it shall be the responsibility of the bartender, or person in charge of the establishment, to assure compliance with this provision.

SEC. X. *Sale of used containers prohibited.* No person shall buy or sell any package which has previously contained intoxicating liquor sold under the provisions of this ordinance, or refill any such package: *Provided, however,* That this section shall not apply to beer containers.

SEC. XI. *High point beer.* A license under part (h) of section 3 hereof is authorized to operate as both a package dealer and an on sale dealer in high point beer, and in no other intoxicating liquor.

SEC. XII. *Scope of ordinance.* The provisions of this ordinance, unless the context otherwise clearly requires, shall be construed to relate only to intoxicating liquor, and not to non-intoxicating beer or wine.

SEC. XIII. *Definitions.* Terms used in this ordinance, unless the context otherwise plainly requires, shall mean:

(a) "Intoxicating liquor", any liquid, either commonly used, or reasonably adapted to use, for beverage purposes, and containing in excess of three and two-tenths per centum of alcohol by weight;

(b) "Reservation", any restricted Indian land, whether tribally or individually owned, contained within the original boundaries of the Cheyenne River Reservation as defined and described by the Act of March 2, 1889.

(c) "High point beer", any beer having an alcoholic content in excess of three and two-tenths per centum by weight, and not in excess of six per centum by weight;

(d) "Distiller", any person who owns, or who himself or through others, directly or indirectly, operates or aids in operating any distillery or other establishment for the production, rectifying, blending or bottling of intoxicating liquor other than high point beer;

(e) "Sale", the transfer, for a consideration, of title to any alcoholic beverage;

(f) "Package", the bottle or immediate container of any alcoholic beverage;

(g) "Off sale", the sale of any alcoholic beverage for consumption off the premises where sold;

(h) "On sale", the sale of any alcoholic beverage for consumption only upon the premises where sold;

(i) "Wholesaler", any person who sells alcoholic beverages to retailers for resale;

(j) "Retailer", any person who sells alcoholic beverages for other than resale;

(k) "Hotel", any building wherein is regularly and continuously conducted a hotel business, with its lobby or office on the ground floor, with an adequate staff for the conduct of its business, and which maintains for the accommodation of patrons at least ten rooms, and which maintains as an integral part thereof, or attached thereto, a dining room or cafe, with appropriate facilities for seating at least twenty persons at one time;

(l) "Club", any organization duly licensed by the Tribal Council for civic, fraternal, or business purposes, or for intellectual improvement, or for promotion of sports, which club has more than twenty-five members and has for more than one year owned or leased a building or portion thereof adequate for the accommodation of its members and whose affairs and management are conducted by a board of directors or similar body chosen by its members and none of whose members, officers, agents, or employees, directly or indirectly, received any profit from sale of beverages other than a reasonable salary;

(m) "Transportation company", any common carrier or operator of a private vehicle transporting or accepting for transportation any intoxicating liquor, but not including transportation by carriers in interstate commerce where the shipment originates outside of the reservation and is destined to a point outside of the reservation;

(n) "Solicitor", any person employed by a licensed wholesaler within or without the reservation, or by any distiller or manufacturer within or without the reservation, who solicits orders of intoxicating liquor from wholesale or retail dealers within the reservation;

SEC. XIV. *Licensee whose license has been revoked; ineligible for one year.* Any licensee under this ordinance, whose license is revoked under section 7 hereof, shall not for a year thereafter be granted any license under this ordinance. When within such year application for a license is made by any member of the family of any such former licensee, or any of his employees or former employees, the license may be granted only upon affirmative and satisfactory proof that such former licensee will have no interest whatsoever in the business.

SEC. XV. *Conformity to state laws and regulations.* In any matters relating to the sale, trade, transport or manufacture of intoxicating liquor on the reservation that are not covered by this ordinance, the laws and regulations of the State of South Dakota governing such sale, trade, transport and manufacture of intoxicating liquor shall be applicable on the reservation: *Provided, however,* That the Tribal Council shall maintain jurisdiction and administration.

[Ordinance No. ----]

### XII—NON-INTOXICATING LIQUOR

SECTION I. Any person, firm, company, association or corporation desiring to engage in the possession, sale, trade, transport or manufacture of non-intoxicating beer or wine on the Cheyenne River Sioux Reservation shall comply with the rules and regulations set forth in this ordinance.

SEC. II. *Granting of licenses.* Any person, firm, company, association, or corporation authorized to sell, trade, transport, or manufacture non-intoxicating beer or wine in the communities on the Reservation, or other designated place, shall make application in writing for a permit and present same to the Cheyenne River Sioux Tribal Council for approval.

SEC. III. *Payment of license fees.* Any person, firm, company, association, of corporation authorized to sell, trade, transport or manufacture non-intoxicating beer or wine within the territorial limits of the Reservation on restricted or tribal owned and controlled land shall pay to the Tribal Treasurer in annual payment on January 1 of each calendar year, the following prescribed fees:

(a) For manufacturers—one hundred and twenty-five dollars;

(b) For wholesalers—one hundred dollars;

(c) For package dealers — twenty-five dollars;

(d) For retail dealers, being both package dealers and on sale dealers, forty dollars;

(e) For operating a concession, such as at a rodeo, fair, 4th of July celebration, etc., a fee of not less than $50.00 in addition to the regular fee of $40.00 for retail dealers under part (d) hereof: *Provided,* That concessions at such public gatherings may be operated upon a percentage basis at the option of the Tribal Council, or its authorized representative.

SEC. IV. *Restrictions on eligibility of licensees.* The granting of licenses under this ordinance shall be subject to the following restrictions.

(a) Any individual applicant for a license must be a resident of the Cheyenne River Reservation for more than a year next prior to application for such license;

(b) Any applicant for a license must be the owner or actual lessee of premises where the business is to be conducted, and the sole owner of the business to be operated under such license;

(c) Such premises must conform to all the laws, health and fire regulations applicable thereto, and be a safe and proper place.

SEC. V. *Period covered by license.* The period covered by license shall not exceed one year and shall expire at midnight on the next thirty-first of December following the date on which it becomes effective, and the full fee shall be charged for any license for a portion of such period.

SEC. VI. *Restrictions on general conduct of business in non-intoxicating beer or wine.* Conduct of business under this ordinance shall be subject to the following restrictions.

(a) No licensee shall manufacture, bottle, transport, or sell any non-intoxicating beer or wine except from the premises specifically designated or described in his license;

(b) No non-intoxicating beer or wine shall be sold by any dealer licensed under parts (a) and (b) of section 2 hereof in a package or bulk container of less than seventy-two fluid ounces;

(c) No licensee shall sell or give to any person who is less than eighteen years old, non-intoxicating beer or wine;

(d) No licensee under parts (c) and (d) of section 2 hereof shall sell, serve, or allow to be consumed on the premises covered by the license, any non-intoxicating beer or wine between the hours of two o'clock a. m. and seven o'clock a. m. of any day, or on any general or special election day until after the close of the polls on such election day.

SEC. VII. *Scope of ordinance.* The provisions of this ordinance, unless the context otherwise clearly requires, shall be construed to relate only to non-intoxicating beer or wine, and not to intoxicating liquor.

SEC. VIII. *Definitions.* Terms used in this ordinance, unless the context otherwise plainly requires, shall mean:

(a) "Non-intoxicating beer", any liquid either commonly used, or reasonably adapted to use, for beverage purposes, and which is produced wholly or in part from brewing of any grain or grains, malt or malt substitutes, and which contains any alcohol whatsoever, but not more than three and two-tenths per centum by weight;

(b) "Non-intoxicating wine," any liquid other than beer, either commonly used, or reasonably adapted to use, for beverage purposes, and containing alcohol by weight to the extent of more than one-half of one per centum and not more than three and two-tenths per centum;

(c) "Reservation," any restricted Indian land, whether tribally or individually owned, contained within the original boundaries of the Cheyenne River Sioux Reservation as defined and described by the Act of March 2, 1889;

(d) "Manufacturer," any person who owns, or who himself or through others, directly or indirectly, operates or aids in operating any establishment for the brewing, production, bottling, or blending of non-intoxicating beer or wine, or high point beer;

(e) "Sale," the transfer, for a consideration, of title to any alcoholic beverage;

(f) "Package," the bottle or immediate container of any alcoholic beverage;

(g) "Bulk container," any package, or any container, within which container are one or more packages;

(h) "Off sale," the sale of any alcoholic beverage, for consumption off the premises where sold;

(i) "On sale," the sale of any alcoholic beverage for consumption only on the premises where sold;

(j) "Wholesaler," any person who sells alcoholic beverage to retailers for resale;

(k) "Retailer," any person who sells alcoholic beverages for other than resale;

(l) "Package dealer," any person other than a distiller, manufacturer, or wholesaler, who sells, or keeps for sale, any alcoholic beverage for consumption off the premises where sold;

(m) "On sale dealer," any person who sells, or keeps for sale, any alcoholic beverage for consumption on the premises where sold;

SEC. IX. *License required.* It shall be unlawful for any person, firm, company, association or corporation to engage in, pursue, or transact any business in non-intoxicating beer or wine within the territorial limits of the Reservation on restricted or tribally owned or controlled land without first having obtained a license therefor as herein provided. The Tribal Council shall not approve an application for such license unless the applicant agrees in writing to comply with the provisions of this ordinance.

SEC. X. *Complying with laws and regulations.* Any person, firm, company, association or corporation licensed and operating a business within the territorial limits of the Reservation under the provisions of this ordinance shall comply with all laws and regulations as provided by the Code of Offenses of the Cheyenne River Sioux Tribal Court: *Provided,* That any person, firm, company, association or corporation proved to be charging excessive rates, or failing to comply with all the provisions of this ordinance, or otherwise indulging in practices detrimental to the economic and/or moral welfare of the tribe or its members shall have its license revoked.

SEC. XI. *Transfer of license.* In the event a licensee under this ordinance transfers the ownership of his place of business to another persons, firm, company, association or corporation, he may also transfer his license without additional cost to the parties concerned: *Provided,* That notice of intention of such transfer shall be filed with the Tribal Council not less than thirty days before the effective date of the transfer, and that record of such transfer shall be made with the Tribal Treasurer.

SEC. XII. *Licensee whose license has been revoked; ineligible for one year.* Any licensee under this ordinance, whose license is revoked under section 10 hereof, shall not for a year thereafter be granted any license under this ordinance. When within such year application for a license is made by any member of the family of any such former licensee, or any of his employees or former employees, the license may be granted only upon affirmative and satisfactory proof that such former licensee will have no interest whatsoever in the business.

SEC. XIII. *Conformity to state laws and regulations.* In any matters relating to the sale, trade, transport or manufacture of non-intoxicating beer or wine on the Reservation that are not covered by this ordinance, the laws and regulations of the State of South Dakota governing such sale, trade, transport, and manufacture of non-intoxicating beer or wine shall be applicable on the reservation: *Provided, however,* That the Tribal Council shall maintain jurisdiction and administration.

[F. R. Doc. 53-9804; Filed, Nov. 20, 1953; 8:55 a. m.]

---

## DEPARTMENT OF LABOR

## Wage and Hour Division

### LEARNER EMPLOYMENT CERTIFICATES

#### ISSUANCE TO VARIOUS INDUSTRIES

Notice is hereby given that pursuant to section 14 of the Fair Labor Standards Act of 1938, as amended (52 Stat. 1068, as amended; 29 U. S. C. and Sup. 214), and Part 522 of the regulations issued thereunder (29 CFR Part 522), special certificates authorizing the employment of learners at hourly wage rates lower than the minimum wage rates applicable under section 6 of the act have been issued to the firms listed below. The employment of learners under these certificates is limited to the terms and conditions therein contained and is subject to the provisions of Part 522. The effective and expiration dates, occupations, wage rates, number or proportion of learners, and learning period for certificates issued under the general learner regulations (§§ 522.1 to 522.14) are as indicated below; conditions provided in certificates issued under special industry regulations are as established in these regulations.

### Single Pants, Shirts and Allied Garments, Women's Apparel, Sportswear and Other Odd Outerwear, Rainwear, Robes and Leather and Sheep-Lined Garments Divisions of the Apparel Industry Learner Regulations (29 CFR 522.160 to 522.168, as amended June 2, 1952, 17 F. R. 3818).

Benjamin & Johnes, Inc., 413 South Clinton Avenue, Dunn, N. C., effective 11-6-53 to 11-5-54; 10 learners for normal labor turnover purposes (women's foundation garments).

Blue Ridge Manufacturers, Inc., Christiansburg, Va., effective 11-14-53 to 11-13-54; 10 percent of the total number of factory production workers for normal labor turnover purposes (men's and boys' dungarees).

Brookfield Mills, Inc., Sanford, Fla., effective 11-9-53 to 5-8-54; 20 learners for expansion purposes (women's nightgowns and pajamas).

Carlton Shirt Co., Inc., Mena, Ark., effective 11-4-53 to 4-11-54; 50 additional learners for expansion purposes (men's and boys' shirts) (supplemental certificate).

Cater Frock Co., New Braunfels, Tex., effective 11-9-53 to 11-8-54; 10 learners for normal labor turnover purposes (children's dresses).

Clover Dress Co., Inc., 92 South Empire Street, Wilkes-Barre, Pa., effective 11-9-53 to 11-8-54; 10 percent of the total number of factory production workers for normal labor turnover purposes (misses' and women's dresses).

Hartsville Manufacturing Co., Hartsville, S. C., effective 11-4-53 to 5-3-54; 25 learners for expansion purposes (ladies' dresses).

Hazlehurst Manufacturing Co., Hazlehurst, Ga., effective 11-5-53 to 5-4-54; 15 learners for expansion purposes (ladies' lingerie).

Hazlehurst Manufacturing Co., Hazlehurst, Ga., effective 11-5-53 to 11-4-54; 10 learners for normal labor turnover purposes (ladies' lingerie).

The Jay Garment Co., Brookville, Ind., effective 11-16-53 to 11-15-54; 25 learners for expansion purposes (children's cotton overalls).

Joyner-Fields, Inc., Sherman, Miss., effective 11-3-53 to 11-2-54; 10 percent of the factory production force for normal labor turnover purposes (sport shirts).

Kentucky Pants Co., 117 North Race Street, Glasgow, Ky., effective 11-16-53 to 11-15-54; 10 percent of the total number of factory production workers for normal labor turnover purposes (work pants).

Madison Apparel Co., Inc., 296 Madison Street, Wilkes-Barre, Pa., effective 11-5-53 to 11-4-54; 10 learners for normal labor turnover purposes (dresses).

Mode O'Day Corp., 840 Twelfth NW., Mason City, Iowa, effective 11-6-53 to 11-5-54; 10 learners for normal labor turnover purposes (ladies' lingerie).

Monticello Manufacturing Co., Monticello, Miss., effective 11-24-53 to 11-23-54; 10 percent of the total number of factory production workers for normal labor turnover purposes (men's cotton work pants).

N & W Industries, Inc., Rocky Mount, Va., effective 11-17-53 to 11-16-54; 10 percent of the total number of factory production workers for normal labor turnover purposes (dungarees).

Newport News Children's Dress Co., 824 South Thirty-Ninth Street, Newport News, Va., effective 11-17-53 to 11-16-54; 10 percent of the total number of factory production workers for normal labor turnover purposes (children's and girls' dresses and play suits).

Rice Mills, Inc., Belton, S. C., effective 11-6-53 to 11-5-54; 10 learners for normal labor turnover purposes (bathrobes).

Rocket Manufacturing Co., Inc., 1000 Spring Street, Little Rock, Ark., effective 11-13-53 to 5-12-54; 50 learners for expansion purposes (blouses).

Salant & Salant, Inc., South First Street, Union City, Tenn., effective 11-14-53 to 11-13-54; 10 percent of the total number of factory production workers for normal labor turnover purposes (work shirts and work pants).

Seamprufe, Inc., McAlester, Okla., effective 11-9-53 to 11-8-54; 10 percent of the total number of factory production workers for normal labor turnover purposes (slips and lingerie).

The Van Wert Manufacturing Co., Main and Market Streets, Van Wert, Ohio, effective 11-16-53 to 11-15-54; 10 percent of the total number of factory production workers for normal labor turnover purposes (men's pants, cotton utility jackets, work shirts, etc.).

Walterboro Manufacturing Corp., Walterboro, S. C., effective 11-9-53 to 11-8-54; 10 percent of the total number of factory production workers for normal labor turnover purposes (dresses).

Wyoming Valley Garment Co., 212 South Washington Street, Wilkes-Barre, Pa., effective 11-17-53 to 11-16-54; 10 learners for normal labor turnover purposes (boys' trousers).

### Cigar Industry Learner Regulations (29 CFR 522.201 to 522.211, as amended October 27, 1952, 17 F. R. 8633).

H. N. Heusner & Son, Inc., 228-30 High Street, Hanover, Pa., effective 11-16-53 to 11-15-54; 10 percent of the number of factory workers. Cigar machine operating, 320 hours at 65 cents an hour; cigar packing (cigars retailing for 6 cents or less), 160 hours at 65 cents an hour; machine stripping, 160 hours at 65 cents an hour.

I. Lewis Cigar Manufacturing Co., Second and Washington Streets, Steelton, Pa., effective 11-21-53 to 11-20-54; 10 percent of the number of factory workers. Cigar machine operating, 320 hours at 65 cents an hour; packing (cigars retailing for over 6 cents), 320 hours at 65 cents an hour; cigar retailing for 6 cents or less, 160 hours at 65 cents an hour; machine stripping, 160 hours at 65 cents an hour.

John H. Swisher & Son, Inc., 600 Haines Avenue, Waycross, Ga., effective 11-17-53 to 11-16-54; 10 percent of the total number of workers. Cigar machine operating, 320 hours; cigar packing (cigars retailing for more than 6 cents), 320 hours; (cigars retailing for 6 cents or less), 160 hours; machine stripping, 160 hours; each 65 cents an hour.

John H. Swisher & Son, Inc., 501 East Sixteenth Street, Jacksonville, Fla., effective 11-10-53 to 11-9-54; 10 percent of the total number of workers. Cigar machine operating, 320 hours; cigar packing (cigars retailing for over 6 cents), 320 hours, cigars retailing for 6 cents or less, 160 hours; machine stripping, 160 hours; each 65 cents an hour.

### Glove Industry Learner Regulations (29 CFR 522.220 to 522.231, as amended July 13, 1953, 18 F. R. 3292).

Indianapolis Glove Co., Inc., Glenwood, Ark., effective 11-11-53 to 5-10-54; 35 learners for expansion purposes (canton flannel and leather palm work gloves).

Newton Glove Manufacturing Co., P. O. Box 271, Newton, N. C., effective 11-21-53 to 11-20-54; 10 percent of the total number of machine stitchers for normal labor turnover purposes (work gloves).

Wells Lemont Corp., Barry, Ill., effective 11-3-53 to 11-2-54; 5 learners for normal labor turnover purposes (work gloves).

### Hosiery Industry Learner Regulations (29 CFR 522.40 to 522.51, as amended November 19, 1951, 16 F. R. 10733).

Berkshire Knitting Mills, Andrews, N. C., effective 11-24-53 to 11-23-54; 5 percent of the total number of factory production workers for normal labor turnover purposes.

Villa Rica Hosiery Mills, Villa Rica, Ga., effective 11-19-53 to 11-18-54; 5 percent of the total number of factory production workers for normal labor turnover purposes.

### Independent Telephone Industry Learner Regulations (29 CFR 522.82 to 522.93, as amended January 25, 1950, 15 F. R. 398).

Thermal Belt Telephone Co., Tryon, N. C., effective 11-30-53 to 11-29-54.

### Shoe Industry Learner Regulations (29 CFR 522.250 to 522.260, as amended March 17, 1952, 17 F. R. 1500).

Rex Shoe Co., Inc., 1950 Wyoming Avenue, Exeter Borough, Pa., effective 11-14-53 to 11-13-54; 10 percent of the productive factory workers.

The following special learner certificates were issued to the school-operated industries listed below:

Oak Park Academy, Nevada, Iowa, effective 9-1-53 to 8-31-54; print shop—compositor, pressman and related skilled and semiskilled occupations; 5 learners; 350 hours at 60 cents per hour, 325 hours at 65 cents per hour, 325 hours at 70 cents per hour; broom shop—broom maker (winder) stitcher, sorter, and related skilled and semiskilled occupations; 8 learners; 150 hours at 60 cents per hour, 125 hours at 65 cents per hour, 125 hours at 70 cents per hour.

The following special learner certificates were issued in Puerto Rico to the companies hereinafter named. The effective and expiration dates, the number of learners, the learner occupations, the length of the learning period and the learner wage rates are indicated, respectively.

Garrou, Inc., Cidra, P. R., effective 11-2-53 to 5-1-54; 12 learners. Knitting, 240 hours at 30 cents an hour, 240 hours at 35 cents an hour; examining and inspecting, 240 hours at 30 cents an hour; looping, 480 hours at 30 cents an hour, 480 hours at 35 cents an hour; seaming, 480 hours at 30 cents an hour, 480 hours at 35 cents an hour; mending, 480 hours at 30 cents an hour, 480 hours at 35 cents an hour (full-fashioned hosiery).

Maremont Manufacturing Corp., Bayamon, P. R., effective 11-2-53 to 5-1-54; 30 learners. All factory production operations involved in the manufacture of leaf springs, 160 hours at 33 cents an hour, 160 hours at 40 cents an hour, 160 hours at 47 cents an hour (leaf springs for motor vehicles).

Each certificate has been issued upon the employer's representation that employment of learners at subminimum rates is necessary in order to prevent curtailment of opportunities for employment, and that experienced workers for the learner occupations are not available. The certificates may be cancelled in the manner provided in the regulations and as indicated in the certificates. Any person aggrieved by the issuance of any of these certificates may seek a review or reconsideration thereof within fifteen days after publication of this notice in the FEDERAL REGISTER, pursuant to the provisions of Part 522.

Signed at Washington, D. C., this 9th day of November 1953.

MILTON BROOKE,
*Authorized Representative of the Administrator.*

[F. R. Doc. 53-9845; Filed, Nov. 20, 1953; 8:55 a. m.]

---

## ATOMIC ENERGY COMMISSION

### Patent Compensation Board

[Docket No. 13]

### ARNOLD PACYNA

NOTICE OF APPLICATION

Notice is hereby given that Arnold Pacyna has filed an application before the Patent Compensation Board, United States Atomic Energy Commission, for an award. The application is based on a treatment of radio-active wastes and relates to alleged improvements in U. S. Patent 2,485,841.

The application of Arnold Pacyna is on file with the Patent Compensation Board. Any person other than the applicant desiring to be heard with reference to the application should file with the Patent Compensation Board, United States Atomic Energy Commission, Washington 25, D. C., within thirty days from the date of publication of this notice, a statement of facts concerning the nature of his interest.

SARAH K. GRANDSTAFF,
*Acting Clerk,*
*Patent Compensation Board.*

NOVEMBER 16, 1953.

[F. R. Doc. 53-9797; Filed, Nov. 20, 1953; 8:45 a. m.]

---

[Docket No. 14]

### SHERMAN DOUGLAS RAPP

NOTICE OF APPLICATION

Notice is hereby given that Sherman Douglas Rapp has filed an application before the Patent Compensation Board, United States Atomic Energy Commission, for an award. The application is based on an alleged invention of the Uranium Fission Bomb and Uranium Fission Slow Reactors.

The application of Sherman Douglas Rapp is on file with the Patent Compensation Board. Any person other than the applicant desiring to be heard with reference to the application should file with the Patent Compensation Board, United States Atomic Energy Commission, Washington 25, D. C., within thirty days from the date of publication of this notice, a statement of facts concerning the nature of his interest.

SARAH K. GRANDSTAFF,
*Acting Clerk,*
*Patent Compensation Board.*

NOVEMBER 16, 1953.

[F. R. Doc. 53-9798; Filed, Nov. 20, 1953; 8:45 a. m.]

---

## DEPARTMENT OF AGRICULTURE

### Commodity Credit Corporation

### SALES OF CERTAIN COMMODITIES AT FIXED PRICES

NOVEMBER 1953 DOMESTIC AND EXPORT PRICE LISTS

Pursuant to the Pricing Policy of Commodity Credit Corporation issued March 22, 1950, as amended January 9, 1953 (15 F. R. 1593, 18 F. R. 176), and subject to the conditions stated therein, the following commodities are available for sale in the quantities and at the prices stated:

NOVEMBER 1953 EXPORT PRICE LIST

| Commodity and approximate quantity available (subject to prior sale) | Export price list |
|---|---|
| Cottonseed oil, refined, 801,000,000 pounds.[1] | Bid basis f. o. b. tank cars or tank wagons at points of storage locations. Available New Orleans PMA Commodity office. |
| Cottonseed oil, crude, 25,000,000 pounds.[1] | Bid basis f. o. b. tank cars or tank wagons at producer's mills. Available New Orleans PMA Commodity office. |
| Linseed oil, raw, 143,000,000 pounds.[1] | Bid basis f. o. b. tank cars at points of storage locations. Available Chicago, Dallas, New Orleans, Portland, and Minneapolis PMA Commodity offices. |
| Olive oil, edible, 202,825 gallons [1] | Bid basis in 50/55 gallon drums f. o. b. points of storage locations. Available Portland PMA Commodity office. |
| Peanuts, shelled, bagged (for crushing), approximately 10,000 short tons. | Bid basis, f. a. s. vessel at specified ports, subject to terms and conditions of USDA Announcement FO-28/53. Peanuts may be 1953 crop peanuts acquired by calling loans, as well as CCC stocks from previous crops. (These peanuts are also available as farmer's stock for export on bid basis, f. o. b. points of storage locations subject to the terms and conditions of USDA Announcements CCC Peanut Forms 34 and 40.) Additional quantities of peanuts for export will be announced as available under separate announcements. Available Fats and Oils Branch, Production and Marketing Administration, USDA, Washington 25, D. C., and New Orleans PMA Commodity office. |
| Corn, bulk, 50,000,000 bushels [1] | Market price on date of sale at point of delivery, provided delivery takes place with 15 days unless otherwise agreed upon. |

[1] These same lots also are available at domestic sales prices announced today.

NOVEMBER 1953 DOMESTIC PRICE LIST

| Commodity and approximate quantity available (subject to prior sale) | Domestic sales price |
|---|---|
| Nonfat dry milk solids, in carload lots only, 340,000,000 pounds, spray; 75,000,000 pounds, roller. | Spray process, U. S. Extra Grade, 17 cents per pound; roller process, U. S. Extra Grade, 15 cents per pound. Prices apply "in store" at location of stocks in any State. ("In store" means at the processor's plant or in storage at warehouse, but with any prepaid storage and outhandling charges for the benefit of the buyer.) |
| Salted creamery butter (in carload lots only), 260,000,000 pounds. | U. S. Grade A and higher: All States except those listed below, 68.75 cents per pound. New York, New Jersey, Pennsylvania, New England, and other States bordering the Atlantic Ocean and Gulf of Mexico: 69.50 cents per pound. California, Oregon, and Washington: 69.75 cents per pound. U. S. Grade B: 2 cents per pound less than Grade A prices. Prices apply "in store" at location of stocks in those States where butter is stored. ("In store" means at the processor's plant or warehouse but with any prepaid storage and outhandling charges for the benefit of the buyer.) |
| Cheddar cheese, cheddar and twin styles (standard moisture basis, in carload lots only, 260,000,000 pounds. | U. S. Grade A and higher: All States except those listed below: 39 cents per lb. New York, New Jersey, Pennsylvania, New England, and other States bordering the Atlantic and Pacific Oceans and Gulf of Mexico: 40 cents per pound. U. S. Grade B: 1 cent per pound less than Grade A prices. Prices apply "in store" at location of stocks in those States where cheese is stored. All prices are subject to usual adjustment for moisture content. ("In store" means at the processor's plant or warehouse but with any prepaid storage and outhandling charges for the benefit of the buyer.) |
| Cottonseed oil, refined, 801,000,000 pounds.[1] | Market price but not less than the minimum crude price, with appropriate adjustments for refining, location and quality f. o. b. tankcars or tank wagons at points of storage locations. Available New Orleans PMA Commodity office. Prices will not be reduced during period ending June 30, 1954. |
| Cottonseed Oil, Crude 25,000,000 pounds.[1] | Market price but not less than 14 cents per pound, prime, Valley basis, f. o. b. tank cars or tank wagons at producer's mills subject to premiums or discounts comparable to Bulletin 3 of the 1953 crop cottonseed price support program. Available New Orleans PMA Commodity office. Price will not be reduced during period ending June 30, 1954. |
| Linseed oil, raw, 143,000,000 pounds.[1] | Market price on date of sale, but not less than equivalent of the price support for flaxseed. Price will not be reduced during period ending May 31, 1954. Available Chicago, Dallas, New Orleans, Portland, and Minneapolis PMA Commodity offices. |
| Olive oil, edible, 202,825 gallons [1] | Market price or $2.68 per gallon in 55-gallon drums, whichever is higher, f. o. b. points of storage locations. Available Portland PMA Commodity office. |
| Peanuts—Farmer's stock: Virginia type, bagged, 1951 crop, 8,000 tons; 1952 crop, 9,000 tons. Spanish: 1952 crop, 3,000 tons. Runners: 1952 crop, 19,000 tons. | Bid basis, f. o. b. points of storage locations, subject to the terms and conditions of Announcement CCC Peanut Form 40. In addition, farmer's stock peanuts from CCC Stocks including any 1953 crop peanuts acquired by calling loans, may be offered under separate announcement for domestic crushing subject to the terms and conditions of CCC Peanut Form 34. Available New Orleans PMA Commodity office. |
| Dry edible beans | On all beans, for areas other than those shown below, adjust price upward or downward by an amount equal to the price support program differential between areas. Where no price support differential occurs, the price listed will apply. For other grades of all beans, adjust by market differentials. Prices listed below, on all beans, are at point of production. Amount of paid-in freight to be added, as applicable. |
| Large lima, bagged, 1952 crop, 371,838 hundredweight. | $12.65 per 100 pounds for U. S. No. 1 basis, California points of production Available Portland PMA Commodity office. |
| Baby lima, bagged 1950 and 1951 crops, 69,718 hundredweight. | The market price but not less than: $7.10 per hundredweight for U. S. Extra No. 1; $7 per hundredweight for U. S. No. 1; $6.75 per hundredweight for U. S. No. 2. All prices f. o. b. California points of production. Available Portland PMA Commodity office. |
| Seeds | On all seeds except ladino: Offers will not be accepted for less than the minimum carlot weight as prescribed by railroad carrier's regulation at point of storage. However, if quantity available at any location is less than carlot, offers will be accepted for the entire lot. |
| Common and Willamette Vetch seed, bagged, 149,360 hundredweight. | $6 per 100 pounds, f. o. b. point of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Available Dallas, Portland, and New Orleans PMA Commodity offices. |

[1] These same lots also are available at export sales prices announced today.

NOVEMBER 1953 DOMESTIC PRICE LIST—Continued

| Commodity and approximate quantity available (subject to prior sale) | Domestic sales price |
|---|---|
| Red clover seed (uncertified), bagged, 76,400 hundredweight. | $36.75 per 100 pounds, f. o. b. point of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland, Chicago, Kansas City, Minneapolis, and New Orleans PMA Commodity offices. |
| Red clover seed (certified), bagged, Cumberland, 997 hundredweight; Midland, 625 hundredweight. | $36.75 per 100 pounds, f. o. b. point of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland and Kansas City PMA Commodity offices. |
| Red clover seed (Kenland certified), bagged, 140 hundredweight. | $43 per 100 pounds., f. o. b. point of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland PMA Commodity office. |
| White clover seed, bagged, 768 hundredweight. | $53.50 per 100 pounds, f. o. b. area of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available New Orleans PMA Commodity office. |
| Ladino clover seed (certified), bagged, 144,340 hundredweight. | $65 per 100 pounds, basis f. o. b. point of production, plus any paid-in freight, as applicable. $60 in lots of 60,000 pounds, or more. Available Portland, Minneapolis, and Kansas City PMA Commodity offices. |
| Crimson clover seed, bagged, 1,040 hundredweight. | $18 per 100 pounds, f. o. b. point of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Available Portland and New Orleans PMA Commodity offices. |
| Biennial sweet clove seed, bagged, 29,110 hundredweight. | $9.45 per 100 pounds, f. o. b. point of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Kansas City, Minneapolis, Dallas, Chicago, and Portland PMA Commodity offices. |
| Alsike clover seed, bagged, 19,250 hundredweight. | $27 per 100 pounds, f. o. b. point of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland, Kansas City, and Chicago PMA Commodity offices. |
| Smooth bromegrass seed (uncertified), bagged, 751 hundredweight. | $15.75 per 100 pounds, f. o. b. point of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland and Chicago PMA Commodity officers. |
| Smooth bromegrass seed (Manchar certified) bagged, 345 hundredweight. | $22.50 per 100 pounds, f. o. b. point of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland PMA Commodity office. |
| Mountain bromegrass seed (Bromar certified), bagged, 530 hundredweight. | $21 per 100 pounds, f. o. b. point of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland PMA Commodity office. |
| Hairy Vetch seed, bagged, 200,020 hundredweight. | $1 plus 1953 support price per 100 pounds, f. o. b. point of production plus any paid-in freight as applicable basis current freight rate at time of sale. Available Portland, Dallas, and New Orleans PMA Commodity offices. |
| Birdsfoot Trefoil seed, bagged, 826 hundredweight. | $78.75 per 100 pounds, f. o. b. point of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland PMA Commodity office. |
| Primar slender wheat-grass seed (certified), bagged, 577 hundredweight. | $31.50 per 100 pounds, f. o. b. point of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland and Minneapolis PMA Commodity offices. |
| Alfalfa seed, Northern, bagged, 172,927 hundredweight. | $37.50 per 100 pounds, f. o. b. area of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland, Minneapolis, and Kansas City PMA Commodity offices. |
| Alfalfa seed, Central, bagged, 37,671 hundredweight. | $30 per 100 pounds, f. o. b. area of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland, Dallas, Kansas City, and Chicago PMA Commodity offices. |
| Alfalfa seed, Southern, bagged, 4,497 hundredweight. | $22 per 100 pounds, f. o. b. area of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland and Dallas PMA Commodity offices. |
| Alfalfa seed (certified), bagged: Ranger, 83,229 hundredweight: Ladak, 9,230 hundredweight; Grimm, 6,855 hundredweight; Buffalo, 43,700 hundredweight; Atlantic, 6,155 hundredweight. | $43 per 100 pounds, f. o. b. area of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. All available in Portland and Kansas City, all but Buffalo and Atlantic in Minneapolis, and only Buffalo and Atlantic in Dallas PMA Commodity offices. |
| Alfalfa seed (certified), bagged: Hairy Peruvian, 323 hundredweight; Indian, 1,181 hundredweight. | $23.70 per 100 pounds, f. o. b. area of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland PMA Commodity office. |
| Tall Fescue seed (common), bagged, 101,340 hundredweight. | $21.50 per 100 pounds, f. o. b. area of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland, Dallas, Chicago, and New Orleans PMA Commodity offices. |
| Tall Fescue seed (certified), bagged, 55,236 hundredweight. | $29 per 100 pounds, f. o. b. area of production, plus any paid-in freight as applicable basis current freight rate at time of sale. Price will not be reduced during period ending June 30, 1954. Available Portland and Minneapolis PMA Commodity offices. |
| Oats, bulk (for feed only), 900,000 bushels. | Market price for feed, basis in store. Available Portland, Minneapolis, Kansas City and New Orleans PMA Commodity offices. |
| Corn, bulk, 50,000,000 bushels [1] | At points of production, basis in store, the market price but not less than the applicable 1953 county loan rate for No. 3 yellow plus: (1) 17 cents per bushel if received by truck, or (2) 13 cents per bushel if received by rail or barge. At other locations, the foregoing plus average paid-in freight. Examples of minimum prices per bushel: Chicago, No. 3 yellow, $1.91; St. Louis, No. 3 yellow, $1.93; Minneapolis, No. 3 yellow, $1.82; Omaha, No. 3 yellow, $1.84; Kansas City, No. 3 yellow, $1.89. For other classes, grades and quality, market differentials will apply. |
| Grain sorghums, bulk (for feed only), 43,000 hundredweight. | Market price for feed, basis in store. Available Minneapolis, Dallas and Kansas City PMA Commodity offices. |
| Barley, bulk (for feed only), 469,000 bushels. | Market price for feed, basis in store. Available Chicago, Minneapolis, Kansas City and Portland PMA Commodity offices. |
| Rye, bulk (for feed only), 123,000 bushels. | Market price for feed, basis in store. Available Minneapolis PMA Commodity office. |
| Flaxseed, bulk (for crushing only), 206,000 bushels. | Less than carlot lots in Minneapolis area, basis in store, at the market price. Available Minneapolis PMA Commodity office. |
| Soybeans, bulk (for crushing only), 1,492,000 bushels. | Market price. Available Chicago, Minneapolis, Kansas City, New Orleans, and Dallas PMA Commodity offices. |
| Cottonseed meal, and pellets, bulk (1953 production), 15,000 short tons. | Market price as determined by CCC, but not less than $54.50 per short ton Valley basis with differentials for quality and by area as provided for in § 643.917 of 1953 Cottonseed Bulletin 3, Revision 1, as amended. Price will not be reduced during period ending December 31, 1953. Information covering quantities and locations can be secured from the New Orleans PMA Commodity office. |
| Wool, shorn and pulled grease (including some scoured), 97,500,000 pounds. | Sales of wool will be made at prices reflecting the higher of the market price or 103 percent of the price support appraisal value per pound plus an allowance for sales commission on wool, Boston basis, adjusted for net freight on wool stored outside the Boston storage area. Sales will be made ex-warehouse where the wool is stored. Available Boston PMA Commodity office. |

The above prices will not be applicable to sales made in connection with drought relief programs carried out in disaster areas.

[1] These same lots also are available at export sales prices announced today.

(Sec. 407, 63 Stat. 1051.)

Issued: November 17, 1953.

[SEAL]

HOWARD H. GORDON,
*President,*
*Commodity Credit Corporation.*

[F. R. Doc. 53-9818; Filed, Nov. 20, 1953; 8:49 a. m.]

## Production and Marketing Administration

### PEANUTS

NOTICE OF REDELEGATION OF FINAL AUTHORITY BY NEW MEXICO STATE PRODUCTION AND MARKETING ADMINISTRATION COMMITTEE

Section 729.530 of the Marketing Quota Regulations for the 1954 Crop of Peanuts (18 F. R. 6372), issued pursuant to the marketing quota provisions of the Agricultural Adjustment Act of 1938, as amended (7 U. S. C. 1301-1376), provides that any authority delegated to the State Production and Marketing Administration Committee by the regulations may be redelegated by the State committee. In accordance with section 3 (a) (1) of the Administrative Procedure Act (5 U. S. C. 1002 (a)), which requires delegations of final authority to be published in the FEDERAL REGISTER, there are set out herein the redelegations of final authority which have been made by the New Mexico State Production and Marketing Administration Committee by authority vested in such committee by the Secretary of Agriculture in the regulations referred to above. Shown below are the sections of the regulations in which such authority appears and the person to whom the authority has been redelegated:

NEW MEXICO

Sections 729.517 (b) (5), 729.518, 729.519, 729.522 (a), 729.524 (c), 729.527 (a), and 729.528—Donald W. Vance and W. C. Hutchins, Jr., Administrative Assistants of the State PMA Office.

(Sec. 375, 52 Stat. 66, as amended; 7 U. S. C. 1375. Interpret or apply secs. 301, 358, 359, 361-368, 373, 374; 52 Stat. 38, 62, 65, as amended, 55 Stat. 88, as amended; 66 Stat. 27; 7 U. S. C. 1301, 1358, 1359, 1361-1368, 1373, 1374)

Issued at Washington, D. C., this 17th day of November 1953.

[SEAL] HOWARD H. GORDON,
*Administrator, Production and Marketing Administration.*

[F. R. Doc. 53-9817; Filed, Nov. 20, 1953; 8:48 a. m.]

---

## Rural Electrification Administration

[Administrative Order 4396]

### ALLOCATION OF FUNDS FOR LOANS

NOVEMBER 3, 1953.

I hereby amend:

(a) Administrative Order No. 935, dated July 23, 1945, by reducing the allocation of $25,000 therein made for "North Carolina 46066S1 Chowan" by $6,643 so that the reduced allocation shall be $18,357; and

(b) Administrative Order No. 3396, dated June 29, 1951, by rescinding the loan of $30,000 therein made for "North Carolina 66E Chowan".

[SEAL] ANCHER NELSEN,
*Administrator.*

[F. R. Doc. 53-9823; Filed, Nov. 20, 1953; 8:50 a. m.]

---

[Administrative Order 4397]

### OREGON

LOAN ANNOUNCEMENT

NOVEMBER 3, 1953.

Pursuant to the provisions of the Rural Electrification Act of 1936, as amended, a loan contract bearing the following designation has been signed on behalf of the Government acting through the Administrator of the Rural Electrification Administration:

| Loan designation: | *Amount* |
|---|---|
| Oregon 26 N Wasco | $279,000 |

[SEAL] ANCHER NELSEN,
*Administrator.*

[F. R. Doc. 53-9824; Filed, Nov. 20, 1953; 8:50 a. m.]

---

[Administrative Order 4398]

### GEORGIA

LOAN ANNOUNCEMENT

NOVEMBER 3, 1953.

Pursuant to the provisions of the Rural Electrification Act of 1936, as amended, a loan contract bearing the following designation has been signed on behalf of the Government acting through the Administrator of the Rural Electrification Administration:

| Loan designation: | *Amount* |
|---|---|
| Georgia 84R Cobb | $420,000 |

[SEAL] ANCHER NELSEN,
*Administrator.*

[F. R. Doc. 53-9825; Filed, Nov. 20, 1953; 8:50 a. m.]

---

[Administrative Order 4399]

### ARKANSAS

LOAN ANNOUNCEMENT

NOVEMBER 3, 1953.

Pursuant to the provisions of the Rural Electrification Act of 1936, as amended, a loan contract bearing the following designation has been signed on behalf of the Government acting through the Administrator of the Rural Electrification Administration:

| Loan designation: | *Amount* |
|---|---|
| Arkansas 11 P Jackson | $245,000 |

[SEAL] ANCHER NELSEN,
*Administrator.*

[F. R. Doc. 53-9826; Filed, Nov. 20, 1953; 8:51 a. m.]

---

[Administrative Order 4400]

### WISCONSIN

LOAN ANNOUNCEMENT

NOVEMBER 3, 1953.

Pursuant to the provisions of the Rural Electrification Act of 1936, as amended, a loan contract bearing the following designation has been signed on behalf of the Government acting through the Administrator of the Rural Electrification Administration:

| Loan designation: | *Amount* |
|---|---|
| Wisconsin 66C Portage-Waupaca | $23,000 |

[SEAL] ANCHER NELSEN,
*Administrator.*

[F. R. Doc. 53-9827; Filed, Nov. 20, 1953; 8:51 a. m.]

---

[Administrative Order 4401]

### MONTANA

LOAN ANNOUNCEMENT

NOVEMBER 3, 1953.

Pursuant to the provisions of the Rural Electrification Act of 1936, as amended, a loan contract bearing the following designation has been signed on behalf of the Government acting through the Administrator of the Rural Electrification Administration:

| Loan designation: | *Amount* |
|---|---|
| Montana 15 S Fergus | $225,000 |

[SEAL] ANCHER NELSEN,
*Administrator.*

[F. R. Doc. 53-9828; Filed, Nov. 20, 1953; 8:51 a. m.]

---

[Administrative Order 4403]

### OHIO

LOAN ANNOUNCEMENT

NOVEMBER 4, 1953.

Pursuant to the provisions of the Rural Electrification Act of 1936, as amended, a loan contract bearing the following designation has been signed on behalf of the Government acting through the Administrator of the Rural Electrification Administration:

| Loan designation: | *Amount* |
|---|---|
| Ohio 33 P Auglaize | $200,000 |

[SEAL] ANCHER NELSEN,
*Administrator.*

[F. R. Doc. 53-9829; Filed, Nov. 20, 1953; 8:51 a. m.]

---

[Administrative Order 4402]

### ALABAMA

LOAN ANNOUNCEMENT

NOVEMBER 3, 1953.

Pursuant to the provisions of the Rural Electrification Act of 1936, as amended, a loan contract bearing the following designation has been signed on behalf of the Government acting through the Administrator of the Rural Electrification Administration:

| Loan designation: | *Amount* |
|---|---|
| Alabama 18U Cullman | $540,000 |

[SEAL] ANCHER NELSEN,
*Administrator.*

[F. R. Doc. 53-9830; Filed, Nov. 20, 1953; 8:51 a. m.]

---

[Administrative Order 4404]

### NEW MEXICO

LOAN ANNOUNCEMENT

NOVEMBER 4, 1953.

Pursuant to the provisions of the Rural Electrification Act of 1936, as amended, a loan contract bearing the following designation has been signed on behalf of the Government acting through the Administrator of the Rural Electrification Administration:

| Loan designation: | *Amount* |
|---|---|
| New Mexico 25K Luna | $1,725,000 |

[SEAL] ANCHER NELSEN,
*Administrator.*

[F. R. Doc. 53-9831; Filed, Nov. 20, 1953; 8:51 a. m.]

---

[Administrative Order 4405]

### TEXAS

LOAN ANNOUNCEMENT

NOVEMBER 4, 1953.

Pursuant to the provisions of the Rural Electrification Act of 1936, as amended, a loan contract bearing the following designation has been signed on behalf of the Government acting through the Administrator of the Rural Electrification Administration:

| Loan designation: | *Amount* |
|---|---|
| Texas 125L Jasper | $514,000 |

[SEAL] ANCHER NELSEN,
*Administrator.*

[F. R. Doc. 53-9832; Filed, Nov. 20, 1953; 8:51 a. m.]

---

# FEDERAL POWER COMMISSION

[Docket No. E-6518]

## KANSAS GAS AND ELECTRIC CO.

### NOTICE OF ORDER AUTHORIZING ISSUANCE OF PREFERRED STOCK

NOVEMBER 17, 1953.

Notice is hereby given that on November 16, 1953, the Federal Power Commission issued its order adopted November 13, 1953, authorizing issuance of preferred stock in the above-entitled matter.

[SEAL] LEON M. FUQUAY,
*Secretary.*

[F. R. Doc. 53-9807; Filed, Nov. 20, 1953; 8:46 a. m.]

---

[Docket No. G-681]

## UNITED GAS PIPE LINE CO.

### NOTICE OF ORDER CANCELLING CERTIFICATE OF PUBLIC CONVENIENCE AND NECESSITY

NOVEMBER 17, 1953.

Notice is hereby given that on November 16, 1953, the Federal Power Commission issued its order adopted November 12, 1953, in the above-entitled matter, cancelling certificate of public convenience and necessity issued on January 6, 1950 (15 F. R. 268).

[SEAL] LEON M. FUQUAY,
*Secretary.*

[F. R. Doc. 53-9808; Filed, Nov. 20, 1953; 8:46 a. m.]

---

[Project No. 2021]

## COUNTY OF PLACER, CALIFORNIA

### NOTICE OF ORDER FURTHER EXTENDING PERIOD OF PRELIMINARY PERMIT

NOVEMBER 17, 1953.

Notice is hereby given that on November 16, 1953, the Federal Power Commission issued its order adopted November 12, 1953, further extending period of preliminary permit in the above-entitled matter.

[SEAL] LEON M. FUQUAY,
*Secretary.*

[F. R. Doc. 53-9809; Filed, Nov. 20, 1953; 8:47 a. m.]

---

## ARIZONA PUBLIC SERVICE CO.

### NOTICE OF ORDER APPROVING AND DIRECTING DISPOSITION OF ACCOUNTING ADJUSTMENTS

NOVEMBER 17, 1953.

Notice is hereby given that on November 16, 1953, the Federal Power Commission issued its order adopted November 13, 1953, approving and directing disposition of accounting adjustments in the above-entitled matter.

[SEAL] LEON M. FUQUAY,
*Secretary.*

[F. R. Doc. 53-9810; Filed, Nov. 20, 1953; 8:47 a. m.]

---

# SECURITIES AND EXCHANGE COMMISSION

[File No. 70-3145]

## ATTLEBORO STEAM AND ELECTRIC CO. ET AL.

### ORDER AUTHORIZING ISSUE AND SALE OF SHORT-TERM UNSECURED PROMISSORY NOTES TO BANKS AND TO PARENT COMPANY

NOVEMBER 17, 1953.

In the matter of Attleboro Steam and Electric Company, Haverhill Electric Company, The Lowell Electric Light Corporation, Weymouth Light and Power Company, Worcester County Electric Company, New England Electric System, File No. 70-3145.

New England Electric System ("NEES"), a registered holding company, and its above named subsidiary companies, hereinafter individually referred to as "Attleboro," "Haverhill", "Lowell", "Weymouth", and "Worcester" and collectively referred to as "the borrowing companies", having filed a joint application-declaration with this Commission pursuant to sections 6 (a), 7, 9 (a), 10 and 12 (f) of the Public Utility Holding Company Act of 1935 ("the act") and Rules U-23, U-42 (b) (2), U-43 (a), U-45 (b) (1) and U-50 (a) (2) and (3) promulgated thereunder with respect to the following proposed transactions:

Lowell and Worcester propose to issue to banks, from time to time but not later than December 31, 1953, unsecured promissory notes in the respective amounts of $200,000 and $3,500,000. Attleboro, Haverhill and Weymouth propose to issue to NEES, from time to time but not later than December 31, 1953, unsecured promissory notes in the respective amounts of $75,000, $100,000 and $150,000.

Each of such notes to be issued to NEES will mature on April 1, 1954, and each of the notes to be issued to banks will mature six months after the issue date thereof. Such notes will bear interest at the prime rate of interest at the time of the issuance thereof. It is stated that said prime interest rate at the present time is 3¼ percent.

According to the application-declaration, the proceeds derived from the proposed additional notes will be used for the payment of note indebtedness and construction and other purposes.

Each of the borrowing companies has stipulated that if any permanent financing is done prior to the maturity date of its then outstanding unsecured promissory notes, the proceeds derived therefrom will be applied in reduction of, or in total payment of, notes then outstanding, and the amount of then authorized but unissued promissory notes will be reduced by the amount, if any, by which such permanent financing exceeds the amount of the then outstanding unsecured promissory notes. At the present time Worcester has pending before the Commission an application-declaration (identified by File No. 70-3135) in which it seeks authority to issue 75,000 shares of $100 par value cumulative preferred stock (See Holding Company Act Release No. 12177). Worcester has stipulated that if said sale of preferred stock is approved by the Commission and the proceeds therefrom are available prior to November 30, 1953, Worcester will relinquish all right to issue the $3,500,000 of notes proposed in the instant application-declaration.

The application-declaration states that incidental services in connection with the proposed note issues will be performed at cost by New England Power Service Company, an affiliated service company, such cost being estimated not to exceed $100 for NEES and each borrowing company, or an aggregate of $600.

The application-declaration further states that no State commission and no Federal commission, other than this Commission, has jurisdiction over the proposed transactions.

NEES and the borrowing companies request that the Commission's order herein become effective forthwith upon issuance.

Due notice having been given of the filing of the application-declaration, and a hearing not having been requested or ordered by the Commission; and the Commission finding that the applicable provisions of the act and the rules promulgated thereunder are satisfied and that no adverse findings are necessary; and deeming it appropriate in the public interest and in the interest of investors and consumers that said application-declaration be granted and permitted to become effective forthwith, without the imposition of terms and conditions other than those prescribed in Rule U-24:

*It is ordered,* Pursuant to Rule U-23 and the applicable provisions of the act, that said application-declaration be granted and permitted to become effective forthwith, subject to the terms and conditions prescribed in Rule U-24.

By the Commission.

[SEAL] ORVAL L. DUBOIS,
*Secretary.*

[F. R. Doc. 53-9815; Filed, Nov. 20, 1953; 8:48 a. m.]

---

[File No. 70-3146]

## DELAWARE POWER & LIGHT CO.

### ORDER AUTHORIZING ISSUANCE AND SALE OF SHARES OF COMMON STOCK

NOVEMBER 17, 1953.

Delaware Power & Light Company ("Delaware"), a registered holding company and a public utility operating company, having filed a declaration with this Commission pursuant to section 7 of the Public Utility Holding Company Act of 1935 ("act") and rules thereunder with respect to the following proposed transactions:

Delaware proposes to issue and sell 232,520 shares of its Common Stock, par value $13.50 per share, and in addition to sell such shares, but not in excess of 23,252 shares, as may be purchased for the purpose of stabilizing the price of the common stock. The 232,520 shares of common stock will be offered to stockholders in accordance with their preemptive rights and upon the basis of one share for each seven shares. Transferable warrants evidencing the right to subscribe will be issued to common stockholders of record as of the close of business on November 25, 1953. Subject to such rights of the stockholders, the stock will also be offered to employees of Delaware and its subsidiaries in an amount not exceeding 150 shares per employee. The balance, if any, of the stock not subscribed for by holders of warrants and employees will be sold to underwriters.

The Board of Directors of Delaware will, not later than 12:00 o'clock noon on November 23, 1953, determine the offering price of the stock to stockholders and to employees, which price will be specified in the bids submitted by underwriters as the price to be paid the company for any unsubscribed stock. Immediately following determination by the Board of Directors of such offering price, notice of the price will be given to prospective bidders and will be publicly announced by the company. Bids for the unsubscribed stock will specify the compensation to be paid the underwriters.

Delaware proposes that, for the purpose of stabilizing the price of its common stock, it may purchase up to 23,252 shares of its common stock on the New York Stock Exchange, the Philadelphia-Baltimore Stock Exchange, in the over-the-counter market, or otherwise. Such stabilization, if commenced, will be terminated not later than the time fixed for the acceptance of a bid for the purchase of the unsubscribed stock. Shares acquired by Delaware as a result of such stabilization will be included as part of the unsubscribed stock which will be sold to the underwriters.

Delaware requests that the period between the publication of the invitation for bids which it expects will take place on November 18, 1953, and the time of opening of bids be shortened to seven days in order that bids for the stock may be opened on November 25, 1953.

The net proceeds from the proposed sale of common stock will be used to finance a portion of the construction program of Delaware and its two subsidiaries which, it is contemplated, will require expenditure of approximately $30,000,000 in 1953 and 1954.

The issuance of the warrants and the issuance and sale of the 232,520 shares of common stock was approved by the Public Service Commission of Delaware by order dated October 15, 1953. Delaware requests that the Commission's orders entered herein become effective upon the issuance thereof.

Due notice having been given of the filing of the declaration, and a hearing not having been requested of or ordered by the Commission; and the Commission finding that the applicable provisions of the act and rules promulgated thereunder are satisfied and that no adverse findings are necessary, and deeming it appropriate in the public interest and the interest of investors and consumers that said declaration be permitted to become effective forthwith, all subject to the terms and conditions specified below:

*It is ordered*, Pursuant to the applicable provisions of the act and the rules thereunder, that said declaration be, and the same hereby is, permitted to become effective forthwith, and that for the purposes of this proceeding the ten-day period for the invitation of bids, as prescribed by Rule U-50, be, and the same hereby is, shortened to a period of not less than seven days, all subject, however, to the provisions of Rule U-24 and to the following terms and conditions:

(1) That the proposed issue and sale of said stock shall not be consummated until the results of competitive bidding shall have been made a matter of record in this proceeding and a further order entered by this Commission on the basis of the record so supplemented, which order may contain such terms and conditions, if any, as may then be deemed appropriate, jurisdiction being reserved for this purpose; and

(2) That jurisdiction be reserved with respect to the payment of all fees and expenses in connection with the proposed transactions, including fees and expenses of counsel for the successful bidders.

By the Commission.

[SEAL] ORVAL L. DUBOIS,
*Secretary.*

[F. R. Doc. 53-9814; Filed, Nov. 20, 1953; 8:48 a. m.]

---

[File No. 70-3148]

## NARRAGANSETT ELECTRIC CO. AND NEW ENGLAND ELECTRIC SYSTEM

### NOTICE OF PROPOSED ISSUANCE AND SALE OF COMMON STOCK BY SUBSIDIARY TO PARENT COMPANY

NOVEMBER 17, 1953.

Notice is hereby given that New England Electric System ("NEES"), a registered holding company, and The Narragansett Electric Company ("Narragansett"), a wholly-owned subsidiary of NEES, have filed a joint application, pursuant to the Public Utility Holding Company Act of 1935 ("the act"), designating sections 6 (b), 9 and 10 of the act and Rule U-42 (b) (2) promulgated thereunder as applicable to their proposed transactions, which are summarized as follows:

Under a contract dated October 27, 1953, Narragansett proposes to issue and sell to NEES, prior to April 1, 1954, 100,000 additional shares of $50 par value common stock at the price of $50 per share. It is indicated that such sale is proposed in order to provide Narragansett with new money required to finance, in part, its 1954 construction program. The proceeds derived from the sale of the common stock will be applied by Narragansett to the payment of its then outstanding short-term note indebtedness and any balance will be used for construction or to reimburse its treasury therefor.

The issue and sale of the common stock is subject to the jurisdiction of the Public Utility Administrator, Department of Business Regulation of the State of Rhode Island in which state Narragansett is organized and doing business.

The expenses to be incurred in connection with said transactions are estimated at $12,500 for Narragansett and $300 for NEES.

Applicants request that the Commission's order be made effective upon issuance.

Notice is further given that any interested person may, not later than December 2, 1953 at 5:30 p. m., e. s. t., request the Commission in writing that a hearing be held on such matter, stating the nature of his interest, the reasons for such request and the issues of fact or law, if any, raised by the said joint application which he desires to controvert, or may request that he be notified if the Commission should order a hearing thereon. Any such request should be addressed: Secretary, Securities and Exchange Commission, 425 Second Street NW., Washington 25, D. C. At any time after said date, said application, as filed or as amended, may be granted as provided in Rule U-23 of the rules and regulations promulgated under the act, or the Commission may exempt such transactions as provided in Rule U-20 (a) and Rule U-100 thereof.

By the Commission.

[SEAL] ORVAL L. DUBOIS,
*Secretary.*

[F. R. Doc. 53-9813; Filed, Nov. 20, 1953; 8:47 a. m.]

---

[File No. 70-3149]

## NARRAGANSETT ELECTRIC CO.

### NOTICE OF FILING REGARDING SALE OF PREFERRED STOCK AT COMPETITIVE BIDDING

NOVEMBER 17, 1953.

Notice is hereby given that an application-declaration has been filed with this Commission, pursuant to the Public Utility Holding Company Act of 1935 ("the act"), by the Narragansett Electric Company ("Narragansett"), a subsidiary of New England Electric System ("NEES"), a registered holding company. The applicant-declarant has designated sections 6 (a) (2), 6 (b) and 7 (e) of the act and Rules U-42 (b) (2) and U-50 thereunder as applicable to the proposed transactions which are summarized as follows:

Narragansett proposes to issue and sell 150,000 shares of a new series of Preferred Stock of the par value of $50 per share. Such sale will be pursuant to the competitive bidding requirements of Rule U-50. The dividend rate (which shall be expressed in a multiple of 0.08 of 1 percent and not in excess of 6 percent) and the price, exclusive of accrued dividends, to be paid to Narragansett (which shall be not less than $100 and shall not exceed $102.75 per share) will be determined by competitive bidding. Bids will be received up to 12 noon on a date, not less than ten days nor more than thirty days after the date of the invitation for bids, which the company shall fix by giving notice at least forty-two hours in advance to each prospective bidder.

The proceeds from the proposed sale of preferred stock (exclusive of accrued dividends and the expenses of issuance) are to be applied to the payment of short-term note indebtedness presently outstanding in the aggregate of $6,250,000 and, according to the application-declaration may be outstanding in the aggregate amount of $7,450,000 at the time the preferred stock is sold, and the balance, if any, of the proceeds will be used to pay for capitalizable expenditures or to reimburse the treasury therefor.

According to Narragansett, the proposed issue and sale of preferred stock is subject to the jurisdiction of the Public Utility Administrator, Department of Business Regulation of the State of Rhode Island. Copies of the order of that State Commission are to be supplied by amendment.

The estimated fees submitted in respect of filing fees, taxes, services of New England Power Service Company, an affiliated service company, printing, independent public accountants, counsel for Narragansett and mailing and miscellaneous charges aggregate $60,000. Legal fees and expenses of underwriters' counsel are to be supplied by amendment.

It is requested that the Commission's orders entered herein become effective upon the issuance thereof.

Notice is further given that any interested person may, not later than December 2, 1953, at 5:30 p. m., e. s. t., request the Commission in writing that a hearing be held on such matter, stating the nature of his interest, the reason or reasons for such request and the issues, if any, of fact or law proposed to be controverted, or he may request that he be notified if the Commission should order a hearing thereon. Any such request should be addressed: Secretary, Securities and Exchange Commission, 425 Second Street NW., Washington 25, D. C. At any time after said date, the application-declaration, as filed or as amended, may be granted and permitted to become effective as provided in Rule U-23 of the rules and regulations promulgated under the act, or the Commission may exempt such transactions as provided in Rules U-20 and U-100 thereof.

By the Commission.

[SEAL] ORVAL L. DUBOIS,
*Secretary.*

[F. R. Doc. 53-9812; Filed, Nov. 20, 1953; 8:47 a. m.]

---

[File No. 70-3152]

## NORTH CONTINENT UTILITIES CORP.

### NOTICE OF PROPOSED LIQUIDATION AND DISSOLUTION OF REGISTERED HOLDING COMPANY AND PAYMENT OF LIQUIDATING DIVIDEND AND ORDER MAKING EFFECTIVE DECLARATION REGARDING PROXY MATERIAL

NOVEMBER 17, 1953.

Notice is hereby given that an application-declaration has been filed with this Commission pursuant to the Public Utility Holding Company Act of 1935 ("act") by North Continent Utilities Corporation ("North Continent"), a registered holding company. Applicant-declarant has designated sections 11, 12 (c) and 12 (e) of the act and Rules U-23, U-24, U-46 and U-62 promulgated thereunder as applicable to the proposed transactions.

Notice is further given that any interested person may, not later than December 10, 1953, at 5:30 p. m., e. s. t., request the Commission in writing that a hearing be held on such matter, stating the reasons for such request, the nature of his interest and the issues of fact or law raised by said declaration which he desires to controvert, or may request that he be notified if the Commission should order a hearing thereon. Any such request should be addressed: Secretary, Securities and Exchange Commission, 425 Second Street NW., Washington 25, D. C. At any time after December 10, 1953, said declaration, as filed or as amended, may be granted as provided in Rule U-23 of the rules and regulations promulgated under the act, or the Commission may exempt such transactions as provided in Rules U-20 (a) and U-100 thereof.

All interested persons are referred to said application-declaration which is on file in the office of this Commission for a statement of the transactions therein proposed, which are summarized as follows:

The Commission has heretofore directed North Continent in proceedings under section 11 (b) of the act to liquidate and dissolve (North Continent Utilities Corporation, File Nos. 54-74 and 59-69), and North Continent now has one remaining subsidiary, Great Northern Gas Company, Ltd., an Ontario corporation.

Pursuant to prior authorization of the Commission under Rule U-44 (c), North Continent, under date of October 20, 1953, entered into a contract with Alberta Consolidated Gas Utilities Limited, whereby the latter agreed to purchase North Continent's entire interest in Great Northern Gas Company, Limited, at a price of $533,639, plus an amount equal to interest on certain notes and advances from August 1, 1953, to the closing date. The closing date is expected to occur within approximately two weeks from the date hereof. After consummation of said sale, North Continent will have as its sole asset approximately $659,000 in cash. Pursuant to section 275 of the General Corporation Law of Delaware, the Board of Directors has adopted a resolution to the effect that it is advisable and to the best interests of the Corporation to dissolve the Corporation, and has called a special meeting of stockholders to be held on December 15, 1953, to vote on the question of dissolution. Proposed proxy solicitation material for said meeting has been filed, and it is proposed to mail the same immediately after the Commission enters its order so authorizing.

The Board of Directors has also tentatively approved a Plan of Liquidation and Dissolution, said Plan providing in substance for (1) an initial liquidating dividend of $8.50 per share, payable immediately to all holders of capital stock of the corporation upon surrender of their respective certificates for cancellation, and (2) a further liquidating dividend or dividends until all available assets shall have been distributed to stockholders. The application-declaration states that at the present time it is impossible to state definitely in what amounts, or at what times, such further liquidating dividend or dividends may be distributed and that after payment of the initial liquidating dividend of $8.50 per share the corporation will have on hand approximately $110,000, which (together with such further assets as may accrue to the corporation in connection with expiration of rights of holders of old securities of the corporation under the Supplemental Plan of 1950) is considered by the Board of Directors to be an ample reserve for all present or future liabilities, including taxes for the current year, any possible deficiency assessments of taxes for prior years, fees and expenses in connection with the aforementioned sale of Great Northern Gas Company, Limited, and fees and expenses of all types which may be incurred in completing the dissolution program. As and when it can be determined definitely that the aforesaid items will not exhaust the entire reserved amount, the balance will be available to be paid out in a further liquidating dividend or dividends.

Fees and expenses in connection with the foregoing transactions are estimated at $27,000, including legal fees of $15,000 to Dallstream, Schiff, Stern & Hardin, counsel for North Continent.

Applicant-declarant requests that the application-declaration be granted and permitted to become effective forthwith upon issuance.

Applicant-declarant further requests that an order be entered permitting use of the proxy solicitation material promptly after filing thereof, and in advance of the entry of any final order with respect to the other transactions herein described; and

It appearing to the Commission that such request may appropriately be granted:

*It is ordered,* That the declaration regarding the proxy solicitation material, filed pursuant to Rule U-62, be, and hereby is permitted to become effective forthwith.

By the Commission.

[SEAL] ORVAL L. DUBOIS,
*Secretary.*

[F. R. Doc. 53-9811; Filed, Nov. 20, 1953; 8:47 a. m.]

## INTERSTATE COMMERCE COMMISSION

[4th Sec. Application 28654]

### IRON AND STEEL BILLETS, BLOOMS OR SLABS FROM CHICAGO GROUP AND STERLING (ROCK FALLS), ILL., TO BATON ROUGE, LA.

APPLICATION FOR RELIEF

NOVEMBER 18, 1953.

The Commission is in receipt of the above-entitled and numbered application for relief from the long-and-short-haul provision of section 4 (1) of the Interstate Commerce Act.

Filed by: F. C. Kratzmeir, Agent, for carriers parties to Agent R. G. Raasch's tariff I. C. C. No. 776, pursuant to fourth-section order No. 16101.

Commodities involved: Iron and steel billets, blooms or slabs, carloads.

From: Chicago, Ill., and points grouped therewith, and Sterling (Rock Falls), Ill.

To: Baton Rouge, La.

Grounds for relief: Competition with rail carriers, circuitous routes, and operation through higher-rated territory.

Any interested person desiring the Commission to hold a hearing upon such application shall request the Commission in writing so to do within 15 days from the date of this notice. As provided by the general rules of practice of the Commission, Rule 73, persons other than applicants should fairly disclose their interest, and the position they intend to take at the hearing with respect to the application. Otherwise the Commission, in its discretion, may proceed to investigate and determine the matters involved in such application without further or formal hearing. If because of an emergency a grant of temporary relief is found to be necessary before the expiration of the 15-day period, a hearing, upon a request filed within that period, may be held subsequently.

By the Commission.

[SEAL] GEORGE W. LAIRD, *Secretary.*

[F. R. Doc. 53-9833; Filed, Nov. 20, 1953; 8:52 a. m.]

---

[4th Sec. Application 28655]

### COTTON FROM SOUTH ATLANTIC PORTS TO ALABAMA, GEORGIA, NORTH CAROLINA AND SOUTH CAROLINA

APPLICATION FOR RELIEF

NOVEMBER 18, 1953.

The Commission is in receipt of the above-entitled and numbered application for relief from the long-and-short-haul provision of section 4 (1) of the Interstate Commerce Act.

Filed by: R. E. Boyle, Jr., Agent, for carriers parties to schedule listed below.

Commodities involved: Cotton, carloads.

From: Wilmington, N. C., Savannah and Port Wentworth, Ga. (applicable on traffic imported from Egypt, Peru or India).

To: Points in Alabama, Georgia, North Carolina and South Carolina.

Grounds for relief: Competition with rail carriers, circuitous routes, and competition with motor carriers.

Schedules filed containing proposed rates: C. A. Spaninger, Agent, I. C. C. No. 1369, supp. 19.

Any interested person desiring the Commission to hold a hearing upon such application shall request the Commission in writing so to do within 15 days from the date of this notice. As provided by the general rules of practice of the Commission, Rule 73, persons other than applicants should fairly disclose their interest, and the position they intend to take at the hearing with respect to the application. Otherwise the Commission, in its discretion, may proceed to investigate and determine the matters involved in such application without further or formal hearing. If because of an emergency a grant of temporary relief is found to be necessary before the expiration of the 15-day period, a hearing, upon a request filed within that period, may be held subsequently.

By the Commission.

[SEAL] GEORGE W. LAIRD, *Secretary.*

[F. R. Doc. 53-9834; Filed, Nov. 20, 1953; 8:52 a. m.]

---

[4th Sec. Application 28656]

### GRAIN FROM CERTAIN STATES TO LOUISIANA AND ARKANSAS

APPLICATION FOR RELIEF

NOVEMBER 18, 1953.

The Commission is in receipt of the above-entitled and numbered application for relief from the long-and-short-haul provision of section 4 (1) of the Interstate Commerce Act.

Filed by: F. C. Kratzmeir, Agent, for carriers parties to schedules listed below.

Commodities involved: Grain, grain products and related articles, carloads.

From: Points in Kansas, Missouri, Oklahoma and Texas.

To: Points in Arkansas and Louisiana.

Grounds for relief: Competition with rail carriers, circuitous routes, and to maintain grouping.

Schedules filed containing proposed rates: F. C. Kratzmeir, Agent, I. C. C. No. 3940, supp. 30; F. C. Kratzmeir, Agent, I. C. C. No. 3829, supp. 29; F. C. Kratzmeir, Agent, I. C. C. No. 3831, supp. 60; F. C. Kratzmeir, Agent, I. C. C. No. 3939, supp. 39.

Any interested person desiring the Commission to hold a hearing upon such application shall request the Commission in writing so to do within 15 days from the date of this notice. As provided by the general rules of practice of the Commission, Rule 73, persons other than applicants should fairly disclose their interest, and the position they intend to take at the hearing with respect to the application. Otherwise the Commission, in its discretion, may proceed to investigate and determine the matters involved in such application without further or formal hearing. If because of an emergency a grant of temporary relief is found to be necessary before the expiration of the 15-day period, a hearing, upon a request filed within that period, may be held subsequently.

By the Commission.

[SEAL] GEORGE W. LAIRD, *Secretary.*

[F. R. Doc. 53-9835; Filed, Nov. 20, 1953; 8:52 a. m.]

---

[4th Sec. Application 28657]

### GRAIN FROM IOWA, MINNESOTA, MISSOURI AND NEBRASKA TO TEXAS PORTS FOR EXPORT

APPLICATION FOR RELIEF

NOVEMBER 18, 1953.

The Commission is in receipt of the above-entitled and numbered application for relief from the long-and-short-haul provision of section 4 (1) of the Interstate Commerce Act.

Filed by: W. J. Prueter, Agent, for carriers parties to schedules listed below.

Commodities involved: Grain, grain products, and related articles, carloads.

From: Points in Iowa, Minnesota, Missouri, and Nebraska.

To: Houston, Galveston and Texas City, Texas, for export.

Grounds for relief: Competition with rail carriers, circuitous routes.

Schedules filed containing proposed rates: Chicago and North Western Railway Co., I. C. C. No. 11153, supp. 21; Chicago, Burlington & Quincy Railroad Co., I. C. C. No. 20396, supp. 5; Chicago Great Western Railway Co., I. C. C. No. 5605, supp. 8; Chicago, Milwaukee, St. Paul & Pacific Railroad Co., I. C. C. No. B-7626, supp. 17; Chicago, Rock Island and Pacific Railroad Co., I. C. C. No. C-13415, supp. 14; Wabash Railroad Co., I. C. C. No. 7548, supp. 38; Union Pacific Railroad Co., I. C. C. No. 5130, supp. 29.

Any interested person desiring the Commission to hold a hearing upon such application shall request the Commission in writing so to do within 15 days from the date of this notice. As provided by the general rules of practice of the Commission, Rule 73, persons other than applicants should fairly disclose their interest, and the position they intend to take at the hearing with respect to the application. Otherwise the Commission, in its discretion, may proceed to investigate and determine the matters involved in such application without further or formal hearing. If because of an emergency a grant of temporary relief is found to be necessary before the expiration of the 15-day period, a hearing, upon a request filed within that period, may be held subsequently.

By the Commission.

[SEAL] GEORGE W. LAIRD, *Secretary.*

[F. R. Doc. 53-9836; Filed, Nov. 20, 1953; 8:52 a. m.]